# Case 4:21-cv-06338-JST Document 1 Filed 08/17/21 Page 1 of 160

1	Richard Heimann (CA State Bar # 063607)	
2	Nimish R. Desai (CA State Bar # 244953)  LIEFF CABRASER HEIMANN & BERN	STEIN, LLP
3	275 Battery St., 29th Fl San Francisco, CA 94111-3339	
4	Telephone: 415-956-1000 Facsimile: 415-956-1008	
5	rheimann@lchb.com ndesai@lchb.com	
6	David S. Stellings (pro hac vice to be filed)	1)
7	Katherine I. McBride (pro hac vice to be file Jessica A. Moldovan (pro hac vice to be filed the	(h
8	LIEFF CABRASER HEIMANN & BERN 250 Hudson Street, 8th Floor	STEIN, LLP
9	New York, NY 10013 Telephone: 212.355.9500	
10	Facsimile: 212.355.9592 dstellings@lchb.com	
11	kmcbride@lchb.com jmoldovan@lchb.com	
12	Attorneys for Plaintiff Ramiro Pereda	
13	[Additional counsel listed on signature page]	
14	UNITED STATES DISTRICT COURT	
15	NORTHERN DISTRICT OF CALIFORNIA	
16		
17	RAMIRO PEREDA,	Case No.
18	Plaintiff,	CLASS ACTION COMPLAINT
19	v.	JURY TRIAL DEMANDED
20	GENERAL MOTORS LLC, et al.,	
21	Defendant.	
22		
23		
24		
25		
26		
27		
28		

2293238.3 CLASS ACTION COMPLAINT

1			TABLE OF CONTENTS	
2			I	Page
3	I.	INTR	ODUCTION	_
4	II.	PART	TES	3
4		A.	Plaintiff	3
5		B.	Defendants	4
6	III.	JURIS	SDICTION, VENUE, AND INTRADISTRICT ASSIGNMENT	5
7	IV.	GENE	ERAL FACTUAL ALLEGATIONS	5
		A.	SDMs are supposed to detect crashes and control airbags and seatbelts	5
8		B.	GM used a dangerous and defective SDM software calibration in its trucks and SUVs.	8
10		C.	GM knew that the SDM Calibration Defect was dangerous and unjustified but has failed to warn or compensate consumers	11
11			1. Old GM recklessly downplayed serious risks of injury when it chose to include the SDM Calibration Defect in the Class Vehicles	12
12			2. The 45-millisecond cutoff was not necessary to protect against "late" airbag deployments	14
13 14			3. GM knew about a pattern of suspicious accidents involving the SDM Calibration Defect but has done nothing to correct it	16
15			a. GM has litigated personal injury lawsuits for suspicious airbag failures in the Class Vehicles	17
16			b. GM knew or should have known about hundreds of publicly reported airbag failures in the Class Vehicles	20
17		D.	Despite its knowledge, GM misrepresented and concealed important information about the SDM Calibration Defect and Class Vehicle safety	39
18 19			1. Labels and window stickers on the Class Vehicles stated that they were equipped with working airbags and seatbelts and failed to disclose the SDM Calibration Defect	30
20			2. GM published owners' manuals for the Class Vehicles that detailed their safety features but did not disclose the SDM Calibration	37
21			Defect.	43
22			3. GM marketed the Class Vehicles to be safe and reliable but failed to mention the SDM Calibration Defect.	46
23	V.	CLAS	SS ACTION ALLEGATIONS	50
24		A.	The Class Definition	
25		B.	Numerosity: Federal Rule of Civil Procedure 23(a)(1)	51
26		C.	Commonality and Predominance: Federal Rule of Civil Procedure 23(a)(2) and 23(b)(3)	
		D.	Typicality: Federal Rule of Civil Procedure 23(a)(3)	
27		E.	Adequacy: Federal Rule of Civil Procedure 23(a)(4)	
28		F.	Declaratory and Injunctive Relief: Federal Rule of Civil Procedure 23(b)(2)	54

# Case 4:21-cv-06338-JST Document 1 Filed 08/17/21 Page 3 of 160

1		TABLE OF CONTENTS	
2		(continued)	Page
3		G. Superiority: Federal Rule of Civil Procedure 23(b)(3)	· ·
4	VI.	ANY APPLICABLE STATUTES OF LIMITATION ARE TOLLED	54
5	VII.	CAUSES OF ACTION	
		A. Claims Asserted on Behalf of the Nationwide Class	
6		B. State-Specific Claims	
7	VIII.	PRAYER FOR RELIEF	
8	IX.	DEMAND FOR JURY TRIAL	72
9			
10			
11			
12			
13			
14			
15			
16			
17			
18			
19			
20			
21			
22			
23			
24			
25			
26			
27			
28			

Plaintiff Ramiro Pereda, individually and on behalf of all others similarly situated (the "Class"), alleges the following against General Motors LLC, General Motors Holdings LLC, and General Motors Company (collectively, "Defendants," "GM," or "New GM") based, where applicable, on personal knowledge, information and belief, and the pre-filing investigation of counsel and their experts.

### I. INTRODUCTION

- 1. Car crashes kill or seriously injure hundreds of thousands of people every year. Because of this risk, the federal government requires automobile manufacturers to include critical safety features—seatbelts and airbags—in all vehicles sold in the United States. This lifesaving equipment has been mandatory in passenger vehicles since 1997. *See* 49 U.S.C. § 30127.
- 2. This case involves a dangerous defect that compromises these critical safety systems in millions of GM trucks and SUVs. When working properly, during a frontal crash of sufficient severity, the seatbelts should tighten to hold the vehicle occupants in place, and the airbags should inflate to protect them from hard impacts. A defect in GM trucks and SUVs, however, can prevent seatbelt tightening and airbag deployment during certain types of crashes, leaving vehicle occupants without protection exactly when they need it most.
- 3. The defect is contained in the vehicles' airbag control unit, which is referred to by GM and herein as an "SDM" or "Sensing and Diagnostic Module." The defect itself is referred to herein as the "SDM Calibration Defect."
- 4. The SDM is a small computer connected to sensors placed throughout the vehicle. These sensors tell the SDM when they detect irregular behavior and, based on these signals, the SDM will fire the airbags and tighten seatbelts when needed in a crash.
- 5. In the Class Vehicles, the software program that controls the SDM was calibrated to prevent airbag and seatbelt deployment just 45 milliseconds after a crash has begun. This has serious repercussions in real-world accidents that last longer than 45 milliseconds—such as

manufactured, sold, distributed, or leased by Old GM and purchased or leased by Plaintiff or a Class member after July 10, 2009.

2293238.3 - 1 - CLASS ACTION COMPLAINT

The "Class Vehicles" include all vehicles in the United States that contain the SDM Calibration Defect that were (1) manufactured, sold, distributed, or leased by Defendants or (2) manufactured, sold, distributed, or leased by Old GM and purchased or leased by Plaintiff or a

3

6

12

13

17 18

16

19 20

2.1 22

23

24 25

26

27

28

which the airbags and seatbelts in the Class Vehicles can fail.

accidents that involve multiple impacts, or that increase in severity over a period of time—in

- 6. A team of software engineers from Delco Electronics—which designed the SDM software program in the Class Vehicles—expressly warned Old GM in 1999 that preventing airbag and seatbelt deployment after 45 milliseconds was a reckless and dangerous design decision.<sup>2</sup> Old GM's trucks group, which was in charge of design and development for trucks and SUVs, ignored this warning and insisted on using a defective SDM calibration that shuts off the airbags after 45 milliseconds. Tellingly, a separate team in charge of design and development for GM cars rejected this approach after hearing the Delco team's concerns and included a much longer window (150 milliseconds) for the airbags and seatbelts to deploy in a crash for the vehicles they designed.
- 7. When it was formed in 2009, General Motors, LLC ("GM LLC") acquired books, records, and personnel from Old GM that reflected this reckless decision to use the dangerous SDM calibration in its trucks and SUVs. Despite this acquired knowledge, GM continued to use Delco SDMs in its vehicles and, on information and belief, continued to use the defective calibration associated with those Delco SDMs as well.
- 8. Since it was formed, GM has continued to gain knowledge of the defect through individual lawsuits, consumer complaints, and its own investigations into serious crashes where the airbags and seatbelts failed to deploy in the Class Vehicles. As an example, documents in a personal-injury lawsuit filed against GM LLC in 2011 describe the defect in detail and relate Old GM's reckless decision to use it. See § IV.C.3.a, infra.
- 9. Further, publicly available consumer complaints to the National Highway Traffic and Safety Administration ("NHTSA") detail more than eight hundred instances where the airbags and/or seatbelts suspiciously failed in the Class Vehicles during frontal crashes. Many of these reports specifically state that GM knew about and investigated the crash after the reported airbag failures. A separate NHTSA dataset indicates that, from 1999 to the present, at least 1,298

<sup>&</sup>lt;sup>2</sup> As detailed further below, Old GM filed for bankruptcy in 2009, which led to the creation of the contemporary GM entities named as Defendants herein.

2

4

5

3

6 7

9

8

11

10

12

13 14

15

16 17

18

19

20 21

22

23

24 25

26

27

28

people were killed or injured in a frontal collision in which the airbags did not deploy in one of these vehicles. See IV.C.3.b, infra.

- Despite its knowledge of the defect and its impact on safety, GM has concealed the defect and failed to recall or repair the Class Vehicles, presumably to avoid the significant costs and inconveniences of recalling millions of vehicles. GM has hidden the defect in spite of its obligation to disclose it, misrepresented the Class Vehicles to be safe, and continued to sell them to consumers.
- 11. Because of GM's failure to disclose the truth, consumers continue to purchase and drive Class Vehicles with the SDM Calibration Defect every day—on road trips, commutes, and weekend errands alike—unaware that their airbags and seatbelts may not operate in a prolonged frontal crash. This lawsuit seeks redress from GM for the damages incurred when Plaintiff and proposed Class members paid for vehicles with a safety system that may fail in lifethreatening collisions.

#### II. **PARTIES**

#### A. **Plaintiff**

12. Plaintiff Ramiro Pereda ("Plaintiff" for the purposes of this paragraph) is an individual residing in San Leandro, CA. During 2016, Plaintiff purchased a pre-owned 2010 Silverado 2500 HD (for purposes of Plaintiff's allegations, the "Class Vehicle") from Trucks and Toyz, a used vehicle dealership, located in Fairfield, CA. At the time, Plaintiff reasonably expected that the airbags and seatbelts would function in the event of a crash and had no way of knowing that it contained a dangerous and defective SDM calibration that could cause the airbags and seatbelts to fail during a crash. To the contrary, before acquiring the vehicle, Plaintiff viewed or heard commercials and reviews through television, radio, and the internet that touted the safety and reliability of Plaintiff's vehicle and GM vehicles generally. GM concealed the existence of the defective SDM calibration from consumers including Plaintiff. Plaintiff would not have purchased the Class Vehicle, or would have paid less for it, if Defendants did not conceal material information about the defective SDM calibration.

- 3 -2293238.3 CLASS ACTION COMPLAINT

## **B.** Defendants

- 13. General Motors LLC ("GM LLC") is a Delaware limited liability company with its principal place of business located at 300 Renaissance Center, Detroit, Michigan, and is a citizen of the States of Delaware and Michigan. The sole member and owner of GM LLC is General Motors Holdings LLC.
- 14. General Motors Holdings LLC ("GM Holdings") is a Delaware limited liability company with its principal place of business in Detroit, Michigan, and is a citizen of the States of Delaware and Michigan. The sole member and owner of GM Holdings is General Motors Company.
- 15. General Motors Company ("GM Parent") is a Delaware corporation with its principal place of business in Detroit, Michigan, and is a citizen of the States of Delaware and Michigan. GM Parent's only asset is its 100% ownership interest in GM Holdings. In public SEC filings, GM Parent states: "We design, build and sell cars, trucks, crossovers and automobile parts worldwide." GM Parent sells vehicles "through [its] dealer network to retail customers." As further noted in SEC filings, GM Parent is also responsible for making reports to NHTSA related to vehicle safety and making determinations as to vehicle recalls.<sup>3</sup>
- 16. Each of GM LLC, GM Holdings, and GM Parent operates out of GM's Global Headquarters in Detroit, Michigan.
- 17. In June 2009, General Motors Corporation ("Old GM") filed for bankruptcy. Defendants were then created on or about July 10, 2009, in connection with the sale of substantially all of Old GM's assets pursuant to a Master Sale and Purchase Agreement. As a result of the sale, GM LLC acquired substantially all of Old GM's books, records, and personnel. GM LLC then transferred some of these assets to GM Holdings (formed shortly after the bankruptcy sale). Defendants thereby acquired from Old GM the knowledge about the SDM Calibration Defect (defined below) that those books, records, and personnel held. GM Parent and GM LLC also took responsibility for any necessary recalls of Old GM vehicles going forward.

2293238.3 - 4 - CLASS ACTION COMPLAINT

<sup>&</sup>lt;sup>3</sup> See General Motors Company's Form 10-K for fiscal year 2019.

18. The causes of action in this Complaint are directed to GM Parent, GM Holdings, and GM LLC and are based on their misconduct.

## III. JURISDICTION, VENUE, AND INTRADISTRICT ASSIGNMENT

- 19. This Court has original jurisdiction over this action pursuant to the Class Action Fairness Act ("CAFA"), 28 U.S.C. § 1332(d), because at least one Class member is of diverse citizenship from one Defendant, there are more than 100 Class members, and the aggregate amount in controversy exceeds \$5 million, exclusive of interest and costs.
- 20. This Court has personal jurisdiction over Defendants under California Code of Civil Procedure section 410.10.
- 21. Venue is proper in this District under 28 U.S.C. § 1391, and this action should be assigned to the San Francisco or Oakland Divisions under N.D. Cal. L.R. 3-2, because a substantial part of the events or omissions which give rise to the claims occurred in Alameda county, where Plaintiff resides and where the property that is the subject of his legal claims—his Class Vehicle—is located. GM conducts substantial business, including through numerous dealerships, and marketed, advertised, sold, and leased Class Vehicle in this District.

## IV. GENERAL FACTUAL ALLEGATIONS

### A. SDMs are supposed to detect crashes and control airbags and seatbelts.

- 22. Motor vehicles are required by federal law to use safety features to protect occupants in the event of a crash. These features include seatbelt pretensioners, which tighten seatbelts to secure the occupants, and airbags, which are cushions that rapidly inflate from the steering wheel and other areas of the vehicle. During an accident, seatbelt pretensioners hold vehicle occupants in place, and airbags buffer or prevent impact between occupants and hard structures in the vehicle. Without the airbags, slamming into the hard structures (such as the steering wheel) during a crash can cause serious injuries or death.
- 23. When functioning properly, the combination of seatbelts and airbags is highly effective in reducing the safety risk in automobile collisions. NHTSA reports that the use of seatbelts and airbags reduces fatality risk by 61 percent compared to an unbelted occupant in a

2293238.3 - 5 - CLASS ACTION COMPLAINT

vehicle without airbags.<sup>4</sup> From 1987 to 2017, an estimated 50,457 lives were saved because frontal airbags deployed during a crash.<sup>5</sup>

- 24. Although airbags work effectively to protect occupants when necessary, they are not meant to deploy with every impact. A crash may be of lower intensity (e.g., a fender bender in a parking lot) such that the seatbelt alone will be sufficient protection for the occupant.<sup>6</sup> Airbags are designed to deploy in "moderate to severe" frontal or near-frontal crashes. A "moderate to severe" frontal crash is the equivalent of hitting a solid, fixed barrier at 8-14 miles per hour or higher.<sup>7</sup>
- 25. Seatbelt and airbag systems are known as "passive" safety systems because, when they are needed, they are supposed to operate automatically (meaning, the driver does not need to hit a button to deploy the airbag). They use sophisticated components and software to activate and deploy the seatbelts and airbags systems automatically.
- 26. The "brain" behind this operation is the airbag control unit or "ACU" (also known as an Electronic Control Unit or "ECU"). GM refers to this component as the "Sensing and Diagnostic Module" or "SDM," and that term is used throughout this Complaint. SDMs are effectively computers that control the car's safety systems. They are intended, where necessary, to issue a "command" to deploy airbags and tighten seatbelts to prevent or mitigate injury to the vehicle occupants in a crash.
- 27. The SDM operates in three basic phases. First, during regular vehicle operation, the SDM is set in a resting or "normal" mode. In this mode, the SDM constantly receives signals from sensors placed throughout the vehicle, which collect and report information on inputs such

26

27

28

25

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15

16

17

18

19

20

21

22

23

- 6 -2293238.3 CLASS ACTION COMPLAINT

<sup>24</sup> 

<sup>&</sup>lt;sup>4</sup> U.S. Department of Transportation, NHTSA, Fatalities in Frontal Crashes Despite Seat Belts and Airbags, NHTSA Technical Report No. DOT HS 811 202 (September 2009).

<sup>&</sup>lt;sup>5</sup> NHTSA, Air Bags Overview. Available at: https://www.nhtsa.gov/equipment/air-bags (last visited August 4, 2021).

<sup>&</sup>lt;sup>6</sup> Dr. Ching-Yao Chan, Fundamentals of Crash Sensing in Automotive Airbag Systems. Copyright Society of Automotive Engineers, (2000), at p. 50.

<sup>&</sup>lt;sup>7</sup> Air Bags Overview, *supra* note 5.

1

4 5

3

6 7

8 9

10

11 12

13 14

15 16

17

18

19 20

21

22

23

24 25

26

28

27

as acceleration, wheel speed, brake pressure, and impacts. The SDM monitors and interprets these signals to determine whether the vehicle is involved (or about to be involved) in a crash.

- 28. Second, while monitoring these signals in "normal" mode, if and when the SDM detects an irregular input that suggests a potential crash, it "wakes up" to search for confirmation of a crash (as opposed to, for example, an irregular input from slamming on the brakes and then avoiding a collision). In this second stage—known as "wake up" or "standby" mode—the SDM's crash-sensing software algorithm is engaged to quickly decipher crash status. After this "wake up" mode is initially triggered by an irregular input, if additional inputs confirm a moderate to severe frontal crash, the SDM should issue a command to "fire" the airbag and/or tighten the seatbelts as needed. <sup>10</sup>
- Third, the final phase in this sequence is the "reset" phase. From "wake up" 29. mode, after it detects that a crash or a potential crash has fully completed, (i.e., that the vehicle has returned to normal operation after an irregular input) the SDM ultimately returns to its normal operating state through "resetting."
- 30. A vehicle striking a pothole illustrates this three-phase sequence. The vehicle first operates with the SDM in "normal" mode as it drives down the road. Then, suddenly, the driver hits an unseen pothole. This jolt from hitting the pothole (and/or related inputs like deceleration) will trigger the SDM to "wake up" mode where it searches for more inputs, quickly asking: "How fast is the vehicle slowing down? Is the front bumper crushed? Is the vehicle speeding back up normally?" and reacting in turn. 11 If the SDM senses that the vehicle returns to normal operation and continues down the road, it will stop looking for confirmation of a crash and reset back to normal after it determines the danger has passed. On the other hand, if, after it hits the

<sup>&</sup>lt;sup>8</sup> Clemson University Vehicular Electronics Laboratory, "Airbag Deployment Systems." Available at: https://cecas.clemson.edu/cvel/auto/systems/airbag\_deployment.html (last visited August 4, 2021).

<sup>9</sup> John Pearley Huffman, "The Physics of Airbags," *Car & Driver*, June 14, 2011. Available at:

https://www.caranddriver.com/features/a15121591/the-physics-of-airbags-feature (last visited August 4, 2021).

<sup>&</sup>lt;sup>10</sup> Jesse Kendall, P.E., and Kenneth Solomon, Ph.D., "Airbag Deployment Criteria" at p. 11. Available at: https://www.experts.com/content/articles/Kenneth-Solomon-Airbag-Paper.pdf (last visited August 4, 2021).

<sup>&</sup>lt;sup>11</sup> Solomon, *supra* note 10, at p. 11.

4

5678

9

12 13

11

15

16

14

17 18

19

21

20

23

22

24

2526

27

28

pothole, the vehicle veers out of its lane and crashes into another vehicle head on, the SDM should detect this second input and fire the airbag.<sup>12</sup>

31. This entire sequence—from sensing an irregular signal (the pothole), to waking up and searching for confirmation of a crash, to firing the airbag where needed—might take only fractions of a second. Indeed, a typical "crash duration" in a frontal, vehicle-to-barrier collision lasts for approximately 80-150 milliseconds (0.08-0.15 seconds). For that reason, timing this sequence properly is critically important to ensure that the seatbelts are tightened, and the airbags deploy to protect the occupants when they need to.

# B. GM used a dangerous and defective SDM software calibration in its trucks and SUVs.

- 32. Throughout the three-phase sequence described above, SDMs rely on software algorithms to interpret signals, estimate crash dynamics, and issue a "deploy" or "do not deploy" command to the safety systems. For the SDM to function as intended, the software that controls it must be designed to recognize and react to crashes so that the airbags inflate when they are needed.
- 33. Crash sensing occurs in "real-time," meaning that the sensing algorithm can only examine a limited window of data to predict and judge the severity of crash events before conclusion, so that the airbags can deploy and protect the occupant on impact.<sup>14</sup> A decision to "deploy" the airbags should occur when thresholds set to tell the SDM a crash is severe enough (i.e. a moderate to severe frontal collision) are met or exceeded. These deployment thresholds are programmed into the SDM software through a process in which engineers "calibrate" the software in the vehicle.
- 34. In the Class Vehicles, the software calibration that controls how the SDM detects accidents and deploys the safety system contains a serious defect (the "SDM Calibration Defect"). Specifically, for frontal crashes, GM calibrated the SDM to prevent deployment of airbags and pretensioners more than 45 milliseconds after it enters "wake up" mode. GM did

<sup>&</sup>lt;sup>12</sup> *Id*. at p. 8.

<sup>&</sup>lt;sup>13</sup> Chan, *supra* note 6, at p. 169.

<sup>&</sup>lt;sup>14</sup> Chan, *supra* note 6, at p. 95.

this by increasing the deployment thresholds to unattainable values 45 milliseconds into the crash sequence. With this calibration in place, no matter how severe the inputs the SDM received after 45 milliseconds, the airbags and pretensioners would not deploy.

- 35. This defect was no accident; rather, as detailed below, GM included it by design when it modified the SDM software program (known as ALGO-S) in the Class Vehicles to include it.
- 36. In affirmatively blocking these critical safety features after 45 milliseconds, GM greatly and needlessly increased the risk of injury and death in a variety of frontal crashes.

  Specifically, the defect manifests in frontal crashes that endure for 45 milliseconds or longer and require airbag deployment or seatbelt tightening after 45 milliseconds.
- 37. For example, this includes frontal crashes with multiple, distinct points of impact known as "concatenated" events. A vehicle that first hits a curb and then veers and hits a tree, or first hits a speed bump and then crashes into the vehicle in front of it, are examples of concatenated crashes. By their nature, concatenated accidents involve multiple discrete inputs for the SDM to detect during a crash sequence.
- 38. In concatenated crashes, the first part of the incident (hitting a curb) sends the SDM into its "wake up" or "stand by" mode. The initial curb hit does not trigger the airbag or tighten the seatbelt, but the SDM "wakes up" to confirm whether further irregular signals will follow and indicate a need for the seatbelts or airbags. In the Class Vehicles—because of the software calibration that controls the SDM—the "wake up" mode lasts for just 45 milliseconds after the first irregular signal. After that time, and by GM's design, the deployment thresholds in the software drastically increase, such that no further input, no matter how severe, could exceed the thresholds and trigger the airbag to deploy or seatbelts to tighten.<sup>15</sup>
- 39. In addition to concatenated crashes, the defect is also implicated in frontal crashes that increase in severity and require airbag deployment or seatbelt tightening after an initial, "soft" impact. These types of crashes are referred to herein as "prolonged" or "long-soft" crash

2293238.3 - 9 - CLASS ACTION COMPLAINT

<sup>&</sup>lt;sup>15</sup> As detailed in this section, the triggering thresholds are pre-set inputs in the software that tell the SDM that a crash is severe enough to deploy an airbag.

1

7 8 9

11 12 13

10

14 15

16 17

18

19 20

21 22

23

24

25

26

27

an angle, which will result in a "softer" impact than a head-on crash into a rigid barrier (which is a "hard" crash). Chan, *supra* note 6, at p. 40. 28

<sup>17</sup> Chan, *supra* note 6, at p. 40.

onsets. This would include, for example, a crash into another vehicle's bumper which—because the bumper is comparatively "soft"—may take time before the "soft" bumper collapses, and a "hard" impact into the engine compartment begins. 16 "Soft" crashes involve a "relatively long" crash duration" that may last 20-50 percent longer than a head-on crash into a rigid barrier, like a cement wall.<sup>17</sup>

- 40. In a prolonged onset crash, the initial impact into a "soft" surface, such as a bumper, starts the SDM clock ticking. Depending on the crash conditions such as speed, road incline, angle of impact, weather, ice on the road, etc., this "soft" impact may last longer than 45 milliseconds. Throughout the "soft" impact, the SDM will be in wake-up mode to search for a confirmatory signal. But it will not find another input sufficient to trigger the airbags from the "soft" impact. As explained above, in the Class Vehicles, the SDM clock effectively times out when the 45 millisecond mark hits. So, if the crash proceeds through the "soft" layers and into the engine compartment of another vehicle at say, 70 milliseconds, no airbag or seatbelt deployment is possible no matter how severe the later, "hard" impact gets.
- 41. In practice, this means that the airbags and seatbelt pretensioners in the Class Vehicles can only be fired within 45 milliseconds of a first, irregular signal. If a second signal occurs after 45 milliseconds, the SDM purposefully, by design, disregards signals that would otherwise trigger airbag deployment.
- 42. The net result is a "dead zone" starting just 45 milliseconds into a crash, after which vehicle occupants are completely vulnerable. The dead zone lasts until the SDM detects that the crash has ended completely (meaning that the irregular signals have concluded, and the vehicle has resumed normal operation), and then resets back to normal mode.
- 43. This significant gap in protection after 45 milliseconds is unreasonably dangerous because accidents—particularly complicated, real-world accidents—are not necessarily completed at that point. In many cases, a crash continues, and airbags and seatbelts are needed,

<sup>16</sup> An example of a "soft" crash is where a vehicle crashes into a deformable barrier, or crashes at

well after that time. Yet, GM's SDM software calibration in the Class Vehicles makes it impossible for the airbags to deploy and seatbelts to tighten in the "dead zone" in which a crash may still be underway—which is a serious, unjustified, and dangerous safety defect. Indeed, even GM's own cars division includes a significantly longer window for potential deployment.

# C. GM knew that the SDM Calibration Defect was dangerous and unjustified but has failed to warn or compensate consumers.

- 44. GM knew or had reason to know of the SDM Calibration Defect and the risks it entails from at least July 10, 2009, when GM acquired substantially all of Old GM's books, records, and personnel, and the knowledge about the defective SDM software calibration those books, records, and personnel held. GM has continued to acquire knowledge—based on lawsuits implicating the SDM Calibration Defect and hundreds of publicly reported accidents with airbag and seatbelt failures—from 2009 to the present.
- 45. Nonetheless, GM has continued to conceal this problem and the pattern of accidents, injuries, and deaths that have resulted from it. GM has failed to share this information with the consumers who paid for and drive these Class Vehicles every day.
- 46. It should come as no surprise that GM has unreasonably and unsafely delayed disclosure of the SDM Calibration Defect. Indeed, GM has a recent history of attempts to avoid the costs, potential liabilities, and reputational harms from a safety recall for Takata airbags and seems to have repeated that same tactic here.
- 47. As is now public knowledge, millions of GM vehicles contain the dangerous and defective Takata airbag inflators that can explode with too much force and spray metal shrapnel into vehicle passenger compartments. While the dangers of these Takata airbags were widely known for years, GM lobbied regulators to delay a recall for its affected vehicles to avoid a resulting hit to its profits.<sup>18</sup> In 2016, GM reported that recalling its vehicles with Takata inflators would cost hundreds of millions of dollars.<sup>19</sup>

<sup>&</sup>lt;sup>18</sup> "GM seeks to delay recall of 1 million vehicles with Takata air bag inflators." *Reuters*, September 16, 2016. Available at: https://www.reuters.com/article/us-gm-recall/gm-seeks-to-delay-recall-of-1-million-vehicles-with-takata-air-bag-inflators-idUSKCN11M27N (last visited August 4, 2021).

- 48. Consumers brought a putative class action seeking redress. See In re Takata Airbag Product Liability Litigation, Case No. 14-cv-240009, Dkt. 2750, (S.D. Fl.). While other vehicle manufacturers had earlier and voluntarily recalled their vehicles with Takata airbags, it was only years later, with that consumer litigation pending, that GM finally issued a belated recall. And importantly, it did so only after regulators from NHTSA denied GM's petition for inconsequentiality, in which it attempted to argue that a recall was not necessary.<sup>20</sup>
- 49. Here, as in Takata, GM knew or should have known that the SDM software calibration in the Class Vehicles—which includes a dead zone that prevents the airbag and seatbelts from deploying after 45 milliseconds—was dangerous. Nonetheless, GM kept using it anyway, did not recall or repair the Class Vehicles to correct it, and still has not told consumers about it.
  - 1. Old GM recklessly downplayed serious risks of injury when it chose to include the SDM Calibration Defect in the Class Vehicles.
- 50. In general, the vehicle manufacturer sets the deployment thresholds in the SDM software calibration that will trigger a command to fire the airbags and/or tighten the seatbelts. The vehicle manufacturer uses results from laboratory crash testing to inform these parameters.<sup>21</sup>
- 51. But laboratory results are not sufficient in themselves, because real-world accidents—which can occur from multiple angles and involve inputs from myriad variables like weather, temperature, or incline—will differ from the testing environment.<sup>22</sup> For that reason, manufacturers must exercise appropriate care to design crash sensing frameworks that function to keep people safe in the real world.
- 52. Old GM worked with an external team of engineers from Delco Electronics (later called Delphi Electronics) to develop the SDM software program used in the Class Vehicles, starting with Model Year 1999. The team from Delco developed a proposed software program, known as ALGO-S, which it presented to Old GM for review.

2293238.3

<sup>&</sup>lt;sup>20</sup> "GM will recall 7 million vehicles for air bag issue worldwide." *Reuters*, November 23, 2020. Available at: https://www.reuters.com/article/us-gm-recall/gm-will-recall-7-million-vehicles-for-air-bag-issue-worldwide-idUSKBN2831TH (last visited August 4, 2021).

<sup>&</sup>lt;sup>21</sup> Huffman, *supra* note 9.

<sup>&</sup>lt;sup>22</sup> Solomon, *supra* note 10, at 13.

- 53. During this time, Old GM divided the design and development of its vehicles into a "cars" group and a "trucks" group, with the trucks group responsible for design, development, and production of larger model trucks and SUVs. After it reviewed the Delco team's proposed SDM software algorithm, ALGO-S, the trucks group insisted on adding the 45-millisecond cut off described above when it calibrated that program for use in its trucks and SUVs. On information and belief, the trucks group proposed this cutoff based on test results which indicated that frontal-barrier accidents in its trucks and SUVs would be complete within 45 milliseconds or less in laboratory conditions.
- 54. In response, the Delco team expressly warned the trucks group that such an aggressive cutoff could fail to capture additional signals in complex crashes outside of the laboratory, leaving occupants completely unprotected during prolonged onset crashes or crashes with multiple impact points. The trucks group insisted, however, and the 45-millisecond cutoff was added in the SDM software calibration for GM trucks and SUVs.
- 55. On information and belief, documents, records, and personnel reflecting GM trucks' insistence—over Delco's objection—to include this cutoff were passed on from Old GM to New GM in 2009. On information and belief, other major vehicle manufacturers throughout the industry include a significantly longer window for the SDM to detect a potential accident and deploy the airbags and seatbelts.
- 56. Indeed, in the ALGO-S program as it was designed by Delco, the window in which the airbags and seatbelts can deploy in a crash is up to at least 150 milliseconds—over three times the interval that GM trucks added in the defective calibration. Tellingly, after the Delco team repeated the same warnings about the truck group's proposed 45-millisecond cutoff to GM's cars group, the cars group rejected the shorter cutoff. Instead, the cars group used the ALGO-S software with the Delco-recommended period of 150 milliseconds for deployment.
- 57. Delco's original 150 millisecond window allows for airbag and seatbelt deployment in real-world frontal crashes, which themselves can endure for up to 150 milliseconds.<sup>23</sup> When GM trucks added the defective 45-millisecond cutoff to the software

2293238.3 - 13 - CLASS ACTION COMPLAINT

<sup>&</sup>lt;sup>23</sup> Chan, *supra* note 6, at p. 169.

calibration in the Class Vehicles, it prematurely, and dangerously, prevented the airbags and seatbelts from functioning when a frontal crash may still be well underway.

3

#### 2. The 45-millisecond cutoff was not necessary to protect against "late" airbag deployments.

5

6

59.

4

58. GM trucks group's insistence on the 45 millisecond window after which the airbags and seatbelts cannot deploy was unjustified and unsafe.

7 8

9

10 11

12 13

14 15

17

16

18 19

20 21

22 23

24

25

26

to concerns about the potential for airbags to deploy "too late" during an accident. But as the trucks group also knew, these concerns were unwarranted given technology that mitigated the risks of "late" airbag deployments.

On information and belief, the trucks group chose to set this aggressive cutoff due

- A brief history of airbags in motor vehicles puts this reckless decision in context. 60. Before 1998, airbag systems were effectively one-size-fits-all. Designed to protect against only frontal crashes, these "first-generation" airbags were built to meet a standardized government test that required they protect an unbelted, midsize adult male dummy (175 pounds) in a 30-MPH crash into a rigid barrier.<sup>24</sup> To do so, an airbag had to fill up quickly with gas, resulting in a deployment speed of up to 200 MPH.<sup>25</sup>
- 61. Not all vehicle occupants fit this description, however, and the intensity of firstgeneration airbag deployment could prove dangerous for children and those who were positioned too close to the bag when it inflated (for example, because they had already been thrown forward toward the steering wheel during an under-way accident).<sup>26</sup>
- 62. Public perception about airbag safety in motor vehicles, and in turn, the vehicle manufacturers that sold them, turned increasingly unfavorable following reports of late and aggressive deployments in first generation airbags. Both regulators and vehicle manufacturers

- 14 -CLASS ACTION COMPLAINT 2293238.3

27

<sup>&</sup>lt;sup>24</sup> Jack Keebler, Airbags Safe Insane? – Special Report, Motortrend (Sept. 1, 2000), https://www.motortrend.com/news/airbags-safe-insane-special-report/ (last visited August 4, 2021).

<sup>&</sup>lt;sup>25</sup> Id.; see also David B. Ottaway & Warren Brown, From Life Saver to Fatal Threat, The Wash. Post (June 1, 1997), https://www.washingtonpost.com/archive/politics/1997/06/01/from-lifesaver-to-fatal-threat/56d05b9e-a1bc-49b7-beb4-43480762b25e/ (last visited August 4, 2021). <sup>26</sup> Susan A. Ferguson & Lawrence W. Schneider, An Overview of Frontal Airbag Performance with Changes in Frontal Crash-Test Requirements: Findings of the Blue Ribbon Panel for the Evaluation of Advanced Technology Airbags, Traffic Injury Prevention 3 (Nov. 2008).

1

3

4

5 6

8 9

7

10 11

13 14

12

15 16

17 18

19

20 21

22

23

24

25

26

<sup>30</sup> See NHTSA Redesign Report, supra note 27 at 25. 27 <sup>31</sup> *Id*. at vii. 28

<sup>32</sup> Keebler, *supra* note 24.

recognized the need to address these issues.<sup>27</sup> Beginning in October 1995, NHTSA initiated a series of actions to minimize and eventually eliminate the adverse effects of late and aggressive airbag deployments while preserving their life-saving benefits.<sup>28</sup>

- In 1997, NHTSA issued modified federal rules to allow automakers to reduce the energy in frontal airbags. This led to "an industry-wide changeover" to "redesigned" airbags in the very next model years (1998-1999).<sup>29</sup> The "redesign" consisted of several new technology innovations. The first and immediate solution was "depowered" airbags: automobile manufacturers removed some of the gas-generating propellant or stored gas from the inflators to reduce the pressure and velocity of deployments. This change alone was highly effective in reducing low-to-moderate speed fatalities.<sup>30</sup>
- Other innovations to reduce the risk of aggressive deployments included reducing 64. the volume or rearward extent of airbags, positioning them further from occupants, revised folding techniques, and tethering and shifting from pyrotechnic inflators to hybrids including stored gas.<sup>31</sup>
- 65. Old GM knew about and employed these new technologies in its vehicles. Indeed, as the director of Old GM's Safety Center Terry Connolly said in 2000, there were no significant downsides to using this new "depowered" airbag technology, even for unbelted passengers.<sup>32</sup>
- Further innovations referred to as "advanced" or "smart" airbags followed soon 66. thereafter.<sup>33</sup> "Advanced" airbags alter deployment patterns according to feedback from a number of sensors. These sensors tailor how the airbag deploys based on the severity of the crash, the

<sup>27</sup> U.S. Department of Transportation, NHTSA, An Evaluation of the 1998–1999 Redesign of

Frontal Air Bags, NHTSA Technical Report No. DOT HS 810 685, p.11, (August 2006) [hereinafter "NHTSA Redesign Report"]; see also Ferguson & Schneider, supra note 26. <sup>28</sup> NHTSA Redesign Report, *supra* note 27, at vii. <sup>29</sup> Id.; see also Micah Wright, The Hidden Dangers of Older Airbags, MotorBiscuit (May 8, 2015), https://www.motorbiscuit.com/the-hidden-dangers-of-older-airbags (last visited August 4,

<sup>&</sup>lt;sup>33</sup> See NHTSA Redesign Report, supra note 27 at p. 3.

size and posture of the vehicle occupant, whether the occupant is wearing a seatbelt, and how close the occupant is to the airbag. <sup>34</sup>

- 67. Many "advanced" systems use dual-stage or multi-stage inflators. This means that they have two inflation stages that can be ignited sequentially or simultaneously depending on crash severity.
- 68. "Advanced" airbags were phased into production beginning September 1, 2003 and were required in all new vehicles by September 1, 2006.<sup>35</sup>
- 69. Thus, based on the depowered and advanced airbag technology starting in 1998 and 1999, the risks posed by "late" deployments in early generation airbags had greatly diminished. Indeed, while NHTSA estimates that more than 290 deaths were caused by frontal airbag inflation between 1990 and 2008, nearly 90 percent of those deaths occurred in vehicles manufactured before 1998 (i.e. with first generation airbag technology). Today, with this new technology, serious injuries from properly functioning airbags are rare. Today
- 70. Despite knowledge and use of the new technology mitigating the risks of late deployments, the trucks group still insisted on shutting off the airbags and seatbelts in the Class Vehicles after 45 milliseconds. On information and belief, despite these well-established advancements in airbag technology outlined above, GM continued to use this same defective software algorithm in its vehicles in 2009 and beyond.<sup>38</sup>
- 71. This reckless decision and continued disregard for clear warnings about the risks in shutting off the SDM too soon during an accident has had real and tragic consequences.
  - 3. GM knew about a pattern of suspicious accidents involving the SDM Calibration Defect but has done nothing to correct it.
- 72. As outlined above, GM has known about the SDM Calibration Defect since it took over Old GM's books, records, and personnel in 2009. GM has continued to accrue

2293238.3 - 16 - CLASS ACTION COMPLAINT

<sup>&</sup>lt;sup>34</sup> Wright, *supra* note 29.

<sup>&</sup>lt;sup>35</sup> NHTSA Redesign Report, *supra* note 27, at vii.

<sup>&</sup>lt;sup>36</sup> Insurance Institute for Highway Safety. "Airbags" (2021), available at:

https://www.iihs.org/topics/airbags (last visited August 4, 2021).

 $<sup>^{37}</sup>$  *Îd*.

<sup>&</sup>lt;sup>38</sup> Publicly available crash data reports from NHTSA indicate that the Delco SDM was used in GM trucks vehicles up through at least MY 2015.

knowledge of the defect, and its serious consequences, in the years since. Indeed, GM has known about, investigated, and even litigated numerous crashes in which airbags suspiciously failed to deploy in multi-impact or prolonged onset frontal crashes in the Class Vehicles—a clear indication of the SDM Calibration Defect.

73. Despite obvious signs of a known and dangerous risk, GM concealed these accidents and the SDM Calibration Defect from consumers and regulators to avoid or at least delay a recall and the attendant costs and reputational damage therefrom. To date, GM has taken no corrective action to repair or recall the Class Vehicles to address this defect.

# a. <u>GM has litigated personal injury lawsuits for suspicious airbag</u> failures in the Class Vehicles.

- 74. In addition to its institutional records and knowledge, GM was on notice of the SDM Calibration Defect through litigating personal injury lawsuits involving airbag and seatbelts failures consistent with the SDM Calibration Defect.
- 75. In one case filed in 2011—just two years after GM was formed—plaintiff James Nossar sued GM LLC following a crash in his 2005 Chevrolet Trailblazer (a Class Vehicle here). As detailed in that complaint, on or about February 25, 2010, Mr. Nossar drove his Trailblazer into the back of a 1999 Suburban "and sustained a moderate to severe frontal impact . . . at a rate of speed that exceeded the airbag system's predetermined deployment threshold." *See Nossar v. General Motors LLC*, Dkt. 4, Case No. 1:11-cv-02129 (N.D. Ga.). Despite this "significant frontal collision," the airbag failed to deploy and seatbelt pretensioners failed to trigger. Without the airbag or seatbelt to protect him, Mr. Nossar's head slammed into the steering wheel, which caused "fracturing practically every bone in his face and brain injuries." *Id.*
- 76. In support of his claims, in April 2012, Mr. Nossar filed an expert report from Chris Caruso. Mr. Caruso is an expert in automotive crash sensing systems and worked for Delco engineering during the development of the defective SDM software in the Class Vehicles. *See id.* at Dkt. 40-2.

- 77. In that report, Caruso detailed the same flaws in the SDM software calibration described herein. He explained that the airbag sensing system in the Trailblazer was "defective by design and has the potential to not deploy frontal impact airbags in high speed frontal impacts where conditions vary slightly from the perfect laboratory conditions where the system was designed and tested." Based on Caruso's experience working in the development of the SDM software, he related that there were concerns, due to the calibration, "that in longer duration, but high severity events and in concatenated events (such as a curb impact followed by a utility pole impact), the airbags would fail to deploy because the algorithm deployment thresholds were no longer active." *Id*.
- 78. Caruso further related that as that litigation proceeded into discovery, he would "expect to identify emails and other correspondence between GM Truck Engineers and Delphi Crash Sensor engineers discussing the concerns over GM Truck Groups' edict to set certain crash sensor calibration parameters outside the recommended minimum guidelines set by the crash sensing algorithm designers [i.e. the Delphi/Delco engineers]." Caruso "ha[d] seen these documents before and kn[e]w the content," and summarized that "the calibration values result in premature turning off of algorithm thresholds which effectively disables the front airbags after 45 to 50ms." *Id.* (emphasis added).
- 79. As to Mr. Nossar's crash specifically, Caruso concluded that the airbags and seatbelts failed because, at the time the airbags should have deployed, "the SDM calibration had already timed out after 45-ms after the crash started." Caruso's conclusion there was that "[t]he failure by GM to understand the risks of certain dictated calibration values [in the SDM software calibration] led directly to the design defect that rendered the frontal impact airbag system in the 2005 Chevrolet Trailblazer defective and unreasonably dangerous in certain field relevant, real-world crashes." *Id*.
- 80. GM LLC, a named defendant in that case, clearly knew about and received Mr. Caruso's report outlining the history of these issues in the SDM software calibration.
- 81. Another plaintiff, Chad Vaith, filed a lawsuit against GM LLC in 2017 after an accident in his MY 2014 Silverado. As that complaint relates, in December 2015, Mr. Vaith was

2293238.3 - 18 - CLASS ACTION COMPLAINT

	1
	2
	3
	4
	5
	6
	7
	8
	9
1	0
1	1
1	2
1	3
1	4
1	5
1	6
1	7
1	8
1	9
2	0
2	1
2	2
2	3

involved in an accident in which he drove his Silverado "off the road into a ditch," after which he "continued through the ditch for approximately forty yards before launching over the driveway/culvert. . . before coming to a final rest approximately twenty yards south." *See Vaith v. General Motors LLC*, Dkt. 1, Case No. 18-cv-00031 (D. Minn.). Despite multiple impacts in that prolonged accident, the airbags and seatbelts did not deploy, causing Mr. Vaith to "suffer severe personal injuries." Mr. Caruso was also a disclosed expert in that case, although a report was not publicly filed. *See*, *e.g.*, *id.* at Dkt. 64.

- 82. Mr. Vaith's case proceeded into fact discovery and ultimately resulted in a "negotiated settlement" between Mr. Vaith and GM. *Id.* at Dkt. 82.
- 83. Apart from previous lawsuits against GM with Mr. Caruso as an expert, another automotive crash expert, Sal Fariello, wrote directly to GM's CEO Mary Barra twice in December 2016 to raise similar concerns about issues he had observed in the airbag sensing system in model year 2006 GM SUVs. Mr. Fariello's letters are available in NHTSA's public records.<sup>39</sup>
- 84. Mr. Fariello's letters to GM's CEO focused on an accident in a 2006 Trailblazer (a Class Vehicle here) for which he served as a litigation consultant in a lawsuit filed in or around 2014. Therein, he lists multiple technical issues with the airbag sensing system that he wanted to bring to GM's attention and urge them to address. For example, he cautions that, in his view:
- a. "The deployment thresholds [i.e. the inputs that will trigger deployment] for the airbag were set too high and compromised driver and passenger safety as a result of GM's improper effort to mitigate lawsuits related to relatively low speed deployments of the airbag.";
- b. "The deployment threshold did not meet GM's and generally accepted standards for when an airbag should deploy in order to prevent occupant death based on written technical papers and educational videos produced by GM or its employees."; and

28

24

25

2293238.3 - 19 - CLASS ACTION COMPLAINT

<sup>2627</sup> 

<sup>&</sup>lt;sup>39</sup> Mr. Fariello is a forensic crash investigator. *See* Bill Saporito, "Air Bag Blow Out," *Time Magazine*, (December 4, 2014). Available at: https://time.com/3617681/the-air-bag-blowout (last visited August 4, 2021).

1	c. "Failure of the SDM to independently process a crash pulse and deploy the
2	airbag implicates a defective software algorithm; specifically 'Algo S-H' [the software algorithm
3	in the Class Vehicles]."
4	85. At the time, in 2016, Mr. Fariello noted that the SDM could be re-programed
5	"with a more responsive algorithm" to resolve these issues, and that GM's "only apparent motive
6	for not doing this related to the cost of implementing a recall."
7	86. Frustrated by the response he received from GM's counsel in response to these
8	letters, Mr. Fariello then wrote to Senator Bill Nelson of Florida enclosing his correspondence to
9	GM and escalating his concerns. Senator Nelson then forwarded that correspondence to
10	NHTSA. <sup>40</sup>
11	87. As Mr. Fariello concluded, in his view, GM was stalling on this issue "just as
12	they did with the Takata airbag matter."
13	b. GM knew or should have known about hundreds of publicly
14	reported airbag failures in the Class Vehicles.
15	88. GM was also on notice of the SDM Calibration Defect and its attendant safety
16	risks from consumer complaints. These complaints are publicly available online through
17	NHTSA's website. Between 1999 and the present, hundreds of consumers reported to NHTSA
18	that airbags and/or seatbelts had suspiciously failed during frontal crashes involving
19	concatenated (multiple) impacts or potentially prolonged crash onsets.
20	89. On information and belief, vehicle manufacturers such as GM monitor these
21	public databases for complaints about their vehicles, considering their statutory obligations to
22	report known safety defects in their vehicles to NHTSA and consumers. Moreover, in many of
23	these reports, it is expressly clear that GM was directly informed of, and even investigated, the
24	accident in question. While GM has access to the full body of these complaints from 1999 and
25	
26	
27	

- 20 -CLASS ACTION COMPLAINT 2293238.3

 $<sup>^{40}</sup>$  Mr. Fariello's letters to GM and further documentation are available at:  $https://static.nhtsa.gov/odi/cmpl/2017/CL-10955948-3381.pdf \ (last \ visited \ August \ 4, \ 2021).$ 

onward in the public database, it bears mention that over three hundred of them were filed after the new GM entities were created in 2009.<sup>41</sup>

90. One such complaint details an accident in a 2004 Chevrolet Trailblazer in August 2014. The driver states that they were traveling 50 MPH on a four-lane highway where another vehicle, waiting to U-turn, "decided to turn right into me—oncoming traffic." The vehicles crashed, which then "sent [the driver] into a head on collision with the guard rail." The driver questions that "there were 2 incidents in that sequence of events that the airbags should have deployed, but did not! This accident caused several injuries to myself and my passenger. We definitely could have been killed and no airbags to help save our lives..." Photos of the damage to the vehicle from that accident follow. (NHTSA Complaint #1100694).



<sup>&</sup>lt;sup>41</sup> Many publicly reported accidents occurred prior to 2009, which information would likewise have been available to Old GM. GM would have acquired Old GM's knowledge of these accidents, reflected in its books, records, and personnel, when it was formed in 2009.



91. Another report describes a September 2012 accident in a 2005 Chevrolet Trailblazer. It states that the driver, at 30 MPH, swerved to avoid a deer in the road, which caused the vehicle to lose control, exit the road, and ultimately "crash[] off a 9 foot embankment." From there, the vehicle continued to crash through a field, into a dirt levy, and finally into a drainage ditch. None of the airbags deployed. The driver "became unconscious after his head crashed into the steering wheel" and "suffered severe neck injuries." The dealer later inspected the vehicle but responded that the results were "inconclusive" and that the manufacturer "was notified but offered no assistance." Photos of the damage to the vehicle from that accident follow. (NHTSA Complaint #942950).<sup>42</sup>

<sup>42</sup> Accident documentation and photos are available at: https://static.nhtsa.gov/odi/cmpl/2012/EQ-10477257-8767.pdf (last visited August 4, 2021).

2293238.3 - 22 - CLASS ACTION COMPLAINT






92. In another example, the complaint describes a serious accident in March 2019 involving a 2005 Chevrolet Equinox. The vehicle crashed into the front of another vehicle at 35

MPH. The airbags did not deploy. The driver sustained injuries to the head and ankle and required medical attention. Photos of the damage to the vehicle from that accident follow.

93. (NHTSA Complaint #1550406).<sup>43</sup>

2293238.3 - 24 - CLASS ACTION COMPLAINT

<sup>&</sup>lt;sup>43</sup> Photos and accident information are available at: https://static.nhtsa.gov/odi/cmpl/2019/EQ-11191960-7090.pdf (last visited August 4, 2021).

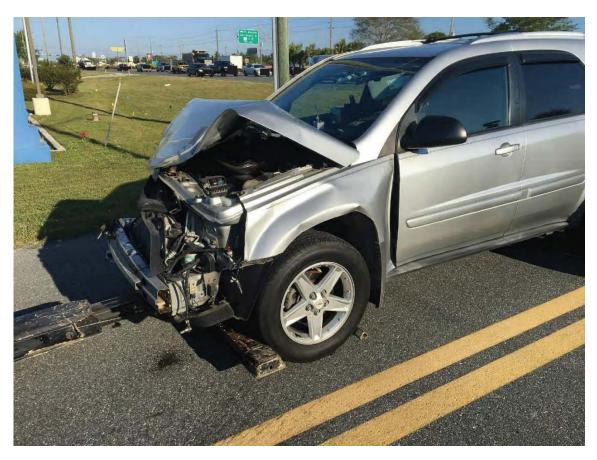

94. Another account of a July 2007 accident in a model year 2001 Isuzu Rodeo describes a crash at 65 MPH so severe that "the median on the highway sustained property damage" and "the vehicle was destroyed," but the airbags did not deploy. This is how the vehicle looked after that accident:



1	95. Additional examples of similarly suspicious frontal accidents—i.e., frontal
2	accidents with multiple discrete impacts, or potentially prolonged onset frontal crashes involving
3	"soft" impacts—in which the airbags and/or seatbelts failed include:
4	a. NHTSA complaint #753287 dated Tuesday, October 16, 2001, reported an
5	accident on Monday, October 8, 2001 involving a 1999 CHEVROLET SUBURBAN in Andover,
6	KS. The complaint states: "60 MPH CROSS WIND BLEW THE SUBURBAN HEAD ON INTO
7	THE CONCRETE MEDIAN. THE VEHICLE SPUN 360 DEGREES, WENT INTO THE
8	DITCH, THE FRONT END HIT AGAIN THE VEHICLE WENT UP THE OTHER SIDE OF
9	THE EMBANKMENT AND STOPPED IN A FIELD. ENTIRE FRONT END OF THE FRAME
10	NOT REPAIRABLE FRONT CROSSMEMBER BENT AND ENGINE MOVED
11	UPWARDS AT A 10 DEGREE ANGLE. AIR BAGS FAILED TO DEPLOY. *AK"44
12	b. NHTSA complaint #859858 dated Friday, April 7, 2000, reported an
13	accident on Saturday, April 3, 1999 involving a 1999 CHEVROLET SILVERADO. The
14	complaint states: "WHILE TRAVELING ON A WET ROAD AT HIGHWAY SPEED OF 60
15	MPH VEHICLE HYDROPLANED, SPUN INTO A DITCH, AND COLLIDED INTO A TREE
16	WITH BOTH SIDES AND FRONT OF VEHICLE. UPON IMPACT, AIR BAGS FAILED TO
17	<b>DEPLOY</b> . MFR. NOTIFIED. *AK"
18	c. NHTSA complaint #877320 dated Wednesday, January 3, 2001, reported
19	an accident on Friday, December 1, 2000 involving a 1999 CHEVROLET SUBURBAN in
20	Amarillo, TX. The complaint states: "CONSUMER WAS TRAVELING ABOUT 40MPH ON
21	HIGHWAY AND ANOTHER VEHICLE VEERED INTO HER LANE, HITTING HER HEAD-
22	ON, AND PUSHING VEHICLE INTO ANOTHER LANE. VEHICLE HIT TELEPHONE
23	POLE, AND DUAL AIRBAGS DIDN'T DEPLOY. CONSUMER WAS INJURED.
24	CHEVROLET HAS BEEN NOTIFIED. *AK"
25	d. NHTSA complaint #10060150 dated Tuesday, March 2, 2004, reported an
26	accident on Tuesday, February 24, 2004 involving a 2001 CHEVROLET BLAZER in Austin,
27	TX. The complaint states: "DRIVER SIDE AIR BAG FAILED TO DEPLOY IN A CRASH
28	

2293238.3 - 26 - Class action complaint

<sup>44</sup> Emphasis is supplied here and in the paragraphs that follow.

1	THROUGH: 1. A SIX FOOT TALL WOODEN FENCE AT ALMOST 30MPH, THEN 2. THE
2	EXTERIOR SIDE OF A 2-STORY HOME THAT CONTAINED THE KITCHEN SINK AND
3	PLUMBING FIXTURES, WHILE SMASHING UP AND OVER THE FIFTEEN-INCH
4	CONCRETE FOUNDATION, FRONT-END FIRST.*AK"
5	e. NHTSA complaint #10082050 dated Thursday, July 15, 2004, reported an
6	accident on Wednesday, July 14, 2004 involving a 2003 CHEVROLET SUBURBAN in Fresno,
7	CA. The complaint states: "THE CONSUMER WAS INVOLVED IN AN ACCIDENT WHERE
8	IT WAS HIT FROM THE FRONT DRIVER SIDE, THE IMPACT CAUSED THE VEHICLE
9	TO HIT A TELEPHONE POLE HEAD ON. THE AIR BAGS DID NOT DEPLOY. *JB"
10	f. NHTSA complaint #10103512 dated Friday, December 10, 2004, reported
11	an accident on Sunday, December 5, 2004 involving a 2001 CHEVROLET SILVERADO in
12	Rialto, CA. The complaint states: "CONSUMER'S VEHICLE WAS REAR ENDED WHILE
13	DRIVING 50 MPH. THE VEHICLE WAS FORCE[D] INTO A SPIN AND THEN, IT HIT A
14	CONCRETE ROAD DIVIDER. UPON IMPACT, NEITHER FRONTAL AIR BAGS
15	<b>DEPLOYED</b> . DRIVER SUSTAINED INJURIES, AND HAD TO BE TRANSPORTED TO A
16	LOCAL HOSPITAL. DEALER AND MANUFACTURER WERE NOTIFIED. THE
17	CONSUMER STATED THAT THE SEAT BELT DID NOT KEEP HER FROM HITTING HER
18	CHEST ON THE STEERING WHEEL."
19	g. NHTSA complaint #10108404 dated Tuesday, February 1, 2005, reported
20	an accident on Tuesday, January 11, 2005 involving a 2000 CHEVROLET SILVERADO in
21	Toney, AL. The complaint states: "A CAR PULLED OUT IN FRONT OF ME WHICH STILL
22	HIT THE DRIVER'S SIDE OF MY VEHICLE (2000 CHEVY SILVERADO). THEN MY
23	TRUCK HAD A FULL FRONTAL IMPACT AT GREATER THAN 30 MPH INTO A
24	DIRT WALL IN WHICH NEITHER THE DRIVER'S NOR PASSENGER'S AIRBAGS
25	<b>DEPLOYED</b> (THE TRUCK IS TOTALLED). I HIT THE STEERING WHEEL AND GOT A
26	CONCUSSION WITH BLOOD AROUND THE BRAIN A BROKE CHEEK BONE AND

2293238.3 - 27 - CLASS ACTION COMPLAINT

FRACTURED HIP. MY WIFE WAS 33 WEEKS PREGNANT AT THE TIME AND HER

WATER BROKE AND SHE GOT A COMPOUND FRACTURE IN THE LOWER

1	LEG/ANKLE. AS A RESULT OF THE WATER BREAKING MY SON WAS BORN 3 DAYS
2	LATER 7 WEEKS PREMATURE. AS FOR WHAT WAS DONE TO CORRECT THE
3	PROBLEM I'M HOPING IT WILL AT LEAST BE INVESTIGATED TO MAKE SURE THIS
4	IS NOT A SYSTEMIC PROBLEM (I.E. SOFTWARE SCREWUP SOMETHING NOT
5	HOOKED UP RIGHT IN THE AIRBAG SYSTEM ETC)."
6	h. NHTSA complaint #10115806 dated Thursday, March 24, 2005, reported
7	an accident on Thursday, March 24, 2005 involving a 2002 CHEVROLET SILVERADO in
8	Claremore, OK. The complaint states: "A PIECE OF FURNITURE WAS LOCATED IN THE
9	MIDDLE OF THE HIGHWAY WHILE DRIVING, CAUSING THE DRIVER TO HIT THE
10	FURNITURE. DRIVER LOST CONTROL OF A VEHICLE, AND IT CRASHED INTO A
11	CONCRETE WALL. DRIVER'S SIDE SEAT BELT FAILED, AND THE AIRBAGS DID
12	NOT DEPLOY."
13	i. NHTSA complaint #10158090 dated Tuesday, May 23, 2006, reported an
14	accident on Sunday, February 26, 2006 involving a 2004 CHEVROLET TRAILBLAZER in
15	Fayetteville, NC. The complaint states: "DT*: THE CONTACT STATED WHILE DRIVING 50
16	MPH THE VEHICLE WAS INVOLVED IN A HEAD ON COLLISION WITH ANOTHER
17	VEHICLE. THE VEHICLE CONTINUED MOVING AND STOPPED BY COLLIDING WITH
18	A STORE SIGN. THE AIR BAGS DID NOT DEPLOY AND SEAT BELTS WERE WORN .
19	. THE INSURANCE COMPANY DETERMINED THE VEHICLE WAS TOTALED DUE TO
20	THE ACCIDENT. THE DEALER DOES NOT HAVE THE MEANS TO TEST FOR AIR BAG
21	NON-DEPLOYMENT. UPDATED 1/24/2007 - *NM"
22	j. NHTSA complaint #10161658 dated Thursday, July 6, 2006, reported an
23	accident on Saturday, June 3, 2006 involving a 1999 CHEVROLET BLAZER in Ludlow, MA.
24	The complaint states in part: "CHEVY DRIVER HIT A CAR IN HER LANE FIRST, THEN
25	RICOCHETED HEAD ON INTO A TREE. <b>NEITHER TIME DID AIRBAGS DEPLOY</b> .
26	*TT"

2293238.3 - 28 - CLASS ACTION COMPLAINT

accident on Thursday, July 20, 2006 involving a 2000 ISUZU RODEO in Nederland, TX. The

NHTSA complaint #10163811 dated Friday, July 28, 2006, reported an

27

k.

1	complaint states: "A GIRL RAN A RED LIGHT AND I HIT HER IN THE PASSENGER SIDE
2	OF HER CAR HEAD ON WITH MY 2000 ISUZU RODEO. IT WAS A FULL FRONTAL
3	COLLISION FOR ME AND MY CHILDREN. LUCKILY, WE ARE ALWAYS BUCKLED UP
4	BECAUSE NONE OF MY AIRBAGS DEPLOYED AT ALL. THE OTHER CAR WAS
5	GOING ABOUT 60 MPH AND HER AIRBAG DEPLOYED WHEN I HIT HER BUT MINE
6	DID NOT. LUCKILY, MY CHILDREN WERE NOT HURT BADLY BUT
7	UNFORTUNATELY, I SUSTAINED NECK, BACK AND KNEE INJURIES. I WAS AND
8	STILL AM VERY UPSET THAT MY AIRBAGS FAILED. EVEN THE OWNER OF THE
9	BODY SHOP I USE WAS IN SHOCK THAT THEY DID NOT DEPLOY AS THE IMPACT
10	WAS ENOUGH TO SPLIT THE FRAME OF MY RODEO AND TOTAL IT OUT THANK
11	YOU FOR YOUR TIME, I HOPE I CAN HELP ANOTHER FAMILY FROM GETTING
12	INJURED."
13	1. NHTSA complaint #10217793 dated Tuesday, February 12, 2008, reported
14	an accident on Thursday, February 7, 2008 involving a 2006 CHEVROLET TRAILBLAZER in
15	Lakewood, OH. The complaint states: "A 2006 CHEVY TRAILBLAZER TRAVELING OVER
16	THE SPEED LIMIT ON MY STREET CRASHED INTO A TREE, A PARKED CAR, AND
17	THEN CONTINUED TO ROLL OVER ACROSS MY FRONT LAWN, LANDING
18	SIDEWAYS AFTER FLIPPING SEVERAL TIMES. THE OCCUPANTS WERE SEVERELY
19	INJURED. NO AIRBAGS DEPLOYED DURING THE CRASH. THE DRIVER OF THE
20	VEHICLE IS IN ICU NEEDING FACIAL RECONSTRUCTIVE SURGERY. *TR"
21	m. NHTSA complaint #10221319 dated Saturday, March 15, 2008, reported
22	an accident on Thursday, February 21, 2008 involving a 2005 CHEVROLET TRAILBLAZER in
23	Clay, NY. The complaint states: "I WAS DRIVING ON A 2 LANE ROAD GOING 45MPH. A
24	CAR WAS FOLLOWING CLOSE BEHIND ME SO I WENT TO GET INTO RIGHT LANE
25	AND MY TRUCK DID 5 360 AND HIT 3 TREES HEAD ON AND AIR BAG NEVER
26	DEPLOYED. *TR"
27	n. NHTSA complaint #10263896 dated Wednesday, April 1, 2009, reported
28	an accident on Thursday, March 26, 2009 involving a 2002 CHEVROLET TRAILBLAZER in

2293238.3 - 29 - CLASS ACTION COMPLAINT

Elizabeth, NJ. The complaint states: "I WAS IN A CAR ACCIDENT, WHERE I WAS
TRAVELING AT ABOUT 35 MPH. AN AGGRESSIVE DRIVER SPEED AROUND ME AND
CUT ME OFF AND THAN STOMPED ON THIS BRAKES IN FRONT OF ME. DUE TO
THAT I SWERVED TO MISS HIM CLIPPING HIS RIGHT BACK LIGHT AD BUMPER
WITH MY LEFT HEADLIGHT AND BUMPER. AS I WAS SWERVING I HIT A TREE JUST
ABOUT DEAD ON WITH MY CAR I HIT THE TREE AT A SPEED OF ABOUT 28-30
MPH. AFTER INITIAL IMPACT I WAS RUSHED TO THE HOSPITAL DUE TO
UNCONSCIOUS AND FACIAL CONTUSIONS. DURING THE FIRST MOMENTS AFTER
THE ACCIDENT, ONE OF THE FIRST THINGS OFFICERS, EMTS AND WITNESSES SAID
WAS "I CAN'T BELIEVE THE AIRBAGS DIDN'T GO OFF." IN THE RECENT DAYS
AFTER THE ACCIDENT I HAVE HAD SEVERAL MECHANICS AND SUCH APPRAISE
THE CAR, THE ONE COMMON THEME THEY ALL SHARE IS THAT THEY SUSPECT
THERE MIGHT NOT BE AN AIRBAG WHERE IT BELONGS. OR THE LACK THERE OF.
*TR"
o. NHTSA complaint #10463248 dated Wednesday, June 27, 2012, reported

an accident on Friday, July 15, 2011 involving a 2005 GMC in Richmond, VA. The complaint states: "THE CONTACT STATED WHILE DRIVING 55 MPH, HE CRASHED INTO A TREE.

THE AIR BAGS FAILED TO DEPLOY . . . A POLICE REPORT WAS FILED. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE; HOWEVER, THEY PROVIDED NO ASSISTANCE . . . THE CONSUMER'S VEHICLE WAS DAMAGED WHEN HE TRIED TO AVOID HITTING THE VEHICLE BY SWERVING SIDEWAYS AND SLIDING INTO THE GRASS. HE TRIED STOPPING THE VEHICLE WHILE IT WAS STILL ON THE PAVEMENT BUT HE INEVITABLY RAN INTO THE DITCH AND FLEW AIRBORNE INTO A TREE, AND THE TRUCK OVERTURNED."

p. NHTSA complaint #10524151 dated Wednesday, July 10, 2013, reported an accident on Thursday, May 30, 2013 involving a 2006 CHEVROLET TRAILBLAZER in Mansfield, OH. The complaint states: "THIS COMPLAINT IS BEING FILED ON BEHALF OF THE VEHICLE OWNER AND DRIVER. THIS CHEVY TRAILBLAZER WAS INVOLVED

2293238.3 - 30 - CLASS ACTION COMPLAINT

1	IN A TWO VEHICLE, DOUBLE FATAL CRASH. THE FRONT OF THE TRAILBLAZER
2	STRUCK THE DRIVER'S SIDE DOOR OF A CAVALIER THAT FAILED TO YIELD FROM
3	A STOP SIGN. THE TRAILBLAZER STAYED CONNECTED WITH THE CAVALIER,
4	FORCING IT OFF THE LEFT SIDE OF THE ROADWAY AND INTO A LARGE TREE.
5	BOTH OCCUPANTS IN THE CAVALIER WERE FATALLY INJURED. THE FRONT
6	AIRBAGS DID NOT DEPLOY ON THE TRAILBLAZER AND NO EVENT WAS
7	RECORDED ON THE AIRBAG CONTROL MODULE. *TR"
8	q. NHTSA complaint #10537593 dated Tuesday, August 27, 2013, reported
9	an accident on Tuesday, August 13, 2013 involving a 2003 CHEVROLET BLAZER in Harrison
10	Township, MI. The complaint states: "I WAS TRAVELING SOUTHBOUND WHEN I
11	EXPERIENCED A SEIZURE AND LOST CONTROL OF MY VEHICLE. I PROCEEDED TO
12	VEER TO THE LEFT WHERE I CLIPPED SEVERAL CARS THAT WERE HEADED
13	NORTHBOUND I THEN PROCEEDED OVER A TREE LAWN AND INTO A PARKING
14	LOT. I HIT A DODGE RAM PICKUP WITH THE RIGHT FRONT CORNER OF MY
15	VEHICLE AND PUSHED THAT VEHICLE INTO ANOTHER PARKED CAR THAT WAS
16	NEXT TO IT. BOTH VEHICLES ENDED UP SIDEWAYS AND MY VEHICLE ENDED UP
17	SPUN AROUND 180 DEGREES THE JAWS OF LIFE WERE USED TO EXTRACT ME
18	FROM MY VEHICLE. I WAS TAKEN TO A LOCAL HOSPITAL WHERE IT WAS
19	DETERMINED THAT I SUFFERED BURST FRACTURES OF L1, L2, AND L3. I ALSO
20	SUFFERED AN EVULSION FRACTURE OF MY LEFT ANKLE. THE POLICE REPORT
21	STATES THAT I WAS TRAVELLING AT A HIGH RATE OF SPEED AND THAT THE
22	VEHICLES WHICH WERE NORTHBOUND WERE JUST CLIPPED. THE AIRBAGS ARE
23	BOTH STILL WITHIN THEIR CASES AS NEITHER DEPLOYED THE INSURANCE
24	INVESTIGATOR EVEN EXPRESSED TO MY WIFE THAT HE WAS SURPRISED THAT
25	THE AIR BAG DID NOT DEPLOY."
26	r. NHTSA complaint #10550276 dated Wednesday, October 30, 2013,
27	reported an accident on Monday, October 28, 2013 involving a 2006 CHEVROLET
28	TRAILBLAZER in Neihart, MT. The complaint states: "TL* THE CONTACT OWNS A 2006

2293238.3 - 31 - CLASS ACTION COMPLAINT

CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT WHILE DRIVING
APPROXIMATELY 35 MPH, SHE LOST CONTROL OF THE VEHICLE WHILE DRIVING
IN SNOWY WEATHER. THE VEHICLE NOSE DIVED INTO AN EMBANKMENT AND
THEN CRASHED INTO A BOULDER. THE AIR BAGS FAILED TO DEPLOY. THE
CONTACT WAS TRANSPORTED TO THE HOSPITAL VIA AMBULANCE FOR
TREATMENT OF A CONCUSSION AND BRUISING. THE FRONT PASSENGER WAS
ALSO INJURED AND SUSTAINED BRUISING. THE VEHICLE WAS DESTROYED. THE
MANUFACTURER WAS MADE AWARE OF THE FAILURE."

- s. NHTSA complaint #10574295 dated Sunday, March 23, 2014, reported an accident on Friday, February 21, 2014 involving a 2010 GMC TERRAIN in Saint Joe, IN. The complaint states: "INVOLVED IN A 21 CAR PILE UP IN THE UPPER PENINSULA DURING A COMPLETE WHITE OUT. WE WERE ONLY TRAVELING APPROXIMATELY 25 MILES PER HOUR BUT, WE DID HAVE SERIOUS IMPACT IN THE FRONT, AFTER HITTING A TRAILER AND ALSO SERIOUS IMPACT FROM BEHIND WHEN HIT BY A TRUCK AND TRAILER. NO AIRBAGS DEPLOYED. THE TRUCK TRAVELING AHEAD OF US, THAT WE HIT, THE AIRBAGS DID DEPLOY. MY FATHER AND BROTHER, WHO WERE ALSO BOTH DRIVING CHEVY TRUCKS, AND ALSO HAD SERIOUS FRONT END DAMAGE DURING THE SAME ACCIDENT, THEIR AIRBAGS DID NOT DEPLOY EITHER. \*TR"
- t. NHTSA complaint #10576031 dated Monday, March 31, 2014, reported an accident on Sunday, March 23, 2014 involving a 2012 CADILLAC SRX in Kaplan, LA. The complaint states: "I FELL ASLEEP WHILE DRIVING, JUMPED A LEVEE, RAN THROUGH A FENCE, AND WRECKED IN A GRASSY WATERY AREA. MY ENGINE WAS SMASHED, THE MOTOR MOUNT BROKE, AND MY TIRES ARE PUSHED BACK. MY AIR BAGS DID NOT DEPLOY. MY FACE HIT THE STEERING WHEEL AND MY NOSE IS BROKEN. I WOULD LIKE TO FIND OUT IF THERE IS ANY RECALLS ON THIS CAR. \*TR"

2293238.3 - 32 - CLASS ACTION COMPLAINT

1	u. NHTSA complaint #10583703 dated Saturday, April 19, 2014, reported an
2	accident on Thursday, March 13, 2014 involving a 2012 GMC TERRAIN in Moneta, VA. The
3	complaint states: "I INADVERTENTLY VEERED OFF SIDE ROADWAY, (VA HIGHWAY
4	220) COLLIDING WITH A TREE/ROADSIDE SHRUBS, ETC (WAS KNOCKED
5	UNCONSCIOUS AS FOREHEAD HIT STEERING WHEEL ON INITIAL IMPACT).
6	AIRBAGS DID NOT DEPLOY ALLOWING ME TO SUSTAIN A HEAD INJURY THAT
7	KNOCKED ME UNCONSCIOUS FOREHEAD WAS GASHED WITH SIGNIFICANT
8	BLEEDING. I WAS TRANSPORTED BY AMBULANCE IN UNCONSCIOUS STATE.
9	DAMAGE TO VEHICLE IS IN EXCESS OF \$8,000 SO FAR AS VEHICLE STILL IN
10	REPAIR SHOP WITH MASSIVE FRONT END DAMAGE THAT AFFECTS STEERING
11	LINKAGE, ETC. THE IMPACT OF VEHICLE AGAINST FOLIAGE, TREES SHRUBS,
12	SHOULD HAVE FORCED AIR BAGS TO DEPLOY AND I BELIEVE THAT I WOULD NOT
13	HAVE SUSTAINED A HEAD INJURY THAT RENDERED ME UNCONSCIOUS WITH
14	MILD CONCUSSION AND COULD NOT CONTROL VEHICLE LEAVING ROADWAY.
15	*TR"
16	v. NHTSA complaint #10592423 dated Monday, May 19, 2014, reported an
17	accident on Thursday, May 8, 2014 involving a 2003 CHEVROLET SILVERADO in
18	Burtonsville, MD. The complaint states: "TRUCK COLIDED WITH GUARD RAIL.
19	BOUNCED OFF, HIT VEHICLE 1, THEN INTO VEHICLE 2 THEN STOPPED AFTER
20	HITTING VEHICLE 3 A SEMI TRUCK. ALL DAMAGE WAS DONE TO FRONT OF THE
21	CHEVY SILVERADO. AT NO TIME DID THE AIRBAGS DEPLOY."
22	w. NHTSA complaint #10622016 dated Wednesday, August 13, 2014,
23	reported an accident on Saturday, August 9, 2014 involving a 2012 CHEVROLET TAHOE in
24	The Colony, TX. The complaint states: "WHILE TURNING LEFT (TAHOE) WITH A
25	PROTECTED GREEN ARROW AT AN X-SHAPED INTERSECTION, VEHICLE (KIA
26	SEDAN) AT FAULT FAILED TO YIELD AND ENTERED THE INTERSECTION AT

2293238.3 - 33 - CLASS ACTION COMPLAINT

SPEEDS UPWARDS OF 40 MPH FROM THE LEFT OF THE TAHOE. FRONT-IMPACT

COLLISION OCCURRED . . . TAHOE STRUCK PASSENGER SIDE OF KIA SEDAN.

1	TRAJECTORY OF IMPACT CAUSED DIRECTIONAL CHANGES IN UPWARDS OF 90*
2	FOR BOTH VEHICLES; THE FORCE OF THE PRIMARY ACCIDENT DESCRIBED ABOVE
3	ALSO CAUSED MENTIONED VEHICLES TO COLLIDE WITH LEFT REAR OF ANOTHER
4	VEHICLE (HONDA SEDAN) DUE TO THE FORCE OF IMPACT, FRONT & SIDE
5	AIRBAGS DEPLOYED ON BOTH THE KIA SEDAN AND THE HONDA SEDAN, BUT
6	FAILED TO DEPLOY ON THE TAHOE FORCE WAS SUCH THAT AFTER THE
7	COLLISION, TAHOE TRANSMISSION WAS IN DRIVE, BUT REMAINED AT A
8	COMPLETE STOP. DAMAGE SUSTAINED ON THE TAHOE INCLUDE FRONT-END
9	BODY DAMAGE, ENGINE DAMAGE (VEHICLE REQUIRED TOWING AND WAS
10	INOPERABLE), AND FRAME DAMAGE, AT A MINIMUM MULTIPLE FIRST-
11	RESPONDERS COMMENTED ON THE ODDITY THAT, GIVEN THE DAMAGE
12	SUSTAINED BY THE TAHOE AND THE VELOCITY AT IMPACT, THE AIRBAGS
13	DEPLOYED ON ALL VEHICLES BUT THE TAHOE. *TR"
14	x. NHTSA complaint #10641399 dated Saturday, October 4, 2014, reported
15	an accident on Tuesday, June 7, 2011 involving a 2002 CHEVROLET TAHOE in Cheney, WA.
16	The complaint states: "THE CONTACT STATED THAT WHILE THE DRIVER WAS
17	DRIVING AT 45 MPH AND ATTEMPTED TO AVOID A CRASH WITH ANOTHER
18	VEHICLE. AS A RESULT, THE DRIVER CRASHED INTO A GUARDRAIL AND THE AIR
19	BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT WAS
20	TAKEN TO A HOSPITAL AND SUSTAINED INJURIES TO THE RIBS, THE COLLAR
21	BONES, A BRAIN TRAUMA AND A COLLAPSED LUNG. THE DRIVER SUFFERED
22	FROM FATAL INJURIES."
23	y. NHTSA complaint #10767586 dated Tuesday, September 22, 2015,
24	reported an accident on Saturday, August 1, 2015 involving a 2004 CHEVROLET
25	TRAILBLAZER in Tallahassee, FL. The complaint states: "MY MOTHER WAS INVOLVED
26	IN A 1 CAR ACCIDENT ON BAUM RD LOCATED IN TALLAHASSEE, FL. SHE WAS THE
27	ONLY PASSENGER DETERMINED TO BE IN THE VEHICLE AT THE TIME OF THE
28	ACCIDENT. ACCORDING TO THE CRASH REPORT, D1 (DRIVER ONE) WAS

2293238.3 - 34 - CLASS ACTION COMPLAINT

1	I
2	
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	
16	
17	
18	

TRAVELING WESTBOUND ON BAUM RD GOING THE NORMAL POSTED SPEED OF 55MPH, WHEN SHE VEERED TOWARDS THE CENTER OF THE RD AND SUDDENLY TURNED RIGHT VEERING OF THE RIGHT SHOULDER OF THE RD AND STRIKING SEVERAL TREES ON THE DRIVERS SIDE AND FRONT END . . . WHEN I WENT TO RETRIEVE MY MOTHERS THINGS FROM HER TRAILBLAZER, I NOTICED THAT NO AIR BAGS HAD DEPLOYED. AND AS FAST AS MY MOM WAS GOING AND THE TYPE OF IMPACT & DAMAGE HER SUV SUSTAINED, I WOULD THINK AND HOPE THE AIRBAGS WOULD DEPLOY IN THIS TYPE OF ACCIDENT, THUS PREVENTING SERIOUS INJURY OR DEATH. MY MOM WAS NOT SO LUCKY, AND MYSELF AND MY FAMILY HAVE ENDURED GREAT PAIN FROM LOOSING HER SO SUDDENLY."

- z. NHTSA complaint #10907149 dated Friday, September 16, 2016, reported an accident on Thursday, September 1, 2016 involving a 2006 CADILLAC SRX in Happy Valley, OR. The complaint states: "THE VEHICLE HIT A CURB AND DROVE INTO A BUILDING. **THE AIR BAGS FAILED TO DEPLOY**. THE CONTACT SUSTAINED INJURIES THAT REQUIRED MEDICAL ATTENTION . . . THE MANUFACTURER WAS NOTIFIED OF THE FAILURE."
- 96. GM knew or had reason to know about these complaints, which are publicly available on NHTSA's website. Indeed, many complaints explicitly state that GM was directly informed of and/or investigated these suspicious accidents. For example:
- a. A complaint about an August 2018 accident in a 2008 GMC Acadia details that the airbags and seatbelt pretensioners did not deploy after the complainant's wife fell asleep at the wheel and struck a utility pole and then a large dirt embankment—which caused her to "hit the steering column so hard . . . it broke the column and broke her sternum," and caused the granddaughter in the passenger seat to break her back in two places. It continues that "GENERAL MOTORS . . . SENT A MAN TO DOWNLOAD THE COMPUTER INFORMATION THEY SENT ME A COPY OF THE INFO AND LATER CONTACTED ME SAYING THE INFO SHOWED EVERYTHING WAS WORKING PROPERLY." NHTSA complaint #11066850.

28

27

19

20

21

22

23

24

25

26

- b. After a July 2014 head on collision at 50 MPH where the airbags did not deploy in a 2007 Silverado, totaling the vehicle, another driver was "TOLD BY GM THAT CRASH DID NOT MEET CRITERIA FOR DEPLOYMENT." The driver expressed skepticism about this response, and in the complaint, stated "A HEAD ON COLLISION AT 50 MPH THAT TOTALED 2500 SERIES CHEVY TRUCK. HARD FOR ME TO BELIEVE . . . DO I NEED TO [BE] CONCERNED?" NHTSA complaint #10608220.
- C. Another driver reported on a May 2014 accident in a 2012 GMC Terrain in Moneta, VA. The driver struck "something" head on after veering off the highway and proceeded through trees and brush. They were knocked unconscious after hitting their head on the steering wheel upon the first impact, as the airbags had failed to deploy. They were transported to a hospital by ambulance and spent two days in inpatient care. The driver later "CONTACTED GMC CORPORATE . . . TO ADVISE MY CONCERNS FOR SAFETY . . . RECEIVED A FOLLOW UP TELEPHONE CALL FROM GMC REPRESENTATIVE . . . HE EXPRESSED NO INTEREST IN MY COMPLAINT . . . REFUSED TO COMMENT ON MY STATEMENT THAT AIR BAG FAILED TO DEPLOY RESULTING IN EXTENSIVE DAMAGE TO FRONT OF VEHICLE AND SUSTAINING A HEAD INJURY AS NO BAG DEPLOYED . . . I WAS ADVISED THAT GMC HAD NO FURTHER INTEREST IN THIS MATTER AND WOULD NOT EVALUATE MY SAFETY CONCERNS." NHTSA complaint #10588334.
- d. After a July 2012 accident involving a 2012 GMC Terrain in San Clemente, CA in which the Terrain was hit multiple times in an intersection in the driver's front end, but no airbags deployed, resulting in whiplash and contusions to the driver, a GM representative responded to a complaint lodged by the driver's parents and stated that there was "NO NEED FOR DEPLOYMENT" because it was a "LOW THRESHOLD EVENT." NHTSA complaint #10466384.
- e. After hitting a patch of black ice at 58 MPH in a Chevrolet Silverado in January 2008, another complainant described that they lost control of the vehicle, ran off the road, crashed into a telephone pole and ultimately into a frozen embankment. The airbags did not deploy, causing the driver to hit the steering wheel. As the complainant relates, they "FILED A

2293238.3 - 36 - CLASS ACTION COMPLAINT

2.1

COMPLAINT WITH THE MANUFACTURER, BUT THE COMPLAINT WAS DENIED. THE
MANUFACTURER WAS UNABLE TO DIAGNOSE THE VEHICLE; HOWEVER, AFTER
INSPECTION OF THE VEHICLE, THE MANUFACTURER CONFIRMED THAT THE AIR
BAGS WERE ENABLED AT THE TIME OF IMPACT. THEY DID NOT GIVE AN
EXPLANATION FOR THE DEPLOYMENT FAILURE." NHTSA complaint #10238395.

- f. In a report about a March 2006 accident involving a 2005 Cadillac Escalade in Louisville, KY, the complainant describes that after none of the airbags deployed in a front end collision in their 4-week old vehicle, they "CALLED CADILLAC CUSTOMER SERVICE AND WAS GIVEN AN AIRBAG HISTORY LESSON VIA TELEPHONE FROM SOMEONE THAT HAD NEVER SEEN MY VEHICLE OR INSPECTED IT FOR DAMAGE AFTER THE ACCIDENT. AT THE END OF OUR CONVERSATION I WAS TOLD ALL WAS OK, NONE OF MY AIRBAGS SHOULD HAVE DEPLOYED AND NOT TO WORRY ABOUT IT. THE ENTIRE FRONT END OF MY VEHICLE WAS KNOCKED OFF, THE FRAME HAS MULTIPLE CRACKS AND IS BENT AS A RESULT OF THE COLLISION AND THE COLLISION CENTER IS 90% CERTAIN THE VEHICLE IS NOT REPAIRABLE. \*JB" NHTSA complaint #10152376.
- g. After an August 2004 accident involving a 1999 Chevrolet Astro in Norfolk, Virginia in which the vehicle jumped a curb, struck and fire hydrant, and then struck a tree without the airbags deploying, the driver was taken by ambulance to the hospital for head and neck injuries. After the accident, the "CONSUMER CONTACTED THE MANUFACTURER AND A REPRESENTATIVE CAME DOWN TO MEET WITH THE DEALER AND CONSUMER. THE REPRESENTATIVE INFORMED CONSUMER THAT THE VEHICLE WAS FUNCTIONING AS DESIGNED." NHTSA complaint # 10087718.
- h. Another driver contacted GM after the airbags did not deploy in a February 2004 front end collision at 25-30 MPH in their 2000 Isuzu Rodeo in Westwood, NJ. "THE CONSUMER CONTACTED THE MANUFACTURER ABOUT THE AIR BAGS BUT THE REPRESENTATIVE DID NOT SEEM TO BE TOO CONCERNED ABOUT THE SITUATION." NHTSA complaint #10087550.

2293238.3 - 37 - CLASS ACTION COMPLAINT

i.

- Chevrolet Tahoe in which the airbags did not deploy and the seatbelts did not tighten. The driver hit their head on the steering wheel, knocking them unconscious. A readout from the vehicle's computer showed the seatbelts were in working order, and GM responded by sending a representative to inspect the vehicle in person. The complainant was awaiting a response from GM at the time of the report. NHTSA complaint #10353935.

Another driver described a head on collision at 39 MPH in their 2002

- 97. More than eight hundred similar complaints—i.e. frontal crashes in the Class Vehicles with airbag and seatbelt failures following multiple impacts, or, potentially long-soft frontal impacts—are attached hereto as Exhibit A.<sup>45</sup>
- 98. In addition to these consumer complaints, a separate, public dataset from NHTSA, the Fatality Analysis Reporting System ("FARS") provides a nationwide census of crashes that resulted in fatal injuries. While the complaints outlined above are reported to NHTSA by consumers and can include any type of complaint or incident, FARS data is reported by state agencies responsible for monitoring all qualifying fatal crashes in their states. To be included in FARS data, a crash must involve a motor vehicle traveling on a public road and result in the death of a person in one or more of the vehicles involved in the crash within 30 days of the crash. The dataset collects information on over 100 different data elements that characterize the crash, the vehicles, and the people involved—including whether or not the airbags deployed.
- 99. NHTSA's FARS dataset also reveals a recurring pattern of suspicious nondeployments during frontal crashes (i.e., the crash dynamics that can implicate the SDM Calibration Defect) and reinforces the extremely high stakes of such incidents. From 1999 to present, FARS data reflects at least 1,946 frontal crashes where the airbags did not deploy in a Class Vehicle—1,167 of which occurred in 2009 or later, after New GM was formed. This same data reflects that at least 1,298 individual occupants (drivers or passengers) in a Class Vehicle were injured or killed in these crashes.

2.1

2293238.3 - 38 - CLASS ACTION COMPLAINT

<sup>&</sup>lt;sup>45</sup> The accidents in the preceding paragraph and Exhibit A include data for Class Vehicles in model years 1999-2014.

# D. <u>Despite its knowledge, GM misrepresented and concealed important</u> information about the SDM Calibration Defect and Class Vehicle safety.

100. For many consumers, including Plaintiff, safety is one of the most important factors when buying or leasing a vehicle. GM capitalized on this fact in advertising and other consumer-facing representations about the Class Vehicles and touted the safety of the Class Vehicles in national marketing campaigns.

101. In advertisements and promotional materials, GM maintained that the Class Vehicles were safe and reliable, and it did not correct representations about the Class Vehicles' safety and reliability made by Old GM in the past. Instead, GM has repeatedly touted the Class Vehicles' passenger safety systems and assured consumers they could be relied upon to activate the airbags and seatbelts during a crash. These representations are false and misleading because of what they fail to say; GM uniformly failed to disclose that the SDM Calibration Defect could—at the worst possible moment—prevent the airbags and seatbelts from activating.

102. Plaintiff and Class members, directly or indirectly, were exposed to these advertisements and promotional materials prior to purchasing or leasing their Class Vehicles. If GM had instead chosen to disclose the truth about the SDM Calibration Defect—including at dealerships, on its website, in brochures, press releases or in other promotional materials—Plaintiff and Class members would have seen those disclosures. The misleading statements about Class Vehicles' safety in GM's advertisements and promotional materials, as well as GM's omission of the truth about the SDM Calibration Defect, influenced Plaintiff and Class members' decisions to purchase or lease Class Vehicles.

# 1. <u>Labels and window stickers on the Class Vehicles stated that they were equipped with working airbags and seatbelts and failed to disclose the SDM Calibration Defect.</u>

103. To sell vehicles in the United States, GM was required to "certify to the distributor or dealer at delivery that the vehicle or equipment complies with applicable motor vehicle safety standards prescribed" by NHTSA under Chapter 301 of Title 49 of the U.S. Code. GM "may not issue the certificate if, in exercising reasonable care," they have "reason to know

2293238.3 - 39 - CLASS ACTION COMPLAINT

the certificate is false or misleading in a material respect." 49 U.S.C. § 30115; see also 49 U.S.C. § 30112.

- 104. Because "[c]ertification of a vehicle must be shown by a label permanently fixed to the vehicle," all Class Vehicles have a permanent label certifying compliance with the safety regulations prescribed by NHTSA. Since all the Class Vehicles are passenger vehicles, the permanent label must state: "This vehicle conforms to all applicable Federal motor vehicle safety, bumper, and theft prevention standards in effect on the date of manufacture shown above." 49 C.F.R. § 567.4(g)(5).
- 105. These labels were false and misleading because they failed to warn consumers about the risk that the SDM would fail during a frontal crash, and instead indicated that the passenger safety system would function properly. See 49 C.F.R. § 571.208 (S4.1.5.4, S4.1.5.5) (Federal motor vehicle safety standards requiring Occupant Restraint Systems with airbags and seatbelts).
- 106. Vehicle manufacturers have a duty to disclose known safety defects to the public and to NHTSA. When a vehicle manufacturer learns of a safety defect, federal law requires it to disclose the defect to NHTSA and to the owners, purchasers, and dealers of the vehicle. 49 U.S.C. § 30118(c). Indeed, GM Parent acknowledges these obligations in its public SEC filings. In its Form 10-K for fiscal year 2019, GM Parent states: "If we or NHTSA determine that either a vehicle or vehicle equipment does not comply with a safety standard or if a vehicle defect creates an unreasonable safety risk, the manufacturer is required to notify owners and provide a remedy."
- 107. The interiors of the Class Vehicles also contain prominent labels that alert the driver and passengers to the vehicle's airbag system. For example, steering wheels and passenger dashboards typically have labels identifying the airbag and safety restraint system (or "SRS").
- 108. GM was also specifically required to include in their vehicles warning labels that alerted consumers of the need to perform airbag maintenance. For example, S4.5.1 of 49 C.F.R. § 571.208 states:

1	
2	
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	

26

27

28

Air bag maintenance or replacement information. If the vehicle manufacturer recommends periodic maintenance or replacement of an inflatable restraint system, as that term is defined in S4.1.5.1(b) of this standard, installed in a vehicle, that vehicle shall be labeled with the recommended schedule for maintenance or replacement. The schedule shall be specified by month and year, or in terms of vehicle mileage, or by intervals measured from the date appearing on the vehicle certification label provided pursuant to 49 CFR Part 567. The label shall be permanently affixed to the vehicle within the passenger compartment and lettered in English in block capital and numerals not less than three thirty-seconds of an inch high. This label may be combined with the label required by S4.5.1(b) of this standard to appear on the sun visor.

- 109. Plaintiff is unaware of any label in any Class Vehicle that alerted consumers to the SDM Calibration Defect or the need to perform maintenance to protect the SDM from preventing airbag deployment or seatbelt tightening when they are needed.
- 110. GM also distributed the Class Vehicles with so-called "Monroney" labels (also known as "window stickers") that described the equipment and safety features of the vehicles, including airbags. Dealers sell Class Vehicles to consumers with these labels visible. An image of a Monroney label for the 2012 Silverado is included below as a representative example. In the center of the image, it features a "Five Star" frontal crash rating for drivers. Under "Safety & Security" features, it touts the "dual stage" airbags.

2293238.3 - 41 - CLASS ACTION COMPLAINT



- 111. Monroney labels for many of the Class Vehicles are available at: https://monroneylabels.com. Additional exemplars of Monroney labels from some of the Class Vehicles are attached as Exhibit B.
- 112. As demonstrated by these examples, Monroney labels uniformly assured consumers that the Class Vehicles had working airbags and seatbelts. This information would have suggested to any reasonable consumer that the passenger safety system did not suffer from a defect and would perform its intended function of activating the seatbelts and airbags during a frontal collision.
- 113. Had GM disclosed the defective nature of the SDM software calibration on the Monroney labels or other labels or marketing for the Class Vehicles, Plaintiff and Class members would have seen that disclosure.

2293238.3 - 42 - CLASS ACTION COMPLAINT

23

24

25

26

27

28

# 2. <u>GM published owners' manuals for the Class Vehicles that detailed</u> their safety features but did not disclose the SDM Calibration Defect.

- 114. GM (and Old GM before it) published owners' manuals for each of the Class Vehicles. These manuals were directed at consumers and included misleading statements regarding seatbelts, airbags, and passenger safety systems. These statements uniformly omitted any warning to consumers that the SDM could effectively shut off during a crash after just 45 milliseconds.
- 115. Representative examples of statements from owners' manuals with materially misleading omissions concerning the effectiveness of their airbags follow in the paragraphs below.
- 116. The manual for the 2002 Cadillac Escalade provides extensive detail about the vehicle's airbags, including the below details and images. In addition to explaining the types of airbags and where they are located, the manual specifically alerts consumers that the airbags "are designed to inflate in moderate to severe frontal or near-frontal crashes" where "the impact speed is above the system's designed 'threshold level." As to frontal airbags, it explains that they have been "designed to help reduce the risk of injury from the force of an inflating airbag."

#### Supplemental Restraint Systems (SRS)

This part explains the frontal and side impact Supplemental Restraint Systems (SRS) or air bag systems.

Your vehicle has four air bags -- a frontal air bag for the driver, another frontal air bag for the right front passenger, a side impact air bag for the driver, and another side impact air bag for the right front passenger.

Frontal air bags are designed to help reduce the risk of injury from the force of an inflating frontal air bag. But these air bags must inflate very quickly to do their job and comply with federal regulations.

#### When should an air bag inflate?

The driver's and right front passenger's frontal air bags are designed to inflate in moderate to severe frontal or near-frontal crashes. But they are designed to inflate only if the impact speed is above the system's designed "threshold level."

If your vehicle goes straight into a wall that doesn't move or deform, the threshold level is about 9 to 16 mph (14 to 26 km/h). The threshold level can vary, however, with specific vehicle design, so that it can be somewhat above or below this range.

If your vehicle strikes something that will move or deform, such as a parked car, the threshold level will be higher. The driver's and right front passenger's frontal air bags are not designed to inflate in rollovers, side impacts, or rear impacts, because inflation would not help the occupant.

2293238.3 - 43 - CLASS ACTION COMPLAINT

How the Air Bag Systems Work Where are the air bags?



The driver's frontal air bag is in the middle of the steering wheel.



The right front passenger's frontal air bag is in the instrument panel on the passenger's side.

The driver's side impact air bag is in the side of the driver's seatback closest to the door.

# How the Air Bag Systems Work Where are the air bags?



The driver's frontal air bag is in the middle of the steering wheel.



The right front passenger's frontal air bag is in the instrument panel on the passenger's side.

The driver's side impact air bag is in the side of the driver's seatback closest to the door.

# 2

# 3 4

# 56

# 7

# 8 9

# 1011

### 12

13

# 1415

# 16

## 17

18

19

2021

22

23

24

25

2627

28

# When Should an Airbag Inflate?

Frontal airbags are designed to inflate in moderate to severe frontal or near-frontal crashes to help reduce the potential for severe injuries mainly to the driver's or right front passenger's head and chest. However, they are only designed to inflate if the impact exceeds a predetermined deployment threshold. Deployment threshold. Deployment thresholds are used to predict how severe a crash is likely to be in time for the airbags to inflate and help restrain the occupants.

Whether the frontal airbags will or should deploy is not based on how fast your vehicle is traveling. It depends largely on what you hit, the direction of the impact, and how quickly your vehicle slows down. All of the airbags in the vehicle will have the word AIRBAG embossed in the trim or on an attached label near the deployment opening.

For frontal airbags, the word AIRBAG will appear on the middle part of the steering wheel for the driver and on the instrument panel for the right front passenger.

With seat-mounted side impact airbags, the word AIRBAG will appear on the side of the seatback closest to the door.

With roof-rail airbags, the word AIRBAG will appear along the headliner or trim.

Airbags are designed to supplement the protection provided by safety belts. Even though today's airbags are also designed to help reduce the risk of injury from the force of an inflating bag, all airbags must inflate very quickly to do their job.

### Airbag System

The vehicle has the following airbags:

- A frontal airbag for the driver.
- A frontal airbag for the right front passenger.
- A seat-mounted side impact airbag for the driver.
- A seat-mounted side impact airbag for the right front passenger.
- A roof-rail airbag for the driver, passenger seated directly behind the driver, and the third row outboard passenger position.
- A roof-rail airbag for the right front passenger, passenger seated directly behind the right front passenger, and the third row outboard passenger position.
- 117. The manuals for the 2009 Chevy Traverse and 2010 Buick Enclave include similar details and images. Like the manual for the 2002 Cadillac Escalade, they also assure consumers that the vehicle's airbags are "designed to help reduce the risk of injury from the force of an inflating bag" and, thus, that the aggressive deployment problems that plagued first-generation airbags had been alleviated. It also assures that the frontal airbags have been "designed to inflate in moderate to severe frontal crashes to help reduce the potential for severe injuries...." It continues that airbag "deployment thresholds are used to predict how severe a crash is likely to be in time for the airbags to inflate and help restrain the occupants." While it gives very specific detail on the way the passenger safety systems should function, the manual notably fails to say that the deployment thresholds are wholly and intentionally ignored just 45 milliseconds into a crash sequence, preventing the airbags and seatbelts from functioning when they need to.
- 118. The manual for the 2014 GMC Acadia provides additional detail about how the passenger safety system functions. It explains that "Airbags are designed to inflate if the impact exceeds the specific airbag system's deployment thresholds." Yet again, however, the manual

2293238.3 - 45 - CLASS ACTION COMPLAINT

25

26

27

28

does not indicate that the SDM and its sensors are rendered useless in multi-impact crashes that endure for longer than a specific, 45 millisecond time frame.

#### Where Are the Airbags?



The driver frontal airbag is in the center of the steering wheel.



The front outboard passenger frontal airbag is in the passenger side instrument panel.



If the vehicle has a front center airbag, it is in the inboard side of the driver seatback

#### When Should an Airbag Inflate?

This vehicle is equipped with airbags. See Airbag System on page 3-23. Airbags are designed to inflate if the impact exceeds the specific airbag system's deployment threshold. Deployment thresholds are used to predict how severe a crash is likely to be in time for the airbags to inflate and help restrain the occupants. The vehicle has electronic sensors that help the airbag system determine the severity of the impact. Deployment thresholds can vary with specific vehicle design

Frontal airbags are designed to inflate in moderate to severe frontal or near frontal crashes to help reduce the potential for severe injuries, mainly to the driver's or front outboard passenger's head and chest.

Whether the frontal airbags will or should inflate is not based primarily on how fast the vehicle is traveling. It depends on what is hit, the direction of the impact, and how quickly the vehicle slows down.

Frontal airbags may inflate at different crash speeds depending on whether the vehicle hits an object straight on or at an angle, and whether the object is fixed or moving, rigid or deformable, narrow or wide.

Frontal airbags are not intended to inflate during vehicle rollovers, rear impacts, or many side impacts.

In addition, the vehicle has advanced technology frontal airbags. Advanced technology frontal airbags adjust the restraint according to crash severity.

The front center airbag, if equipped. is designed to inflate in moderate to severe side crashes depending upon the location of the impact, when either side of the vehicle is struck. In addition, the front center airbag is designed to inflate when the sensing system predicts that the vehicle is about to roll over on its

side. The front center airbag is not designed to inflate in frontal impacts, near frontal impacts, or rear impacts.

Seat-mounted side impact airbags are designed to inflate in moderate to severe side crashes depending on the location of the impact Seat-mounted side impact airbags are not designed to inflate in frontal impacts, near frontal impacts, rollovers, or rear impacts. A seat-mounted side impact airbag

is designed to inflate on the side of the vehicle that is struck.

Roof-rail airbags are designed to inflate in moderate to severe side crashes depending on the location of the impact. In addition, these roof-rail airbags are designed to inflate during a rollover or in a severe frontal impact. Roof-rail airbags are not designed to inflate in rear impacts. Both roof-rail airbags will inflate when either side of the vehicle is struck, if the sensing

#### GM marketed the Class Vehicles to be safe and reliable but failed to 3. mention the SDM Calibration Defect.

119. Like its other consumer-facing representations, GM's advertisements for the Class Vehicles left out a crucial part of the story. By uniformly omitting any information about the SDM Calibration Defect, GM misled consumers into believing that their airbags would function properly in a crash, despite its knowledge to the contrary.

120. A 2013 press release about the 2014 Chevy Silverado 1500, GMC Sierra, and Sierra Denali 1500 is further illustrative of GM's misleading statements about the Class Vehicles. Acknowledging that safety is "as important to truck buyers as it is to car buyers," Gay Kent, GM general director of Vehicle Safety and Crashworthiness, stated that the "Silverado and Sierra set a benchmark for pickup truck safety by offering a full array of advanced features designed to protect occupants before, during and after a collision." The press release noted the vehicle's "[s]ix standard air bags and 360-degree sensor system, including dual-stage frontal air bags, head-curtain side-impact air bags with rollover protect, and front outboard seat-mounted side-impact air bags."

- 121. Brochures and press releases for other Class Vehicles use similar language to send a misleading message of safety. Illustrative examples are described below.
- a. Beginning with the 1999 Chevy Blazer, GM promised to go "to the ends of the earth to bring you driving security," assuring "peace of mind" with its "mainstay features such as Next Generation driver and right-front-passenger airbags."
- b. "Because safety and security are so important to your family," the brochure for the 2002 Chevy Astro reads, "Astro features a comprehensive system to help you feel secure while you're driving." Among other safety features, "[s]tandard driver and front-passenger air bags . . . [are] designed to give you peace of mind. Chevy Astro. It's the midsize van that's serious about safety and security."
- c. The brochure for the 2006 GMC Yukon promises, "should the worst happen, your Yukon will protect you and your passengers with front and rear crush zones, a sturdy steel safety cage, up to four air bags and a host of other important safety features."
- d. The brochure for the 2008 Buick Enclave explains that "[s]afety and protection were top priorities in the design of the Enclave" and touts the vehicle's "360° perimeter safety system [that] will deploy the appropriate airbags."
- e. Promising "[f]eelings of security and confidence," the brochure for the 2009 Chevy Equinox states the vehicle's "dual-stage frontal and head-curtain side-impact air bags" helped earn it "the highest possible government rating for frontal crash tests five stars."
- f. Declaring that "[s]afety never goes out of style," the brochure for the 2009 Chevy Traverse highlights the vehicle's "five-star frontal and side-impact crash test ratings" and its "six air bags that help protect all three rows of seating."

- A press release for the 2009 Cadillac Escalade ESV goes further, g. proclaiming that the "Escalade is designed to be among the industry's safest and most secure vehicles, with numerous safety systems and crash-avoidance technologies."
- "Speaking of safety," the brochure for the 2010 Buick Enclave reads, "Enclave has earned an impressive five-star crash rating for both front and side impacts . . . . Five-star rating is for the driver and front passenger seating positions in the frontal crash test and for the front and rear seating positions in the side-impact crash test."
- i. The brochure for the 2010 GMC Terrain describes the vehicle as "the state of the art in air bags" and contends that "[s]egment-best safety is anticipated, with features that include . . . six standard air bags: dual frontal airbags; head curtain side air bags and pelvic/thorax seat-mounted side airbags."
- į. The brochure for the 2010 Silverado assures that the "head of security never goes off the clock," boasting of a "five-star frontal crash test rating," including through its "driver and right-front passenger dual-stage airbags."
- k. A press release for the 2011 Cadillac Escalade Hybrid explains, "[f]rontimage airbags for the driver and passenger have been designed to protect the head during a frontal crash."
- 1. According to the brochure for the 2011 Cadillac SRX, "[p]assenger safety is a primary consideration throughout the engineering process." If an incident occurs, "the SRX looks out for you and yours," with its "six standard airbags, including advanced, frontal dualstage and seat mounted side-impact airbags for the driver and front-seat passenger, as well as first- and second- row outboard head-curtain airbags."
- m. Describing Buick's "holistic[]" approach to safety, the brochure for the 2012 Enclave proclaims "Enclave's approach to safety helps you and your companions feel safe and secure before, during and after your travels." Inside the vehicle, "all rows have curtain sideimpact air bags with rollover protection, along with driver and front-passenger side-impact and dual-sage airbags."

- 48 -CLASS ACTION COMPLAINT

2293238.3

28

- n. In a 2013 press release announcing that NHTSA gave "its highest possible 5-star Overall Score" to a number of Chevrolet vehicles, including the Traverse and the Silverado, Kent said "We design safety and crashworthiness into our vehicles very early in development." He continued, "We are committed to offering advanced safety technologies on a broad range of models . . . . All of our vehicles are designed to provide continuous protection for customers before, during and after a crash."
- o. A press release for the 2013 Buick Enclave likewise publicized Buick's safety record: "In 2012, every Buick model was named a Top Safety Pick by the Insurance Institute for Highway Safety, underscoring the brand's commitment to safety leadership. The 2013 builds on that distinction with the industry's first front center side air bag a standard feature."
- p. "With head curtain side-impact air bags reaching from the front to the third row of seating for outboard passengers," the 2014 brochure for the GMC Yukon XL reads, "Yukon is engineered to help protect passengers regardless of where they're seated."
- q. Claiming to "set[] the standard . . . in everything from safety to performance," the brochure for the 2014 Cadillac Escalade touts the vehicle's "eight standard airbags," including "[d]ual-stage driver and front passenger, front-impact, Automatic Occupant Sensing System, driver and front passenger seat-mounted side-impact airbags for thorax and pelvic protection and head-curtain side-impact airbags with rollover protection for all outboard passenger rows."
- r. The brochure for the 2014 Buick Enclave promises that the vehicle has "your back, front and sides, proclaiming that "in an industry first, the standard driver's seat sidemounted front center air bag adds another layer of protection by providing cushioning between you and your front passenger to help reduce injuries in side impacts." The brochure includes the below picture, indicating that the airbags will function as expected.

2293238.3 - 49 - CLASS ACTION COMPLAINT



122. Based on information and belief, every single Class Vehicle advertisement omitted any mention that the vehicles' airbags and seatbelts could fail in a serious frontal collision due to the SDM Calibration Defect.

\* \* \*

123. GM's deceptive actions harmed Plaintiff and the Class(es). As a result of GM's unfair, deceptive, and/or fraudulent business practices, and failure to disclose that the Class Vehicles carried a dangerous safety defect that would cause the passenger safety systems to shut off during certain types of accidents, owners and lessees of the Class Vehicles have lost money and/or property.

### V. <u>CLASS ACTION ALLEGATIONS</u>

124. This case is about GM's legal responsibility for its knowledge, conduct, and products. The proposed Class members' claims all derive directly from a single course of conduct by GM. The objective facts are the same for all Class members. Within each Claim for Relief asserted by the respective proposed Classes, the same legal standards govern.

Additionally, many states share the same legal standards and elements of proof, facilitating the certification of multistate or nationwide classes for some or all claims.

125. Accordingly, Plaintiff brings this lawsuit as a class action on his own behalf, and on behalf of all other persons similarly situated, as members of the proposed Classes pursuant to Federal Rules of Civil Procedure 23(a), (b)(2), and/or (b)(3), and/or (c)(4). This action satisfies the numerosity, commonality, typicality, adequacy, predominance, and superiority requirements

of those provisions. Certification of Plaintiff's claims for class-wide treatment is appropriate because Plaintiff can prove the elements of the claims on a class-wide basis using the same evidence as would be used in individual actions alleging the same claims.

#### **A.** The Class Definition

- 126. The "Class Vehicles" herein include all vehicles in the United States that contain the SDM Calibration Defect that were (1) manufactured, sold, distributed, or leased by Defendants or (2) manufactured, sold, distributed, or leased by Old GM and purchased or leased by Plaintiff or a Class member after July 10, 2009.
- 127. On information and belief, the SDM Calibration Defect exists in all GM trucks and SUVs starting with model year 1999. This would include, for example, trucks and SUVs such as the Silverado, Tahoe, Astro, and Trailblazer. Discovery will reveal when, if ever, GM discontinued use of the SDM Calibration Defect in its trucks and SUVs.
- 128. The proposed Nationwide Class includes all persons and entities that purchased or leased a Class Vehicle in the United States, including its territories. Plaintiff also proposes a separate State Class for California, including all persons and entities that purchased or leased a Class Vehicle in California.
  - 129. Excluded from the Classes are:
- a. Defendants' officers, directors and employees and participants in the Porsche Associate Lease Program; Defendants' affiliates and affiliates' officers, directors, and employees; Defendants' distributors and distributors' officers, directors, and employees; and
- b. Judicial officers and their immediate family members and associated court staff assigned to this case.
- 130. Plaintiff reserves the right to amend the Class definitions if discovery and further investigation reveal that any Class should be expanded, reduced, divided into additional subclasses under Rule 23(c)(5), or otherwise modified.

#### **B.** Numerosity: Federal Rule of Civil Procedure 23(a)(1)

131. The members of the Classes are so numerous and geographically dispersed that individual joinder of all Class members is impracticable. There are millions of Class Vehicles

2293238.3 - 51 - CLASS ACTION COMPLAINT

1	and Class members nationwide. The precise number and identities of Nationwide Class and				
2	California Class members may be ascertained from Defendants' records and motor vehicle				
3	regulatory data. Class members may be notified of the pendency of this action by recognized,				
4	Court-approved notice dissemination methods.				
5	C. Commonality and Predominance: Federal Rule of Civil Procedure 23(a)(2) and 23(b)(3)				
6	and 23(b)(3)				
7	132. This action involves common questions of law and fact, which predominate over				
8	any questions affecting individual Class members. These include, without limitation, the				
9	following:				
10	a. Whether the Class Vehicles' SDM software calibration is defective, as				
11	described herein;				
12	b. Whether Defendants knew, or should have known, about the SDM				
13	Calibration Defect, and, if so, how long they have or should have known about it;				
14	c. Whether Defendants had a duty to disclose the defective nature of the Class				
15	Vehicles to Plaintiff and Class members;				
16	d. Whether Defendants' concealment of the SDM Calibration Defect caused				
17	Plaintiff and Class members to act to their detriment by purchasing or leasing the Class Vehicles;				
18	e. Whether Defendants' certifications concerning vehicle safety were				
19	misleading considering the risk that the SDMs will not trigger airbags and seatbelts during certain				
20	types of collisions;				
21	f. Whether Defendants' conduct tolls any or all applicable limitations periods				
22	by acts of fraudulent concealment, application of the discovery rule, or equitable estoppel;				
23	g. Whether Defendants misrepresented that the Class Vehicles were safe;				
24	h. Whether the Defendants concealed that SDM Calibration Defect;				
25	i. Whether Defendants' statements, concealments, and omissions regarding				
26	the Class Vehicles were material, in that a reasonable consumer could consider them important in				
27	purchasing, selling, maintaining, or operating such vehicles;				
28					

2293238.3 - 52 - CLASS ACTION COMPLAINT

3

4

5

6 7

9

10

8

11

12

13

14 15

16 17

18

19 20

21

22 23

24

25

26 27

28

j. Whether Defendants engaged in unfair, deceptive, unlawful and/or fraudulent acts or practices, in trade or commerce, by failing to disclose that the Class Vehicles were designed, manufactured, and sold with defective airbag components;

- k. Whether the Class Vehicles were unfit for the ordinary purposes for which they were used, in violation of the implied warranty of merchantability;
- 1. Whether Defendants' concealment of the true defective nature of the Class Vehicles caused their market price to incorporate a premium reflecting the assumption by consumers that the Class Vehicles were equipped with fully functional passenger safety systems and, if so, the market value of that premium; and
- Whether Plaintiff and the other Class members are entitled to damages and m. other monetary relief and, if so, in what amount.

#### **Typicality: Federal Rule of Civil Procedure 23(a)(3)** D.

133. Plaintiff's claims are typical of the claims of the Class members whom he seeks to represent under Fed. R. Civ. P. 23(a)(3), because Plaintiff and each Class member purchased or leased a Class Vehicle and were comparably injured through Defendants' wrongful conduct as described above. Plaintiff and the other Class members suffered damages as a direct proximate result of the same wrongful practices by Defendants. Plaintiff's claims arise from the same practices and courses of conduct that give rise to the claims of the other Class members. Plaintiff's claims are based upon the same legal theories as the claims of the other Class members.

#### E. Adequacy: Federal Rule of Civil Procedure 23(a)(4)

134. Plaintiff will fairly and adequately represent and protect the interests of the Class members as required by Fed. R. Civ. P. 23(a)(4). Plaintiff's interests do not conflict with the interests of the Class members. Plaintiff have retained counsel competent and experienced in complex class action litigation, including automobile defect litigation and other consumer protection litigation. Plaintiff intends to prosecute this action vigorously. Neither Plaintiff nor counsel have interests that conflict with the interests of the other Class members. Therefore, the interests of the Class members will be fairly and adequately protected.

- 53 -2293238.3 CLASS ACTION COMPLAINT

# 

# 

# 

# 

# 

# 

# 

# 

# 

# 

# 

#### F. <u>Declaratory and Injunctive Relief: Federal Rule of Civil Procedure 23(b)(2)</u>

135. Defendants have acted or refused to act on grounds generally applicable to Plaintiff and the other members of the Class, thereby making appropriate final injunctive relief and declaratory relief, as described below, with respect to the Class as a whole.

#### G. Superiority: Federal Rule of Civil Procedure 23(b)(3)

- 136. A class action is superior to any other available means for the fair and efficient adjudication of this controversy, and no unusual difficulties are likely to be encountered in its management. The damages or other financial detriment suffered by Plaintiff and the other Class members are relatively small compared to the burden and expense that would be required to individually litigate their claims against Defendants such that it would be impracticable for members of the Classes to individually seek redress for Defendants' wrongful conduct.
- 137. Even if Class members could afford individual litigation, the court system could not. Individualized litigation creates a potential for inconsistent or contradictory judgments and increases the delay and expense to all parties and the court system. By contrast, the class action device presents far fewer management difficulties and provides the benefits of single adjudication, economy of scale, and comprehensive supervision by a single court.

#### VI. ANY APPLICABLE STATUTES OF LIMITATION ARE TOLLED

- GM learned, through books, records, and personnel, that Old GM had launched the defective algorithm despite clear warnings of the risk of doing so, and then continued to use that defective software thereafter. They obtained further knowledge of the risks of the SDM Calibration Defect from lawsuits and multiple suspicious accidents (involving airbag and seatbelt failures in frontal accidents) occurring in practically every year since, which provided additional and confirmatory notice of the continued risks of the SDM Calibration Defect.
- 139. Despite this knowledge, for years, Defendants did not disclose the seriousness of the issue and in fact concealed the prevalence of the problem. In so doing, Defendants have failed to warn consumers, initiate timely recalls, or inform NHTSA, as GM is obligated to do.

2293238.3 - 54 - CLASS ACTION COMPLAINT

140. Defendants had a duty to disclose the SDM Calibration Defect to consumers and NHTSA. Contrary to this duty, GM concealed the defect by continuing to distribute, sell, and/or lease the Class Vehicles to Plaintiff and the Class members; to advertise the safety of the Class Vehicles; and to fail to notify regulators or Plaintiff and the Class members about the true nature of the Class Vehicles.

- 141. Due to the highly technical nature of the SDM Calibration Defect, Plaintiff and Class members were unable to independently discover it using reasonable diligence. Prior to the retention of counsel and without third-party experts, Plaintiff and Class members lack the necessary expertise to analyze the software algorithm for the SDMs and to understand its defective nature.
- 142. Accordingly: (1) Defendants' fraudulent concealment tolls the statute of limitations; (2) Defendants are estopped from relying on the statute of limitations; and (3) the statute of limitations is tolled by the discovery rule.

#### VII. CAUSES OF ACTION

#### A. Claims Asserted on Behalf of the Nationwide Class

## NATIONWIDE COUNT I: FRAUD BY CONCEALMENT (Common Law)

- 143. Plaintiff re-alleges and incorporates by reference all paragraphs as though fully set forth herein.
- 144. Plaintiff brings this claim on behalf of himself and the Nationwide Class under the common law of fraudulent concealment, as there are no true conflicts among various states' laws of fraudulent concealment. Defendants are liable for both fraudulent concealment and non-disclosure. See, e.g., Restatement (Second) of Torts §§ 550-51 (1977). In the alternative, Plaintiff brings this claim on behalf of the California State Class.
- 145. Defendants intentionally and knowingly concealed and suppressed material facts from regulators and consumers regarding the SDM Calibration Defect that causes the airbags

2293238.3 - 55 - CLASS ACTION COMPLAINT

and seatbelts to fail in prolonged onset, complex, or otherwise multi-impact accidents, causing a serious risk or injury or death.

- 146. A reasonable consumer would not have expected that the Class Vehicles contained a software program that was calibrated to prevent seatbelt tightening and airbag deployment during certain types of frontal crashes. Defendants knew that reasonable consumers expect that their vehicle has working airbags and seatbelt pretensioners and would rely on those facts in deciding whether to purchase, lease, or retain a new or used motor vehicle. Whether a manufacturer's products are safe and reliable, and whether that manufacturer stands behind its products, are material concerns to a consumer.
- 147. Defendants ensured that Plaintiff and the Class did not discover this information through actively concealing it and misrepresenting the Class Vehicles' safety systems without disclosing the truth. Defendants intended for Plaintiff and the Class to rely on their omissions—which they did by purchasing and leasing the Class Vehicles at the prices they paid.
  - 148. Defendants had a duty to disclose the SDM Calibration Defect because:
- a. GM had exclusive and/or far superior knowledge and access to the facts about this hidden and complex safety defect. Defendants also knew that these technical facts were not known to or reasonably discoverable by Plaintiff and the Class;
- b. GM knew the SDM Calibration Defect (and its safety risks) was a material fact that would affect Plaintiff's or Class members' decisions to buy or lease Class Vehicles;
- c. GM is subject to statutory duties to disclose known safety defects to consumers and to NHTSA; and
- d. GM made incomplete representations about the safety and reliability of the Class Vehicles and their passenger safety systems, while purposefully withholding material facts about a known safety defect. In uniform advertising and materials provided with each Class Vehicle, Defendants intentionally concealed, suppressed, and failed to disclose to Plaintiff and the Class that the Class Vehicles contained the dangerous SDM Calibration Defect. Because they volunteered to provide information about the Class Vehicles that they offered for sale to Plaintiff and the Class, Defendants had the duty to disclose the whole truth. They did not.

2293238.3 - **56** - CLASS ACTION COMPLAINT

set forth herein.

149. To this day, Defendants have not made full and adequate disclosure, continue to defraud Plaintiff and the Class, and continue to conceal material information regarding the SDM Calibration Defect. The omitted and concealed facts were material because reasonable person would find them important in purchasing, leasing, or retaining a new or used motor vehicle, and because they directly impact the value of the Class Vehicles purchased or leased by Plaintiff and the Class.

- 150. Defendants actively concealed or suppressed these material facts, in whole or in part, to maintain a market for their vehicles, to protect profits, and to avoid recalls that would hurt the brand's image and cost money. They did so at the expense of Plaintiff and the Class. Had they been aware of the SDM Calibration Defect in the Class Vehicles, and Defendants' callous disregard for safety, Plaintiff and the Class either would not have paid as much as they did for their Class Vehicles, or they would not have purchased or leased them.
- 151. Accordingly, Defendants are liable to Plaintiff and the Class for their damages in an amount to be proven at trial, including, but not limited to, their lost overpayment for the Class Vehicles at the time of purchase or lease.
- 152. Defendants' acts were done maliciously, oppressively, deliberately, with intent to defraud; in reckless disregard of Plaintiff's and the Class' rights and well-being; and to enrich themselves. Their misconduct warrants an assessment of punitive damages in an amount sufficient to deter such conduct in the future, which amount shall be determined according to proof at trial.

## NATIONWIDE COUNT II: UNJUST ENRICHMENT (Common Law)

- 153. Plaintiff re-alleges and incorporates by reference all paragraphs as though fully
- 154. Plaintiff asserts this Unjust Enrichment count on behalf of himself and the Nationwide Class or, in the alternative, on behalf of the California State Class.

2293238.3 - 57 - CLASS ACTION COMPLAINT

- 155. By reason of their conduct, Defendants caused damages to Plaintiff and Class members.
- 156. Plaintiff and Class members conferred a benefit on the Defendants by overpaying for Class Vehicles at prices that were artificially inflated by Defendants' concealment of the SDM Calibration Defect and misrepresentations regarding the Class Vehicles' safety.
- 157. As a result of Defendants' fraud and deception, Plaintiff and Class members were not aware of the true facts concerning the Class Vehicles and did not benefit from the Defendants' misconduct.
- 158. Defendants knowingly benefitted from their unjust conduct. They sold and leased Class Vehicles equipped with a SDM Calibration Defect for more than what the vehicles were worth, at the expense of Plaintiff and Class members.
- 159. Defendants readily accepted and retained these benefits from Plaintiff and Class members.
- 160. It is inequitable and unconscionable for Defendants to retain these benefits because they misrepresented that the Class Vehicles were safe, and intentionally concealed, suppressed, and failed to disclose the SDM Calibration Defect to consumers. Plaintiff and Class members would not have purchased or leased the Class Vehicles or would have paid less for them, had Defendants not concealed the SDM Calibration Defect.
  - 161. Plaintiff and Class members do not have an adequate remedy at law.
- 162. Equity cannot in good conscience permit the Defendants to retain the benefits that they derived from Plaintiff and Class members through unjust and unlawful acts, and therefore restitution or disgorgement of the amount of the Defendants' unjust enrichment is necessary.

2293238.3 - 58 - CLASS ACTION COMPLAINT

28

#### B. State-Specific Claims

#### 1. California

#### **CALIFORNIA COUNT I:**

Violation of California Consumers Legal Remedies Act Cal. Civ. Code § 1750, et seq. (On Behalf of the California State Class)

- 163. Plaintiff re-alleges and incorporates by reference all preceding allegations as though fully set forth herein.
- 164. Plaintiff Pereda brings this claim on behalf of himself and the California State Class against the Defendants.
- 165. Plaintiff and California State Class members are "consumers" within the meaning of Cal. Civ. Code § 1761(d).
- 166. Defendants, the California Plaintiff, and California State Class members are "persons" within the meaning of Cal. Civ. Code § 1761(c).
  - 167. The Class Vehicles are "goods" within the meaning of Cal. Civ. Code § 1761(a).
- 168. The California Legal Remedies Act ("CLRA") prohibits "unfair methods of competition and unfair or deceptive acts or practices undertaken by any person in a transaction intended to result or that results in the sale or lease of goods or services to any consumer[.]" Cal. Civ. Code § 1770.
- 169. Defendants engaged in unfair or deceptive acts or practices when, in the course of their business they, among other acts and practices, intentionally and knowingly made materially false representations regarding the reliability, safety, and performance of the Class Vehicles and/or the defective SDM software calibration, as detailed above.
- 170. Specifically, by misrepresenting the Class Vehicles as safe and/or free from defects, and by failing to disclose and actively concealing the dangers and risk posed by the Class Vehicles, Defendants engaged in one or more of the following unfair or deceptive business practices as defined in Cal. Civ. Code § 1770(a):
- a. Representing that the Class Vehicles have characteristics, uses, benefits,
   and qualities which they do not have.

- b. Representing that the Class Vehicles are of a particular standard, quality, and grade when they are not.
- c. Advertising the Class Vehicles and/or with the intent not to sell or lease them as advertised.
- d. Representing that the subject of a transaction has been supplied in accordance with a previous representation when it has not.
  - Cal. Civ. Code §§ 1770(a)(5), (7), (9), and (16).
- 171. Additionally, in the various channels of information through which Defendants sold and marketed Class Vehicles, Defendants failed to disclose material information concerning the Class Vehicles, which they had a duty to disclose. Defendants had a duty to disclose the defect because, as detailed above: (a) Defendants knew about the defect in the SDM software calibration in the Class Vehicles; (b) Defendants had exclusive knowledge of material facts not known to the general public or the other California State Class members; (c) Defendants actively concealed material facts concerning the software calibration from the general public and Plaintiff and California State Class members; and (d) Defendants made partial representations about the Class Vehicles that were misleading because they did not disclose the full truth.
- 172. Defendants' unfair or deceptive acts or practices, including their misrepresentations, concealments, omissions, and/or suppressions of material facts, had a tendency or capacity to mislead and create a false impression in consumers, and were likely to and did in fact deceive reasonable consumers, including Plaintiff and California State Class members, about the true safety and reliability of Class Vehicles, the quality of the Class Vehicles, and the true value of the Class Vehicles.
- 173. Plaintiff and the other California State Class members have suffered injury in fact and actual damages resulting from Defendants' material omissions.
- 174. Defendants' violations present a continuing risk to Plaintiff and California State Class members, as well as to the general public, and therefore affect the public interest.
- 175. Defendants are on notice of the issues raised in this count and this Complaint by way of, among other things, the individual personal injury litigation and hundreds of public

2293238.3 - 60 - CLASS ACTION COMPLAINT

	3
	4
	5
	6
	7
	8
	9
1	0
1	1
1	2
1	3
1	4
1	5
	6
1	7
1	8
1	9
2	0
2	1
2	2
2	3
2	4
2	5
2	6
2	7
2	8

2

consumer complaints detailed above, as well as their own intrinsic knowledge of defect they have included in the Class Vehicles by design. Plaintiff has also sent a notice letter to Defendants in accordance with Cal. Civ. Code § 1782(a) of the CLRA, notifying Defendants of their alleged violations of Cal. Civ. Code § 1770(a) and demanding that Defendants correct or agree to correct the actions described therein within thirty (30) days of the notice letter. If Defendants fail to do so, Plaintiff will amend this Complaint as of right (or otherwise seek leave to amend the Complaint) to include compensatory and monetary damages to which Plaintiff and California Class Members are entitled under the CLRA.

176. Attached hereto as Exhibit C is the venue affidavit required by CLRA, Cal. Civ. Code § 1780(d).

#### **CALIFORNIA COUNT III:**

### Violations of the California Unfair Competition Law Cal. Bus. & Prof. Code § 17200, et seq. (On Behalf of the California State Class)

- 177. Plaintiff re-alleges and incorporates by reference all preceding allegations as though fully set forth herein.
- 178. Plaintiff Pereda brings this claim on behalf of himself and the California State Class against all Defendants.
- 179. The California Unfair Competition Law ("UCL"), Cal. Bus. and Prof. Code § 17200, prohibits any "unlawful, unfair, or fraudulent business act or practices."
- 180. Defendants' knowing and intentional conduct described in this Complaint constitutes unlawful, fraudulent, and unfair business acts and practices in violation of the UCL. Specifically, Defendants' conduct is unlawful, fraudulent, and unfair in at least the following ways:
- a. by knowingly and intentionally concealing from Plaintiff and California State Class members that the Class Vehicles suffer from the SDM Calibration Defect while obtaining money from the California State Class members;
- b. by marketing Class Vehicles as possessing a functional, safe, and defectfree passenger safety system.

- c. by purposefully designing and manufacturing the Class Vehicles to contain a defective SDM software calibration that causes airbags and seatbelts to fail in certain accidents contrary to what was disclosed to regulators and represented to consumers who purchased or leased Class Vehicles, and failing to fix the SDM Calibration Defect free of charge; and
- d. by violating the other California laws alleged herein, including the False Advertising Law, Consumers Legal Remedies Act, California Commercial Code, and Song-Beverly Consumer Warranty Act.
- 181. Defendants' misrepresentations, omissions, and concealment were material to the California Plaintiff and California State Class members, and Defendants misrepresented, concealed, or failed to disclose the truth with the intention that consumers would rely on the misrepresentations, concealment, and omissions.
- 182. Defendants' material misrepresentations and omissions alleged herein caused Plaintiff and the California State Class members to make their purchases or leases of their Class Vehicles. Absent those misrepresentations and omissions, Plaintiff and California State Class members would not have purchased or leased these vehicles or would not have purchased or leased these Class Vehicles at the prices they paid.
- 183. Accordingly, Plaintiff and California State Class members have suffered ascertainable loss and actual damages as a direct and proximate result of Defendants' misrepresentations and their concealment of and failure to disclose material information.
- 184. Defendants' violations present a continuing risk to Plaintiff and California State Class members, as well as to the general public. Defendants' unlawful acts and practices complained of herein affect the public interest.
- 185. Plaintiff requests that this Court enter an order enjoining Defendants from continuing their unfair, unlawful, and/or deceptive practices and restoring to members of the California State Class any money Defendants acquired by unfair competition, including restitution and/or restitutionary disgorgement, as provided in Cal. Bus. & Prof. Code § 17203 and Cal. Bus. & Prof. Code § 3345, and for such other relief set forth below.

2293238.3 - 62 - CLASS ACTION COMPLAINT

#### **CALIFORNIA COUNT IIIII:**

### Violations of the California False Advertising Law Cal. Bus. & Prof. Code § 17500, et seq. (On Behalf of the California State Class)

- 186. Plaintiff re-alleges and incorporates by reference all preceding allegations as though fully set forth herein.
- 187. Plaintiff Ramiro Pereda (for the purposes of this count, "Plaintiff") brings this claim on behalf of himself and the California State Class against all Defendants.
- 188. The California False Advertising Law ("FAL"), Cal. Bus. & Prof. Code § 17500, prohibits false advertising.
- 189. Defendants, Plaintiff, and California State Class members are "persons" within the meaning of Cal. Bus. & Prof. Code § 17506.
- 190. Defendants violated the FAL by causing to be made or disseminated through California and the United States, through advertising, marketing and other publications, statements regarding the safety of the Class Vehicles that were untrue or misleading, and which were known, or which by the exercise of reasonable care should have been known to Defendants, to be untrue and misleading to consumers, including California State Class members. Numerous examples of these statements and advertisements appear in the preceding paragraphs throughout this Complaint and in Exhibit B.
- 191. The misrepresentations and omissions regarding the reliability and safety of Class Vehicles as set forth in this Complaint were material and had a tendency or capacity to mislead and create a false impression in consumers, and were likely to and did in fact deceive reasonable consumers, including Plaintiff and California State Class members, about the true safety and reliability of Class Vehicles, the quality of the Defendants' brands, and the true value of the Class Vehicles.
- 192. In purchasing or leasing their Class Vehicles, the California State Class members relied on the misrepresentations and/or omissions of Defendants with respect to the safety and reliability of the Class Vehicles. Defendants' representations turned out not to be true because

2293238.3 - 63 - CLASS ACTION COMPLAINT

the Class Vehicles are distributed with a dangerous safety defect, rendering the vehicles' airbags and seatbelts inoperative in certain types of accidents.

- 193. Plaintiff and the other California State Class members have suffered an injury in fact, including the loss of money or property, as a result of Defendants' unfair, unlawful, and/or deceptive practices. Had they known the truth, Plaintiff and California State Class members would not have purchased or leased the Class Vehicles or would have paid significantly less for them.
- 194. Plaintiff and California State Class members had no way of discerning that Defendants' representations were false and misleading, or otherwise learning the facts that Defendants had concealed or failed to disclose. Plaintiff and California State Class members did not, and could not, unravel Defendants' deception on their own.
- 195. Defendants had an ongoing duty to Plaintiff and California State Class members to refrain from unfair or deceptive practices under the California False Advertising Law in the course of their business. Specifically, the Defendants owed Plaintiff and California State Class members a duty to disclose all the material facts concerning the SDM Calibration Defect in the Class Vehicles because they possessed exclusive knowledge, they intentionally concealed the defect from Plaintiff and California State Class members, and/or they made misrepresentations that were rendered misleading because they were contradicted by withheld facts.
- 196. All of the wrongful conduct alleged herein occurred, and continues to occur, in the conduct of Defendants business. Defendants' wrongful conduct is part of a pattern or generalized course of conduct that is still perpetuated and repeated, both in the State of California and nationwide.
- 197. Defendants' violations present a continuing risk to Plaintiff and California State Class members, as well as to the general public. Defendants' unlawful acts and practices complained of herein affect the public interest.
- 198. Plaintiff requests that this Court enter an order enjoining Defendants from continuing their unfair, unlawful, and/or deceptive practices and restoring to the California State

Class any money Defendants acquired by unfair competition, including restitution and/or restitutionary disgorgement, and for such other relief set forth below.

# CALIFORNIA COUNT IVV: Breach of Express Warranty Cal. Com. Code §§ 2313 and 10210 (On Behalf of the California State Class)

- 199. Plaintiff re-alleges and incorporates by reference all preceding allegations as though fully set forth herein.
- 200. Plaintiff Pereda brings this claim on behalf of himself and the California State Class against all Defendants.
- 201. Defendants are and were at all relevant times "merchant[s]" with respect to motor vehicles under Cal. Com. Code §§ 2104(1) and 10103(c), and "sellers" of motor vehicles under § 2103(1)(d).
- 202. With respect to leases, Defendants are and were at all relevant times "lessors" of motor vehicles under Cal. Com. Code § 10103(a)(16).
- 203. All California State Class members who purchased Class Vehicles in California are "buyers" within the meaning of Cal. Com. Code § 2103(1)(a).
- 204. All California State Class members who leased Class Vehicles in the California are "lessees" within the meaning of Cal. Com. Code § 10103(a)(14).
- 205. The Class Vehicles are and were at all relevant times "goods" within the meaning of Cal. Com. Code §§ 2105(1) and 10103(a)(8).
- 206. In connection with the purchase or lease of Class Vehicles, Defendants provided Plaintiff and California State Class members with written express warranties covering the repair or replacement of components that are defective in materials or workmanship.
- 207. Defendants' warranties formed the basis of the bargain that was reached when Plaintiff and California State Class members unknowingly purchased or leased Class Vehicles that came equipped with a SDM Calibration Defect.
- 208. However, Defendants knew or should have known that the warranties were false and/or misleading. Specifically, Defendants were aware of the SDM Calibration Defect in the

Class Vehicles, which made the vehicles inherently defective and dangerous at the time that they were sold and leased to Plaintiff and California State Class members.

- 209. Plaintiff and California State Class members reasonably relied on Defendants' express warranties when purchasing or leasing their Class Vehicles.
- 210. Defendants knowingly breached their express warranties to repair defects in materials and workmanship by failing to repair the SDM Calibration Defect or replace the defective SDMs in the Class Vehicles. Defendants also breached their express warranties by providing a product containing defects that were never disclosed to Plaintiff and California State Class members.
- 211. Defendants were on reasonable notice of these issues and an opportunity to cure the breaches due to their extensive knowledge of the SDM Calibration Defect, as detailed herein. Any opportunity to cure the breach is unnecessary and futile, Defendants have not cured the breaches of their warranties despite years of knowledge of those breaches.
- 212. As a direct and proximate result of Defendants' breach of express warranties, Plaintiff and California State Class members have been damaged in an amount to be proven at trial.

# CALIFORNIA COUNT V: Breach of Implied Warranty of Merchantability Cal. Com. Code §§ 2314 and 10212 (On Behalf of the California State Class)

- 213. Plaintiff re-alleges and incorporates by reference all preceding allegations as though fully set forth herein.
- 214. Plaintiff Ramiro Pereda (for the purposes of this count, "Plaintiff") brings this claim on behalf of himself and the California State Class against all Defendants.
- 215. Defendants are and were at all relevant times "merchant[s]" with respect to motor vehicles under Cal. Com. Code §§ 2104(1) and 10103(c), and "sellers" of motor vehicles under § 2103(1)(d).
- 216. With respect to leases, Defendants are and were at all relevant times "lessors" of motor vehicles under Cal. Com. Code § 10103(a)(16).

- 217. All California State Class members who purchased Class Vehicles in California are "buyers" within the meaning of Cal. Com. Code § 2103(1)(a).
- 218. All California State Class members who leased Class Vehicles in the California are "lessees" within the meaning of Cal. Com. Code § 10103(a)(14).
- 219. The Class Vehicles are and were at all relevant times "goods" within the meaning of Cal. Com. Code §§ 2105(1) and 10103(a)(8).
- 220. The Class Vehicles are and were at all relevant times "goods" within the meaning of Cal. Com. Code §§ 2105(1) and 10103(a)(8).
- 221. A warranty that the Class Vehicles were in merchantable condition and fit for the ordinary purpose for which vehicles are used is implied by law pursuant to Cal. Com. Code §§ 2314 and 10212.
- 222. The Class Vehicles did not comply with the implied warranty of merchantability because, at the time of sale and at all times thereafter, they were defective and not in merchantable condition, would not pass without objection in the trade, and were not fit for the ordinary purpose for which vehicles were used. Specifically, the Class Vehicles suffer from the SDM Calibration Defect, which may cause the airbags and seatbelt to fail to deploy during an accident, rendering the Class Vehicles inherently defective and dangerous.
- 223. Defendants were on reasonable notice of these issues and an opportunity to cure the breaches due to their extensive knowledge of the SDM Calibration Defect, as detailed herein. Any opportunity to cure the breach is unnecessary and futile, Defendants have not cured the breaches of their warranties despite years of knowledge of those breaches.
- 224. As a direct and proximate result of Defendants' breach of the implied warranty of merchantability, Plaintiff and California State Class members have been damaged in an amount to be proven at trial.

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27

### CALIFORNIA COUNT VI:

Violation of Song-Beverly Consumer Warranty Act,
Breach of Implied Warranty
Cal Civ. Code § 1790, et seq.
(On Behalf of the California State Class)

- 225. Plaintiff re-alleges and incorporates by reference all preceding allegations as though fully set forth herein.
- 226. Plaintiff Ramiro Pereda (for the purposes of this count, "Plaintiff") brings this claim on behalf of himself and the California State Class against all Defendants.
- 227. All California State Class members who purchased Class Vehicles in California are "buyers" within the meaning of Cal. Civ. Code § 1791(b).
- 228. All California State Class members who leased Class Vehicles in California are "lessors" within the meaning of Cal. Civ. Code § 1791(h).
- 229. The Class Vehicles are "consumer goods" within the meaning of Cal. Civ. Code § 1791(a).
- 230. Defendants are the "manufacturer[s]" of the Class Vehicles within the meaning of Cal. Civ. Code § 1791(j).
- 231. Defendants impliedly warranted to Plaintiff and the other members of the California State Class that the Class Vehicles were "merchantable" within the meaning of Cal. Civ. Code §§ 1791.1(a) & 1792; however, the Class Vehicles do not have the quality that a buyer would reasonably expect.
- 232. The Class Vehicles would not pass without objection in the automotive trade due to the SDM Calibration Defect. Because the Class Vehicles contain defective SDMs, the Class Vehicles are not in merchantable condition and thus not fit for ordinary purposes.
- 233. The Class Vehicles are not adequately labeled because the labeling fails to disclose the SDM Calibration Defect. The Class Vehicles do not conform to the promises and affirmations made by the Defendants regarding safety.

2293238.3 - 68 - CLASS ACTION COMPLAINT

234. The Defendants' breach of the implied warranty of merchantability caused damage to Plaintiff and California State Class members who purchased or leased the defective Class Vehicles. The amount of damages due will be proven at trial.

235. Pursuant to Cal. Civ. Code §§ 1791.1(d) and 1794, Plaintiff and California State Class members seek an order enjoining Defendants' unfair and/or deceptive acts or practices, damages, punitive damages, and any other just and proper relief available under the Song-Beverly Consumer Warranty Act.

#### **CALIFORNIA COUNT VII:**

Violation of the Song-Beverly Consumer Protection Act, Breach of Express Warranty Cal Civ. Code § 1790, et seq. (On Behalf of the California State Class)

- 236. Plaintiff re-alleges and incorporates by reference all preceding allegations as though fully set forth herein.
- 237. Plaintiff Ramiro Pereda (for the purposes of this count, "Plaintiff") brings this claim on behalf of himself and the California State Class against all Defendants.
- 238. All California State Class members who purchased Class Vehicles in California are "buyers" within the meaning of Cal. Civ. Code § 1791(b).
- 239. All California State Class members who leased Class Vehicles in California are "lessors" within the meaning of Cal. Civ. Code § 1791(h).
- 240. The Class Vehicles are "consumer goods" within the meaning of Cal. Civ. Code § 1791(a).
- 241. Defendants are "manufacturer[s]" of the Class Vehicles within the meaning of California Civil Code § 1791(j).
- 242. Defendants are and were at all relevant times "sellers" of motor vehicles under Cal. Civ. Code § 1791(l).
- 243. With respect to leases, Defendants are and were at all relevant times "lessors" of motor vehicles under Cal. Civ. Code § 1791(i).

2293238.3 - 69 - CLASS ACTION COMPLAINT

- 244. Defendants made express warranties to members of the California State Class within the meaning of California Civil Code §§ 1791.2 and 1793.2.
- 245. In connection with the purchase or lease of Class Vehicles, Defendants provided Plaintiff and California State Class members with written express warranties covering the repair or replacement of components that are defective in materials or workmanship.
- 246. Defendants' warranties formed the basis of the bargain that was reached when Plaintiff and California State Class members unknowingly purchased or leased their Class Vehicles equipped with a SDM Calibration Defect.
- 247. However, Defendants knew or should have known that their warranties were false and misleading. Specifically, Defendants were aware of the SDM Calibration Defect in the Class Vehicles which made the vehicles inherently defective and dangerous at the time that they were sold and leased to Plaintiff and California State Class members.
- 248. Plaintiff and California State Class members reasonably relied on Defendants' express warranties when purchasing or leasing the California Class Vehicles.
- 249. Defendants knowingly breached their express warranties to repair defects in materials and workmanship by failing to repair the SDM Calibration Defect or replace the defective SDMs in the Class Vehicles. Defendants also breached their express warranties by providing a product containing defects that were never disclosed to Plaintiff and California State Class members.
- 250. Defendants were on reasonable notice of these issues and an opportunity to cure the breaches due to their extensive knowledge of the SDM Defect, as detailed herein. Any opportunity to cure the breach is unnecessary and futile, Defendants have not cured the breaches of their warranties despite years of knowledge of those breaches, as detailed herein.
- 251. As a result of Defendants' breach of their express warranties, members of the California State Class received goods whose defect substantially impairs their value to Plaintiff and the other members of the California State Class. Plaintiff and members of the California State Class have been damaged as a result of, inter alia, the diminished value of Defendants' products.

2293238.3 - 70 - CLASS ACTION COMPLAINT

1	252. Pursuant to California Civil Code §§ 1793.2 & 1794, Plaintiff and members of the								
2	California State Class are entitled to damages and other legal and equitable relief including, at								
3	their election, the purchase price of their Class Vehicles, or the overpayment or diminution in								
4	value of their Class Vehicles.								
5	253. Pursuant to California Civil Code § 1794, the Class is entitled to costs and								
6	attorneys' fees.								
7	VIII. PRAYER FOR RELIEF								
8	Plaintiff, on behalf of himself and all others similarly situated, requests the Court to enter								
9	judgment against the Defendants, as follows:								
10	i. An order certifying the proposed Class(es), designating Plaintiff as								
11	the named representatives of the Class(es), designating the undersigned as Class Counsel, and								
12	making such further orders for the protection of Class members as the Court deems appropriate,								
13	under Fed. R. Civ. P. 23;								
14	ii. An order enjoining the Defendants to desist from further deceptive								
15	distribution, sales, and lease practices with respect to the Class Vehicles and such other injunctive								
16	relief that the Court deems just and proper;								
17	iii. An award to Plaintiff and Class Members of compensatory,								
18	exemplary, and punitive remedies and damages and statutory penalties, including interest, in an								
19	amount to be proven at trial;								
20	iv. A declaration that Defendants are financially responsible for all								
21	Class notice and the administration of Class relief;								
22	v. Costs, restitution, compensatory damages for economic loss and								
23	out-of-pocket costs, multiple damages under applicable states' laws, punitive and exemplary								
24	damages under applicable law; and disgorgement, in an amount to be determined at trial;								
25	vi. Any applicable statutory and civil penalties;								
26	vii. An award of costs and attorneys' fees, as allowed by law;								
27	viii. An order requiring Defendants to pay both pre- and post-judgment								
20	interest on any amounts awarded								

2293238.3 - 71 - CLASS ACTION COMPLAINT

1	ix.	Leave to amend this Complaint to conform to the evidence
2	produced at trial; and	
3	X.	Such other or further relief as the Court may deem appropriate, just,
4	and equitable under the circu	umstances.
5	IX. <u>DEMAND FOR JU</u>	RY TRIAL
6		Rule of Civil Procedure 38(b), Plaintiff demand a trial by jury of any
7	and all issues in this action t	
8	und un issues in uns ueuen e	inote by a fary.
9	Dated: August 17, 2021	Respectfully Submitted,
10		By: /s/ Nimish R. Desai
11		Richard Heimann (CA Bar # 063607)
12		Nimish R. Desai (CA Bar # 244953) LIEFF CABRASER HEIMANN & BERNSTEIN, LLP
13		275 Battery St., 29th Fl.
13		San Francisco, CA 94111-3339 Telephone: 415-956-1000
14		Facsimile: 415-956-1008
15		rheimann@lchb.com
16		ndesai@lchb.com
17		David S. Stellings (pro hac vice to be filed)
		Katherine I. McBride (pro hac vice to be filed) Jessica A. Moldovan (pro hac vice to be filed)
18		LIEFF CABRASER HEIMANN & BERNSTEIN, LLP
19		250 Hudson Street, 8th Floor New York, NY 10013
20		Telephone: 212.355.9500
21		Facsimile: 212.355.9592 dstellings@lchb.com
22		kmcbride@lchb.com
23		jmoldovan@lchb.com
24		
25		
26		
27		
28		
/ (		

2293238.3 - 72 - CLASS ACTION COMPLAINT

1	Roland Tellis (CA Bar #186269)
2	David Fernandes (CA Bar #280944)
	Adam Tamburelli (CA Bar #301902) <b>BARON &amp; BUDD, P.C.</b>
3	15910 Ventura Boulevard, Suite 1600
4	Encino, California 91436 Telephone: (818) 839-2333
5	Facsimile: (214) 520-1181
6	rtellis@baronbudd.com
7	dfernandes@baronbudd.com atamburelli@baronbudd.com
8	David M. Birka-White (CA Bar # 85721)  BIRKA-WHITE LAW OFFICES
9	178 E. Prospect Avenue
10	Danville, CA 94526
11	Telephone: (925) 362-9999 dbw@birka-white.com
12	
	E. Powell Miller (pro hac vice to be filed) <b>THE MILLER LAW FIRM, P.C.</b>
13	950 West University Drive, Suite 300
14	Rochester, MI 48307 Telephone: (248) 841-2200
15	Facsimile: (248) 652-2852
16	epm@millerlawpc.com
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	

2293238.3 - 73 - CLASS ACTION COMPLAINT

## **EXHIBIT A**

NHTSA ID No.	make	model	year	failure_date	full_text
10915473	BUICK	ENCLAVE	2014	2016-06-25	TL* THE CONTACT OWNED A 2014 BUICK ENCLAVE. WHILE DRIVING INTO AN INTERSECTION, THE DRIVER'S SIDE OF THE CONTACT'S VEHICLE WAS STRUCK BY AN ONCOMING VEHICLE. THE CONTACT'S VEHICLE SPUN OFF THE ROAD AND LANDED IN A DITCH. THE FRONT END AND DRIVER'S SIDE OF THE VEHICLE WERE SEVERELY DAMAGED. THE CONTACT WAS UNABLE TO RECALL THE DETAILS OF THE CRASH. THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS INFORMED THAT THE SEAT BELT FAILED TO LOCK AND PROPERLY RESTRAIN HIM. THE VEHICLE WAS TOWED AND TOTALED. A POLICE REPORT WAS FILED. THE CONTACT RECEIVED INJURIES TO THE RIBS, CLAVICLE, AND SHOULDER, WHICH REQUIRED MEDICAL ATTENTION. THE APPROXIMATE FAILURE MILEAGE WAS 40,000.
10995504	BUICK	ENCORE	2014	2017-06-15	I TOOK MY VEHICLE INTO THE SERRA DEALERSHIP IN WASHINGTON, MI ON 3/20/17 TO HAVE THE FRONTAL AIRBAG AND PRETENSIONER NON DEPOY SAFETY RECALL (16007) REPAIRED. ON, 6/15/17, I WAS IN A CAR ACCIDENT TRAVELING AT ROUGHLY 50 MPH AND MY AIRBAGS DID NOT DEPLOY. A FORD F-150 TURNED INTO ONCOMING TRAFFIC WITHOUT LOOKING CAUSING THE FRONT OF MY VEHICLE TO CRASH INTO THE SIDE OF HER TRUCK. THE OTHER DRIVER WAS ISSUED THE CITATION FROM THE POLICE. MY BUICK ENCORE IS MOST LIKELY TOTALED (AWAITING CONFIRMATION ON THAT).
10726387	CADILLAC	SRX	2014	2015-06-17	I WAS IN A SEVERE CRASH AND SUFFERED A SEVERE CONCUSSION. MY RIBBON FLEW OFF MY HEAD WHEN I CAME TO, I DID LOSE CONSCIOUSNESS AND WOKE UP TO ON STAR TELLING ME MY VEHICLE WAS IN A CRASH. I HAVE SEVERE PAIN IN MY NECK SHOULDER, ABRASIONS TO THE LEFT SIDE OF MY BODY AND BRUISING. THE VEHICLE IS TOTALED BUT THE AIRBAG NEVER DEPLOYED AND IT SHOULD HAVE WITHOUT A DOUBT. THERE WAS SEVERE DAMAGE TO THE ENTIRE VEHICLE.
					TL* THE CONTACT OWNS A 2014 CADILLAC SRX. WHILE DRIVING 65 MPH, THE CONTACT LOST CONTROL OF THE VEHICLE AND IT VEERED OFF THE ROAD IN BOTH DIRECTIONS AND CRASHED. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT DID NOT SUSTAIN INJURIES. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO A DEALER WHERE IT WAS DIAGNOSED THAT THE REAR DRIVER SIDE CONTROL ARM NEEDED TO BE REPLACED. THE VEHICLE WAS REPAIRED. THE VEHICLE WAS PREVIOUSLY REPAIRED UNDER NHTSA CAMPAIGN NUMBER: 14V571000 (SUSPENSION). THE
10871604	CADILLAC	SRX	2014	2016-05-27	MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 32,000.  TL* THE CONTACT OWNS A 2014 CHEVROLET EQUINOX. THE CONTACT STATED THAT WHILE
10615335	CHEVROLET	EQUINOX	2014	2014-05-24	DRIVING 16 MPH, THE CONTACT CRASHED INTO THE DRIVER'S SIDE DOOR OF ANOTHER VEHICLE. THE AIR BAGS DID NOT DEPLOY. THE CONTACT SUSTAINED CHEST, RIGHT KNEE, SHOULDER AND SPINE INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE VEHICLE WAS NOT REPAIRED. THE FAILURE MILEAGE WAS UNKNOWN.
10864509	CHEVROLET	EQUINOX	2014	2016-05-05	I BOUGHT MY 2014 CHEVY EQUINOX NEW. I WAS IN CRASH WHICH I HIT A FULL SIZE CHEVY TRUCK IN THE DRIVER DOOR AND IT TOTALED MY CAR AND NOT ONE AIR BAG CAME. I WAS CROSSING EAST AND WEST THE TRUCK WAS GOING NORTH TO SOUTH
10915132 11124021	CHEVROLET CHEVROLET	EQUINOX EQUINOX	2014	2016-09-08 2018-09-01	WAS INVOLVED IN ACCIDENT 9/8/2016. IT WAS A TOTAL LOSS. FRONT END HEAVILY DAMAGED. AIRBAGS DID NOT WORK OR THE PASSENGER SIDE SEATBELT. DRIVING STRAIGHT AT INTERSECTION AND OTHER PARTY RAN RED LIGHT STRIKING THE LEFT FRONT AND CAUSING FRAME TO CRACK. I HIT A DEER ON SEPT. 1, 2018 AND MY AIRBAGS DIDN'T DEPLOY.
11186171		EQUINOX	2014	2019-03-05	VEHICLE WAS IN MOTION TRAVELING STRAIGHT GOING APPROXIMATELY 50MPH WHEN IT STRUCK ANOTHER VEHICLE THAT FAILED TO YIELD THE RIGHT OF WAY. THE EQUINOX SUFFERED EXTENSIVE FRONT END DAMAGE ON THE DRIVERS SIDE BUT NO AIRBAGS DEPLOYED.
11376003	CHEVROLET	EQUINOX	2014	2020-11-16	I WAS INVOLVED IN A CAR ACCIDENT ON NOVEMBER 16, 2020 AND NEITHER OF MY AIRBAGS DEPLOYED.
10599029	CHEVROLET	SILVERADO	2014	2014-06-10	MY WIFE & SISTER WERE RUN OFF THE ROAD . THEY WENT UP A DITCH & HIT A COLVURT . THE SEATBELTS DID NOT LOCK IN PLACE & AIR BAGS DID NOT INFLATE . THIS WAS A LOANER TRUCK FROM DEALER . IT WAS A 2014 4 DOOR CHEVY SILVERADO FROM LUCAS CHEVY IN COLUMBIA TN. 38401 . I THINK THE WAS SOME SORT OF TROUBLE WITH THIS HAPPENING . PLEAS CALL FOR COMPLETE INFO ON THIS . *TR
10695408	CHEVROLET	SILVERADO	2014	2015-02-18	TL* THE CONTACT OWNED A 2014 CHEVROLET SILVERADO. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT REACHED OVER TO TURN THE HEAT OFF AND THE VEHICLE WENT OFF THE ROAD, DOWN A HILL, AND INTO A DITCH. THE VEHICLE CONTINUED ON UNTIL IT CRASHED INTO A CABLE THAT WAS CONNECTED TO A TELEPHONE POLE. THE TELEPHONE POLE SPLIT IN HALF. THE SEAT BELT FAILED TO RESTRAIN THE CONTACT AND THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED INJURIES TO HIS BACK, KNEE, AND HIP THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED AND TOWED TO A LOT. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 7,956.

IL THE CONTACT OWNS A 2014 CHEVROLET TRAVERSE. WHILE DRIVING AS MPH, THE CONTACT CRASHED INTO THE REAR PASSENGER QUARTER PARE. OF A HONDA ACCORD. THERE WERR NO WARNING MINICATORS ILLUMINATED. THE ARR BASED ON POT DEPLOY. THE CONTACT SUSTAINED NECK AND BACK HOURSES, WHICH DID NOT REQUIRE MEDICAL ATTENTION. THE TWO COLEANING OF THE HONDA SUSTAINED UNKNOWN INJURIES, WHICH EXCURSE DEPLOY AND INDEPCEMBENT OF THE HONDA SUSTAINED UNKNOWN INJURIES, WHICH EXCURSE DEPLOY AND INDEPCEMBENT HEIGH AND INTERCHANCE, BUT WAS TO AN INDEPCEMBENT HEIGH AND INTERCHANCE, BUT WAS THE WAS TO AN INDEPCEMBENT HEIGH AND INTERCHANCE, BUT WAS THE WAS THE WAS TO AN INDEPCEMBENT HEIGH AND INTERCHANCE, BUT WAS THE WA						
111-79851 CHEVROLET TRAVERSE. WHILE DRIVING 45 MPH, THE CONTACT CRASHED INTO THE REAR PASSENGER QUARTER PANEL OF A HORAL ACCIDAT. THERE WERE NO WARNING MINICATORS LUMBRATED THE ARR RASE DO NOT DEPLOY. THE CONTACT SUSTAINED NECK AND BACK RIVINESS. WHICH DID NOT REQUIRE MEDICAL ATTENTION. THE TWO COLUMNTS OF THE HORAL SUSTAINED LUMBRA SUSTAINED S	10712235	CHEVROI FT	SILVERADO	2014	2015-03-21	MPH, THE VEHICLE STRUCK A DEER ON THE HIGHWAY. THE FRONT AND REAR AIR BAGS FAILED TO DEPLOY. THERE WERE NO INJURIES AND A POLICE REPORT WAS NOT FILED. THE VEHICLE WAS TAKEN TO A DEALER, BUT WAS NOT DIAGNOSED OR REPAIRED. THE MANUFACTURER WAS NOT
CRASHED INTO THE REAR PASSENGER QUARTER PANEL OF A HONDA ACCORD. THESE WEER NO WARNING MICHARDS LUMINATED. THE AREA RASS DID NOT DETUCE CONTACT STATED HAT WHITE CONTACT STATED HAT WHITE TRAVERSE  OF THE HONDA SUSTAINED UNKNOWN INJURIES, WHICH DO NOT REQUIRE MEDICAL ATTENTION AT THE SCENE. A POLICE REPORT WAS FILED. THE VEHICLE WAS TAKEN TO AN INDEPENDENT MECHANIC. BUT WAS NOT DIAGNOSCO BERPAIRED. THE COLOL DEALER AND PROBLEMATE THE HONDA SUSTAINED WAS PROBLEMANT OF THE VEHICLE WAS TAKEN TO AN INDEPENDENT MECHANIC. CONTACT CONTROL FOR REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE VEHICLE WAS THE COLOR DEALER AND AND AVAILABLE AT APPROXIMATE IN DIRECT WAS APPROXIMATELY \$2,000. THE WIN WAS THE NOT AVAILABLE AT APPROXIMATELY 10 MPH AND MAKING A LEFT TURN, ANDTHE VEHICLE CRASHED INTO THE VEHICLE HADO ON. THE FRONT ALL BOOK DAYS ON THE VEHICLE CRASHED INTO THE VEHICLE HADO ON. THE FRONT ALL BOOK DAYS ON THE PROVINCE AND PRED PERTINENT WEER PRESENT. NO INJURISES WEER REPORTED. THE VEHICLE WAS DESTROYED AND TOWED TO A APPROXIMATE FAILURE WHITE SEAL DAYS ON THE PROVINCE OF THE FAILURE THE APPROXIMATE FAILURE PROVINCE OF THE FRONT END OF MY CAR WAS DESTROYED. THE APPROXIMATE FAILURE PROVINCE OF THE FRONT END OF WAS TRAVELUMG AND THE SENCE AND SHE OF THE FAILURE THE APPROXIMATE OF THE FRONT END OF MY CAR WAS DESTROYED. THE HOOD WAS CRUMPLED AND DOTH FRONT QUARTER PANELS DAMAGE. IT THE FRONT END OF WAS TRAVELUMG AND THE LOCATION OF IMPACT DID NOT CASE THE ARBRAGIS DID NOT DEPLOY. THE ENTIRE FRONT END OF MY CAR WAS DESTROYED. THE FRONT END OF WAS TRAVELUMG AND THE LOCATION OF IMPACT DID NOT CASE THE ARBRAGIS DID NOT DEPLOY. THAT SHAPPED AND THE PROVINCE OF THE FRONT END OF THE VEHICLE FAILURE. THE SENCE AND DEPLOY AND THE SENCE AND DEVINCE AND THE PROVINCE OF THE FRONT END OF THE VEHICLE WAS DESTROYED. THE MAN AND THE CONTACT STATED THAT WHILE TRAVELING SHAPPED AND TH	10/12233	CHEVROLLI	SILVLINADO	2014	2013-03-21	WADE AWARE OF THE FAILURE WILLIAGE WAS 8,000.
WARNING INDICATORS ILLUMINATED. THE AIR BAGS DID NOT DEPLOY. THE CONTACT SUSTAINED NEXT AND BACK NUMBER, WHICH DID NOT BEQUIRE MEDICAL ATTENTION AT THE SCENE, A POLICE REPORT WAS FILED. THE VALUE WAS STAND IN THE YOU COLOURANTS OF THE HONDA SUSTAINED UNKNOWN INJURIES, WHICH REQUIRED MEDICAL ATTENTION AT THE SCENE, A POLICE REPORT WAS FILED. THE VALUE WAS STAND THE PROVIDED WAS						TL* THE CONTACT OWNS A 2014 CHEVROLET TRAVERSE. WHILE DRIVING 45 MPH, THE CONTACT
NECK AND BACK INJURIES, WHICH DID NOT REQUIRE MEDICAL ATTENTION IT THE CONTROL OF THE HONDA SUSTAINED UNKNOWN NUMBERS, WHICH REQUIRED MEDICAL ATTENTION AT THE SCENE, A POLICE REPORT WAS FILED. THE VEHICLE WAS TAKEN TO AN INDEPENDENT MECHANIC BUT WAS NOT DIAGNOSCO BE REPAIRED. THE COLOQUE DATE AND AND AND TAKEN TO AN INDEPENDENT MECHANIC BUT WAS NOT DIAGNOSCO BE REPAIRED. THE COLOQUE DATE AND AND AND AND TAKEN TO CONTACTED. THE FAILURE MILE AGE WAS APPROXIMATELY \$2,000. THE VIN WAS TO TAVILLABLE WAS THE CONTROL TO MEND AD 40 AM THE TURN, AND THE VEHICLE CRASHED INTO THE VEHICLE HAS DO THE FROM THE OTHER OT						·
OF THE HONDA SUSTAINED UNKNOWN INJURIES, WHICH REQUIRED MEDICAL ATTENTION AT THE SCENE, A POLICE REPORT WAS FILED. THE VEHICLE WAS SEATON TO AN INDEPENDENT MECHANICAL SULF WAS NOT DIAGNOSED OR REPARED. THE LOCAL DEALER AND ANALYCAURABLE.  TILT THE CONTACT DWINED A 2014 6MC TERRAIN. THE CONTACT STATED THAT WHILE DRIVING A APPROXIMATELY SO, APPROXIMATELY SO, AND THE WAS NOT OWNED TO THE VEHICLE HAS DO STORE PERSON. THE WAS NOT OWNED TO THE VEHICLE HAS DO STORE PERSON. THE WAS NOT OWNED TO THE VEHICLE HAS DO STORE PERSON. THE WAS NOT OWNED TO THE VEHICLE HAS DO STORE PERSON. THE WAS NOT OWNED TO THE VEHICLE HAS DO STORE PERSON. THE POLICE WAS DESTROYED AND TOWNED TO THE VEHICLE HAS DO STORE PERSON. THE POLICE WAS DESTROYED AND TOWNED TO A COLLISION LOT. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE APPROXIMATE FAILURE MILES SEVEN WAS 27,448.  I HAD A FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. THE POLICE WAS DESTROYED AND TOWNED TO THE QUARTER PARKED DAMAGE. IT IS HARD FOR ME TO UNDRESTAND HOW AN IMPACT AT THIS SPEED IN WAS TRAVELING AND THE CONTACT OF HER PONT DOORS ARE ARRAGE(S) TO DEPLOY. HAD TO BE TRANSPORTED ON A AMBULANCE FROM THE SCENE AND SUFFERED A CONCUSSION FROM MY TO BE TRANSPORTED ON A MINUANCE FROM THE SCENE AND SUFFERED A CONCUSSION FROM MY SOME THAN THE POLICE AND THE AND THE CONTACT WAS INJURED AND REQUIRED IMMEDIATE MEDICAL THE FAILURE. THE FAILURE. THE FAILURE HAD DESTROY THE POLICE AND THE AIR BASES DID NOT DEPLOY. THE CONTACT WAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE MANUFACTURE WAS POTTERED AND THE AIR BASES DID NOT DEPLOY AND SEAT MOVED TO PROVIDE THE AIR WAS DOTTED OF THE FAILURE. THE FAILURE HAD DESTROY THE POLICE AND THE AIR BASES DID NOT DEPLOY AND SEAT MOVED TO PROVIDE A POLICE WAS DESTROYED. THE AIR MANUFACT AND SOME OF ANY AIR BASES DID NOT DEPLOY AND SEAT MOVED TO PROVIDE A SINGLE WAS DESTROYED. THE AIR PROVIDED OF THE FAILURE WAS DESTROYED. A POLICE REPORT WAS SINGLE WAS DESTROYED. THE AIR PROVIDED						
SCENE, A POLICE REPORT WAS FILED. THE VEHICLE WAS TAKEN TO AN INDEPENDENT MECHANIC, 11129851 CHEVROLET TRAVERSE 2014 2018-09-15 CONTACTED. THE FAILURE MILEAGE WAS APPROXIMATELY 62,000. THE VIVAS NOT JANA/DAY THE CONTACT OWNER 2 2014 REPORT THE COAL DEATH AND ANALYCATURES WERE NOT CONTACTED. THE FAILURE MILEAGE WAS APPROXIMATELY 62,000. THE VIVAS NOT JAVAILABLE.  10909600 GMC TERRAIN 2014 2016-09-18 INDEPENDENT OF THE CONTACT OWNER 2 2014 MORE AND THE VEHICLE WAS DESTROYED AND TOWED TO A APPROXIMATELY 10 MPH AND MAKING A LEFT TURK, ANOTHER VEHICLE CRASHED INTO THE VEHICLE WAS DESTROYED AND TOWED TO A COLLISION IOT. THE MANUFACTURER WAS NOT NOTHER OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 27,448.  10909600 GMC TERRAIN 2014 2016-09-18  1						
CONTACTED. THE FAILURE MILEAGE WAS APPROXIMATELY 62,000. THE VIN WAS NOT AVAILABLE.  10.009600 GMC TERRIN 2014 2016-09-18 FINE CONTACT OWNER PAD 2014 GMC TERRINI. THE CONTACT OWNER PAD 1014 GMC TERRINI. THE CONTACT OWNER REPORTED. THE VEHICLE WAS DESTROYED AND TOWED TO A DOUGH TO THE FAILURE THE APPROXIMATE FARINI. THE CONTACT OWNER WAS NOT NOTHER OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 27,448.  10.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2014-09-18 FAILURE MILEAGE WAS 27,448.  11.009600 GMC TERRIN 2014 2014-09-18 FAILURE MILEAGE WAS 2014-09-18 FAILURE MILEA						· · · · · · · · · · · · · · · · · · ·
TIL* THE CONTACT OWNED A 2014 GONG TERRAIN. THE CONTACT STATED THAT WHILE DRIVING AT APPRICAMENTAL OWN PAID AND AMASING A LEFT TURN, AND TOWNED TO A COLUMN ON THE PROOF AND THE POLICE AND FIRE OPERATION TO THE VEHICLE FAILURE. AND TOWNED TO A COLUMN ON THE PROOF AND THE POLICE AND FIRE OPERATION TO COLUMN ON THE PROOF AND THE POLICE AND FIRE OPERATION TO COLUMN ON THE PROOF AND TOWNED TO A COLUMN ON THE PROOF AND THE POLICE AND FIRE OPERATION TO COLUMN ON THE PROOF AND THE POLICE AND FIRE OPERATION TO COLUMN ON THE PROOF AND THE POLICE AND FIRE OPERATION TO COLUMN ON THE PROOF AND THE POLICE AND THE						BUT WAS NOT DIAGNOSED OR REPAIRED. THE LOCAL DEALER AND MANUFACTURER WERE NOT
APPROXIMATELY 10 MPH AND MAXING A LEFT TUN, ANOTHER VEHICLE READ INTO THE VEHICLE HAD ON INTER FRONTAL AIR BAGS DID NOT DEPLOY. THE POLICE AND FIRE PERATRAMENT WERE PRESENT, NO INJURIES WERE REPORTED. THE VEHICLE WAS DESTROYED AND TOWED TO A COLUSION LOT. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 27,448.  I HAD A FRONT END COLUSION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. THE ENTIRE FRONT END OF MY CAR WAS DESTROYED. THE HOOD WAS CRIMMPLED AND BOTH FRONT QUARTER PANEL DAMAGE. IT IS HARD FOR ME TO UNDESTRAIN HOW MIMPACT AT THE SPEED IN A SHAPE AND THE LOCATION OF IMPACT DID NOT CAUSE THE AIRBAG(S) TO DEPLOY. HAD TO BE TRANSPORTED VIA AMBULANCE FROM THE SCENE AND SUFFERED A CONCUSSION FROM MY END AT THE SCENE AND SUFFERED A CONCUSSION FROM MY END AT THE CONTACT SWEED AS ADMINISTED ON INTO ANOTHER VEHICLE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT CHAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE AIRBAG(S) DID NOT DEPLOY AND SEAT MOVED POPIOY. THE CONTACT CHAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE AIRBAG SID NOT DEPLOY AND SEAT MOVED POPIOY. THE CONTACT CHAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE AIRBAG SID NOT DEPLOY AND SEAT MOVED POPIOY. THE CONTACT CHAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE AIRBAG SID NOT DEPLOY AND SEAT MOVED POPIOY. THE CONTACT CHAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE AIRBAG SID NOT DEPLOY AND SEAT MOVED POPIOY. THE CONTACT CHAS INJURED AND REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE AIRBAG SID NOT DEPLOY AND SEAT MOVED POPIOY. THE FRONT END OF VEHICLE CAUSISION RECEIVED BY OTHER AIRBAGS. AIRBAGS DID NOT DEPLOY AND SEAT MOVED POPIOY. THE FRONT END OF VEHICLE CAUSISTON RECEIVED BY OTHER AIRBAGS. AIRBAGS DID NOT DEPLOY AND SEAT MOVED POPIOY. THE REAP PASSENCE SEAT OCCUPANT SUSTAINED A PROJECT FROM THE FRONT END	11129851	CHEVROLET	TRAVERSE	2014	2018-09-15	
VEHICLE HEAD ON. THE FRONTAL AIR BAGS DID NOT DEPLOY. THE POLICE AND FIRE DEPARTMENT WERE PRESENT NO INJURIES WERE REPORTED. THE VEHIX AS DESTROYED AND TOWDE TO A COLUSION LOT. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 27.448.  I HAD A FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. THE ENTIRE FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. THE ENTIRE FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. THE ENTIRE FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. THE ENTIRE FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. THE ENTIRE FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. THE ENTIRE FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. HE ENTIRE FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. AND SUFFERED A CONCUSSION FROM THE QUARTER PARKED DAMAGE. IT IS HADE FOR MY EDU CONCUSSION PROME AND SUFFERED A CONCUSSION FROM THE STEER HADE AND SUFFERED A CONCUSSION FROM THE STEER HADE AND SUFFERED A CONCUSSION FROM THE STEER HADE AND SUFFERED A CONCUSSION FROM THE AIR BAGS DID NOT DEPLOY. HE AND SUFFERED A CONCUSSION FROM THE AIR BAGS DID NOT DEPLOY HAD SUFFERED A CONCUSSION FROM THE AIR BAGS DID NOT DEPLOY. HADE AND SUFFERED A CONCUSSION FROM THE AIR BAGS DID NOT DEPLOY. HADE AND SUFFERED A CONCUSSION FROM THE AIR BAGS DID NOT DEPLOY. HADE AND SUFFER DEPLOY AND SEAT MOVED.  **INTERPORT OF THE STEEL SUFFER AIR BAGS DID NOT DEPLOY AND SEAT MOVED.  **INTERPORT OF THE AIR BAGS DID NOT DEPLOY AND SEAT MOVED.  **INTERPORT OF THE AIR BAGS DID NOT DEPLOY. HADE AND SEAT MOVED.  **INTERPORT OF THE AIR BAGS DID NOT DEPLOY. HADE AND SEAD SEAT SEAD OF THE FRONT END OF THE VEHICLE HARBER BAGS DID NOT DEPLOY. HADE AND SEAD SEAD SEAT SEAT OF THE AIR BAGS DID NOT DEPLOY. HADE AND SEAD SEAT SEAT OF THE AIR BAGS DID NOT DEPLOY. HADE AND SEAD SEAT SEAT OF THE AIR BAGS DID NOT DEPLOY. HAVE AND						
COLLISION LOT. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE APPROXIMATE  FAILURE MILEAGE WAS 27.448.  I HAD A FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAGIS) DID NOT DEPLOY. THE ENTIRE FRONT END OF MY CAR WAS DESTROYED. THE HOOD WAS CRUMMED AND BOTH FRONT CUARTER PANELS DAMAGE. THE FRONT DOORS ARE NOT EASILY OPENED DUE TO THE QUARTER PANELS DAMAGE. THE FRONT DOORS ARE NOT EASILY OPENED DUE TO THE QUARTER PANELS DAMAGE. THE FRONT DOORS ARE NOT EASILY OPENED DUE TO THE QUARTER PANELS DAMAGE. THE FRONT DO NOT CAUSE THE AIRBAGIS) TO DEPLOY. THE COLDANGE. IT IS HARD FOR MET OUT AND SUFFERING A CONCUSSION FROM MY HEAD SLAMMING DOWN ON THE STEERING WHELE. "IS  IT 'THE CONTACT OWNS A 2013 BUICK ENCLAVE." THE CONTACT STATED THAT WHILE TRAVELING S MPH, THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS NOTIFIED AND FROM THE CONTACT STATED THAT WHILE TRAVELING S MPH, THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS NOTIFIED AND FREQUENCE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS NOTIFIED AND FREQUENCE AND THE FAILURE. THE FAILURE HEAD ON NOTIFIED OF THE FAILURE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS NOTIFIED AND FREQUENCY AND SEAT MOVED. FORWARD. RESULTING IN ER VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  HEAD ON COLLISION AT 40 MPH ON A CITY STREET. AIR BAGS DID NOT DEPLOY AND SEAT MOVED. FORWARD. RESULTING IN ER VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS. THE TOTAL PROMISE AND THE PROVIDED BY DEPLOY. AND SEAT MOVED. THE FRONT END OF THE VEHICLE SUSTIMED SIGNIFICANT OF THIS ACCIDENT. "IT IS ARREST DID NOT DEPLOY. THE WAS INVOIVED IN AN ACCIDENT. "IT IS ARREST DID NOT DEPLOY. THE RAR PASSINGER SHAPE AND THE PROVIDER OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. THE RAR PASSINGER SHAPE AND THE PROVIDER OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE RAR PASSINGER SHAPE AN						· ·
10009600 GMC TERRAIN 2014 2016-09-18 FAILURE MILEAGE WAS 27,448.  I HAD A FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAGIS) DID NOT DEPLOY. THE ENTIRE FRONT TEND OF MY CAR WAS DESTROYED. THE HOLD WAS CRUMMED AND BOTH FRONT COURT OF MY CAR WAS DESTROYED. THE HOLD WAS CRUMMED AND BOTH FRONT COURT OF MY CAR WAS DESTROYED. THE HOLD WAS CRUMMED AND BOTH FRONT COURT OF MY CAR WAS DESTROYED. THE HOLD OWN AS CRUMMED AND BOTH FRONT COURT OF MY CAR WAS DESTROYED. THE HOLD OWN AS CRUMMED AND BOTH FRONT COURT OF MY CAR WAS DESTROYED. THE HOLD OWN CAUSE THE AIRBAGIS TO DEPLOY. HAD TO BE TRANSPORTED VIA AMBULANCE FROM THE SCENE AND SUFFERED A CONCUSSION FROM MY HEAD STAMMING DOWN ON THE STERRING WHEEL TERRAL BRAGS DID NOT DEPLOY. HAD TO BE TRANSPORTED VIA AMBULANCE FROM THE SCENE AND SUFFERED A CONCUSSION FROM MY HEAD STAMMING DOWN ON THE STERRING WHEEL THE TRAVELING TO BE TRANSPORTED WAS AMBULANCE FROM THE SCENE AND SUFFERED A CONCUSSION FROM MY HEAD STAMMING DOWN ON THE STERRING WHEEL THAT WHILE TRAVELING SME WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE AND CURRENT WAS NOTIFIED OF THE FAILURE. THE FAILURE AND CURRENT WAS NOTIFIED OF THE FAILURE. THE FAILURE AND CURRENT WAS NOTIFIED OF THE FAILURE. THE FAILURE AND CURRENT WAS NOTIFIED OF THE FAILURE THE FAILURE AND CURRENT WAS NOTIFIED OF THE FAILURE. THE FAILURE THE FAILURE AND CURRENT WAS NOTIFIED OF THE FAILURE THE FAILURE AND CURRENT WAS NOTIFIED OF THE FAILURE. THE FAILURE AND CURRENT WAS NOTIFIED OF THE FAILURE WAS NOTIFIED OF THE FAILURE WHEN TO COME AND CURRENT WAS NOTIFIED OF THE FAILURE WAS NOTIFIED AND CURRENT WAS NOTIFIED OF THE FAILURE WHEN TO						WERE PRESENT. NO INJURIES WERE REPORTED. THE VEHICLE WAS DESTROYED AND TOWED TO A
IHAD A FRONT END COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRBAG(S) DID NOT DEPLOY. THE ENTIRE FRONT END OF MY CAR WAS DESTROYED. THE HOOD WAS CRUMPLED AND BOTH FRONT QUARTER PANELS DAMAGED. THE FRONT DOORS ARE NOT EASILY OPENED DUE TO THE QUARTER PANEL DAMAGE. IT IS HARD FOR ME TO INDRESTRAND HOW AN IMPACT AT THE SPEED I WAS TRAVELING AND THE LOCATION OF IMPACT DID NOT CAUSE THE AIRBAG(S) TO DEPLOY. I HAD TO BE TRANSPORTED VIA ANBIQUANCE FROM THE SCENE AND SUFFERED A CONCUSSION FROM MY HEAD SLAMMING DOWN ON THE STEERING WHELE. *IS  TI "THE CONTACT WAS NO SID BUICK ENCLY. THE CONTACT STATED THAT WHILE TRAVELING S MMH, THE VEHICLE CRASHED HEAD-ON INTO ANOTHER VEHICLE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS NOT BURGED AND REQUISION MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE AND CONTACT WAS INJURIED AND REQUISION MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. AND CURRENT MILEAGE WAS 11,500.  HEAD ON COLLISION AT 40 MPH ON A CITY STREET. AIR BAGS DID NOT DEPLOY AND SEAT MOVED FORWARD. RESULTING IN ER VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  HIT A DEER WITH FRONT END OF VEHICLE CAUSING APPROXIMATELY SO,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY. CAUSING CONCUSSION RECEIVED BY DRIVEN. BY STILL EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. "TR  WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END OF THE VEHICLE. THA AIR BAGS DID NOT DEPLOY. ON HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. "TO  "TAMABA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT DEER AT 75-80 MPH ON A HAVY I'M HIT MY PORIVERS SIDE OF THE VEHICLE. THAIR BAGS DID NOT DEPLOY. WHILE DRIVING APPROXIMATELY 60  "TAMABA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I THAT DEER AT 75-80 MPH ON A HAVY I'M THY WORN OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REA						
THE ENTIRE FRONT END OF MY CAR WAS DESTROYED. THE HOOD WAS CRUMPLED AND BOTH FRONT QUARTER PANEL DAMAGE. THE FRONT END OGNE ARE NOT EASILY OPENED DUE TO THE QUARTER PANEL DAMAGE. IT IS HARD FOR ME TO UNDERSTAND HOW AN IMPACT AT THE SPEED I WAS TRAVELING AND THE LOCATION OF IMPACT DID NOT CAUSE THE AIRBAGIS TO DEFLOY. I HAD TO BE TRANSPORTED VIA AMBRIGATION TO SEND FAMON MY HEAD SLAMMING DOWN ON THE STEERING WHEEL. "IS  10595132 BUICK ENCLAVE 2013 2014-05-29 THE THE CONTACT STATED THAT WHILE TRAVELING SMPH, THE VEHICLE CRASHED HEAD-ON INTO ANOTHER VEHICLE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. AND SEAT MOVED FORWARD. RESULTING IN RE YEST AND HEAD LACKERATION AND LOSS OF CONSCIOUSNESS.  10595764 CHEVROLET EQUINOX 2013 2013-11-11 EVALUATION OF THE VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY AND SEAT MOVED OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. THE VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY. AND SEAT MOVED OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. THE RECEIVED BY DRIVER IS STILL EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. "TO HAVE CONTACTED GMT WINCE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT." "DT "LAKE CONTACT SISTANCE DEPARTMENT." "DT "	10909600	GMC	TERRAIN	2014	2016-09-18	FAILURE MILEAGE WAS 27,448.
THE ENTIRE FRONT END OF MY CAR WAS DESTROYED. THE HOOD WAS CRUMPLED AND BOTH FRONT QUARTER PANEL DAMAGE. THE FRONT END OGNE ARE NOT EASILY OPENED DUE TO THE QUARTER PANEL DAMAGE. IT IS HARD FOR ME TO UNDERSTAND HOW AN IMPACT AT THE SPEED I WAS TRAVELING AND THE LOCATION OF IMPACT DID NOT CAUSE THE AIRBAGIS TO DEFLOY. I HAD TO BE TRANSPORTED VIA AMBRIGATION TO SEND FAMON MY HEAD SLAMMING DOWN ON THE STEERING WHEEL. "IS  10595132 BUICK ENCLAVE 2013 2014-05-29 THE THE CONTACT STATED THAT WHILE TRAVELING SMPH, THE VEHICLE CRASHED HEAD-ON INTO ANOTHER VEHICLE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. THE CONTACT WAS INJURIED AND REQUISION MEDITATE BAGS DID NOT DEPLOY. AND SEAT MOVED FORWARD. RESULTING IN RE YEST AND HEAD LACKERATION AND LOSS OF CONSCIOUSNESS.  10595764 CHEVROLET EQUINOX 2013 2013-11-11 EVALUATION OF THE VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY AND SEAT MOVED OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. THE VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY. AND SEAT MOVED OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. THE RECEIVED BY DRIVER IS STILL EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. "TO HAVE CONTACTED GMT WINCE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT." "DT "LAKE CONTACT SISTANCE DEPARTMENT." "DT "						I HAD A FRONT FND COLLISION AT 25 MPH WITH A PARKED CAR. MY AIRRAG(S) DID NOT DEPLOY
QUARTER PANEL DAMAGE. IT IS HARD FOR ME TO UNDERSTAND HOW AN IMPACT AT THE SPEED I WAS TRAVELING AND THE LOCATION OF IMPACT DID NOT CAUSE THE AIRBAGS IT O DEPLOY. HAD TO BE TRANSPORTED VIA AMBULANCE FROM THE SCENE AND SUFFERED A CONCUSSION FROM MY HEAD SLAMMING DOWN ON THE STEERING WHEEL "18"  11" THE CONTACT OWNS A 2013 BUICK ENCLAVE. THE CONTACT STATED THAT WHILE TRAVELING S. MPH, THE VEHICLE CRASHED HEAD-ON INTO ANOTHER MEDICAL AITTMITON. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE AND CURRENT MILEAGE WAS \$11,500.  HEAD ON COLLISION AT 40 MPH ON A CITY STREET, AIR BAGS DID NOT DEPLOY AND SEAT MOVED FORWARD. RESULTING IN SER VIST AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS. HIT A DEER WITH FRONT END OF VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY CAUSING CONCUSING RECEIVED BY DURING. RECIPIOR BY DURING. HER WITH FRONT END OF THE VEHICLE THA AIR BAGS DID NOT DEPLOY. HAVE CONTACT SIGN RECIPIOR BY DURING. PROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY CAUSING CONCUSING RECEIVED BY DURING. RECIPIOR BY DURING. PROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY CAUSING CONCUSING RECIPIOR BY DURING. PROVINCE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. "DT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY \$6 MPH, THE CONTACT'S VEHICLE SUSTINED SIGNIFICANT DAMAGE. THE FAILURE MILEAGE WAS \$5,000.  "TAMARA RECALL" I'M WRITING REQUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I'M THA WAS THOSE PREATMENT." "DT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY \$6 MPH, THE CONTACT'S VEHICLE REPORT WAS FILED. THE FAILURE MILEAGE WAS \$5,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I'M THA DEER AT 75-80 MPH ON A HAVY I'M THE YOR OVER SHOLD HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS SHORED						` '
WAS TRAVELING AND THE LOCATION OF IMPACT DID NOT CAUSE THE AIRRAG(S) TO DEPLOY. I HAD 10608599  GMC  YUKON  2014  2014-07-04  12014-07-04  FEAD SLAMMING DOWN ON THE STEERING WHEEL "IS  TIT" THE CONTACT OWNS A 2013 BUICK ENCLAYE. THE CONTACT STATED THAT WHILE TRAVELING S MPH, THE VEHICLE CRASHED HEAD-ON INTO ANOTHER VEHICLE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROVED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE AND CURRENT MILEAGE WAS 11,500.  HEAD ON COLLISION AT 40 MPH ON A CITY STREET, AIR BAGS DID NOT DEPLOY AND SEAT MOVED 10575764  CHEVROLET EQUINOX  2013  2013-11-11  FORWARD. RESULTING IN ER VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS. AIRBAGS DID NOT DEPLOY CAUSING CONCUSSION RECEIVED BY DRIVER. DRIVER IS STILL EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. "FIRE 10575764  CHEVROLET EQUINOX  2013  2014-12-14  HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. "DT  TL" THE CONTACT OWNED A 2013 CHEVROLET EQUINOX  2013  2016-11-23  TIT THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 50,00 IN DOTHER ON THE MAD THE MAD THE MAD THE PROPERTY OF THIS ACCIDENT. "FIRE YEHICLE SUSTAINED SIGNIFICANT DAMAGES. THE AIR BAGS DID NOT DEPLOY. THE AREA PASSENGER SEAT OCCUPANT SUSTAINED ON THE RODUCT ASSISTANCE DEPARTMENT. "DT  TL" THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60  MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE AREA PASSENGER SEAT OCCUPANT SUSTAINED SIGNIFICANT DAMAGES. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED FOR THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HAT A DEER AT 75-80 MPH ON A HAVY ITH ITM YOR DIVERSES SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTIVALLY DENTE PART OF MY PASSENGER SIDE FROME FOR THE MADER OF THE DEER HITTING JUMPING OUT AT ME A WARNING						FRONT QUARTER PANELS DAMAGED. THE FRONT DOORS ARE NOT EASILY OPENED DUE TO THE
TO BE TRANSPORTED VIA AMBULANCE FROM THE SCENE AND SUFFERED A CONCUSSION FROM MY HEAD SLAMMING DOWN ON THE STERNING WHEEL. *JS  TI.* THE CONTACT OWNS A 2013 BUICK ENCLAVE. THE CONTACT STATED THAT WHILE TRAVELING S MPH, THE VEHICLE CRASHED HEAD-ON INTO ANOTHER VEHICLE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT TWAS INJURED AND CARE QUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE CONTACT WAS INJURED AND AND THE AIR BAGS DID NOT DEPLOY THE CONTACT WAS INJURED AND AND AND THE FAILURE. THE FAILURE AND CURRENT MILEAGE WAS \$1,500.  HEAD ON COLLISION AT 40 MPH ON A CITY STREET. AIR BAGS DID NOT DEPLOY AND SEAT MOVED 1352287  CADILLAC SRX 2013 2020-08-27 FORWARD RESULTING IN FR VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS. AIRBAGS DID NOT DEPLOY AND SEAT MOVED 1575764  CHEVROLET EQUINOX 2013 2013-11-11 EXPENDENCING MEDICAL ROPOLETY CAUSING CONCUSSION SERVEN. THE AIR BAGS DID NOT DEPLOY AND SEAT MOVED OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY AND SEAT MOVED OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY AND SEAT MOVED OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY AND SEAT MOVED OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY ASSISTANCE DEPARTMENT. **DT  TI.* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT SHOULD SHOULD AND SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE BUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE BUSTAINED AND ACCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE BUSTAINED AND ACCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE BUSTAINED AND ACCUPANT SUS						
10608599 GMC YUKON 2014 2014-07-04 HEAD SLAMMING DOWN ON THE STEERING WHEEL "JS  TL" THE CONTACT OWNS A 2013 BUICK ENCLAVE. THE CONTACT STATED THAT WHILE TRAVELING SMPH, THE VEHICLE CRASHED HEAD-ON INTO ANOTHER VEHICLE AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE MANUPFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE HAD DEPLOY. AND CURRENT MILEAGE WAS 11,500.  HEAD ON COLLISION AT 40 MPH ON A CITY STREET. AIR BAGS DID NOT DEPLOY AND SEAT MOVED FORWARD. RESULTING IN ER NIST AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  HIT A DEER WITH FRONT END OF VEHICLE SURING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY AND SEAT MOVED FORWARD. RESULTING IN ER NIST AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  HIT A DEER WITH FRONT END OF VEHICLE SURING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY AND SEAT MOVED EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCURENT. THE VEHICLE THE AIR BAGS DID NOT DEPLOY. HAVE CONTACTED ON TWICE THIS WERK AND OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. HAVE CONTACTED ON TWICE THIS WERK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. "DT  TI-" THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE ROT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAP PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY IN THE RAP PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAP PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE SUSTAINED SIGNIFICANT DAMAGES. THE FRONT END OF THE SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE SUSTAINED AND AND AND AND AND AND AND AND AND						. ,
TL* THE CONTACT OWNS A 2013 BUICK ENCLAVE. THE CONTACT STATED THAT WHILE TRAVELING 5 MPH, THE VEHICLE CRASHED HEAD-ON INTO ANOTHER VEHICLE AND THE ARIBAGS DID NOT DEPLOY. THE CONTACT WAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE AND CURRENT MILEAGE WAS 11,500.  HEAD ON COLLISION AT 40 MPH ON A CITY STREET. AIR BAGS DID NOT DEPLOY AND SEAT MOVED FORWARD. RESULTING IN ER VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  HIT A DEER WITH FRONT END OF VEHICLE CAUSING APPROXIMATELY 56,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY CAUSING CONCUSION RECEIVED BY DRIVER. DRIVER IS STILL EXPRENENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. *TR  I WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DIT VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE BUT NONE OF MY AIR BAGS WAS DESTROYED. A POLICE REPORT WAS FILLD. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" "I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS WAS 1000. AND ACTUALLY DENTED PART OF MY PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE BUT NONE OF MY AIR BAGS WENT OFF. LUCKLY II HAD MY SEAT BELT ON WHICH SOME HITTING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE HID DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKLY II HAD MY SEAT BELT ON WHICH SOME HITTING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE HEAD ON THE HEAD ON THE HEAD ON THE GROUND NO FIRST HARMYCULLY IN WAYS TOTALED AND MANY HAVE QUE	10608599	GMC	ALIKUN	2014	2014-07-04	
DEPLOY, THE CONTACT WAS INJURED AND REQUIRED IMMEDIATE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE 10595132  BUICK  CADILLAC  SRX  2013  2020-08-27  FORWARD. RESUlTING IN ER VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  HIT A DEER WITH FRONT END OF VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY AND SEAT MOVED OF THE VEHICLE. THE FAILURE DID NOT DEPLOY CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY CAUSING CONCUSSION RECEIVED BY DRIVER. DRIVER IS STILL EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. **TR  I WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. **DIT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACTS VEHICLE CASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE SUSTAINED AND ADD ACTUALLY DENTED PART OF MY PASSENGER SEAT OCCUPANT SUSTAINED AND THE SEAT TO SECOND VEHICLE. THAT IT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DALE OF THE SEAT BELT ON WHICH AND WAS TOTALED AND M	10000333	GIVIC	TOKON	2014	2014 07 04	
VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE AND CURRENT MILEAGE WAS 11,500.  HEAD ON COLLISION AT 40 MPH ON A CITY STREET. AIR BAGS DID NOT DEPLOY AND SEAT MOVED FORWARD. RESUlting IN RE VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  AIRBAGS DID NOT DEPLOY CAUSING CONCUSSION RECEIVED BY DRIVER. DRIVER IS STILL EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. *TR  10575764  CHEVROLET EQUINOX 2013 2013-11-11  EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. *TR  I WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HOW? I HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OR THE DOOR ALL THE WAY! NONE OF MY AIR BAGS DEPLOYED ON MY DASS DESTROYED. A POLICE REPORT WHO DAY NO A CITUALLY DEPLOY. THE REAR PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY ARS BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMNE COMMING FOOM MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AND SAGS USED THE MAD ON THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY APASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY APASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY APASSENGER GOOT FILED FOR THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POP						5 MPH, THE VEHICLE CRASHED HEAD-ON INTO ANOTHER VEHICLE AND THE AIR BAGS DID NOT
10595132 BUICK ENCLAVE 2013 2014-05-29 AND CURRENT MILEAGE WAS 11,500.  HEAD ON COLLISION AT 40 MPH ON A CITY STREET. AIR BAGS DID NOT DEPLOY AND SEAT MOVED FORWARD. RESULTING IN ER VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  HIT A DEER WITH FRONT END OF VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY CAUSING CONCUSSION RECEIVED BY DRIVER. DRIVER IS STILL EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. **TR  I WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. I HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  TL* THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DEPARTMENT OF THE VEHICLE SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DEPART OF ANY AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DEPLOYED ? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKLY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKLY I HAD MY SEAT BELT ON WHICH SOMETHING OUT AT ME A WARNING POPPED UP ON MY DOOD IN HAD SMOKE COMING FROM MY VEHICLE FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD HAVE HEADLY						
HEAD ON COLLISION AT 40 MPH ON A CITY STREET. AIR BAGS DID NOT DEPLOY AND SEAT MOVED FORWARD, RESULTING IN ER VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  HIT A DEER WITH FRONT END OF VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY CAUSING CONCUSSION RECEIVED BY DRIVER. DRIVER IS STILL EXPERIENCING MEDICAL PROBLEMS DUE THIS ACCIDENT. *TR  I WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. I HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDIN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS SIDE FENDER I COULDIN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS DEDICATED TO WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABBOUT EVERTING UNDER MY HOOD. HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF!! VE DONE RESEARCH! HAVEN'T SEEN ANY	10505133	DITICK	ENCLAYE	2012	2014 05 20	
1352287 CADILLAC  SRX  2013  2020-08-27 FORWARD. RESULTING IN ER VISIT AND HEAD LACERATION AND LOSS OF CONSCIOUSNESS.  HIT A DEER WITH FRONT END OP VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES.  AIRRAGS DID NOT DEPLOY CAUSING CONCUSSION RECEIVED BY DRIVER. DRIVER IS STILL  EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. *TR  I WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END  OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. I HAVE CONTACTED GM TWICE THIS WEEK AND  OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. I HAVE CONTACTED GM TWICE THIS WEEK AND  10667442 CHEVROLET EQUINOX  2013  2014-12-14 HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  TL* THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE  VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER  SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE  WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARAR RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT  NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE  HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER  SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF.  LUCKILY! HAD MY SEAT BEST ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME  IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP  ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST  ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE  GROUND NO FIRE THANKFULLY! I MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT  THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE  GO OFF? I! WOULDN'T HAVE HAD MY SEAT BELT ON WHY NON KNOWS WHAT WOULD HAVE  HAPPENED WITH THE AIR BAGS NOT GOING OFF!! VE DONE RESEARCH I HAVEN'T SEEN ANY	10595152	BUICK	ENCLAVE	2013	2014-05-29	AND CURRENT MILEAGE WAS 11,500.
HIT A DEER WITH FRONT END OF VEHICLE CAUSING APPROXIMATELY \$6,000 IN DAMAGES. AIRBAGS DID NOT DEPLOY CAUSING CONCUSSION RECEIVED BY DRIVER. DRIVER IS STILL EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. *TR  1 WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. I HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  1058946 CHEVROLET EQUINOX 2013 2014-12-14 HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  1058946 CHEVROLET EQUINOX 2013 2016-11-23 EQUINOX WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED ISIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY I MY SUV WAS TOTALED AND MAY HAVE PUCLE ILLUDS ON THE GROUND NO FIRE THANKFULLY I MY SUV WAS TOTALED AND MAY HAVE PUCLE ILLUDS ON THE GROUND NO FIRE THANKFULLY I MY SUV WAS TOTALED AND MAY HAVE PUCLE ILLUDS ON THE GROUND NO FIRE THANKFULLY I MY SUV WAS TOTALED AND HAVE WHICLE, FLUIDS ON THE GROUND NO HAVE BAGS MOST OFFICE OF ILLUDGE OFFICE OFFICE OFFICE OFFICE O						HEAD ON COLLISION AT 40 MPH ON A CITY STREET. AIR BAGS DID NOT DEPLOY AND SEAT MOVED
AIRBAGS DID NOT DEPLOY CAUSING CONCUSSION RECEIVED BY DRIVER. DRIVER IS STILL EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. *TR  I WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. I HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE UNAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKPULLY! I MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF IF WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY	11352287	CADILLAC	SRX	2013	2020-08-27	
10575764 CHEVROLET EQUINOX 2013 2013-11-11 EXPERIENCING MEDICAL PROBLEMS DUE TO THIS ACCIDENT. *TR  I WAS INVOLVED IN AN ACCIDENT THAT RESULTED IN DAMAGES OVER \$14,000 TO THE FRONT END OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. I HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE BUT NONE OF MY AIR BAGS AND PHO NO A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELTEVES SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY I MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						
OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. I HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDIN EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF ? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY	10575764	CHEVROLET	EQUINOX	2013	2013-11-11	
OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY. I HAVE CONTACTED GM TWICE THIS WEEK AND HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDIN EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF ? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY			-			
10667442 CHEVROLET EQUINOX 2013 2014-12-14 HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. *DT  TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE UNSO DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED?! HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER! COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY! HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? I'E I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH! HAVEN'T SEEN ANY						
TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY	10007443	CUEV/DOLET	FOLUNOV	2012	2014 12 14	
MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY	10667442	CHEVROLET	EQUINOX	2013	2014-12-14	HAVE NOT YET SPOKEN TO ANYONE IN THEIR PRODUCT ASSISTANCE DEPARTMENT. "DT
VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE REAR PASSENGER SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						TL* THE CONTACT OWNED A 2013 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 60
SEAT OCCUPANT SUSTAINED A HEAD INJURY, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 50,000.  "TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						MPH, THE CONTACT'S VEHICLE CRASHED INTO A SECOND VEHICLE. THE FRONT END OF THE
TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER! COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						
"TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY	10059046	CHEVIDOLET	FOLUNOV	2012	2016 11 22	·
NONE OF MY AIR BAGS DEPLOYED? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER! COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY! HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH! HAVEN'T SEEN ANY	10958946	CHEVROLET	EQUINOX	2013	2016-11-23	WAS DESTROYED. A POLICE REPORT WAS FILED. THE FAILURE WILLEAGE WAS 50,000.
HEADLIGHT AND CONTINUED UP OVER MY HOOD AND ACTUALLY DENTED PART OF MY PASSENGER SIDE FENDER! COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY! HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH! HAVEN'T SEEN ANY						"TAMARA RECALL" I'M WRITING REGUARDING AN ACCIDENT THAT TOTALED OUT MY VEHICLE BUT
SIDE FENDER I COULDN'T EVEN OPEN THE DOOR ALL THE WAY! NONE OF MY AIR BAGS WENT OFF. LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						NONE OF MY AIR BAGS DEPLOYED ? I HIT A DEER AT 75-80 MPH ON A HWY IT HIT MY DRIVERS SIDE
LUCKILY I HAD MY SEAT BELT ON WHICH SOMETHING IN THE SEAT BELT BLEW WHEN IT LOCKED ME IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						
IN PLACE DUE TO THE IMPACT OF THE DEER HITTING JUMPING OUT AT ME A WARNING POPPED UP ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST, IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						
ON MY DASH BELIEVE SAID "LOCKED" BUT ALL HAPPENED SO FAST , IT PUSHED & CRACKED JUST ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						
ABOUT EVERYTHING UNDER MY HOOD. I HAD SMOKE COMING FROM MY VEHICLE, FLUIDS ON THE GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						
THE AIR BAGS. I'M NOW WONDERING THE SAME THING. WHY IN THE WORLD DID NONE OF THESE GO OFF? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						·
GO OFF ? IF I WOULDN'T HAVE HAD MY SEAT BELT ON WHO KNOWS WHAT WOULD HAVE HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						GROUND NO FIRE THANKFULLY! MY SUV WAS TOTALED AND MANY HAVE QUESTIONED ME ABOUT
HAPPENED WITH THE AIR BAGS NOT GOING OFF! I'VE DONE RESEARCH I HAVEN'T SEEN ANY						
10993565   CHEVROLET   EQUINOX   2013   2017-05-09   RECALLS, BUT I AM A LITTLE CONFUSED BY THIS!	10993565	CHEVROLET	EQUINOX	2013	2017-05-09	RECALLS, BUT I AM A LITTLE CONFUSED BY THIS!

10576260	CHEMPOLET	SHIVEDADO	2012	2014 02 19	ON TUESDAY MARCH 18, 2014 I WAS DRIVING A 2013 CHEVY SILVERADO AND REAR ENDED A CHEVY TAHAO AT APPROXIMATELY 20 MPH WITHOUT HITTING MY BRAKES. CONDITIONS AT THE TIME WERE CLEAR AND DRY ALTHOUGH VERY WINDY. I WAS THE ONLY PASSENGER IN MY TRUCK. I WAS WEARING MY SEATBELT. I HIT THE STEERING WHEEL WITH MY CHEST. THE ONSTAR SYSTEM CALLED TO SAY THEY COULD SEE I WAS IN AN ACCIDENT AND HELP WAS ON THE WAY. I EXCHANGED INFO WITH THE OTHER DRIVER AND RETURNED TO MY VEHICLE. THE SEATBELT WAS IN THE EXTENDED POSITION AND WOULD NOT EXTEND FURTHER OR RETRACT. ON THE DISPLAY PANEL IT HAD AN 'AIRBAG DEPLOYED' ICON AND MESSAGE 'SERVICE AIRBAG'. MY INSURANCE COMPANY GAVE ME A AUTO REPAIR SHOP TO GO TO FOR AN ESTIMATE, HOWEVER, THE SHOP TOLD ME THEY WOULD NOT TOUCH THE VEHICLE UNTIL A GM REPRESENTATIVE INVESTIGATED THE SYSTEM FIRST AS THEY FELT THE SEATBELT SHOULD HAVE PREVENTED ME FROM HITTING THE STEERING WHEEL. I CALLED GM AND SPOKE WITH WALTER IN CUSTOMER SERVICE. HE ARRANGED TO HAVE A 'THIRD PARTY' INVESTIGATOR COME AND DO A INTERROGATION OF THE SYSTEM AND ARRANGED FOR A LOANER VEHICLE. RAYTHEON REPRESENTATIVE 'JEFF" CALLED ME SUNDAY MARCH 20 AND STATED HE WAS TO INTERROGATE THE SYSTEM AND WOULD CONTACT ME FROM THE AIRPORT WHEN HE GOT TO TOWN ON WEDNESDAY MARCH 23. ON WEDNESDAY MARCH 23 I CALLED JEFF TO SEE IF HE WAS IN TOWN AND HE STATED HE WAS AT THE AIRPORT 'LEAVING' TOWN, HE HAD DONE HIS INVESTIGATION AND DETERMINED EVERYTHING WORKED LIKE IT SHOULD. I ASKED HIM IF I WAS SUPPOSED TO HIT THE STEERING WHEEL AND HE STATED HE DID NOT AGREE OR DISAGREE. **TR
10576260	CHEVROLET	SILVERADO	2013	2014-03-18	NOT AGREE OR DISAGREE. *TR  TI.* THE CONTACT OWNS A 2013 CHEVROLET SILVERADO. THE CONTACT STATED WHILE DRIVING
10598445	CHEVROLET	SILVERADO	2013	2014-06-08	APPROXIMATELY 35 MPH A DRUNK DRIVER CRASHED INTO THE CONTACTS VEHICLE. THE AIR BAGS DID NOT DEPLOY. THE PASSENGER SUSTAINED A BROKEN FOOT AND WAS TAKEN TO THE HOSPITAL. THE APPROXIMATE FAILURE MILEAGE WAS 22,000.
11055507	CHEVROLET	TRAVERSE	2013	2016-10-25	ON OCT 25 OF LAST YEAR WE WERE INVOLVED IN A ACCIDENT WHERE WE HIT A CAR BROADSIDED DOING ABOUT 30 MPH CAUSING CONSIDERABLE DAMAGE TO OUR CAR, BOTH MY WIFE AND MYSELF HAD TERRIBLE WHIPLASHES. AND I BELIEVE THAT SOME OF OUR PAIN COULD HAVE BEEN PREVENTED IF THE AIR BAGS WOULD HAVE DEPLOYED WHICH THEY DID NOT DO. WE WERE ON 4 LANE DIVIDED ROAD GOING THROUGH THE TOWN OF CHIEFLAND FL. WE WERE PASSING A SEMI TRUCK WHICH WAS SLOWING DOWN TO MAKE A TURN WHEN A VEHICLE CAME ACROSS THE FRONT OF THE TRUCK AND CONTINUED TO COME INTO OUR LANE WITH NO REGARDS TO STOPPING AND WE HAD NO CHOICE OR TIME TO STOP.
11093533	CHEVROLET	TRAVERSE	2013	2017-09-18	HAVE HAD MY VEHICLE IN DEALER TO FIX AIR BAG LIGHT SEVERAL TIMES AND IT IS STILL ON. MY WIFE WAS INVOLVED IN AN ACCIDENT WHERE AIRBAGS SHOULD OF DEPLOYED AND DIDN'T. LUCKILY SHE WAS NOT INJURED.
10556077	GMC	TERRAIN	2013	2013-12-13	VEHICLE WAS INVOLVED IN A SEVERE ACCIDENT WHERE THE OTHER DRIVER RAN A STOP SIGN AND HIT TERRAIN CAUSING SEVERE FRONT END AND ENGINE DAMAGE. AIR BAGS FAILED TO DEPLOY. INJURES INCLUDED WERE NECK AND BACK. DAMAGE WAS SEVERE ENOUGH TO CAUSE AIRBAGS TO DEPLOY BUT NEVER DID. HAVING AN INDEPT INSPECTION CONDUCTED AS TO WHY THEY NEVER DEPLOYED. *TR
					WAS DRIVING DOWN HIGHWAY US19 AND COLLIDED WITH ANOTHER VEHICLE AT AT LEAST 40MPH
10895896	GMC	TERRAIN	2013	2016-08-15	AND AIRBAGS DID NOT DEPLOY  I WAS IN A COLLISION ON 6/21/2019 THAT HAD SEVERE FRONT END OBSTRUCTIONS AND WITH A
11222110	BUICK	ENCLAVE	2012	2019-06-21	STRONG TOTAL LOSS AS A RESULT. MY AIRBAGS NEVER DEPLOYED. THE VEHICLE WAS IN MOTION ON ASSEMBLY STREET, COLUMBIA SC.
10576031	CADILLAC	SRX	2012	2014-03-23	I FELL ASLEEP WHILE DRIVING, JUMPED A LEVEE, RAN THROUGH A FENCE, AND WRECKED IN A GRASSY WATERY AREA. MY ENGINE WAS SMASHED, THE MOTOR MOUNT BROKE, AND MY TIRES ARE PUSHED BACK. MY AIR BAGS DID NOT DEPLOY. MY FACE HIT THE STEERING WHEEL AND MY NOSE IS BROKEN. I WOULD LIKE TO FIND OUT IF THERE IS ANY RECALLS ON THIS CAR. *TR
					VEHICLE DRIVER AIR BAG DID NOT DEPLOY, NOR ANY OTHER AIR BAG, UPON COLLISION TO REAR  OF A STOPPED PICK UP TRUCK. SPEED OF OFFENDING VEHICLE WAS APPROXIMATELY 45 MPH.
10576905	CADILLAC	SRX	2012	2014-03-27	DRIVER SUFFERED CHEST INJURY FROM SEAT BELT. DAMAGE ESTIMATED TO FRONT END EXCEEDS \$10,000. *TR
10682471	CADILLAC	SRX	2012	2014-12-14	MVA WITH TWO IMPACTS; FRONT DRIVER SIDE (SIGNIFICANT IMPACT) AND FRONT OF VEHICLE NO AIRBAGS DEPLOYED. *TR
10993443	CADILLAC	SRX	2012	2017-05-31	TWO CARS AHEAD OF ME WAS GOING STRAIGHT AND ALL OF A SUDDEN TURNED INTO A STRIP MALL WITHOUT INDICATOR, THE CAR IN FRONT OF ME SLAMMED ON THEIR BRAKES AND SO DID I, BUT I STILL ENDED UP REAR ENDING THE VEHICLE IN FRONT. I THINK MY SPEED WAS AROUND 30 AT THE TIME OF IMPACT. I HIT MY CHIN TO THE STEERING WHEEL. GOT MULTIPLE CUTS INSIDE OF MY MOUTH. AND COUPLE OF THEM ON MY FACE WHICH REQUIRED STITCHES. MY AIR BAG DID NOT DEPLOY AND NEITHER THE SEATBELT PREVENTED IT, WHICH I THOUGHT WAS ODD. CHECKED WITH CADILLAC IF HEY WERE AWARE OF ANY PROBLEM WITH THE CAR. THEY DENIED THE EXISTENCE OF SUCH AN ISSUE. SO I WANT TO GET THE VEHICLE INVESTIGATED, SO THAT NOBODY ELSE SHOULD GET HURT THE WAY I DID; ALSO I HAVE ANOTHER CADILLAC AND NEED TO KNOW. WILL REALLY APPRECIATE IT. THANKS

	1		I		T
11138938	CADILLAC	SRX	2012	2018-06-25	ON 6/25/18, MY WIFE WAS TRAVELING 45 MPH., IN OUR 2012 CADILLAC SRX. THE VEHICLE IN FRONT OF HER WENT TO MAKE A LEFT TURN INTO A SUBDIVISION. BUT, THEN DECIDED NOT TO DO THAT AND PULLED BACK INTO THE LANE OF MY WIFE. SHE SLAMMED ON HER BRAKES, TO AVOID HITTING THE VEHICLE. HOWEVER, SHE COULDN?T ANTICIPATE THEIR MOVE. SHE HIT THEM FROM BEHIND, GOING 45MPH. SHE HIT HER FOREHEAD ON THE VISOR BAR TWICE, CAUSING A SKULL FRACTURE, BRAIN BLEED, SEVER CONCUSSION, DEEP LACERATIONS, A BURST ARTERY IN HER FOREHEAD TO WHERE SHE WAS BLEEDING HEAVILY AND UNCONSCIOUS. HER CHEST HIT THE STEERING WHEEL, WHICH BADLY BRUISED HER RIBS, CAUSING A HIATAL HERNIA, DUE TO THE IMPACT. SHE SUFFERED LACERATIONS TO HER LEFT ARM, KNEE AND HAS RUPTURED DISCS IN HER CERVICAL SPINE. SHE WAS ICU FOR SEVERAL DAYS DUE TO THE BRAIN BLEED AND HEAD INJURIES SHE SUSTAINED. OUR AIR BAG NEVER DEPLOYED AND THE DRIVER SEAT BELT DIDN?T LOCK ON IMPACT, ALLOWING HER TO BOUNCE UPWARD TWICE AND SUSTAINED THE HEAD INJURIES. THE CADILLAC AIR BAGS AND SEAT LOCKING MECHANISMS FAILED TO PROTECT HER FROM INJURIES SHE SHOULD HAD NEVER HAD. SOMEONE NEEDS TO RESEARCH FURTHER THESE ISSUES FOR THE 2012 SRX SO OTHER CONSUMERS DON?T FEEL SAFE IN A VEHICLE, WHERE THE SAFETY MECHANISMS FAIL. CADILLAC SHOULD NOT BE ABLE TO GET AWAY WITH THIS. SHOULD THE 2012 SRX HAVE A RECALL ON AIR BAGS AND SEAT BELT LOCKING MECHANISMS FAILING? MORE THAN ONE COMPLAINT HAS BEEN POSTED, SO I HOPE THE NHTSA INVESTIGATES THIS FOR US ALL. PLEASE CONSIDER THIS A FORMAL COMPLAINT! THANK YOU, AND PLEASE FOLLOW UP! *TR
10546238	CHEVROLET	EQUINOX	2012	2013-09-20	SHOULD I PROCEED? *TR
10979985	CHEVROLET	EQUINOX	2012	2017-03-31	I WAS INVOLVED IN AN ACCIDENT WHERE I REAR ENDED A STOPPED VEHICLE. MY CRUISE WAS SET AT 57 MPH AND I DID NOT APPLY BRAKES. BECAUSE CRUISE WAS SET, I HIT ONCE, BOUNCED BACK AND HIT AGAIN. MY AIRBAGS DID NOT DEPLOY AT ALL. THE VEHICLE HAS EXTENSIVE DAMAGE TO THE FRAME BUT NO AIRBAG DEPLOYMENT.
11329614	CHEVROLET	EQUINOX	2012	2020-05-31	TL* THE CONTACT OWNED A 2012 CHEVROLET EQUINOX. THE CONTACT STATED THAT WHILE HER HUSBAND WAS DRIVING ABOUT 25 MPH, HE SUFFERED A MEDICAL CONDITION AND LOST CONTROL OF THE VEHICLE, CRASHING INTO A THREE FEET HIGH CEMENT BOULDER. THE AIR BAGS DID NOT DEPLOY. BOTH THE DRIVER AND THE FRONT PASSENGER SUSTAINED INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE DRIVER AND THE PASSENGER HAD THEIR SEAT BELTS LATCHED AT THE TIME OF THE CRASH. THE VEHICLE WAS TOTALED AND WAS TOWED TO A TOW YARD. THE DEALER AND THE MANUFACTURER WERE NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS APPROXIMATELY 133,000.
10790202	CHEVROLET	SILVERADO	2012	2015-09-30	RECENTLY I WAS INVOLVED IN AN ACCIDENT THAT WAS A DIRECT IMPACT. AT THE TIME OF THIS ACCIDENT THE SEAT BELT DID NOT LOCK NOR DID THE AIR BAGS DEPLOY. THE SPEED FROM THIS ACCIDENT WAS BETWEEN 50-55 MPH ON THE HIGHWAY. AT THE RATE OF SPEED I WAS GOING BEFORE THE ACCIDENT AND THE FACT THAT I HAD TO SLAM ON THE BREAKS TO BEGIN SLOWING DOWN ONE WOULD HAVE THOUGHT THE SEAT BELT WOULD HAVE LOCKED BUT IT DID NOT AND AT THE POINT OF IMPACT I WAS VERY SURPRISED THAT THE AIRBAGS DID NOT DEPLOY BUT YET THE SYSTEM INDICATED THAT IT DID AND NEEDED TO BE RESET. HOWEVER NOW THAT THE VEHICLE IS IN PROCESS OF BEING REPAIRED I AM BEING TOLD THAT THE ENTIRE AIRBAG SYSTEM HAS TO BE REPLACED ALONG WITH THE DRIVER SEAT BELT.
10622016	CHEVROLET	ТАНОЕ	2012	2014-08-09	WHILE TURNING LEFT (TAHOE) WITH A PROTECTED GREEN ARROW AT AN X-SHAPED INTERSECTION, VEHICLE (KIA SEDAN) AT FAULT FAILED TO YIELD AND ENTERED THE INTERSECTION AT SPEEDS UPWARDS OF 40 MPH FROM THE LEFT OF THE TAHOE. FRONT-IMPACT COLLISION OCCURRED; DUE TO THE SHAPE OF THE INTERSECTION AND THE VELOCITY OF THE IMPACT, TAHOE STRUCK PASSENGER SIDE OF KIA SEDAN. TRAJECTORY OF IMPACT CAUSED DIRECTIONAL CHANGES IN UPWARDS OF 90* FOR BOTH VEHICLES; THE FORCE OF THE PRIMARY ACCIDENT DESCRIBED ABOVE ALSO CAUSED MENTIONED VEHICLES TO COLLIDE WITH LEFT REAR OF ANOTHER VEHICLE (HONDA SEDAN), CAUSING NEAR 360* ROTATION OF THE HONDA SEDAN. DUE TO THE FORCE OF IMPACT, FRONT & SIDE AIRBAGS DEPLOYED ON BOTH THE KIA SEDAN AND THE HONDA SEDAN, BUT FAILED TO DEPLOY ON THE TAHOE. SCENE INDICATED THAT THE KIA SEDAN MADE NO ATTEMPT TO BRAKE OR DECREASE SPEED PRIOR TO COLLISION; POSTED SPEED LIMIT AT INTERSECTION IS 40 MPH. FORCE WAS SUCH THAT AFTER THE COLLISION, TAHOE TRANSMISSION WAS IN DRIVE, BUT REMAINED AT A COMPLETE STOP. DAMAGE SUSTAINED ON THE TAHOE INCLUDE FRONT-END BODY DAMAGE, ENGINE DAMAGE (VEHICLE REQUIRED TOWING AND WAS INOPERABLE), AND FRAME DAMAGE, AT A MINIMUM. IN ADDITION, ENGINE SERVICE LIGHTS AS WELL AS ONSTAR VEHICLE DIAGNOSTIC REPORTS INDICATE THAT THE AIRBAG SYSTEM, ANTILOCK BRAKING SYSTEM, AND THE STABILITRAK STABILITY CONTROL SYSTEM ALSO SUSTAINED DAMAGE AND REQUIRE ATTENTION. MULTIPLE FIRST-RESPONDERS COMMENTED ON THE ODDITY THAT, GIVEN THE DAMAGE SUSTAINED BY THE TAHOE AND THE VELOCITY AT IMPACT, THE AIRBAGS DEPLOYED ON ALL VEHICLES BUT THE TAHOE. *TR

					I WAS DRIVING WEST BOUND ON 176TH ST AND AS I APPROACHED THE LIGHT I COULD NOT BRAKE
					OR TURN MY CAR TO THE RIGHT IN WHICH I HAD A HEAD ON COLLISION WITH ANOTHER VEHICLE.
					ON IN PACKED MY AIRBAGS DID NOT DEPLOY! THE DRIVER OF THE OTHER VEHICLE EVEN TOLD THE
					OFFICER HE WAS TRYING TO TURN , HIS EYES WERE AS BIG AS A COWS CLEARLY HE WAS IN
11194940	CHEVROLET	TAHOE	2012	2018-03-19	DISTRESS. LUCKILY NEITHER OF US WERE INJURED.
					AS I WAS DRIVING ON 176TH GETTING READY TO TURN ON SPANAWAY LOOP MY WOULDN'T
11270707	CHEVIDOLET	TAHOE	2012	2019 09 24	COMPLETE THE RIGHT TURN OR STOP SO I HAD A HEAD ON COLLISION WITH ANOTHER TRUCK AND MY AIR BAGS DIDN'T DEPLOY.
11278797	CHEVROLET	TAHOE	2012	2018-08-24	THE DRIVER STEERING WHEEL FRONT AIRBAG DID NOT DEPLOY WHEN I HIT ANOTHER VEHICLE
					FROM BEHIND. WHEN WE RECEIVED THE LETTER ABOUT RECALL WE BROUGHT THE VEHICLE INTO
10885565	CHEVROLET	TRAVERSE	2012	2016-06-30	SERVICE CHEVROLET IN LAFAYETTE, LA.
10003303	GHE VIII GEE	11011121102	2022	2010 00 00	
					MY WIFE AND THREE DAUGHTERS, AGES 11, 9, AND 6, WERE INVOLVED IN A MAJOR CRASH. AN
					ELDERLY MALE TRAVELED THRU A STEADY RED TRAFFIC SIGNAL AND STRUCK THE PASSENGER SIDE
					OF MY WIFE'S VEHICLE AS SHE WAS CROSSING THE INTERSECTION WITH A GREEN TRAFFIC SIGNAL.
					AFTER IMPACT, THEY WERE PUSHED HEAD ON INTO A TRAFFIC STANDARD (WHICH WAS TAKEN
					OUT COMPLETELY) AND THEN INTO A TELEPHONE POLE, ALSO HEAD ON. NOT ONE AIRBAG
					DEPLOYED. THE VEHICLE IS SUPPOSEDLY EQUIPPED WITH FRONT AND SIDE AIRBAGS. IN MARCH
					OF 2014 THERE WAS A RECALL CONCERNING THE AIRBAGS NOT DEPLOYING IN THESE VEHICLES (#
					14V118000). I HAVE OWNED THIS VEHICLE SINCE NEW AND DID RETURN IT TO THE DEALERSHIP IN
40000000	0.40		2012	2016 06 11	MAY OF 2014 FOR THE RECALL SHORTLY AFTER RECEIVING NOTIFICATION. I WAS ADVISED THAT IT
10882239	GMC	ACADIA	2012	2016-06-14	WAS TAKEN CARE OF.
					THE VEHICLE WAS IN MOTION NEAR AN INTERSECTION AND APPROACHING THE LIGHT TO TURN.
					NEAR AIRPORT IN RALEIGH NC) THE FRONT AND SIDE AIRBAGS FAILED TO DEPLOY DURING THE CRASH. THE OTHER VEHICLE HAS BEEN DECLARED TOTAL LOSS AND MINE HAS SIGNIFICANT
					DAMAGE AND COULD BE CLASSIFIED AS TOTAL LOSS. THERE ARE PERSONAL INJURIES. I AM
10925628	GMC	ACADIA	2012	2016-09-27	ATTACHING PICTURES OF THE VEHICLE AND ACCIDENT REPORT.
	0.11.0				
					ON APRIL 16TH OUR SON WAS DRIVING ON FAIRVIEW RD. AND TRAVELING THROUGH A GREEN
					LIGHT WHEN A CAR THAT RAN A RED LIGHT HIT HIM. ?HIS CAR ? A GMC 2012 TERRAIN WAS HIT
					MULTIPLE TIMES ? DRIVER'S FRONT END, FRONT END AND SPUN AROUND FROM THE FORCE AND
					HIT ON THE PASSENGER SIDE. NO AIRBAGS DEPLOYED ?[XXX] WAS IMMEDIATELY CONTACTED BY
					ON STAR, THEY CALLED POLICE, HIS CAR WAS TOTALED ?ON 4/21 I EMAILED GMC AND ASKED
					WHAT DEPARTMENT I WOULD CONTACT TO FILE A COMPLAINT ABOUT THE FRONT AND SIDE
					AIRBAGS NOT DEPLOYING CALL FROM GMC 866-790-5700 EXT. 22745 SAID ON VOICE MAIL? THE
					AIRBAG DID NOT DEPLOY AS IT SHOULD HAVE? HE MADE A CASE NUMBER [XXX] GMC HAS SINCE
					DECLARED THIS WAS A LOW THRESHOLD EVENT - NO NEED FOR AIRBAG DEPLOYMENT - YET THE
10466384	GMC	TERRAIN	2012	2012-04-16	CAR WAS TOTALED AND OUR SON HAS WHIPLASH AND CONTUSIONS INFORMATION REDACTED PURSUANT TO THE FREEDOM OF INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6). *TR
10400384	GIVIC	TEINIAIN	2012	2012-04-10	FORSOANT TO THE TREEDOM OF INFORMATION ACT (FOIA), 3 0.3.C. 332(b)(0).
					TL* THE CONTACT OWNS A 2012 GMC TERRAIN. THE CONTACT STATED THAT HE FELL ASLEEP
					WHILE DRIVING AN UNKNOWN SPEED. THE VEHICLE TRAVELED TO THE RIGHT SIDE OF THE ROAD
					AND WENT AIRBORNE APPROXIMATELY 20 FEET, LANDING ON ALL FOUR TIRES. THE VEHICLE THEN
					TRAVELED APPROXIMATELY 200 FEET AND CRASHED INTO AN EMBANKMENT. THE AIR BAGS FAILED
					TO DEPLOY. THE CONTACT SUSTAINED A FRACTURED BACK AS A RESULT. A POLICE OFFICER
					WITNESSED THE INCIDENT AND FILED A REPORT. THE VEHICLE WAS DESTROYED AND TOWED TO A
					COLLISION CENTER. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAULTY AIR BAGS. THE
10477166	GMC	TERRAIN	2012	2012-09-04	APPROXIMATE FAILURE MILEAGE WAS 7,000. UPDATED 10/16/12*LJ
					VEHICLE WAS INVOLVED IN A CAR ACCIDENT AND CRASHED INTO A BRIDGE IRON BEAM HEAD-ON.
					VEHICLE'S AIR BAGS FAILED TO DEPLOY. HOOD AND FRONT OF CAR SMASHED AS VEHICLE WAS
10516265	GMC	TERRAIN	2012	2013-06-08	WRAPPED AROUND BEAM. ONLY MINOR INJURIES TO DRIVER, AS DRIVER WAS WEARING A SEATBELT. *TR
10310203	CIVIC	LIMMIN	2012	2013-00-08	OD HOLET. III
					I INADVERTENTLY VEERED OFF SIDE ROADWAY, (VA HIGHWAY 220) COLLIDING WITH A
					TREE/ROADSIDE SHRUBS, ETC (WAS KNOCKED UNCONSCIOUS AS FOREHEAD HIT STEERING WHEEL
					ON INITIAL IMPACT). AIRBAGS DID NOT DEPLOY ALLOWING ME TO SUSTAIN A HEAD INJURY THAT
					KNOCKED ME UNCONSCIOUS FOREHEAD WAS GASHED WITH SIGNIFICANT BLEEDING. I WAS
					TRANSPORTED BY AMBULANCE IN UNCONSCIOUS STATE. DAMAGE TO VEHICLE IS IN EXCESS OF
					\$8,000 SO FAR AS VEHICLE STILL IN REPAIR SHOP WITH MASSIVE FRONT END DAMAGE THAT
					AFFECTS STEERING LINKAGE, ETC. THE IMPACT OF VEHICLE AGAINST FOLIAGE, TREES SHRUBS,
					SHOULD HAVE FORCED AIR BAGS TO DEPLOY AND I BELIEVE THAT I WOULD NOT HAVE SUSTAINED
		L			A HEAD INJURY THAT RENDERED ME UNCONSCIOUS WITH MILD CONCUSSION AND COULD NOT
10583703	GMC	TERRAIN	2012	2014-03-13	CONTROL VEHICLE LEAVING ROADWAY. *TR

10588334	GMC	TERRAIN	2012	2014-03-13	VEERED OFF SIDE OF HIGHWAY, STRUCK SOMETHING HEAD-ON AND WAS RENDERED UNCONSCIOUS AS HEAD HIT STEERING WHEEL. I WAS TRANSPORTED UNCONSCIOUS IN AMBULANCE FROM CRASH SCENE TO LOCAL HOSPITAL, WHERE I WAS AN INPATIENT FOR TWO DAYS. EXTENSIVE DAMAGE TO FRONT OF VEHICLE INDICATED THE SEVERITY OF IMPACT YET AIR BAGS DID NOT DEPLOY. I BELIEVE AIR BAGS SHOULD HAVE DEPLOYED ON IMPACT AND I WOULD NOT HAVE BEEN RENDERED UNCONSCIOUS, AND COULD HAVE CONTROLLED VEHICLE TO AVOID STRIKING TREE, BRUSH, ETC. I CONTACTED GMC CORPORATE TO ADVISE MY CONCERNS FOR SAFETY RECEIVED A FOLLOW UP TELEPHONE CALL FROM GMC REPRESENTATIVE (HE) EXPRESSED NO INTEREST IN MY COMPLAINT REFUSED TO COMMENT ON MY STATEMENT THAT AIR BAG FAILED TO DEPLOY RESULTING IN EXTENSIVE DAMAGE TO FRONT OF VEHICLE AND SUSTAINING A HEAD INJURY AS NO BAG DEPLOYED. NO MATTER THAT I AM LEASING THE VEHICLE AND FEAR FOR MY SAFETY I WAS ADVISED THAT GMC HAD NO FURTHER INTEREST IN THIS MATTER AND WOULD NOT EVALUATE MY SAFETY CONCERNS. *TR
10300334	CIVIC	TERRO UT	2012	2014 03 13	CAR CRASH AT 45 MPH. FRONT IN DAMAGE AND AIR BAG DID NOT DEPLOY. SEATBELTS DID NOT
10722057	GMC	TERRAIN	2012	2015-05-19	LOCK UP.
10924918	GMC	TERRAIN	2012	2016-11-06	I WAS TRAVELING ABOUT 75MPH WHEN A DEER RAN INFRONT OF ME, I WASN'T ABLE TO STOP COMPLETELY AND HIT THE DEER ON MY RIGHT FRONT SIDE OF MY VEHICLE THE SMELL OF SMOKE CAME FROM MY VEHICLE AND MY "SERVICE AIRBAGS" INDICATOR CAME ON NO AIRBAGS DEPLOYED I HAD MY 6 YEAR OLD SON IN THE CAR WITH ME!! MY CAR ISN'T DRIVABLE DUE TO THE SIGNAL BEING ON EVEN THOUGH THE AIRBAGS DIDN'T DEPLOY.  TL* THE CONTACT OWNED A 2012 GMC TERRAIN. WHILE DRIVING AT AN UNKNOWN SPEED. THE
11088412	GMC	TERRAIN	2012	2016-04-21	DRIVER CRASHED INTO A LANDSCAPING TRUCK. THE AIR BAGS FAILED TO DEPLOY. THERE WERE NO INJURIES. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO A TOW LOT AND DEEMED DESTROYED. THE DEALER WAS NOT CONTACTED TO DETERMINE THE CAUSE OF THE AIR BAG FAILURE. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS UNKNOWN.
11219747	GMC	TERRAIN	2012	2019-06-12	TL* THE CONTACT OWNS A 2012 GMC TERRAIN. THE CONTACT STATED THAT WHILE HER GRANDSON WAS DRIVING APPROXIMATELY 40-45 MPH, A DEER JUMPED INTO THE FRONT OF THE VEHICLE CAUSING SEVERE DAMAGE TO THE FRONT END OF THE VEHICLE BUT THE AIR BAGS DID NOT DEPLOY. THE CONTACT MENTIONED THAT THE RADIATOR WAS PUSHED INTO THE ENGINE. THE CONTACT SUSTAINED WHIPLASH INJURIES THAT DID NOT REQUIRE MEDICAL ATTENTION. A POLICE REPORT WAS NOT FILED. THE VEHICLE WAS TOWED. THE CAUSE OF THE FAILURE WAS NOT DETERMINED BY THE INDEPENDENT MECHANIC. THE LOCAL DEALER WAS NOT NOTIFIED OF THE FAILURE. THE MANUFACTURER WAS CONTACTED AND A CASE WAS OPENED BUT NO ASSISTANCE WAS OFFERED. THE FAILURE MILEAGE WAS 103,000. *AS *AS
10573780	виіск	ENCLAVE	2011	2012-10-10	TURNED CORNER ON IRONWOOD46615 AND REAR ENDED CAR THAT STOPPED SUDDENLY. CRUSHED MY FRONT END BACK TO PUNCTURING THE RADIATOR. NO AIR BAG DEPLOYED AND NO SEAT BELT ON IMPACT. MY KNEES HIT THE DASH UNDER THE STEERING WHEEL. NO ONSTAR AS NO AIRBAG DEPLOYED. HOLDING STEERING WHEEL WAS MY ONLY DETERRENT TO HITTING FORWARD. REPAIRS COST \$5000.+ AND GM DEALER INSISTED AIRBAG AND SEAT BELT WERE FUNCTIONING. KNEES STILL HURT. AND SEEN DOCTOR ABOUT KNEES AND GOING AGAIN SOON. I AM REPORTING THIS AFTER HEARING THAT THERE ARE RECALLED ON SEAT BELTS AND AIRBAGS ON DRIVER SIDE. *TR
10608978	BUICK	ENCLAVE	2011	2014-06-30	TL - THE CONTACT OWNS A 2011 BUICK ENCLAVE. THE CONTACT STATED WHILE DRIVING AT UNKNOWN SPEED, THE VEHICLE CRASHED INTO A DEER CAUSING THE VEHICLE TO CATCH ON FIRE AND THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE. THE FAILURE AND CURRENT MILEAGE WAS 56,000. PAM UPDATED 11/24/14*LJ UPDATED 8/17/2015*JS
10732977	BUICK	ENCLAVE	2011	2015-07-04	DRIVING DOWN THE ROAD ON A 50MPH ZONE AND A VEHICLE PULLED OUT IN FRONT OF US. OUR CAR T-BONED THE CAR THAT PULLED IN FRONT OF US. EVERYONE HAD THERE SEATBELTS ON BUT THE FRONT AIRBAGS NEVER DEPLOYED. I DONT UNDERSTAND WHY THEY WOULDNT HAVE DEPLOYED WHEN WE HIT THE OTHER CAR AT AT LEAST 40MPH AFTER SLAMMING ON THE BREAKS.
10654934	CADILLAC	SRX	2011	2014-10-23	I WAS TURNING SOUTH WITH A GREEN ARROW WHEN THE SECOND DRIVER RAN A RED LIGHT TRAVELING EAST AND WE COLLIDED. HE WAS TRAVELING AT APPROXIMATELY 40-45 MILES PER HOUR AND I WAS TRAVELING AT APPROXIMATELY 30 MILES AN HOUR. OUR IMPACT WAS SOMEWHAT OF A T-INCIDENT WITH THE FRONT END OF MY CAR DAMAGED AND HIS CAR ON THE DRIVER'S SIDE DAMAGED. MY AIR BAGS DID NOT INFLATE, EVEN THOUGH WE BELIEVE THE IMPACT WAS AT THE ANGLE AND THE REQUIRED SPEED OF VEHICLES TO INFLATE THEM. THE AIR BAGS IN THE SECOND DRIVER'S CAR (FORD FOCUS) DID INFLATE. *TR
10679589	CADILLAC	SRX	2011	2015-01-08	INTO ANOTHER VEHICLE. THE AIR BAGS DID NOT DEPLOY AND THE FRONT PASSENGERS SIDE SEAT BELT WAS LOOSE. A POLICE REPORT WAS FILED AND THREE UNKNOWN INJURIES WERE REPORTED. THE CONTACT DID NOT DISCLOSE IF MEDICAL ATTENTION WAS REQUIRED OR NOT. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 60,000.

					I WAS INVOLVED IN AN ACCIDENT, I RAN INTO A VEHICLE THE DAMAGE WAS TO THE FRONT OF THE
					CAR . THE AIRBAGS DIDNT DEPLOY OR THE SENSORS OF THE FRONT OF MY CAR DID NOT GO OFF
11192908	CADILLAC	SRX	2011	2018-12-19	EITHER.
					I WAS RECENTLY IN A PRETTY BAD FRONT END VEHICLE ACCIDENT GOING ABOUT 45 MPH WHEN I
					REAR ENDED SOMEONE. MY CAR HAS BEEN TOTALED DO TO THE DAMAGE TO THE FRONT END OF
					THE VEHICLE. MY AIR BAGS DID NOT DEPLOY IN THIS ACCIDENT, EVERYONE ONE I HAVE TALKED TO
					FROM THE TOWING COMPANY TO THE PARAMEDIC ON SEEN SAID THAT IT SHOULD HAVE
10391449	CHEVROLET	EQUINOX	2011	2011-03-10	DEPLOYED.
					2011 CHEVROLET EQUINOX. CONSUMER STATES AIRBAGS DID NOT DEPLOY DURING CRASH *TGW
					THE CONSUMER STATED ANOTHER VEHICLE PULLED OUT IN FRONT OF HIM FROM A SIDE STREET,
					ON HIS RIGHT SIDE, WHICH RESULTED IN THE CONSUMER HITTING THE OTHER VEHICLE, WHEN
					THAT VEHICLE FAILED TO STOP AT A STOP SIGN. THE CONSUMER STATED THE ENTIRE FRONT END
10449809	CHEVROLET	EQUINOX	2011	2012-01-23	OF THE VEHICLE WAS DESTROYED. *JB
					AIR BAGS DID NOT DEPLOY AT OR ABOVE THE MFG. THRESHOLDS.WHICH CAUSED FOR NO AIR BAG
1					DEPLOYMENT AND SIGNIFICANT FACIAL TRAUMA ON THE STEERING WHEEL. SEAT BELT
					PRETENSTIONERS ALSO DID PRETENSION CAUSING THE UPPER TORSO TO GO FORWARD AND
10552442	CHEVROLET	EQUINOX	2011	2013-07-31	CAUSE THE FACIAL TRAUMA ON THE STEERING WHEEL. *TR
					WHILE CHANGING LANES DURING AN ICE STORM, THE VEHICLE'S BACK END LET LOSE AND THE
					DRIVER LOST CONTROL AND SLIDE INTO THE MEDIA AT WHICH TIME THE VEHICLE WAS PROJECTED
					INTO THE GUARDRAIL HEAD ON. NEITHER FRONT AIRBAGS DEPLOYED NOR DID ANY OF THE
10682338	CHEVROLET	EQUINOX	2011	2015-01-29	AIRBAGS DEPLOY. *TR
					TL* THE CONTACT OWNS A 2011 CHEVROLET EQUINOX. THE CONTACT WAS INVOLVED IN A
					FRONTAL CRASH. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS NOT FILED AND NO
					INJURIES WERE SUSTAINED. THE VEHICLE WAS DECLARED DESTROYED BY THE INSURANCE
					COMPANY. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE
10721958	CHEVROLET	EQUINOX	2011	2015-05-09	WAS 58,000.
					INVOLVED IN AN ACCIDENT WHERE I COLLIDED WITH ANOTHER CAR. THE FRONT END OF MY CAR
					WAS COMPLETED DAMAGED TO THE POINT WHERE THE CAR WAS TOTALED. THE PROBLEM WITH
					THIS ACCIDENT WAS THE AIR BAGS DID NOT GO OFF CAUSING INJURY TO MYSELF AND MY WIFE. I
					ESTIMATE THE SPEED AT COLLISION TO BE AROUND 30MPH. I WAS TRAVELING WEST BOUND AT
					ABOUT 630PM IN THE EVENING, ON A FOUR LANE CITY ROAD WITH A CENTER TURN LANE. I WAS
					IN MY LANE AND FAILED TO STOP BEFORE HITTING THE CAR IN FRONT OF ME. MY WIFE SPOKE
					WITH THE REPAIR SHOP CLERK WHO INFORMED THAT THIS WAS A COMMON ISSUE WITH MANY
					EQUINOX'S UNDER THE SAME CONDITIONS. I BELIEVE THE AIR BAGS SHOULD HAVE GONE OFF AND
10949808	CHEVROLET	EQUINOX	2011	2017-01-31	THEREFORE I
					JUNE 9, 2017 AT 10:00 PM I HIT A DEER ON SOUTH DAKOTA HWY 11 IN LINCOLN COUNTY. THE
					SPEED LIMIT WAS 65 MPH AND I WAS GOING 68 MPH WHEN I HIT THE DEER HEAD ON. I DROVE
					OVER TO THE SIDE OF THE ROAD AND THE VEHICLE STOPPED. AFTER A FEW MINUTES MY WIFE
					AND I SMELLED BURNING ELECTRICAL WIRE. WE GOT OUT OF THE CAR AND STARTED TO WALK
					AWAY AND WITHIN 10 MINUTES THE WHOLE THING WENT UP IN FLAMES. THE CAR WAS TOTALED
					AND THE AIRBAGS DID NOT GO OFF. IF WE WOULD HAVE WENT IN THE DITCH AND BEEN
					UNCONSCIOUS WE WOULD HAVE BURNT UP WITH THE VEHICLE. THERE IS NO REASON THAT
					VEHICLE SHOULD HAVE STARTED ON FIRE. GMC WILL NOT ACKNOWLEDGE THAT THERE WAS
11010876	CHEVROLET	EQUINOX	2011	2017-06-09	ANYTHING WRONG WITH THE VEHICLE.
					VECHICAL WAS INVOLVED IN A CRASH, REAR ENDED ANOTHER VEHICLE, VECHICAL WAS TOTALED.
11189908	CHEVROLET	EQUINOX	2011	2019-03-08	AIRBAGS NEVER WENT OFF. ON A HIGHWAY ABOUT 50-60 MPH.
					MY VEHICLE WAS FORCED OFF THE ROAD BY ANOTHER VEHICLE CAUSING MY VEHICLE TO HIT A
10607261	CHEVROLET	SILVERADO	2011	2014-02-14	LIGHT POLE HEAD ON. NO AIR BAGS DEPLOYED. DRIVER AND PASSENGER SUFFERED INJURY. *TR

10487443	CHEVROLET	ТАНОЕ	2011	2012-12-02	I WAS DRIVING WEST ON RIO RD. IN CHARLOTTESVILLE, VA, AT ROUGHLY 35 MPH. AT APPROXIMATELY 6:00 PM, A DEER EMERGED FROM THE PASSENGER SIDE OF THE VEHICLE. IT HAPPENED INSTANTANEOUSLY AND AVOIDING THE DEER WAS NOT AN OPTION. IMMEDIATELY AFTER STRIKING THE DEER AT THE FRONT RIGHT BUMPER (UNDERNEATH HEADLIGHT), THE SIDE AIRBAGS DEPLOYED IN MY 2011 CHEVY TAHOE. HOWEVER, THE AIRBAG THAT WAS SUPPOSE TO DEPLOY FROM THE DRIVERS SEAT (ON THE SIDE NEAR SEATBELT) DID NOT DEPLOY. ADDITIONALLY, THE FRONT TWO AIRBAGS (FROM STEERING WHEEL AND DASHBOARD) DID NOT DEPLOY AS WELL. MOREOVER, APPROXIMATELY THREE MONTHS BACK, ANOTHER FAMILY MEMBER ALSO HIT A DEER WITH THE SAME VEHICLE (2011 CHEVY TAHOE) AND AT THAT TIME NO AIRBAGS DEPLOYED. IN THIS INCIDENT THE VEHICLE WAS TRAVELING 70 MPH AND THE DEER STRUCK THE LEFT SIDE OF THE FRONT BUMPER AND NO AIRBAGS DEPLOYED. AT THE TIME, WE DIDN'T EVEN THINK ABOUT DEFECTIVE AIRBAGS, BUT NOW, WE ARE VERY, VERY CONCERNED THAT THERE'S A DEFECT. WE SIMPLY DO NOT KNOW WHAT TO DO. I HAVE CONTACTED CHEVROLET DIRECTLY AND THEY ASSURE ME SOMEONE WILL COME OUT AND LOOK AT THE VEHICLE THIS WEEK SOMETIME. I WOULD BE RELIEVED IF SOMEONE FROM THE NHTSA ALSO INVESTIGATES THESE TWO SCENARIOS. WHAT IS CHEVROLET'S RESPONSIBILITY TO ME AND MY FAMILY IN THESE TWO CASES? AND WHAT IS THE BEST COURSE OF ACTION? FURTHERMORE, I CAN ARRANGE FOR MY INSURANCE ADJUSTOR TO GATHER ANY DOCUMENTATION FROM THE FIRST INCIDENT (WHERE AIRBAGS DID NOT DEPLOY) SUCH AS PHOTOS, REPORTS AND PROVIDE THEM TO YOU. THE VEHICLE IS SITTING IN MY DRIVEWAY BECAUSE I AM WAITING FOR A CHEVROLET REPRESENTATIVE TO COME AND INSPECT IT. I WOULD APPRECIATE YOUR PROMPT ACTION IN THIS MATTER. THANK YOU! *TR
10586298		TRAVERSE	2011	2011-05-31	I WAS GOING STRAIGHT AT 40 MPH (CONFIRMED BY GM ENGINEER). ANOTHER VEHICLE TURNED IN FRONT OF ME AND THERE WAS A T-BONE STYLE OF ACCIDENT. THE OTHER CAR WAS TOTALED AND MINE TOOK ABOUT \$18000 OF DAMAGE. NONE OF MY AIRBAGS DEPLOYED. I COMPLAINED TO GM, THEY SENT AN ENGINEER OUT TO LOOK AT THE VEHICLE BEFORE IT WAS REPAIRED TO ASSESS AND THEY SAID THAT THE AIRBAGS NOT DEPLOYING MEANT THAT THEY FUNCTIONED CORRECTLY. THE ENGINEERS REPORT SAID AT THE MOMENT OF IMPACT, MY CAR WAS TRAVELING 40MPH, AND I HAVE A HARD TIME BELIEVING THAT THE AIRBAGS WOULDN'T DEPLOY UNDER ANY CIRCUMSTANCES WHILE THE VEHICLE IS TRAVELING 40MPH. *TR
11113909	CHEVROLET	TRAVERSE	2011	2018-07-16	AIR BAGS DO NOT COME OUT IN HIGHWAY IMPACT OF 70 MILES PER HOUR.
10794590	GMC	TERRAIN	2011	2015-11-12	TL* THE CONTACT OWNS A 2011 GMC TERRAIN. WHILE DRIVING APPROXIMATELY 55 MPH, THE CONTACT CRASHED INTO THE SIDE OF ANOTHER VEHICLE THAT VEERED INTO THE CONTACT'S LANE. THE AIR BAGS FAILED TO DEPLOY. THERE WERE MINOR INJURIES THAT DID NOT REQUIRE MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO A TOW YARD. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 70,000UPDATED 04/01/16 *BF *CN
10851422	GMC	TERRAIN	2011	2016-01-15	TL* THE CONTACT OWNS A 2011 GMC TERRAIN. WHILE DRIVING 55 MPH, THE CONTACT FELL ASLEEP CRASHED INTO THE REAR OF ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT SUSTAINED INJURIES TO THE SPINE, WHICH REQUIRED MEDICAL ATTENTION. THERE WERE NO INJURIES SUSTAINED TO THE DRIVER OF THE OTHER VEHICLE. THE VEHICLE WAS TOWED TO AN INDEPENDENT MECHANIC. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 62,000.
11166326	GMC	TERRAIN	2011	2019-01-04	MY 2011 GMC TERRAIN HIT A VEHICLE IN FRONT, CAUSING MAJOR DAMAGE (THE VEHICLE IS TOTALED OUT) AND NO AIR BAGS DEPLOYED. MY VEHICLE WAS TRAVELING AT APPROXIMATELY 55 MPH NORTHBOUND IN THE #3 LANE OF THE 41 FREEWAY, SOUTH OF THE SHAW EXIT. IMPACT WAS ESTIMATED TO BE BETWEEN 20 TO 30 MPH. THE DRIVER, MY 18 YEAR GRAND-DAUGHTER HIT HER HEAD ON THE STEERING WHEEL AND HER LEFT WRIST WAS INJURED HOLDING ON TO THE STEERING WHEEL. THE 18 YEAR OLD FEMALE RIGHT FRONT SEAT PASSENGER SUFFERED AN ANKLE INJURY. WHY DID THE AIR BAGS FAIL TO DEPLOY, WITH A STRAIGHT ON FRONT END COLLISION WITH THE VEHICLE IN FRONT?! UNACCEPTABLE!!!
10732291	CADILLAC	SRX	2010	2015-06-22	HIT HEAD ON BY TRUCK GOING APPROX. 45 MPH THAT SWERVED INTO MY CENTER TURN LANE. FRONT END DEMOLISHED - CAR WAS TOTALED - BUT AIR BAGS DID NOT DEPLOY. SEAT BELT DID NOT LOCK ON IMPACT. SIDE OF MY HEAD HIT DRIVER'S WINDOW OR FRAME - WAS CATAPULTED FORWARD AND CAUGHT IN SEAT BELT WHEN IT PULLED OUT ALL THE WAY, RESULTING IN HORRIFIC AND PAINFUL CHEST, ABDOMEN AND LEFT LEG INJURIES (SOFT TISSUE).
10027215	CADILLAC	CDY	2010	2016-11 15	I WAS IN A MINOR COLLISION. RAN INTO THE BACK OF SOMEONE. MY AIRBAGS DIDN'T DEPLOY AND MY ENGINE IMMEDIATELY CAUGHT ON FIRE AND IN A FEW MINUTES MY WHOLE CARE WAS ON FIRE AND DESTROYED. THERE WAS NO KNOWN PEASON HOW OF WHY THE FIRE STAPTED.
10927215	CADILLAC	SRX	2010	2016-11-16	ON FIRE AND DESTROYED. THERE WAS NO KNOWN REASON HOW OR WHY THE FIRE STARTED.  I WAS IN A CAR ACCIDENT ALONG WITH TWO OTHER PASSENGERS AND NONE OF THE AIR BAGS
11053454	CADILLAC	SRX	2010	2017-12-02	DEPLOYED

	1		1	1	
10383428	CHEVROLET	EQUINOX	2010	2011-01-17	ON JAN 17TH,2011 MY VEHICLE WAS WRECKED BY THE DEALER ON SITE OF DEALERSHIP. THE WHOLE FRONT END WAS CAVED IN ON CENTER. THE DRIVER A MECHANIC AT DON WOODS CHEVROLET WAS DRIVING AT A HIGHER THEN NORMAL SPEED. HE HIT A POLE DEAD CENTER AND THE AIR BAG DID NOT DEPLOY. THE DRIVER WAS INJURED TO WHAT EXTENT I AM NOT SURE, BUT I AM NOT WANTING THIS CAR BACK FEELING THE AIRBAG MAY DEPLOY AT ANYTIME DUE TO THE HIT IT TOOK OR IT ISN'T SAFE AND WILL NOT DEPLOY UPON AN ACCIDENT. *TR
					AS I APPROACHED AN INTERSECTION, I HIT THE REAR END OF A FORD 150 PICK UP TRUCK THAT WAS IN THE INTERSECTION WAITING TO MAKE A LEFT TURN. MY APPROX SPEED WAS 15 MILES PER HOUR. I HAD MY SEATBELT ON, I WAS TAKEN BY AMBULANCE TO THE HOSPITAL - MY EVALUATION REVEALED SPRAIN/STRAIN TO MY NECK, FRACTURED RIGHT ANKLE, AND CHEST WALL
10460416	CHEVROLET	EQUINOX	2010	2012-05-18	DISCOMFORT RELATED TO THE SEAT BELT. THE CAR WAS TOTALED THE AIRBAG DID NOT DEPLOY. *TR
					TL* THE CONTACT OWNS A 2010 CHEVROLET EQUINOX. THE CONTACT STATED THAT WHILE TRAVELING 15 MPH, ANOTHER DRIVER CRASHED INTO THE FRONT DRIVER'S SIDE CORNER OF THE VEHICLE. THE COLLISION CAUSED THE CONTACT TO THEN CRASH INTO A UTILITY POLE. THE AIR BAGS FAILED TO DEPLOY. THE POLICE ARRIVED AND A REPORT WAS FILED. THE CONTACTS INSURANCE COMPANY INSPECTED THE VEHICLE AND ADVISED THE CONTACT THAT THE AIR BAGS SHOULD HAVE DEPLOYED UPON IMPACT. THE CONTACT SUSTAINED A FRACTURED RIB AND INJURY TO THE HEAD. THE VEHICLE WAS DESTROYED. THE FAILURE AND THE CURRENT MILEAGE WAS
10508670	CHEVROLET	EQUINOX	2010	2013-03-25	42,000. *TR
10746722	CHEVROLET	EQUINOX	2010	2015-07-08	I WAS DRIVING IN TRAFFIC WHEN THE CAR IN FRONT OF ME STOPPED ABRUPTLY IN FRONT OF ME. I READ ENDED HIM GOING ABOUT 40 MILES PER HOUR. MY AIR BAGS DID NOT INFLATE. I EXITED THE CAR AND BEGAN SPEAKING WITH THE OTHER DRIVER WHEN WE HEARD A POP IN MY CAR. SMOKE STARTING COMING OUT OF THE ENGINE COMPARTMENT AND THEN ALMOST IMMEDIATELY MY CAR ENGINE CAUGHT ON FIRE. THE CAR WAS NOT RUNNING. I INJURED MY KNEE AND SHOULDER IN THE INCIDENT.
					TL* THE CONTACT OWNED A 2010 CHEVROLET EQUINOX. WHILE DRIVING 35 MPH, THE CONTACT ATTEMPTED TO AVOID HITTING A DEER AND STRUCK THE GUARDRAIL. THE AIR BAGS FAILED TO DEPLOY. THE EMERGENCY ONSTAR SYSTEM RESPONDED AND CALLED THE POLICE AND AMBULANCE. THE VEHICLE WAS TOWED TO A COLLISON CENTER WHERE THE VEHICLE WAS DIAGNOSED AS DESTROYED. THE CONTACT SUSTAINED INJURIES TO THE HEAD, NECK, BACK, AND HANDS. A POLICE REPORT WAS FILED. THE MANUFACTURER WAS NOTIFIED. THE APPROXIMATE
10809547	CHEVROLET	EQUINOX	2010	2015-12-08	FAILURE MILEAGE WAS 57,000.
10928817	CHEVROLET	EQUINOX	2010	2016-11-25	AIRBAGS DID NOT DEPLOY WHEN INVOLVED IN CAR ACCIDENT ON 11/25/2016  LETTER FROM CONGRESSMAN WITTMAN ON BEHALF OF CONSTITUENT RE AIRBAGS THAT DID NOT
10649152	CHEVROLET	SILVERADO	2010	2013-11-14	DEPLOY. *SMD 2010 CHEVROLET SILVERADO. THE CONSUMER WAS INVOLVED IN AN ACCIDENT.  AS A RESULT, SHE SUSTAINED A BRAIN INJURY.*JB
10315713		TRAVERSE	2010	2010-02-25	1. STOPPED AT RED LIGHT IN 2010 CHEVROLET TRAVERSE SUV AND REAR ENDED BY A NISSAN FRONTIER PICK UP TRUCK TRAVELING AT A HIGH RATE OF SPEED. DRIVER'S SEAT BELT ON BUT DRIVER'S HEAD THROWN AGAINST WINDSHIELD AND THEN DRIVER'S BODY SLAMMED AGAINST THE BACK OF THE DRIVER'S SEAT WHICH WAS FORCED BACK TO A RECLINING POSITION. AIRBAG DID NOT DEPLOY. 2. SEAT BELT FAILED TO PREVENT DRIVER'S HEAD FROM HITTING WINDSHIELD IF IT IS SUPPOSED TO IN THIS TYPE OF COLLISION. DID THE SEAT BACK ACT PROPERLY IN SUCH A COLLISION? WAS THE AIRBAG SUPPOSED TO DEPLOY IN THIS TYPE OF COLLISION. 3. IN BODY SHOP TO REPAIR TO PRE-ACCIDENT CONDITION *TR
					WAS GETTING READY TO PARK ON THE STREET WHEN A CAR HIT ME,I HIT A CAR IN FRONT OF ME,MY CAR WAS THROWN ON THE SIDE WALK,I WAS PASS OUT FOR A FEW SECONDS,BUMP MY
10637484	CHEVROLET	TRAVERSE	2010	2010-07-19	HEAD, MY CAR WAS TOTAL, FRONT AND REAR, SURPRISINGLY MY AIR BAG DID NOT DEPLOY TO HELP PROTECT ME FROM MY INJURIES I GOT. *TR
					TL* THE CONTACT OWNS A 2010 CHEVROLET TRAVERSE. WHILE DRIVING AT AN UNKNOWN SPEED ATTEMPTING TO MAKE A LEFT TURN, ANOTHER VEHICLE CRASHED INTO THE CONTACTS VEHICLE. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED UNKNOWN INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO A SALVAGE YARD. THE VEHICLE WAS NOT DIAGNOSED OR REPAIRED. THE APPROXIMATE FAILURE MILEAGE
10749869	CHEVROLET	TRAVERSE	2010	2015-08-06	WAS 75,000.
11210243	CHEVROLET	TRAVERSE	2010	2018-12-01	TL* THE CONTACT OWNS A 2010 CHEVROLET TRAVERSE. WHILE DRIVING 30 MPH, THE VEHICLE WAS HIT BY ANOTHER VEHICLE COMING FROM THE OPPOSITE DIRECTION AS IT WAS MAKING A TURN INTO A PARKING LOT. THE CONTACT WAS INJURED BUT NOT TRANSPORTED BY AMBULANCE TO A HOSPITAL SHE WENT TO THE DOCTOR THE SAME DAY DAY. A POLICE REPORT WAS FILED THE VEHICLE WAS TOTALED AND TOWED AWAY TO A SALVAGE LOT. THE FRONTAL AIR BAGS DID NOT DEPLOY DURING THE CRASH.THE FAILURE MILEAGE WAS 103,000. TF
					INVOLVED IN A 21 CAR PILE UP IN THE UPPER PENINSULA DURING A COMPLETE WHITE OUT. WE WERE ONLY TRAVELING APPROXIMATELY 25 MILES PER HOUR BUT, WE DID HAVE SERIOUS IMPACT IN THE FRONT, AFTER HITTING A TRAILER AND ALSO SERIOUS IMPACT FROM BEHIND WHEN HIT BY A TRUCK AND TRAILER. NO AIRBAGS DEPLOYED. THE TRUCK TRAVELING AHEAD OF US, THAT WE HIT, THE AIRBAGS DID DEPLOY. MY FATHER AND BROTHER, WHO WERE ALSO BOTH DRIVING CHEVY TRUCKS, AND ALSO HAD SERIOUS FRONT END DAMAGE DURING THE SAME ACCIDENT, THEIR
10574295	GMC	TERRAIN	2010	2014-02-21	AIRBAGS DID NOT DEPLOY EITHER. *TR

TL* THE CONTACT OWNED A 2010 GMC TERRAIN. WHILE	•
INTO THE REAR OF ANOTHER VEHICLE AND THE AIR BAGS WAS FILED. THE CONTACT SUSTAINED FACIAL INJURIES TI VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NO	S FAILED TO DEPLOY. A POLICE REPORT THAT REQUIRED MEDICAL ATTENTION. THE OT NOTIFIED OF THE FAILURE. THE VIN
10810541 GMC TERRAIN 2010 2015-12-05 WAS INVALID. THE APPROXIMATE FAILURE MILEAGE WAS GOT INTO A MAJOR ACCIDENT TWO CARS RAN INTO MY	
AND THE AIR BAGS DID NOT COME ON TO PREVENT THAT	
10547172 BUICK ENCLAVE 2009 2009-08-16 THAT STATES THIS. *TR	
I HAD PASSED OUT WHILE DRIVING TO WORK DUE TO LO VEHICLE CRASHED INTO A STRUCTURE AT APPROXIMATE	
10572633 CHEVROLET EQUINOX 2009 2014-03-11 EVER DEPLOYED. I WAS TRANSPORTED TO THE HOSPITAL	·
TL* THE CONTACT OWNS A 2009 CHEVROLET SILVERADO TRAVELING APPROXIMATELY 35 MPH AND APPROACHING ABNORMALLY VEERED OFF THE ROAD. THE VEHICLE PROG WENT AIRBORNE OVER AND EMBANKMENT BEFORE CRA NOT DEPLOY UPON IMPACT AND THE CONTACT SUSTAIN CONTACT WAS TRANSPORTED TO THE HOSPITAL VIA AMI FILED ACCORDINGLY. THE VEHICLE WAS TOWED TO A CHI 10331539 CHEVROLET SILVERADO 2009 2010-04-19 FAILURE WAS 13,800 UPDATED 7/16/10 *CN UPDATED	G AN INTERSECTION, THE VEHICLE DEED TO TRAVEL OFF THE ROADWAY AND ASHING INTO A DITCH. THE AIR BAGS DID NED MODERATE TO SEVER INJURIES. THE NEULANCE AND A POLICE REPORT WAS NEVROLET DEALER FOR REPAIRS. THE
TL* THE CONTACT OWNS A 2009 CHEVROLET SILVERADO DRIVING 55 MPH, HE FELL ASLEEP AND LOST CONTROL O INTO A CEMENT WALL AND THE FRONT DRIVERS AIR BAG SUFFERED HEAD INJURIES DURING THE CRASH. THE VEHIL INVESTIGATED THE FAILURE AND CONCLUDED THAT THE	OF THE VEHICLE. THE VEHICLE CRASHED G DID NOT DEPLOY. THE CONTACT ICLE WAS REPAIRED. THE MANUFACTURER E AIR BAG PERFORMED AS DESIGNED. THE
10447821 CHEVROLET SILVERADO 2009 2011-10-13 FAILURE MILEAGE WAS 46,000 AND THE CURRENT MILEA	AGE WAS 55,000.
2009 CHEVY SILVERADO LOST TRACTION ON HIGHWAY D VEHICLE SPUN OUT AND HIT A METAL ROPED FENCE HEA MEDIAN AND SLAMMED THE FRONT END OF VEHICLE INT FROM GOING INTO ON COMING TRAFFIC. THE VEHICLES DIRECTLY IN THE CENTER CAUSING A WEDGE INTO THE R OF THE FRAME. THE IMPACT WAS VERY LOUD AND SOLIE STAND ON THE FRONT OF VEHICLE, SLAMMING THE BAC WITH GREAT FORCE. THE AIRBAG DIDN'T DEPLOY WHICH THE PLACE THE VEHICLE WAS HIT IN, MAKES ME VERY CO VEHICLE. MY 5 YEAR OLD SON SAID HIS RIGHT ARM WAS WITH IN THE HOUR OF HAVING THE ACCIDENT MYSELF EI NECK AND A VERY SOAR AND BRUISED BACK, I WAS RELE. CONSIDER MYSELF LUCKY. PLEASE LET ME KNOW IF ANY SITUATION AND THE SAFETY OF MYSELF AND MY SON. **	AD ON AND ALSO WENT ACROSS THE TO A GUARD RAIL STOPPING IT INSTANTLY S DAMAGE WAS ON THE FRONT END RADIATOR, ENGINE AND BENT THE FRONT ID. THE IMPACT CAUSED THE TRUCK TO CK END OF THE VEHICLE ON THE GROUND H AT THE SPEED OF AROUND 60 MPH AND DINCERNED ON THE SAFETY OF THIS S HURTING AFTER THE ACCIDENT AND ENDED UP IN THE HOSPITAL WITH A STIFF EASED WITH MINOR INJURIES AND I
TL* THE CONTACT OWNS A 2009 CHEVROLET SUBURBAN WIFE WAS DRIVING AT A LOW RATE OF SPEED, SHE ATTEI HIT BY A CAR COMING FROM THE OPPOSITE SIDE. THE AIT THE DRIVER WAS TREATED FOR WHIPLASH AND MULTIPL WOULD REQUIRE SURGERY. A POLICE REPORT WAS NOT THE VEHICLE HOME AFTER THE ACCIDENT. THE CONTACT INCLUDED IN NHTSA CAMPAIGN NUMBER: 16V381000 (A THE REPAIR WERE UNAVAILABLE. THE DEALER NOR THE N THE FAILURE. THE VEHICLE HAD YET TO BE REPAIRED. THI	EMPTED TO MAKE A LEFT TURN AND WAS IR BAGS DID NOT DEPLOY UPON IMPACT. LE BULGED DISKS IN HER BACK WHICH FILED. THE DRIVER WAS ABLE TO DRIVE T STATED THAT THE VEHICLE HAD BEEN AIR BAGS); HOWEVER, THE PARTS TO DO MANUFACTURER HAD BEEN NOTIFIED OF
TL* THE CONTACT OWNED A 2009 CHEVROLET TRAILBLAZ CONTACT'S VEHICLE REAR ENDED ANOTHER VEHICLE. IN STRUCK BY A SEMI-TRUCK. THE AIR BAGS DID NOT DEPLO CONTACT SUSTAINED INJURIES TO THE HEAD, KNEES, AN ATTENTION. THE VEHICLE WAS DESTROYED AND TOWED. 10944639 CHEVROLET TRAILBLAZER 2009 2017-01-06 AWARE OF THE CRASH. THE FAILURE MILEAGE WAS 135,(	TURN, THE CONTACT'S VEHICLE WAS DY. A POLICE REPORT WAS FILED. THE ID ARMS, WHICH REQUIRED MEDICAL D. THE MANUFACTURER WAS NOT MADE
11184731 CHEVROLET TRAILBLAZER 2009 2019-02-22 TRAVELING ON HIGHWAY APPLIED BRAKES AND HIT CAR  TL*THE CONTACT OWNS A 2009 CHEVROLET TRAVERSE. T  DRIVING 35 MPH AND THE VEHICLE CRASH INTO THE RA	THE CONTACT APPLIED THE BRAKES WHILE AR END OF THE VEHICLE IN FRONT. THE AIR
BAG DID NOT DEPLOY. THE CONTACT SUFFERED A FRACT STEERING WHEEL. THE CONTACT STATED THAT THE SEAT	FBELT DID NOT LOCK DURING THE CRASH.
THE CONTACT WAS TAKEN TO THE HOSPITAL. THE MANU	JFACTURER STATED THAT THEY WILL T. THE FAILURE MILEAGE WAS 30,000.

	1		1		1
10501339	CHEVROLET	TRAVERSE	2009	2013-02-22	TL* THE CONTACT OWNS A 2009 CHEVROLET TRAVERSE. THE CONTACT STATED THAT WHILE DRIVING APPROXIMATELY 55 MPH, CRASHED INTO A HIGHWAY BARRIER WHILE ATTEMPTING TO AVOID CRASHING INTO ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. THE VEHICLE WAS TOWED TO A SALVAGE YARD. THE POLICE REPORTED TO THE SCENE AND A REPORT WAS FILED. THE CONTACT WAS TRANSPORTED TO THE HOSPITAL VIA AMBULANCE FOR TREATMENT OF INJURIES TO THE BACK. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE VEHICLE WAS NOT REPAIRED. THE VIN WAS NOT AVAILABLE. THE APPROXIMATE FAILURE MILEAGE WAS 48,000.
10620828	GMC	ACADIA	2009	2014-07-12	TL* THE CONTACT OWNS A 2009 GMC ACADIA. THE CONTACT STATED WHILE DRIVING 20 MPH THE FRONT PASSENGER SIDE TIRE BLEW AND THE CONTACT LOST CONTROL OF THE VEHICLE, CRASHING INTO A TWO FOOT DITCH. THE VEHICLE THEN WENT THROUGH A ROW OF HEDGES AND CRASHED INTO A TREE ON THE DRIVER'S SIDE. THE SEAT BELT DID NOT RESTRAIN THE CONTACT AND THE AIR BAGS DID NOT DEPLOY. THE REAR SEATS COLLAPSED AS WELL. THE CONTACT SUSTAINED A SEVERE CONCUSSION FROM HITTING HER HEAD ON THE WINDSHIELD, BRUISED LEGS, ARM, FRACTURED NOSE, AND BRUISING TO THE FACE. THE CONTACT WAS FOUND LYING OVER THE CONSOLE AND WAS TAKEN TO THE EMERGENCY ROOM. A POLICE REPORT WAS NOT FILED. THE VEHICLE WAS TOWED TO A COLLISION SHOP. THE CONTACT LATER RECEIVED NOTIFICATION OF NHTSA RECALL CAMPAIGN NUMBER 14V266000 (SEAT BELT) HOWEVER, THE PART NEEDED FOR THE REPAIR WAS NOT AVAILABLE. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 120,000.
11308898	GMC	ACADIA	2009	2020-02-07	I WAS DRIVING ON THE MAIN HIGHWAY GOING 35MPH AND ANOTHER VEHICLE PULLED OUT I FRONT OF ME CAUSING ME TO HIT HER WITH MY FRONT END. MY AIRBAGS NEVER DEPLOYED BUT MY SERVICE AIRBAGS LIGHT IS ON AS WELL AS THE MESSAGE ON MY BOARD.
10966352	GMC	YUKON	2009	2017-03-13	TL* THE CONTACT OWNS A 2009 GMC YUKON. WHILE DRIVING 35 MPH, THE CONTACT CRASHED INTO THE DRIVER'S SIDE DOOR OF ANOTHER VEHICLE, WHICH THEN ROLLED OVER. THE AIR BAGS FAILED TO DEPLOY. THERE WERE NO WARNING INDICATORS ILLUMINATED. THE CONTACT SUSTAINED INJURIES TO THE LEFT FOOT, LEFT KNEE, A CONCUSION, CHEST PAINS, AND A BLACK EYE. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO A DEALER WHERE THE FAILURE WAS DIAGNOSED. THE DRIVER OF THE OTHER VEHICLE ALSO SUSTAINED MINOR INJURIES. THE CONTACT HAD NOT RECEIVED NOTIFICATION OF NHTSA CAMPAIGN NUMBER: 16V381000 (AIR BAGS), WHICH WAS ASSOCIATED WITH THE VIN. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS 69,000.
11055457	BUICK	ENCLAVE	2008	2017-12-13	TL* THE CONTACT OWNS A 2008 BUICK ENCLAVE. WHILE DRIVING APPROXIMATELY 20 MPH, THE CONTACT LOST CONTROL AND CRASHED HEAD ON INTO ANOTHER VEHICLE. THE AIR BAGS DID NOT DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT SUSTAINED INJURIES TO THE HEAD, WHICH REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS TOWED TO THE CONTACT'S RESIDENCE. THE CONTACT WAS NOT SURE IF THE VEHICLE WAS DESTROYED. A LOCAL DEALER AND MANUFACTURER WERE NOT CONTACTED. THE VIN AND FAILURE MILEAGE WERE NOT AVAILABLE.
10632511		EQUINOX SILVERADO	2008	2014-05-14	TL* THE CONTACT OWNS A 2008 CHEVROLET EQUINOX. THE CONTACT STATED THAT WHILE DRIVING AT AN UNKNOWN SPEED, THE VEHICLE HYDRO-PLANED AND CRASHED. THE CONTACT MENTIONED THAT NONE OF THE AIR BAGS DEPLOYED. A POLICE REPORT WAS FILED AND INJURIES WERE SUSTAINED. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE. THE VEHICLE WAS INSPECTED AND THE TECHNICIAN STATED THAT THE AIR BAGS WERE NOT EXPECTED TO DEPLOY. THE FAILURE MILEAGE WAS 91,000. PAMUPDATED 09/25/14 *BF UPDATED 10/23/2014*LJ THE CONSUMER STATED THE KEY WAS STUCK IN THE IGNITION. UPDATED 12/08/14 *B UPDATED 12/28/15.*JB THE CONSUMER STATED GM CLAIMED TO HAVE INVESTIGATED THE CRASH AND STATED THE AIR BAG WAS NOT DESIGNED TO DEPLOY IN THE TYPE OF CRASH THE CONSUMER WAS INVOLVED IN. UPDATED 01/05/16.*JB UPDATED 06/02/16.*JB *JS TL* THE CONTACT OWNS A 2008 CHEVROLET SILVERADO. THE CONTACT LOST CONTROL OF THE VEHICLE AND CRASHED INTO A TREE. NEITHER THE DRIVER NOR THE PASSENGER SIDE AIR BAGS DEPLOYED. THE VEHICLE WAS DESTROYED AND THE CONTACT SUSTAINED HEAD AND BACK INJURIES. THE CONTACT DID CALL THE MANUFACTURER. THE FAILURE MILEAGE WAS 66,000. UPDATED 02/15/12*LJ UPDATED 02/24/12
10565014	CHEVROLET	SILVERADO	2008	2014-02-18	7:10 A.M. TUESDAY MORNING, I HIT BLACK ICE AND LOST CONTROL OF MY VEHICLE. I PROCEEDED TO SLIDE UNCONTROLLABLY ACROSS THE ROAD. I THEN HIT A CLIFF WITH THE FRONT END OF MY VEHICLE, ONCE I HIT THE THE CLIFF MY VEHICLE THEN FLIPPED IN THE AIR AND LANDED ON THE DRIVER SIDE OF THE VEHICLE. ONCE I HAD LANDED ON THE PAVEMENT, ANOTHER VEHICLE CAME ALONG PROCEEDING AT AROUND 45 MPH. THE VEHICLE PROCEEDED TO HIT THE HOOD OF MY VEHICLE. THE DRIVER HIT MY HOOD DIRECTLY WITH THE FRONT END OF HIS VEHICLE. DURING THE WHOLE INCIDENT, I HAD MY SEATBELT ON. ALSO IT WAS INDICATED THAT MY AIR BAGS WERE ONE AND FUNCTIONING CORRECTLY. THE VEHICLE ITSELF WAS TOTALED AND I SUSTAINED WHIPLASH, A SLIGHT CONCUSSION, SEVERE BRUISES AND CUTS, AND ALSO RECEIVED A CHIPPED TOOTH FROM HITTING THE STEERING WHEEL WITH MY FACE. *TR

					I WAS ON MY WAY HOME FROM WORK AFTER WORKING A VERY LONG DAY AND I FELL ASLEEP AT THE WHEEL AND WENT OFF THE SIDE OF 225. ALL I REMEMBER WAS WAKING UP IN BETWEEN TREES ABOUT TWO FEET AWAY FROM SIMS BAYOU. MY VEHICLE WAS TOTALED. NO AIR BAGS
10672875	CHEVROLET	SILVERADO	2008	2015-01-07	DEPLOYED. *TR  2008 CHEVY SILVERADO 4X4 WT. DRIVER SIDE AIRBAG DID NOT DEPLOY DURING CRASH. VEHICLE
					IMPACT WAS ON THE FRONT. A FATALITY OCCURRED DURING THIS CRASH. (PASSENGER IN OTHER
10678613	CHEVROLET	SILVERADO	2008	2015-01-16	VEHICLE) POINT OF IMPACT WAS FRONT OF SILVERADO INTO PASSENGER SIDE OF OTHER VEHICLE.  *TR
					TL* THE CONTACT OWNS A 2008 CHEVROLET SILVERADO. THE CONTACT STATED THAT THE AIR BAGS FAILED TO DEPLOY AFTER BEING INVOLVED IN A CRASH. THE SPECIFICS OF THE CRASH WERE NOT AVAILABLE. A POLICE REPORT WAS FILED AND THE DRIVER SUSTAINED INJURIES TO THE HEAD, THE NECK, AND THE BACK THAT DID NOT REQUIRE MEDICAL ATTENTION. THE VEHICLE WAS NOT DIAGNOSED OR REPAIRED. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE. THE
10681040	CHEVROLET	SILVERADO	2008	2015-01-21	FAILURE MILEAGE WAS 111,687.
10761080	CHEVROLET	SILVERADO	2008	2015-08-25	TL* THE CONTACT OWNED A 2008 CHEVROLET SILVERADO. WHILE DRIVING 65 MPH, THE CONTACT FELL ASLEEP BEHIND THE WHEEL AND THE VEHICLE DROVE OFF THE ROAD. THE CONTACT CRASHED INTO THE SUPPORT CABLES ON THE SIDE OF THE ROAD. THE CONTACT STATED THAT THE AIR BAGS DID NOT DEPLOY. A POLICE REPORT WAS FILED. THERE WERE NO INJURIES. THE VEHICLE WAS TOWED TO AN INDEPENDENT MECHANIC WHERE IT WAS DEEMED DESTROYED. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS 127,000.
					TISTUE CONTACT OWNIC A 2000 CHEVROLET TRAIL DI AZER, MUHIE PRIMING 25 ANDIL THE CONTACT
				2000 00 07	TL*THE CONTACT OWNS A 2008 CHEVROLET TRAILBLAZER. WHILE DRIVING 35 MPH, THE CONTACT WAS INVOLVED IN A HEAD-ON CRASH. THE ENTIRE FRONT END OF HIS VEHICLE WAS CRUSHED AND THE INSURANCE COMPANY DECLARED THE VEHICLE AS DESTROYED. THE SEAT BELTS PROPERLY RESTRAINED THE CONTACT, BUT THE AIR BAGS FAILED TO DEPLOY. THERE WERE NO
10261711	CHEVROLET	TRAILBLAZER	2008	2009-03-07	INJURIES, BUT A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 6,500.  THE VEHICLE LOST CONTROL ON BLACK ICE, THE STEERING WHEEL AND BRAKES LOCKED UP AND
10679071	CHEVROLET	TRAILBLAZER	2008	2015-01-18	THE TRAILBLAZER HIT A TREE.THE AIRBAG NEVER DEPLOYED. THE VEHICLE'S FRAME WAS BENT. THE SUV WAS CONSIDERED A TOTAL LOSS. THE VEHICLE PICKED UP A LITTLE MORE SPEED WHILE ON THE ICE, BUT NO MORE THAN 30 MPH. *TR
11143666	CHEVROLET	TRAILBLAZER	2008	2018-10-19	WAS TRAVELING 40 MPH AND WAS HIT HEAD ON BY ANOTHER VEHICLE. NONE OF THE AIR BAGS DEPLOYED. WAS ON A CITY STREET WITH A 40 MPH SPEED LIMIT. GOING STRAIGHT.
11324166	CHEVROLET	TRAILBLAZER	2008	2020-05-05	TL* THE CONTACT OWNED A 2008 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT HE CRASHED AND REAR ENDED INTO ANOTHER VEHICLE STOPPED AT A STOP LIGHT AT 53 MPH. THE CONTACT STATED THAT THE AIR BAGS FAILED TO DEPLOY AS WELL AS THE SEAT BELT PRETENSIONER FAILED TO ENGAGE. THE CONTACT SUSTAINED A SEVERE CONCUSSION & ALMOST BIT HIS TONGUE OFF WITH HIS HEAD SMASHING INTO THE WINDSHIELD. HE ALSO SUSTAINED CUTS AND BRUISES ON HIS LOWER BODY AND LEGS AND A BRUISED NECK. THERE WAS A PASSENGER IN THE OTHER VEHICLE THAT HAD TO BE TRANSPORTED TO THE HOSPITAL WITH INJURIES AS WELL. THE VEHICLE WAS TOTALED WITH THE WHOLE FRONT SMASHED IN UP TO THE WINDSHIELD. THE DEALER AND MANUFACTURER HAD NOT BEEN CONTACTED YET. THE FAILURE MILEAGE WAS 220,000. THE VIN WAS NOT AVAILABLE. *LN*JB
10615043	GMC	ACADIA	2008	2013-04-30	TL* THE CONTACT OWNS A 2008 GMC ACADIA. THE CONTACT STATED THAT WHILE DRIVING 50 MPH, THE VEHICLE WAS INVOLVED IN A FRONT END CRASH IN WHICH NO AIR BAGS DEPLOYED. A POLICE REPORT WAS FILED AND NO INJURIES WERE SUSTAINED. THE VEHICLE WAS TAKEN TO A DEALER. THE FAILURE MILEAGE WAS 113,000 AND THE CURRENT MILEAGE WAS 132,653.
11066850	GMC	ACADIA	2008	2015-08-21	MY WIFE FELL ASLEEP RAN OFF THE ROAD STRUCK A UTILITY POLE AND A LARGE DIRT EMBANKMENT. THE AIR BAGS DID NOT DEPLOY NOR DID THE BELT TENSIONERS, SHE HIT THE STEERING COLUMN SO HARD SHE IT BROKE THE COLUMN AND BROKE HER STERNUM. OUR GRANDDAUGHTER WAS IN THE FRONT PASSENGER SEAT THE AIR BAG NOR THE TENNSIONERS DEPLOYED RESULTING HER BACK BEING BROKEN IN TWO PLACES AND ALSO HER FOOT WAS BROKEN. I CONTACTED GENERAL MOTORS AND THEY SENT A MAN TO DOWNLOAD THE COMPUTER INFORMATION THEY SENT ME A COPY OF THE INFO AND LATER CONTACTED ME SAYING THE INFO SHOWED EVERYTHING WAS WORKING PROPERLY. PRYOR TO THE ACCIDENT I HAD THE AUTO IN FOR THE RECALL ON THIS PROBLEM. I ALSO HAD IT IN FOR ANOTHER RECALL FOR THE HEADLIGHTS AND THEY HAD TO REMOVE A LARGE PART OF THE FRONT TO DO THE REPAIR AND DONE A POOR JOB OF PUTTING IT BACK TOGETHER I RETURNED IT AND THEY FINALLY GOT IT RIGHT, IN THE MEAN TIME THE SERVICE AIR BAG LIGHT CAME ON AND THEY REPAIRED THAT.LATER AFTER THE ACCIDENT I WENT BACK TO THE DEALER AND QUESTIONED THE BODY SHOP MANAGER ABOUT PUTTING IT BACK TOGETHER PROPERLY AND THEN TOLD HIM ABOUT THE ACCIDENT THEN HE HAD NOTHING ELSE TO SAY. THE AUTO WAS A TOTAL LOSS AFTER A LENGTH OF TIME WIFE AND GRANDDAUGHTER GOT OUT OF HOSPITAL. THIS CAR WAS RECALLED FOR THIS VERY REASON. MY INSURANCE COMPANY PAID MY GRANDDAUGHTER \$95,000 FOR HER INJURIES AND COMMENTED THAT THEY WOULD PROBABLY SUE GM TO GET THAT BACK.

	1			1	1
11310375	GMC	ACADIA	2008	2015-11-26	VEHICLE WAS SOUTHBOUND ON COUNTY ROAD AND ATTEMPTED TO MAKE A RIGHT TURN AT THE INTERSECTION, WHEN THE CAR STRUCK THE SOUTH EMBANKMENT OF THE T INTERSECTION, AS DRIVER WAS UNABLE TO NAVIGATE THE TURN. NONE OF THE SIDE OR FRONT AIRBAGS IN THE CAR DEPLOYED AS A RESULT OF THE CRASH. I AM ALSO UNSURE IF THE SEAT BELT HAD OPERATED CORRECTLY (SEAT BELT WAS BEING WORN AT THE TIME OF THE CRASH). THE DRIVER'S HEAD HIT THE SIDE WINDOW AND AS A RESULT HE SUSTAINED A HEAD INJURY AND AN EYE INJURY RESULTING IN OPTIC NERVE DAMAGE AND COMPLETE LOSS OF VISION IN THE EYE. I UNDERSTAND THERE WERE PROBLEMS WITH THE AIRBAGS ON THESE VEHICLES WITH A POSSIBLE RECALL ISSUED. I DO HAVE ALL THE CORRESPONDING ACCIDENT REPORTS, MEDICAL REPORTS, ETC.
10667413	GMC	ENVOY	2008	2014-12-19	I WAS IN AN AUTO ACCIDENT ON A MAJOR HIGHWAY AND UPON CRASHING MY AIRBAG DIDN'T DEPLOY AND MY FACE SMASHED INTO THE STEERING WHEEL.
10007413	GIVIC	LIVOI	2000	2014 12 13	DELECT AND INTERCED SWADIED INTO THE STEERING WHELE.
	0.40	5111/01/	2000	2010 10 01	ON 10/24/2018 WHILE DRIVING MY 2008 GMC ENVOY SLT, I WAS INVOLVED IN A HEAD-ON
11143613	GMC	ENVOY	2008	2018-10-24	COLLISION WHICH RESULTED IN MY CAR BEING TOTALED. NONE OF MY AIR BAGS DEPLOYED.
11080754	GMC	YUKON XL	2008	2017-01-08	TL* THE CONTACT OWNS A 2008 GMC YUKON XL. WHILE DRIVING 65 MPH, THE CONTACT NOTICED THAT ANOTHER VEHICLE WAS SWERVING TOWARDS HER VEHICLE. THE CONTACT HAD TO DEPRESS THE ACCELERATOR PEDAL TO INCREASE SPEED AND AVOID A COLLISION; HOWEVER, THE OTHER VEHICLE LOST CONTROL AND CRASHED INTO THE CONTACT'S VEHICLE. THE FRONT FRAME, FRONT PASSENGER SIDE, AND REAR FRAME OF THE CONTACT'S VEHICLE WERE DAMAGED. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT WAS KNOCKED UNCONSCIOUS AND REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED FROM THE SCENE. THE CONTACT STATED THAT THE VEHICLE WAS INSPECTED BY A MECHANIC FRIEND WHO CONFIRMED THE AIR BAGS FAILED TO DEPLOY. THE VEHICLE WAS NOT REPAIRED. THE DEALER WAS NOT CONTACTED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE AND A CASE WAS OPENED. THE CONTACT STATED THAT THE CASE HAD CLOSED. THE APPROXIMATE FAILURE MILEAGE WAS 150,000.
					TL*THE CONTACT OWNED A 2007 CADILLAC ESCALADE. THE CONTACT FELL ASLEEP WHILE DRIVING AT AN UNKNOWN SPEED. THE VEHICLE STRUCK A DITCH, WENT AIRBORNE, AND ROLLED OVER SEVERAL TIMES. A POLICE REPORT WAS FILED. ALL FOUR WHEELS AND TIRES CAME OFF THE VEHICLE AND EACH WINDOW WAS BROKEN AND SMASHED. NONE OF THE EIGHT AIR BAGS DEPLOYED. THE CONTACT SUSTAINED A BROKEN COLLAR BONE, SHOULDER BONE, ROTARY CUP, AND A BROKEN HAND IN TWO PLACES. THE INSURANCE COMPANY STATED THAT THE VEHICLE WAS DESTROYED. CADILLAC HAS BEEN NOTIFIED AND WILL INSPECT THE VEHICLE. THE CURRENT
10207326	CADILLAC	ESCALADE	2007	2007-10-06	AND FAILURE MILEAGES WERE 28,000.
10226642	CADILLAC	ESCALADE	2007	2008-04-26	TL*THE CONTACT OWNS A 2007 CADILLAC ESCALADE. WHILE DRIVING 35 MPH IN THE RAIN, THE VEHICLE HYDROPLANED AND CRASHED INTO SEVERAL TREES. THE VEHICLE SPUN AROUND AND ENDED UP FACING THE OPPOSITE DIRECTION. THE AIR BAGS FAILED TO DEPLOY AND THE CONTACT WAS INJURED. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS UNKNOWN.  TL* THE CONTACT OWNS A 2007 CADILLAC ESCALADE. WHILE DRIVING SHE CRASHED INTO A TREE. THE ENTIRE FRONT-END OF THE VEHICLE WAS DAMAGED, AND NONE OF THE AIR BAGS DEPLOYED. CONSEQUENTLY SHE RECEIVED INJURIES TO HER NECK. A POLICE REPORT WAS FILED. ALSO THE FRONT BRAKE PADS FRACTURED WITHIN THE FIRST TWO MONTHS OF PURCHASING THE VEHICLE. THE BRAKE PADS WERE REPLACED UNDER THE SERVICE WARRANTY. THE FAILURE AND CURRENT MILEAGES WERE 58,000.
10317216	CHEVROLET		2007	2010-03-03	I WAS IN AN ACCIDENT WERE I STRUCK TWO HORSES THAT RUN OUT INTO THE HIGHWAY IN FRONT OF ME IN MY 2007 CHEVROLET EQUINOX LSI. THE FIRST HORSE STRUCK MY PASSENGERSIDE FRONT QUARTER PANEL AND THIS CAUSED ME TO SWERVE INTO ANOTHER HORSE ON THE DRIVER SIDE. I WAS TRAVELING AT APPROXIMATELY 50 MPH AND THE DAMAGE TO THE FRONT OF MY CAR WAS VERY SERIOUS AND MY COMPLAINT IS THAT THE AIRBAGS NEVER DEPLOYED DURING THE CRASH. I KNOW THAT THE AIRBAGS ARE SET OF BY SPECIFIC SPEEDS AND DAMAGE BUT MY WHOLE FRONT OF MY 2007 CHEVROLET EQUINOX LS WAS NEARLY REMOVED. I WAS WEARING MY SAFETY BELT AND IT OFFERED LITTLE HELP SINCE I WAS HIT TWICE FROM OPPOSITE SIDES. I WAS TOLD BY RESPONDING EMERGENCY CREW THAT THE AIRBAG MUST HAVE BEEN FAULTY SINCE IT DID NOT DEPLOY. *TR
					AUTOMOBILE ACCIDENT AT ROUGHLY 20 MILES AN HOUR IN A 2007 CHEVY EQUINOX MOSTLY
10370521	CHEVROLET	FOLINOY	2007	2010-12-13	FRONT END AND DRIVER SIDE DAMAGE. THE AIR BAGS DID NOT DEPLOY. MAJOR FRONT END DAMAGE SUSTAINED. *TR
11128142	CHEVROLET		2007	2018-05-28	TL* THE CONTACT OWNED A 2007 CHEVROLET EQUINOX. WHILE DRIVING 20 MPH, THE CONTACT CRASHED INTO A CONCRETE EMBANKMENT TO AVOID COLLIDING WITH ANOTHER VEHICLE. THE AIR BAG FAILED TO DEPLOY. THE CONTACT SUSTAINED INJURIES TO THE RIGHT SHOULDER AND LEFT ARM THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS NOT FILED. THE VEHICLE WAS DESTROYED AND TOWED TO A TOW LOT. THE CONTACT CALLED ALLEN TILLERY AUTO (LOCATED AT 4573 CENTRAL AVE, HOT SPRING, AR 71913, (501) 881-4160) AND WAS INFORMED THAT THE AIR BAG SHOULD HAVE DEPLOYED SINCE IT WAS JUST INSTALLED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE AND DID NOT ASSIST. THE APPROXIMATE FAILURE MILEAGE WAS 135,000.

				1	<u> </u>
10331536	CHEVROLET	SILVEDADO	2007	2007.09.07	TL* THE CONTACT OWNS A 2007 CHEVROLET SILVERADO. THE CONTACT STATED THAT WHILE TRAVELING APPROXIMATELY 35 MPH, A VEHICLE AHEAD OF HIM MADE AN UNEXPECTED LEFT TURN. THE CONTACT CRASHED INTO THE THE PRECEDING VEHICLE AND THE AIR BAGS DID NOT DEPLOY UPON IMPACT. THE CONTACT WAS INJURED AND A POLICE REPORT WAS FILED ACCORDINGLY. THE VEHICLE WAS TOWED TO A LOCAL DEALER WHERE UNKNOWN REPAIRS WERE MADE THE VEHICLE WAS TRADED IN. THE VIN WAS NOT AVAILABLE AND THE FAILURE MILEAGE WAS APPROXIMATELY 28 000 11 PRATED 07/19/10.* BE LIPDATED 07/21/10
10331536	CHEVROLET	SILVERADO	2007	2007-09-07	WAS APPROXIMATELY 28,000. UPDATED 07/19/10 *BF UPDATED 07/21/10  TI* THE CONTACT OWNS A 2007 CHEVROLET SILVERADO. THE CONTACT STATED THAT WHILE
10585572	CHEVROLET	SILVERADO	2007	2014-04-22	TL* THE CONTACT OWNS A 2007 CHEVROLET SILVERADO. THE CONTACT STATED THAT WHILE DRIVING 45 MPH, THE VEHICLE HYDRO PLANED AND THE CONTACT CRASHED INTO THE ROAD BARRIER. NO AIR BAGS DEPLOYED UPON IMPACT. THERE WERE FOUR INJURIES AND A POLICE REPORT WAS FILED. INJURY DETAILS WERE NOT AVAILABLE. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE AND CURRENT MILEAGE WAS 102,000.
					ON IMPACT TO FRONT END OF MY VEHICLE THE AIR BAGS DID NOT DEPLOY. THE AIR BAGS ON THE
10606814	CHEVROLET	SILVERADO	2007	2014-06-12	OTHER VEHICLE DID DEPLOY. HOW CAN I BE SURE MY AIRBAGS ARE FUNCTIONING PROPERLY. THERE IS ABOUT \$9,000 DAMAGE TO MY VEHICLE. I AM SENDINGAGAIN BECAUSE I AM NOT CERTAIN THE FIRST ONE WENT THROUGH. *TR
10608220	CHEVROLET	SILVERADO	2007	2012-08-17	VEHICLE WAS INVOLVED IN HEAD ON COLLISION THAT TOTALED IT. OTHER VEHICLE WAS AN OLDER MODEL VAN, DO NOT KNOW EXTENT OF DAMAGES TO IT. MY CONCERN IS THE AIR BAGS DID NOT DEPLOY WAS TOLD BY GM THAT CRASH DID NOT MEET CRITERIA FOR DEPLOYMENT!!!!! A HEAD ON COLLISION AT 50 MPH THAT TOTALED 2500 SERIES CHEVY TRUCK. HARD FOR ME TO BELIEVE I NOW OWN A 2008 CHEVY 1500 SERIES, DO I NEED TO CONCERNED? *TR
10649638	CHEVROLET	SILVERADO	2007	2014-09-29	TL* THE CONTACT OWNS A 2007 CHEVROLET SILVERADO 1500. THE CONTACT STATED THAT WHILE DRIVING APPROXIMATELY 15 MPH, THE VEHICLE CRASHED INTO A TREE CAUSING EXTENSIVE DAMAGE TO THE FRONT END. THE CONTACT INDICATED THAT DURING THE CRASH THE FRONT AIR BAGS DID NOT DEPLOY AND THE DRIVER SUFFERED INJURIES TO THE RIGHT KNEE, WHILE THE FRONT PASSENGER SUFFERED INJURIES TO BOTH KNEES AND HEAD. A POLICE REPORT WAS NOT FILED. THE VEHICLE WAS NOT DIAGNOSED OR REPAIRED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 95,000.
10512756	CHEVROLET	SUBURBAN	2007	2013-05-19	WE WERE DRIVING HOME WHEN A PERSON RAN A RED LIGHT AND HIT US. WE WERE CROSSING AN INTERSECTION ABOUT 15 MILES AN HOUR AND THEY HIT THE FRONT PART OF OUR SUBURBAN. EVERYTHING WAS DAMAGED THE HOOD, AND EVERYTHING INSIDE THE HOOD SUSTAINED DAMAGE. THERE WAS A LIQUID THAT WAS LEAKING BUT I AM UNAWARE OF THE SUBSTANCE. THE PERSON THAT HIT US MUST HAVE BEEN GOING ABOUT 40-60 MILES AN HOUR. AFTER THEY FLED THE SEEN POLICE MENTIONED THAT THEIR AIR BAGS WERE DEPLOYED. MY CONCERN WAS WHY OUR AIR BAGS DID NOT DEPLOY AS WELL. MY DAUGHTER AND I BOTH HIT OUR HEADS ON OUR SIDE WINDOWS. MY SON HAD SLIGHT INJURY MOSTLY FROM THE SEATBELT. MY SONS DOOR HAD TO BE OPENED FROM THE POLICE OFFICER ON THE SCREEN. MY BIGGEST CONCERN WAS ABOUT THE AIRBAGS AND ALSO THE ONSTAR DID NOT WORK AS WELL. *TR
					TL* THE CONTACT OWNS A 2007 CHEVROLET TAHOE. THE CONTACT STATED THAT THE VEHICLE
10400538	CHEVROLET	ТАНОЕ	2007	2010-03-19	WAS INVOLVED IN A FRONTAL CRASH WITH ANOTHER VEHICLE AT APPROXIMATELY 30 MPH BUT THE AIR BAGS DID NOT DEPLOY. THE DRIVER OF THE CONTACT'S VEHICLE AND A PASSENGER SUFFERED MINOR INJURIES. THE VEHICLE WAS DESTROYED AND A POLICE REPORT WAS FILED. THE CONTACT CALLED THE MANUFACTURER WHO TOOK A COMPLAINT BUT PROVIDED NO FURTHER ASSISTANCE. THE CURRENT AND FAILURE MILEAGES WERE UNKNOWN. THE VIN WAS UNAVAILABLE.
10659540	CHEVROLET	TAHOE	2007	2014-03-16	2007 CHEVROLET TAHOE. AIRBAG DEPLOYMENT FAILURE DURING AN ACCIDENT. *TA
10811111	CHEVROLET	TAHOE	2007	2014-04-17	TL* THE CONTACT OWNS A 2007 CHEVROLET TAHOE. THE CONTACT STATED THAT WHILE DRIVING 50 MPH, THE CONTACT BLACKED OUT AND CRASHED INTO THE GUARDRAIL. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED HEAD INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. ON ANOTHER OCCASIONS, WHILE MAKING A LEFT TURN AT 15 MPH, THE CONTACT CRASHED INTO ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED AND THERE WERE NO INJURIES REPORTED. THE CONTACT ALSO STATED THAT THERE WERE TWO LARGE CRACKS IN THE DASHBOARD AND A THIRD CRACK DEVELOPED AS A RESULT OF THE FIRST CRASH. THE VEHICLE WAS TAKEN TO A DEALER HOWEVER, THE DIAGNOSIS WAS UNKNOWN. THE VEHICLE WAS REPAIRED AFTER BOTH FAILURES. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS 120,000.
10821342	CHEVROLET	TAHOE	2007	2015-11-16	CRACKED DASH, POTENT HAZARD OF PLASTIC DASH PIECES BECOMING AIRBORNE SHRAPNEL IN THE EVENT OF CRASH WITH AIR BAGS DEPLOY. 2007 TAHOE DASH HAD SMALL 6 INCH CRACK AT THE 2 O CLOCK POSITION ON DRIVERS SIDE INSTRUMENT CLUSTER AND SMALL 1 INCH CRACK ON RIGHT SIDE OF PASSENGER SIDE AIRBAG. AFTER 25 MPH HEAD ON CRASH AIR BAGS DIDN'T DEPLOY BUT ADDITIONAL CRACKS HAVE APPEARED. NOW 10 X WORST. PICS WILL SHOW. DEALER DOESN'T WANT TO REPLACE NOR INSURANCE COMPANY.
					TAHOE WAS INVOLVED IN FRONT COLISION WITH ANOTHER VEHICLE AND BAGS DID NOT DEPLOY.
10854032	CHEVROLET	ТАНОЕ	2007	2016-03-31	BUMPER, HOOD DAMAGED. BUMPER METAL BRACKET PUSHED IN.TAHOE WAS TURNING LEFT ON LIGHT WHEN STRUCK BE ANOTHER VEHICLE LIKE HEAD ON.

10959039	CHEVROLET	ТАНОЕ	2007	2017-02-01	TL* THE CONTACT OWNS A 2007 CHEVROLET TAHOE. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT'S VEHICLE CRASHED INTO THE REAR OF A SECOND VEHICLE. DURING THE CRASH, THE FRONT END OF THE VEHICLE SUSTAINED SIGNIFICANT DAMAGE. THE AIR BAGS DID NOT DEPLOY. THE DRIVER SUSTAINED INJURIES TO THE BACK, SHOULDERS, ARMS, LEFT LEG, AND KNEE. THE PASSENGER SUFFERED INJURIES TO BOTH KNEES. MEDICAL ATTENTION WAS RECEIVED. A POLICE REPORT WAS FILED. THE CAUSE OF THE FAILURE WAS NOT DIAGNOSED. THE VEHICLE WAS NOT REPAIRED. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE VIN WAS NOT AVAILABLE. THE FAILURE MILEAGE WAS 100,000.
44365030		T.110	2007	2000 07.45	TL* THE CONTACT OWNED A 2007 CHEVROLET TAHOE. WHILE DRIVING 35 MPH, A 2012 NISSAN FRONTIER SIDESWIPED THE CONTACT'S VEHICLE. THE CONTACT VEERED OFF THE ROAD AND CRASHED INTO A LIGHT POLE. THE AIR BAGS DID NOT DEPLOY. THE CONTACT SUSTAINED HEAD, BACK, NECK, HAND, AND KNEE INJURIES. MEDICAL ATTENTION WAS RECEIVED. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO AN INDEPENDENT LOT. THE CONTACT CALLED PATTERSON HYUNDAI TYLER (3120 S SW LP, TYLER, TX 75701, (903) 561-2404) AND INFORMED THEM OF THE FAILURE. THE VEHICLE WAS NOT DIAGNOSED. THE MANUFACTURER WAS NOT CONTACTED. THE VEHICLE WAS DEEMED A TOTAL LOSS BY THE INSURANCE COMPANY. THE
11265920	CHEVROLET	TAHOE	2007	2019-07-16	FAILURE MILEAGE WAS 128,122.
10252163	CHEVROLET	TRAILBLAZER	2007	2008-09-24	ON 9/24/08 I WAS INVOLVED IN AN AUTO ACCIDENT WHERE MY 2007 CHEVROLET TRAILBLAZER'S AIRBAGS FAILED TO DEPLOY. MY VEHICLE IMPACTED ANOTHER WITH MY ENTIRE FRONT END AT APPROXIMATELY 45 MPH. MY TRAILBLAZER WAS TOTALED. NOT ONLY DID MY AIRBAGS FAIL TO DEPLOY, THE ONSTAR SYSTEM DID NOT AUTOMATICALLY GO OFF. I HAD TO HIT THE BUTTON TO SUMMON ASSISTANCE. WHEN WE ASKED THE DEALER ABOUT IT, THEIR RESPONSE WAS "SOMETIMES THEY GO OFF, SOMETIMES THEY DON'T" I SUSTAINED A BROKEN LEFT ARM, NUMEROUS BRUISES, A CUT ON MY ANKLE AND AN ANKLE SPRAIN. I ALSO INJURED MY BACK AND NECK WHICH IS REQUIRING ONGOING CARE. *TR
10202100	0.121110221	THE WEBEN LETT	2007	2000 03 2 .	AIRBAGS DID NOT DEPLOY IN CRASH IMPACT ESTIMATED AT APROX 60 MPH. VEHICLES AIRBAG
10289962	CHEVROLET	TRAILBLAZER	2007	2009-10-18	THAT DID NOT DEPLOY WAS A FRONTAL CRASH. T-BONED ANOTHER VEHICLE THAT PULLED OUT IN FRONT OF MENTIONED VEHICLE. *TR
10478475	CHEVROLET	TRAILBLAZER	2007	2012-05-14	TL* THE CONTACT OWNS A 2007 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT WHILE DRIVING 40 MPH, THE CONTACT CRASHED HEAD ON INTO ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT WAS TAKEN TO THE HOSPITAL FOR TREATMENT OF WHIPLASH AND EYE INJURIES. THE ENTIRE FRONT END OF THE VEHICLE WAS SEVERELY DAMAGED. THE POLICE WERE NOTIFIED AND A REPORT WAS FILED. THE MANUFACTURER WAS NOTIFIED AND A REPRESENTATIVE WAS SENT TO INSPECT THE VEHICLE, STATING THAT THE VEHICLE PERFORMED AS DESIGNED. THE VIN WAS UNKNOWN. THE FAILURE MILEAGE WAS 64,056.
10482863	CHEVROLET	TRAILBLAZER	2007	2012-05-13	TL* THE CONTACT OWNS A 2007 CHEVROLET TRAILBLAZER. THE CONTACT STATED HE WAS GETTING SICK WHILE DRIVING AND CRASH INTO ANOTHER VEHICLE. THE CONTACT STATED THAT THE AIR BAGS DID NOT DEPLOY. THE VEHICLE WAS NOT DESTROYED AND THERE WAS A POLICE REPORT FILED. THE CONTACT SUSTAINED A WHIPLASH INJURY AND SEVERE HEADACHE. THE MANUFACTURER WAS NOTIFIED WHO SENT A TECHNICIAN TO LOOK AT THE VEHICLE AND THEY STATED THAT THE AIR BAGS FUNCTIONED PROPERLY. THE FAILURE MILEAGE WAS 65,000. UPDATED 01/10/13*LJ UPDATED 1/11/13 *JS
10661436	CHEVROLET	TRAILBLAZER	2007	2014-12-01	TL* THE CONTACT OWNED A 2007 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 20 MPH, ANOTHER VEHICLE CRASHED INTO THE CONTACTS VEHICLE WHILE CROSSING AN INTERSECTION. THE AIR BAGS FAILED TO DEPLOY. THE VEHICLE WAS DESTROYED. IT WAS UNKNOWN IF ANY INJURIES WERE SUSTAINED OR IF A POLICE REPORT WAS FILED. THE MANUFACTURER WAS NOT NOTIFIED. THE FAILURE MILEAGE WAS 140,000. THE VIN WAS UNAVAILABLE.
10661920	CHEVROLET	TRAILBLAZER	2007	2014-11-12	TL* THE CONTACT OWNS A 2007 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT WHILE DRIVING AT APPROXIMATELY 20 MPH CROSSING AN INTERSECTION, ANOTHER VEHICLE CRASHED INTO THE CONTACTS VEHICLE AND THE AIR BAGS FAILED TO DEPLOY. THE VEHICLE WAS DESTROYED. NO INJURIES WERE REPORTED. THE MANUFACTURER WAS NOT NOTIFIED OF THE ISSUE. THE FAILURE MILEAGE WAS 140,000. THE VIN WAS UNAVAILABLE.
10664216	CHEVROLET	TRAILBLAZER	2007	2014-05-17	IT WAS RAINING AND WE WERE ON OUR WAY HOME DRIVING DOWN THE HIGHWAY AND HIT A WATER PUDDLE AND HYDROPLANED OF THE SIDE OF THE ROAD THE TRUCK CUT OFF AND SPENT AROUND HIT A TREE HEAD ON AND THE AIRBAGS DIDN'T DEPLOY. I WAS HOSPITALIZED WITH MULTIPLE INJURIES AND IM STILL SUFFERING. *TR
10715742	CHEVROLET	TRAILBLAZER	2007	2015-04-27	A VEHICLE WAS STOPPED IN FRONT OF ME AND I REAR ENDED THEM. I WAS GOING AROUND 44-55 MPH. AFTER I HIT THE OTHER CAR FROM BEHIND I CROSSED 2 LANES OF TRAFFIC AND WENT THRU A PRETTY DEEP DITCH. THE AIR BAGS DID NOT DEPLOY AT ALL. I SUSTAINED A CONCUSSION., SEVERAL HEAD LACERATIONS AND A FRACTURED LUMBAR SPINE.
10733714	CHEVROLET	TRAILBLAZER	2007	2015-07-04	SWERVED TO AVOID HITTING A DEER ALMOST HIT MAILBOXES SO SWERVED TO AVOID THEM. I SWERVED TO MUCH THAN IN MY CORRECTION HIT THE GAS INSTEAD OF THE BRAKE. I THAN HIT A TREE BETWEEN 45 - 50 MPH. MY AIRBAGS NEVER DEPLOYED.

10934884	CHEVROLET	TRAILBLAZER	2007	2016-12-07	I HAD MY CRUISE SET ON 55 MPH AND WAS HIT HEAD ON BY VW JETTA PULLING OUT TOWARD MY VEHICLE, THEN FORCED TO LEFT INTO A TELEPHONE POLE. AIRBAGS DIDN'T DEPLOY, AND RECEIVED BROKEN STERNUM. DON'T KNOW IF SEATBELT INJURED ME, OR IF THE SEATBELT DIDN'T LOCK ON 2ND IMPACT AND POSSIBLY HIT THE STEERING WHEEL.
10208661	GMC	ACADIA	2007	2007-10-12	INVOLVED IN FRONTAL COLLISION WITH CONSIDERABLE DAMAGE, BUT AIR BAG DID NOT DEPLOY. *TR
10498046	GMC	ACADIA	2007	2013-02-09	TL* THE CONTACT OWNS A 2007 GMC ACADIA. THE CONTACT STATED THAT WHILE DRIVING 20 MPH, ANOTHER VEHICLE CRASHED INTO HIS VEHICLE IN THE MIDDLE OF THE INTERSECTION. UPON IMPACT, THE AIR BAGS FAILED TO DEPLOY. THE CONTACT STATED THAT HE WAS PINNED IN THE VEHICLE AND COULD NOT GET OUT. THE VEHICLE HAD SEVERE DAMAGES TO THE DRIVER SIDE AND WAS COMPLETELY DESTROYED. THE CONTACT SUSTAINED INJURIES TO HIS HEAD AND CHEST. THE CONTACT WAS TAKEN TO THE EMERGENCY ROOM BY FAMILY. THE POLICE WERE NOTIFIED AND A REPORT WAS AVAILABLE IF NEEDED. THE MANUFACTURER WAS NOTIFIED WHO STATED THAT A REPRESENTATIVE WILL GIVE HIM A RETURN CALL. THE FAILURE MILEAGE WAS 91,000. UPDATED 3/10/13 *CN
10959190	GMC	ACADIA	2007	2017-03-02	TL* THE CONTACT OWNED A 2007 GMC ACADIA. WHILE MAKING A LEFT TURN AT APPROXIMATELY 5 MPH FROM A STOP SIGN, A SPEEDING VEHICLE CRASHED HEAD-ON INTO THE FRONT CENTER OF THE CONTACT'S VEHICLE. THE AIR BAGS DID NOT DEPLOY. BOTH THE CONTACT AND A MINOR PASSENGER, SEATED IN THE REAR BEHIND THE DRIVER, SUSTAINED INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE CONTACT'S VEHICLE WAS TOTALED AND WAS TOWED TO A TOW YARD. THE FAILURE MILEAGE WAS APPROXIMATELY 140,000.
10604975	GMC	ENVOY	2007	2014-06-20	MY WIFE WAS DRIVING HOME FROM THE DOCTOR AND A FULL SIZE CHEVY CAME ACROSS ON HER SIDE AND HIT HER HEAD ON NEITHER AIR BAG DEPLOYED ON THE ENVOY BOTH VEHICLES WAS TOTALED WHAT SHOULD WE DO THANKS. *TR
10639641	GMC	ENVOY	2007	2014-04-27	A GUY HIT ME ON THE DRIVERS SIDE THEN IT PUSHED ME INTO A DRIVEWAY OF A BUSINESS WHICH HAD A BRICK WALL WHICH I HIT &BOUNCED OFF IT .POPPED BOTH TIRES ON THE DRIVERS SIDE. THEN I HIT A TELEPHONE POLE STRAIGHT ON &SMASHED IN MY FRONT ON MY CARI MOVED THE TELEPHONE POLE IN THE CONCRETE ABOUT 2 INI WAS THE SECOND OWNER. THE OTHER OWNER WAS THE DEALERSHIP &THY HAD IT JUST FOR THERE CAR TO RUN FROM 1 DEALERSHIP TO THE OTHERI HAD TO GO TO THE HOSPITAL &I AM STILL HAVING TREATMENT ON MY NECK BACK &SHOULDERNOT 1 OF THE AIR BAGS WENT OFFIT WAS TOWED AWAY &THEN WAS TOTALEDI HAVE HIRED AN ATTORNEY. *TR
10915508	GMC	ENVOY	2007	2016-08-10	I HIT A GUARD RAIL AT 67 MPHSPIKE WITH GMC AND SHE NOTIFY ME THAT MY THRESHOLD (SPEED AND IMPACT) WERE NOT ENOUGH TO SET AIRBAGS OFFREALLY67 MPHI WAS ON A HIGHWAY SWEATED TO MISS SEMIKICKED IT AND IT FLEW ME IN A CIRCLE AND HIT GAURDRAILIMPACT HIT HARD THAT THEY HAD TO PRY BUMPER OFF RAIL AND CARFRAME WENT THROUGH RADIATOR BUT NO AIRBAGS DEPLOEYED??? TRYING TO FIND LAWYER NO ONE WILL TAKE XASE????
10290508	GMC	YUKON	2007	2009-09-14	TRAVELING AT NIGHT, AT 65 MILES AN HOUR IN A 2007 YUKON SLE2 4 DR WAGON, I HIT A STEER (APPROXIMATELY 880LBS). UPON IMPACT, THE BOTTOM OF MY POWER DRIVER'S SEAT MOVED FORWARD AND THE BACK OF THE SEAT TILTED FORWARD, CAUSING ME TO HIT THE STEERING WHEEL. I HAD TO MOVE THE SEAT BACK TO GET OUT OF THE VEHICLE. THE AIRBAGS DID NOT DEPLOY. I REPORTED THE INCIDENT TO THE DEALER, AND MY INSURANCE AGENT BOTH VERBALLY AND IN WRITING. THE VEHICLE HAD OVER \$11,000.00 WORTH OF DAMAGE, BUT THE REPAIR CENTER STATED THEY WERE UNABLE TO FIND ANY DAMAGE TO THE SEAT. I TRADED THE VEHICLE IN, AS I DID NOT FEEL SAFE DRIVING IT WITH THE SEAT NOT BEING REPLACED OR REPAIRED. THE VEHICLE IS NOW FOR SALE AGAIN, AND I AM FEARFUL THAT SOMEONE ELSE WILL BE IN A WRECK AND THE SEAT WILL MALFUNCTION AGAIN. *TR
					TL* THE CONTACT OWNS A 2007 GMC YUKON. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT CRASHED INTO ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. THERE WERE NO INJURIES AND A POLICE REPORT WAS FILED. THE VEHICLE WAS NOT DIAGNOSED OR REPAIRED. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 180,000. THE
10701604	GMC	YUKON	2007	2015-03-06	VIN WAS NOT AVAILABLE.  I HAVE TRIED TO SUBMIT MY YUKON FOR TANAKA RECALL REMEDY SEVERAL TIMES BY CONTACTING MY LOCAL GMC DEALERSHIP. THEIR SERVICE DEPT CONTINUES TO TELL ME THAT THEY DO NOT HAVE PARTS AVAILABLE TO MODIFY MY VEHICLE. A FEW YEARS AGO I BROADSIDED A LEXUS SUV WHICH 'RAN A TRAFFIC LIGHT'. MY AIRBAGS DID NOT DEPLOY, WHILE SEVERAL OF THE AIRBAGS DEPLOYED IN THE LEXUS. I FELT THAT MY LIFE MIGHT HAVE BEEN AT RISK SINCE THE AIRBAGS DID NOT DEPLOY, OR ALTERNATELY, AT EVEN WORST RISK IF THEY DID EXPLODE UPON DEPLOYMENT. WHO IS RESPONSIBLE FOR ADDRESSING THIS ISSUE? THE GMC DEALER SAYS THEY ARE NOT! I HAVE PHOTOS OF THE ACCIDENT AND A POLICE REPORT STATING THAT THE LADY WAS
11034703	GMC	YUKON SRX	2007	2014-10-09	RESPONSIBLE FOR  TL* THE CONTACT OWNED A 2006 CADILLAC SRX. WHILE DRIVING VARIOUS SPEEDS, THE VEHICLE HIT A CURB AND DROVE INTO A BUILDING. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO AN INDEPENDENT MECHANIC WHERE IT WAS DEEMED DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 77,814. UPDATED 10/26/16*LJ *TR

10223015	CHEVROLET	EQUINOX	2006	2008-02-28	FOUR CAR PILEUP ON HWY 41 NB. WE WERE VEH.#3 AND HIT FORWARD AND WERE HIT FROM BEHIND. OUR SEAT BELTS DID NOT RESTRAIN US AND THE AIR BAGS DID NOT DEPLOY. MY HUSBAND, ERNST, FLEW INTO THE DASHBOARD AND I SLAMMED INTO THE STEERING WHEEL. *TR
10241948	CHEVROLET	EQUINOX	2006	2008-09-10	THE VEHICLE WAS INVOLVED IN A FRONTAL CRASH. THE DRIVER NOR THE PASSENGER AIRBAG DEPLOYED. THE WHOLE FRONT END OF THE VEHICLE WAS PUSHED IN. *TR
10241540	CHEVROLET	EQUINOX	2000	2008-09-10	VEHICLE INVOLVED IN A ONE-AUTO ACCIDENT - 2006 CHEVROLET EQUINOX - HYDROPLANED AND HIT AN EMBANKMENT WITH THE FRONT END AND FLIPPED OVER. THE AIR BAG DID NOT DEPLOY. THIS IS NOT THE FIRST TIME THIS VEHICLE HAS HAD AN IMPACT TO THE FRONT BUMPER AND THE AIR BAG HAS NEVER DEPLOYED. EACH TIME THE FRONT BUMPER HAD DAMAGE SUSTAINED WHICH
10279951	CHEVROLET	EQUINOX	2006	2009-08-04	SHOULD HAVE CAUSED THE IMPACT THE SET THE AIR BAG OFF. *TR
10342436	CHEVROLET	EQUINOX	2006	2010-07-07	2006 CHEVY EQUINOX AIR BAGS DID NOT DEPLOY IN MY DAUGHTER'S FRONT CRASH ACCIDENT. HER CAR WAS TOTALED. SHE HIT A MAILBOX AND IN A SPIN ON THE DRIVER'S FRONT SIDE HIT A TELEPHONE POLE. SHE HIT HER HEAD ON THE STEERING WHEEL AND HURT HER BACK. THE REAR WINDSHIELD WAS ALSO SHATTERED AND ALSO HAD A BACK FLAT TIRE. I CALLED OUR LOCAL GM DEALER AND THEY TOLD ME TO CALL GM. SHE CALLED GM BUT THEY GOT HER UPSET AND SHE IN OTHER WORDS SAID THERE WAS NOTHING THEY COULD DO ABOUT THE AIR BAGS NOT DEPLOYING. IN OTHER WORDS THIS IS A DEFECT OF THIS MODEL AND THEY AREN'T GOING TO DO ANYTHING ABOUT IT. *TR
					L DAN OEE THE CIDE OF THE DOAD INTO A CHADDDAIL AND COLLD NOT STOR LINTH LWAS ON TOR
10503970	CHEVROLET	EQUINOX	2006	2013-03-19	I RAN OFF THE SIDE OF THE ROAD INTO A GUARDRAIL AND COULD NOT STOP UNTIL I WAS ON TOP OF THE GUARDRAIL INTO AN EMBANKMENT. MY ENTIRE FRONT END WAS DESTROYED AS WELL AS MOST OF THE UNDERNEATH OF THE CAR. MY FACE HIT THE STEERING WHEEL CAUSING ME TO LOSE CONSCIOUSNESS AS WELL AS GIVING ME A BLACK EYE, CROOKED TEETH, CUTS, BROKEN DENTAL APPLIANCES, AND MY TEETH WENT THROUGH MY LIP. I STRONGLY BELIEVE MY AIRBAGS SHOULD HAVE DEPLOYED AND PREVENTED THE IMPACT OF MY FACE TO THE STEERING WHEEL SINCE I THOUGHT THAT IS WHAT AIRBAGS ARE FOR. MY CAR WAS TOTALED. *TR
10550010	0.151/0.0157				HIT A ONE TON LOW BED DUMP TRUCK, THE WHOLE FRONT END OF MY SUV WAS DEMOLISHED, MY AIRBAGS DIDN'T DEPLOY AND I ENDED UP WITH REALLY BAD WHIPLASH FROM THE ACCIDENT, TO WHERE I'M STILL IN MAJOR PAIN! WONDERING IF THERE WAS LAWSUIT AGAINST THIS?
10560310	CHEVROLET	EQUINOX	2006	2013-11-14	NEVER DEALT WITH A WRECK THIS BAD, I WAS JUST CURIOUS! *TR  MY AIRBAG DID NOT DEPLOY WHEN THE CAR HIT THE TREE. IT HIT SO HARD THE BACK TIRES CAME
10586081	CHEVROLET	EQUINOX	2006	2014-05-01	COMPLETELY OFF THE GROUND. *TR
10939297	CHEVROLET	EQUINOX	2006	2016-12-30	MY GRANDDAUGHTER WAS INVOLVED IN AN ACCIDENT WHERE AS ANOTHER VEHICLE FAILED TO STOP AT A STOP SIGN AND PULLED INTO HER PATH. SHE AND THE OTHER VEHICLE WERE BOTH AT A SPEED OF 25 MPH. THE FRONT CLIP WAS TORN FROM HER CAR AND NO DRIVERS AIRBAG DEPLOYED. SHE DID HAVE HER SEATBELT ON WHICH DID PREVENT SERIOUS INJURY. THE ACCIDENT OCCURRED 30 DEC 2016. THIS HAPPENED ON CITY STREETS.
10343112	CHEVROLET	SILVERADO	2006	2010-03-22	TL* THE CONTACT OWNS A 2006 CHEVROLET SILVERADO. THE CONTACT STATED WHILE TRAVELING AT 40 MPH WHEN AN 18-WHEELER DROVE IN FRONT OF THE CONTACT SUDDENLY. THE CONTACT DID NOT HAVE ENOUGH TIME TO STOP THE VEHICLE BEFORE CRASHING INTO THE TRUCK. THE AIR BAGS DID NOT DEPLOY. THE CONTACT SUSTAINED MINOR BRUISING. THE VEHICLE WAS TOWED TO A LOCAL REPAIR FACILITY WHERE THE CONTACT WAS AWAITING REPAIRS. THE POLICE ADVISED THAT THE AIR BAGS SHOULD HAVE DEPLOYED UPON IMPACT. THE FAILURE MILEAGE AND CURRENT MILEAGES WERE 88,508.
10411579	CHEVROLET	SILVFRADO	2006	2010-07-28	MY 2006 SILVERADO 2500 HD AIR BAG DID NOT DEPLOY DURING MY ACCIDENT ON JULY 28, 2010. I TRIED SENDING ALL INFORMATION IN THE MAIL BUT, YOU JUST SENT IT BACK TO ME. COPING THAT WAS SENT TO ME FROM GENERAL MOTORS OF THEIR EXPLANATION OF THEY ARE NOT THE ONES RESPONSIBLE FOR THIS BECAUSE THEY DIDN'T MAKE THIS PRODUCT. NOT TO MENTION THAT ONSTAR DIDN'T COME ON AS THEY SHOW ON THEIR TV ADS'. IF I HAD NOT REGAIN CONSCIENCE. DON'T KNOW WHEN THEY WOULD HAVE FOUND ME THERE WHERE I WENT OFF THE ROAD JUST 4 MILES FROM MY HOME. DON'T KNOW IF ANYONE WOULD HAVE THOUGHT OF CALLING ONSTAR ABOUT LOOKING FOR MY TRUCK. IF GM VEHICLES ARE SO SAFE AND LEAD US TO BELIEVE HOW? SAFE AND RELIABLE THEIR VEHICLES ARE. THEN WHY? THEY ARE NOT STANDING BEHIND THEIR PARTS NOW. THE VEHICLE WAS TOTAL AND THE ONLY THING THAT SAVED ME WAS MY SEAT BELT. EVEN DOE I WAS STILL BADLY INJURED FROM MY NECK TO MY TAIL BONE. GM DOESN'T CARE TO OWN UP TO NO KIND OF RESPONSIBILITY FOR ANYTHING. I'M STILL AFRAID TO DRIVE MY 2010 CAMARO BECAUSE IT HAS THE SAME EQUIPMENT AS THE 2006 PICKUP THAT I TOTALED. I DRIVE IT WHENEVER I HAVE NO CHOICE. WHEN THE DODGE TRUCK ISN'T HERE. EVERY OTHER WEEK WHEN MY HUSBAND NEEDS IT. I'VE SENT YOU ALL THE PICTURES AND SOME OF THE LETTERS THAT GM'S [XXX] HAS SENT TO ME BUT, YOU DIDN'T EVEN OPEN IT ALL YOU DID WAS SEND IT BACK UNOPENED. WHAT'S UP WITH THIS???????????????? MY NAME IS: [XXX], MY ADDRESS IS:[XXX]; [XXX] INFORMATION REDACTED PURSUANT TO THE FREEDOM OF INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6). *TR

10775393	CHEVROLET	SILVERADO	2006	2010-03-22	TL* THE CONTACT OWNS A 2006 CHEVROLET SILVERADO. WHILE DRIVING AT 25 MPH, ANOTHER VEHICLE FAILED TO YIELD. AS A RESULT, THE CONTACT CRASHED INTO THE PASSENGER SIDE OF ANOTHER VEHICLE AND THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED HIP AND PELVIC INJURIES ON THE RIGHT SIDE THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS NOT DIAGNOSED OR REPAIRED. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 70,000.
					DRIVER FELL ASLEEP RAN INTO THE BACK OF A SEMI TRUCK, AIRBAG DID NOT DEPLOY. VEHICLE
10717429	CHEVROLET	TAHOE	2006	2015-05-09	WAS A TOTAL LOSS.
					AROUND 11:45PM A 2006 CHEVY TRAILBLAZER TRAVELING OVER THE SPEED LIMIT ON MY STREET CRASHED INTO A TREE, A PARKED CAR, AND THEN CONTINUED TO ROLL OVER ACROSS MY FRONT
10217793	CHEVROLET	TRAILBLAZER	2006	2008-02-07	LAWN, LANDING SIDEWAYS AFTER FLIPPING SEVERAL TIMES. THE OCCUPANTS WERE SEVERELY INJURED. NO AIRBAGS DEPLOYED DURING THE CRASH. THE DRIVER OF THE VEHICLE IS IN ICU NEEDING FACIAL RECONSTRUCTIVE SURGERY. *TR
					WHILE DRIVING ON A DIRT ROAD THAT ONLY FITS ON CAR, I WAS INVOLVED IN A HEAD ON COLLISION INVOLVING A JEEP CHEROKEE. THERE WAS EXTENSIVE FRONT DAMAGE HOWEVER, THE AIRBAG DID NOT DEPLOY NOR DID ONSTAR CONTACT ME. I HAVE VERY PAINFUL NECK, HEAD,
10227418	CHEVROLET	TRAILBLAZER	2006	2008-05-09	SHOULDER, AND RIGHT ARM PAIN. *TR
10244652	CHEVROLET	TRAILBLAZER	2006	2008-08-28	WE WERE INVOLVED IN A HEAD ON COLLISION WITH ANOTHER VEHICLE. BOTH WERE TRAVELING AT APPROXIMATELY 45 MPH. THE AIR BAGS DID NOT DEPLOY. I WAS DRIVING THE VEHICLE AND HAVE A BROKEN RIGHT LEG, BROKEN LEFT HEEL AND ANKLE. I WAS TEMPORARILY KNOCKED UNCONSCIOUS FROM HITTING THE STEERING WHEEL. MY WIFE SUFFERED A BROKEN WRIST, FRACTURED PELVIS, AND FRACTURED TIBULA. *TR
10364174	CHEVROLET	TRAILBLAZER	2006	2010-10-01	IN APPROXIMATELY APRIL OF 2010 MY GAS GAGE ON MY 06 TRAILBLAZER QUIT WORKING. THE PART WAS NO LONGER UNDER WARRANTY AT 84K MILES. VERY DANGEROUS WHEN TRAVELING 400 MILES WITH ELDERLY AUNT AND SMALL CHILD 2X A WEEK. ON OCTOBER 1, 2010 I WAS INVOLVED IN A HIGH SPEED COLLISION WHEN A CAR PULLED IN FRONT OF ME, WHILE I WAS GOING 70MPH. THE AIRBAGS DID NOT DEPLOY, I SUFFERED MAJOR TRAUMA TO MY KNEES AND AM UNABLE TO WALK WELL OR DRIVE. I HIT MY HEAD ON THE STEERING WHEEL AND CONTINUE TO HAVE PAIN. MY ELDERLY AUNT BROKE 3 CERVICAL VERTEBRAE AND STILL HAS A TRACHIOTOMY OVER A MONTH LATER. SHE IS STILL IN THE HOSPITAL, AND IT IS UNKNOWN IF SHE WILL COME HOME. *TR
					INERTIA REEL ON SEATBELT FAILED. NO AIR BAG DEPLOYMENT. 2006 TRAILBLAZER, FULL
10389988	CHEVROLET	TRAILBLAZER	2006	2011-02-24	STRAIGHT HEAD ON CRASH. *TR
10524151	CHEVROLET	TRAILBLAZER	2006	2013-05-30	THIS COMPLAINT IS BEING FILED ON BEHALF OF THE VEHICLE OWNER AND DRIVER. THIS CHEVY TRAILBLAZER WAS INVOLVED IN A TWO VEHICLE, DOUBLE FATAL CRASH. THE FRONT OF THE TRAILBLAZER STRUCK THE DRIVER'S SIDE DOOR OF A CAVALIER THAT FAILED TO YIELD FROM A STOP SIGN. THE TRAILBLAZER STAYED CONNECTED WITH THE CAVALIER, FORCING IT OFF THE LEFT SIDE OF THE ROADWAY AND INTO A LARGE TREE. BOTH OCCUPANTS IN THE CAVALIER WERE FATALLY INJURED. THE FRONT AIRBAGS DID NOT DEPLOY ON THE TRAILBLAZER AND NO EVENT WAS RECORDED ON THE AIRBAG CONTROL MODULE. *TR
10548331	CHEVROLET	TRAILBLAZER	2006	2013-10-10	I WAS DRIVING DOWN THE HIGHWAY AND HAD GOT CUT OFF BY A CAR. I SWERVED AND AVOIDED HITTING THE CAR BUT ENDED UP HITTING THE MEDIAN ALMOST DIRECTLY HEAD ON. THE WHOLE FRONT OF THE VEHICLE WAS SMASHED IN AND THE VEHICLE WAS TOTALED. THE AIRBAGS NEVER WENT OFF, ME AND MY PASSENGER WERE BOTH WEARING OUR SEAT BELT AND I ENDED UP HITTING MY HEAD ON THE STEERING WHEEL LEAVING ME UNCONSCIOUS. AN AMBULANCE RUSHED ME TO THE HOSPITAL AND I RECEIVED 10 STITCHES ABOVE MY LEFT EYE. *TR
10550276	CHEVROLET	TRAILBLAZER	2006	2013-10-28	TL* THE CONTACT OWNS A 2006 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT WHILE DRIVING APPROXIMATELY 35 MPH, SHE LOST CONTROL OF THE VEHICLE WHILE DRIVING IN SNOWY WEATHER. THE VEHICLE NOSE DIVED INTO AN EMBANKMENT AND THEN CRASHED INTO A BOULDER. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT WAS TRANSPORTED TO THE HOSPITAL VIA AMBULANCE FOR TREATMENT OF A CONCUSSION AND BRUISING. THE FRONT PASSENGER WAS ALSO INJURED AND SUSTAINED BRUISING. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 102,000.
10679561	CHEVROLET	TRAILBLAZER	2006	2014-10-06	TL* THE CONTACT OWNED A 2006 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT WHILE DRIVING AT 35 MPH, THE DRIVER DRIFTED OFF THE ROAD AND CRASHED THE VEHICLE INTO A TREE. THE AIR BAGS DID NOT DEPLOY. THE CONTACT SUSTAINED A FRACTURED NOSE AND LEFT CHEEKBONE THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED AND TOWED BACK TO THE CONTACTS RESIDENCE. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS 199,000.
					VEHICLE WAS TRAVELING ON CITY STREET AT 30MPH WHEN IT STRUCK A UTILITY POLE, SHEARING IT OFF AT THE BASE. VEHICLE THEN TRAVELED STRAIGHT UP A HILL AND STRUCK A HOUSE, COMING TO REST THERE. NONE OF THE AIR BAGS DEPLOYED. NEWS STORY AT HTTP://WWW.WGEM.COM/CATEGORY/133158/VIDEO-LANDING-
10888990	CHEVROLET	TRAILBLAZER	2006	2016-07-21	PAGE?&CLIPID=12610200&AUTOSTART=TRUE

					LETTER FROM SENATOR NELSON ON BEHALF OF CONSTITUENT REGARDING GENERAL MOTOR
					SAFETY DEFECTS. *LD THE CONSUMER SUGGESTED THERE WAS A DEFECT WITH THE GM AIR BAGS IN 2006 CHEVROLET TRAILBLAZER, IN WHICH THE DRIVER SUSTAINED A BRAIN INJURY AND HIS
					WIFE WAS INJURED, WHEN IT WAS IMPACTED ON THE DRIVER'S SIDE, RESULTING IN LEFT A-PILLAR
					CONTACT WHEN THE AIR BAG FAILED TO DEPLOY AND HIS SEAT BELT RESTRAINTS FAILED. THE CRASH WAS OF ENORMOUS SEVERITY, WITH A SPEED CHANGE OF 38 MPH WITH A LINE FORCE IN
10955948	CHEVROLET	TRAILBLAZER	2006	2016-09-08	THE DIRECTION OF THE A PILLAR. *JB
					I WAS IN A CRASH AND NEITHER FRONT AIRBAG DEPLOYED, MY INSURANCE ADJUSTER QUESTIONED IF THE AIR BAG SYSTEM EVEN WORKS. I HAVE COPY OF THE ESTIMATE TO REPAIR AS
					WELL. DUE TO THE FORCE OF IMPACT EVEN LOCAL REPAIR SHOP STATED THAT MY AIR BAGS
					SHOULD HAVE GONE OFF AS WELL. IS THERE A RECALL ON THIS MODEL FOR AIR BAGS NOT
10966507	CHEVROLET	TRAILBLAZER	2006	2017-02-27	DEPLOYING? I WAS IN A SECOND WRECK ON 3/7/17 AND NEITHER AIR BAG DEPLOYED AT THAT TIME EITHER AND THERE WAS NO BUMPER SO AIR BAGS SHOULD HAVE DEFINITELY GONE OFF.
					I HAD A CRASH AT 45 MPH INTO A LARGE TREE \$9000+ DAMAGE TO THE FRONT END OF MY CAR
10403445	GMC	ENVOY	2006	2011-05-20	AND THE AIRBAG NEVER WENT OFF. ONSTAR WAS CALLED AND HELPED ME.
					I WAS INVOLVED IN A HEAD ON COLLISION, WHERE A CAR CAME AROUND A BUS INTO MY LANE .
					IT WAS A CLEAR CUT CASE OF WHO WAS AT FAULT. MY CONCERN IS THAT MY AIR BAG NEVER
					DEPLOYED. THERE IS A DRIVER AND PASSENGER AIRBAG IN THAT MODEL. IF NOT FOR MY SEAT  BELT. I WOULD HAVE GONE THROUGH THE WINDSHIELD AND THE VEHICLE WAS TOTALED FROM
					THE FORCE. THERE ARE PICTURES I COULD FORWARD OF THE ACCIDENT. I WANTED TO KNOW IF
10704170	GMC	ENVOY	2006	2015-03-22	THERE WAS ANY THING ELSE I COULD DO TO ADDRESS THIS ISSUE. THANK YOU *TR
					MY FATHER WAS DRIVING FROM DIALYSIS ON THE DECLINE OF A BRIDGE WHEN HE PASSED OUT
					BEHIND THE WHEEL. HE WAS WEARING HIS SEATBELT, AND THE VEHICLE RESTED AFTER HITING A
					TREE. THE AIRBAGS DID NOT DEPLOY. I HAVE CONTACTED GMC AND THERE IS AN INVESTIGATION PENDING, THEY HAVE SENT A REPRESENTAIVE TO INSPECT THE VEHICLE AND I AM AWAITING THE
					OUTCOME. I HAVE CONTACTED COPART AND HAD THE VEHICLE PLACED ON HOLD TO ALLOW
					NHTSA THE OPPORTUNITY TO DO THE SAME, IF YOU CHOOSE. 5017 DUNCAN ROAD, PUNTA
10780171	GMC	YUKON	2006	2015-08-21	GORDA, FL (941) 505-9700. PLEASE FEEL FREE TO CONTACT ME WITH ANY QUESTIONS.
					AIRBAG FAILED FUNCTION DUE TO LACK OF INFLATOR PERFORMANCE DURING MY HUSBANDS
					HEAD-ON CRASH AND HE SUFFERED COLLAR BONE AND RIB FRACTURES, MASSIVE HEAD TRAUMA
11377560	GMC	YUKON	2006	2011-06-07	RESULTING IN A CRAINIOTOMY,BRAIN DAMAGE AND DEATH ONE MONTH LATER. THE VEHICLE WAS TRAVELLING AT 45MPH ON A PAVED TWO LANE STREET.
					2005 BUICK RAINIER WAS IN A HEAD ON COLLISION WITH A CHRYSLER TOWN & COUNTRY VAN IN COMING TRAFFIC. MY WIFE DRIVING THE RAINIER HIT HER HEAD ON THE STEERING WHEEL AND
					BENT IT. SHE RECEIVE A LARGE LACERATION REQUIRING ABOUT 30 STITCHES, CLAVICLE STRAIN,
					BROKEN COLLAR BONE AND MULTIPLE BRUISES. SHE WAS WEARING THE SEAT BELT. COLLISION
10275950	BUICK	RAINIER	2005	2009-06-30	WAS STRONG ENOUGH TO LIFT THE REAR OF THE CAR OFF THE GROUND AND TURN IT FACING THE SAME DIRECTION AS THE VAN SHE HIT. THE AIRBAGS DID NOT DEPLOY! *TR
					HAD A FRONT END COLLISION WITH ANOTHER VEHICLE AND NONE OF MY AIRBAGS DEPLOYED.  THE VEHICLE WAS 4 WEEKS OLD AND HAD 1850 MILES AT THE TIME OF THE ACCIDENT. CALLED
					CADILLAC CUSTOMER SERVICE AND WAS GIVEN AN AIRBAG HISTORY LESSON VIA TELEPHONE
					FROM SOMEONE THAT HAD NEVER SEEN MY VEHICLE OR INSPECTED IT FOR DAMAGE AFTER THE
					ACCIDENT. AT THE END OF OUR CONVERSATION I WAS TOLD ALL WAS OK, NONE OF MY AIRBAGS SHOULD HAVE DEPLOYED AND NOT TO WORRY ABOUT IT. THE ENTIRE FRONT END OF MY VEHICLE
					WAS KNOCKED OFF, THE FRAME HAS MULTIPLE CRACKS AND IS BENT AS A RESULT OF THE
10152376	CADILLAC	ESCALADE	2005	2006-03-01	COLLISION AND THE COLLISION CENTER IS 90% CERTAIN THE VEHICLE IS NOT REPAIRABLE. *JB
10895442	CADILLAC	SRX	2005	2016-08-11	AIRBAG DIDN'T DEPLOY IN AN ACCIDENT ON AUGUST 11 2016. AIRBAG IS FAULTY AND CONCERN ABOUT THE SAFETY OF THE 2005 SRC
					TL* THE CONTACT'S DAUGHTER OWNED A 2005 CADILLAC SRX. WHILE DRIVING APPROXIMATELY 40 MPH ON AN ICY, SNOWY ROAD, THE VEHICLE STARTED TO SKID AND THE DRIVER LOST CONTROL
					OF THE VEHICLE. THE DRIVER CRASHED INTO A CEMENT WALL. ALL THE AIR BAGS FAILED TO
					DEPLOY. THE DRIVER SUSTAINED HEAD INJURIES THAT REQUIRED MEDICAL ATTENTION ALONG
					WITH BRUISES TO THE CHEST, RIGHT ARM, AND LEG. A POLICE REPORT WAS FAILED. THE VEHICLE WAS TOWED AND DEEMED DESTROYED. THE MANUFACTURER WAS NOT MADE AWARE OF THE
10968319	CADILLAC	SRX	2005	2017-03-14	FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 110,000. THE VIN WAS UNAVAILABLE.
					2005 CHEVROLET EQUINOX REAR ENDED ANOTHER VEHICLE AFTER BEING HIT IN THE REAR WHILE
					STOPPED. THE AIR BAGS DID NOT DEPLOY AND THE SEAT BELTS DID NOT ENGAGE.*MR THE DRIVER SUSTAINED SOME INJURIES WHEN HE WAS PUSHED FORWARD INTO THE STEERING WHEEL
10120423	CHEVROLET	EQUINOX	2005	2005-05-01	AND DASH. *NM
					2005 CHEVY EQUINOX AIR BAGS DID NOT DEPLOY. CONSUMER STATES THAT HE WAS INVOLVED IN A FRONTAL CRASH AND AIR BAGS FAILED TO DEPLOY. HE STATES THAT THE CRASH SPEED WAS
10221708	CHEVROLET	EQUINOX	2005	1901-01-01	ABOUT 35 MPH. *KB
	•	•		•	

10221964	CHEVROLET	EQUINOX	2005	2007-12-15	I HAD A HEAD ON COLLISION WITH A CONCRETE WALL IN MY 2005 CHEVROLET EQUINOX ON DECEMBER 15, 2007. I WAS TRAVELING ABOUT 55-60 MPH WHEN THE HEAD ON COLLISION OCCURRED. MY AIRBAGS DID NOT DEPLOY. HOWEVER THE TALC POWER AND THE SMELL CAME OUT. I HAD AN INVESTIGATION DONE ON THE AIRBAGS. I WAS TOLD BY A GM INVESTIGATION REP THAT THE VEHICLE HAS TO SLOW DOWN 10-15 MPH FOR THE AIRBAGS TO DEPLOY. THE INVESTIGATION SHOWED THAT THE VEHICLE SLOWED DOWN 11.85 MPH WHICH FALLS WITHIN THE RANGE FOR THE AIRBAGS TO DEPLOY. I NEED A SECOND OPINION BECAUSE GM STATED THAT DESPITE WHAT THE REPORT SAYS, THEY ARE NOT AT FAULT FOR THE AIRBAGS. *TR
10266217	CHEVROLET	EQUINOX	2005	2009-04-14	TL*THE CONTACT OWNS A 2005 CHEVROLET EQUINOX. WHILE DRIVING 40 MPH, ANOTHER DRIVER PULLED OUT IN FRONT OF THE CONTACT'S VEHICLE. AS A RESULT, THE CONTACT CRASHED INTO THE OTHER VEHICLE. THE FRONT DRIVER'S SIDE AIR BAG FAILED TO DEPLOY AND THE CONTACT SUSTAINED MINOR NECK INJURIES. A POLICE REPORT WAS FILED. THE VEHICLE WAS INSPECTED BY HER INSURANCE AGENCY AND THE ATTAIT THAT IT WAS DESTROYED. THE ADJUSTER WAS UNABLE TO DETERMINE WHY THE AIR BAGS DID NOT DEPLOY. THE CONTACT CALLED THE MANUFACTURER AND WAS INFORMED THAT SHE WOULD RECEIVE A CALL BACK REGARDING THE CRASH. THE FAILURE MILEAGE WAS 30,000.
					TL* THE CONTACT OWNS A 2005 CHEVROLET EQUINOX. THE CONTACT WAS DRIVING 30 MPH WHEN A DEER JUMPED A FENCE AND LANDED ON THE HOOD OF THE VEHICLE WITH EXTREME FORCE. THE CONTACT STATED THE ENGINE CONTINUED TO RUN BUT THE INTERIOR AND EXTERIOR LIGHTNING FAILED. THE AIR BAGS ALSO FAILED TO DEPLOY. THE POLICE WERE NOT CONTACTED AND THERE WERE NO INJURIES. THE VEHICLE WAS TAKEN TO A LOCAL REPAIR SHOP AND THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE VEHICLE WAS NOT REPAIRED. THE VIN WAS UNAVAILABLE. THE FAILURE AND THE CURRENT MILEAGES WERE 73,000. UPDATED
10440022	CHEVROLET	EQUINOX	2005	2011-12-13	O1/10/12*LJ  I WAS DRIVING, HIT ICE, FISH TAILED, STARTED TO SPIN, WENT HEAD FIRST INTO THE MEDIAN, PROBABLY GOING 30-45 MPH. AFTER THAT WE CAME TO A STOP, AND WERE HIT BY A SEMI TRAILER TRAVELING AT APPROXIMATELY 45-60 MPH. NEITHER IMPACT SET THE AIR BAGS OFF AND WE BELIEVE THAT IT SHOULD HAVE. *TR
10597676	CHEVROLET		2005	2004-10-31	TL* THE CONTACT OWNS A 2005 CHEVROLET EQUINOX. WHILE DRIVING APPROXIMATELY 70 MPH ON THE HIGHWAY, THE CONTACT NOTICED THE KEY WAS DETACHING FROM THE IGNITION. THE DEALER STATED THAT THE VIN WAS NOT INCLUDED IN NHTSA CAMPAIGN NUMBER: 04V302000 (POWER TRAIN). WHILE DRIVING 35 MPH, THE CONTACT WAS INVOLVED IN A CRASH AND THE AIR BAGS FAILED TO DEPLOY. THE CONTACT WAS INJURED AND RECEIVED MEDICAL ATTENTION. THE VEHICLE WAS REPAIRED BY THE DEALER. THE MANUFACTURER WAS NOT NOTIFIED. THE APPROXIMATE FAILURE MILEAGE WAS 70.
10597688	CHEVROLET	EQUINOX	2005	2005-10-31	DRIVING DOWN STREET CUT OFF BY SEMI RAN INTO FLASHING SIGN WITH NOWHERE ELSE TO GO.  OVER HALF PASSENGER FRONT BUMPER WAS CRUSHED RADIATOR SMASHED, WHOLE FRONT PASSENGER QUARTER SMASHED. CAR WAS UNDRIVEABLE BUT AIR BAGS DID NOT GO OFF. *TR
10936302	CHEVROLET	EQUINOX	2005	2013-12-13	I WAS IN AN ACCIDENT ON 12/15/2016 WHERE I HIT SOMEONE FROM BEHIND. I WAS DRIVING STRAIGHT DOWN THE HIGHWAY AND DIDN'T NOTICE THE PEOPLE IN FRONT OF ME STOPPING. WHEN I HIT THE BRAKES, IT WAS TOO LATE AND MY CHEST WENT FLYING AGAINST THE STEERING WHEEL. WHEN MY EQUINOX HIT THEM, MY SEAT BELT DID NOT LOCK AND MY CHEST HIT THE STEERING WHEEL. I HAD TO GO TO THE HOSPITAL BECAUSE OF THE FORCE OF THE IMPACT. THE FORCE WAS SO HARD THAT THE AIR BAG DID NOT COME OUT. I DON'T KNOW IF THERE IS AN AIR BAG INSIDE THE VEHICLE. I COULD NOT CATCH MY BREATH AND I TESTED OUT MY SEAT BELT AND REALIZED IT DOES NOT LOCK WHEN BREAKING. IT IS ACTUALLY LOSE THE WHOLE TIME I AM DRIVING. THIS IS NOT SAFE FOR ME OR A PASSAGE THAT I HAVE IN THE CAR. TESTED OUT THE PASSAGE SIDE AS WELL AND IT IS THE SAME THING. *TR
11023592	CHEVROLET	EQUINOX	2005	2017-09-06	TL* THE CONTACT OWNS A 2005 CHEVROLET EQUINOX. WHILE DRIVING 45 MPH, THE CONTACT CRASHED INTO ANOTHER VEHICLE. ALL THE AIR BAGS FAILED TO DEPLOY. THE CONTACT NOTICED SMOKE COMING FROM THE RADIATOR. THE VEHICLE WAS TOWED TO XTREME COLOR INC. IN KANSAS CITY, KS 66102; 913-281-0830. A POLICE REPORT WAS FILED. THE CONTACT SUSTAINED A NECK AND BACK INJURY THAT REQUIRED MEDICAL ATTENTION. THE MANUFACTURER WAS NOT CONTACTED. THE APPROXIMATE FAILURE MILEAGE WAS 146,500.
11127938	CHEVROLET	EQUINOX	2005	2018-07-20	TL* THE CONTACT OWNS A 2005 CHEVROLET EQUINOX. WHILE DRIVING 24 MPH ON AN EXIT RAMP, THE VEHICLE INADVERTENTLY DROVE OFF THE SIDE OF THE RAMP AND CRASHED. THE AIR BAGS FAILED TO DEPLOY AND THE SEAT BELT FAILED TO RESTRAIN THE CONTACT. THERE WERE NO WARNING INDICATORS ILLUMINATED. THE CONTACT SUSTAINED MINOR INJURIES TO THE HEAD AND HIPS THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO A TOW LOT. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE AND A FIELD INSPECTOR WAS SENT TO INSPECT THE VEHICLE. THE CONTACT WAS AWAITING THE INSPECTION RESULTS. THE VEHICLE WAS NOT TAKEN TO A DEALER FOR DIAGNOSTIC TESTING. THE FAILURE MILEAGE WAS 140,000.

11191960	CHEVROLET	EQUINOX	2005	2019-03-27	TL* THE CONTACT OWNS A 2005 CHEVROLET EQUINOX. WHILE DRIVING 35 MPH AND DRIVING STRAIGHT PREPARING TO MAKE A RIGHT TURN, THE CONTACT CRASHED INTO THE FRONT QUARTER PANEL OF ANOTHER VEHICLE. THE AIR BAGS DID NOT DEPLOY. THE CONTACT SUSTAINED INJURIES TO THE HEAD AND ANKLE, WHICH REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO AN INDEPENDENT LOT. THE DEALER AND MANUFACTURER WERE NOT CONTACTED. THE VEHICLE WAS NOT DIAGNOSED OR REPAIRED. THE FAILURE MILEAGE WAS 65,000. *DT *TR
11297402	CHEVROLET	FOLUNION	2005	2020-01-05	TL* THE CONTACT OWNED A 2005 CHEVROLET EQUINOX. THE CONTACT STATED THAT WHILE DRIVING 55 MPH AND TURNING ON CURVE TOO FAST, CONTROL OF THE VEHICLE WAS LOST. THE VEHICLE SWERVED LEFT AND RIGHT ULTIMATELY COMING TO A STOP AFTER CRASHING INTO A TREE. THE AIR BAGS FAILED TO DEPLOY. DURING THE IMPACT THE CONTACT HEAD WAS HIT ON THE WINDSHIELD AND ABRASION TO THE KNEE WERE SUSTAINED. MEDICAL ATTENTION WAS NOT SOUGHT. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO A TOW YARD. THE VEHICLE WAS DESTROYED. THE DEALER AND MANUFACTURER WERE NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS APPROXIMATELY 165,000.
10117624	CHEVROLET		2005	2005-03-29	WHILE DRIVING 40 MPH VEHICLE CRASHED INTO A STORE FRONT. UPON IMPACT, DUAL AIRBAGS DID NOT DEPLOY. NO INJURIES REPORTED. *AK
10137371	CHEVROLET		2005	2005-09-20	I HAD AN ACCIDENT ON TUESDAY SEPT. 20, 2005 DRIVING MY 2005 CHEVY PICKUP K2500 HD 4 WHEEL DRIVE. I LOST CONTROL AND WENT OFF HIGHWAY STRIKING A CITY DUMPSTER HEADON AND MOVING THE DUMPSTER APPROXIMATELY 50-60 FT. BY POLICE REPORT AND THAN GOING BACK ON HIGHWAY AND CROSSING ALL 4 LANES BEFORE THE TRUCK STOPPED. MY TRUCK WAS TOTALED BUT MY AIRBAG NEVER DEPLOYED. I WAS UNCONSCIOUS AND WAS AIRLIFTED TO VANDERBILT HOSPITAL IN NASHVILLE TN. WHY DIDN'T MY AIRBAG DEPLOY WITH A HEADON CRASH OF THIS FORCE? THIS SEEMS TO BE A DEFECT IN THE PRODUCT. I RECEIVED A 4 INCH CUT ACROSS THE BOTTOM OF MY CHIN THAT REQUIRED SEVERAL STITCHES AND VERY SORE FROM MY HEAD DOWN MY RIGHT LEG. STILL FOLLOWING UP WITH DOCTORS *NM
10153906	CHEVROLET	SILVERADO	2005	2006-03-27	DT*: THE CONTACT STATED THE VEHICLE WAS INVOLVED IN AN ACCIDENT ON DRY ROADS. TWO VEHICLES COLLIDED IN FRONT OF THE CONTACT, CAUSING AN EMERGENCY BRAKING SITUATION. THE CONTACT COLLIDED WITH THE REAR OF THE SECOND VEHICLE, AND THE AIR BAGS DID NOT DEPLOY. THE CONTACT WAS INJURED IN THE ACCIDENT. AN INDEPENDENT REPAIR SHOP WAS CONSULTED AND THEY WERE UNABLE TO DUPLICATE THE PROBLEM.
10201747	CHEVROLET	SILVERADO	2005	2007-08-27	AIRBAG FAILURE IN HEAD-ON COLLISION, TOTALING 2 TRUCKS. *JB
10455110	CHEVROLET	SUBURBAN	2005	2011-12-06	TL* THE CONTACT OWNS A 2005 CHEVROLET SUBURBAN. THE CONTACT STATED THAT WHILE DRIVING APPROXIMATELY 30 MPH, SHE CRASHED INTO THE REAR OF A TRASH TRUCK. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. THE DRIVER SUSTAINED INJURIES TO THE LEFT ARM AND LEFT LEG. THE POLICE WERE CONTACTED AND A REPORT WAS FILED. THE VEHICLE WAS TOWED TO AN INDEPENDENT MECHANIC WHERE THEY DEEMED THE VEHICLE AS BEING DESTROYED. THE MANUFACTURER WAS CONTACTED AND AFTER DIAGNOSING THE VEHICLE, THEY ADVISED HER THAT THE VEHICLE WAS NOT TRAVELING FAST ENOUGH AT THE TIME OF IMPACT FOR THE AIRBAGS TO DEPLOY. THE FAILURE MILEAGE WAS APPROXIMATELY 80,000.
			2005	2005 07 45	DT: ON JULY 16, 2005 WHILE TRAVELING AT 55 MPH CONSUMER'S VEHICLE WAS INVOLVED IN A HEAD ON COLLISION WITH ANOTHER VEHICLE. TOTALED THE OTHER VEHICLE. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. VEHICLE HAS NOT BEEN INSPECTED TO SEE WHY THEAIR BAGS DID NOT DEPLOY. AIR BAG LIGHT CAME ON. CONSUMER CALLED THE DEALERSHIP, AND THEY ADVISED CONSUMER NOT DRIVE THE VEHICLE TO THE DEALERSHIP BECAUSE THE AIRBAGS MIGHT DEPLOY. THE VEHICLE WAS TAKEN TO THE BODY SHOP YESTERDAY TO BE FIXED. THE CONSUMER SPRAINED
10130316	CHEVROLET	ТАНОЕ	2005	2005-07-16	BACK AND NECK. A POLICE REPORT WAS ISSUED.*AK  AIR BAGS FAILED TO DEPLOY IN A CRASH. THE FRAME OF OUR 2005 CHEVROLET TAHOE WAS BUCKLED IN THE CRASH. CRASH TEST DATA WAS RETRIEVED FROM THE VEHICLE, ALTHOUGH GENERAL MOTORS DOES NOT FEEL THAT THEY ARE IN A POSITION TO HONOR OUR REQUEST FOR DAMAGES AGAINST THEM. MY HUSBAND AND I BOTH RECEIVED BACK AND NECK INJURIES
10200191		TAHOE	2005	2007-06-18	DURING THE ACCIDENT. *TR  TL*THE CONTACT OWNS A 2005 CHEVROLET TAHOE. THE CONTACT STATED THAT WHILE DRIVING AT APPROXIMATELY 55 MPH, THE VEHICLE CRASHED INTO A DEER BUT THE AIR BAGS DID NOT DEPLOY. THERE WAS EXTENSIVE DAMAGE TO THE VEHICLE. A POLICE REPORT WAS FILED. THE DEALER STATED THAT THE VEHICLE COULD BE INSPECTED AT THE CONTACT'S EXPENSE. THE BODY DAMAGE HAD BEEN REPAIRED. THE FAILURE MILEAGE WAS APPROXIMATELY 75,000. THE CURRENT
10335468	CHEVROLET	TAHOE	2005	2009-06-12	MILEAGE WAS APPROXIMATELY 100,000.  2005 CHEVY TAHOE WAS IN AN ACCIDENT AND HIT FRONT DRIVERS SIDE INTO DIRT EMBANKMENT AT 35-40 MPH PUSH DRIVERS SIDE TIRE BACK ABOUT 3" AND BUCKLED HOOD AND FENDER AND THE AIRBAGS DIDN'T GO OFF. *TR

	_		1	T	
10748242	CHEVROLET	ТАНОЕ	2005	2015-08-11	TL* THE CONTACT OWNED A 2005 CHEVROLET TAHOE. WHILE DRIVING APPROXIMATELY 50 MPH, THE REAR DRIVER SIDE WHEEL BECAME DETACHED FROM THE VEHICLE AND CAUSED THE CONTACT TO LOSE CONTROL OF THE VEHICLE. THE CONTACT CRASHED INTO A WOODEN POLE, WHICH CRASHED THROUGH THE FRONT WINDOW. THE VEHICLE FLIPPED OVER THREE TIMES AND LANDED UPSIDE DOWN. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT SUSTAINED BROKEN BONES AND INJURIES THAT REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS TOWED TO THE TOWING COMPANY. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 131,000.
					I WAS INVOLVE IN AN ACCIDENT WHERE I HAVE LOST CONTROL OF A CHEVROLET TRAILBLAZER AND HIT A CENTER DIVIDER ON THE FREEWAY. WITH THE FRONT BUMPER SMASHED ONTO THE
10134099	CHEVROLET	TRAILBLAZER	2005	2005-05-12	CENTER DIVIDER, THE AIR BAG FAILED TO DELPLOY.
					CHEVY TRAILBLAZER ('05 OR '06) REAR ENDED ANOTHER VEHICLE AT A SPEED FAST ENOUGH TO TOTAL THE TRAILBLAZER. THE AIRBAG DID NOT DEPLOY AND THE DRIVER SUSTAINED CHEST AND
10141221	CHEVROLET	TRAILBLAZER	2005	2005-10-19	HEART INJURIES. *NM
10143976	CHEVROLET	TRAILBLAZER	2005	2005-11-20	DT: THE CONTACT'S BOY FRIEND WAS TRAVELING AT 78 MPH WHEN HE LOST CONTROL OF THE VEHICLE, AND IT WAS INVOLVED IN A FRONTAL IMPACT. THE VEHICLE ROLLED OVER SIX TIMES. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. THE CONTACT AND PASSENGER SUSTAINED INJURIES. MANUFACTURER WAS NOT CONTACTED. *AK
10161963	CHEVROLET	TRAILBLAZER	2005	2006-07-08	7/8/06, WHILE TRAVELING HIGHWAY 31 IN NILES, MICHIGAN, SPEED LIMIT OF 70 MPH, WE HIT A DEER HEAD ON WITH OUR 2005 CHEVY TRAILBLAZER LS, S/N. WE HAD NO TIME TO EVEN BRAKE PRIOR TO THE IMPACT. THE IMPACT TOOK OUT THE FRONT END OF THE CAR, PUSHING THE RADIATOR BACK INTO THE ENGINE COMPARTMENT. NEITHER AIR BAG DEPLOYED. THERE WERE 4 PASSENGERS IN THE VEHICLE, INCLUDING AN 11-YEAR OLD BOY, AND A 14-YEAR OLD BOY. *JB
					DT*: THE CONTACT STATED WHILE DRIVING 40 MPH ENTERING THE FREEWAY, THE VEHICLE REAR ENDED ANOTHER VEHICLE AND NONE OF THE AIR BAGS DEPLOYED. THE AIRBAG WARNING LIGHT DID NOT ILLUMINATE PRIOR TO THE CRASH. A POLICE REPORT WAS FILED IN THE STATE OF CALIFORNIA. THERE WERE TWO PEOPLE INJURED; THE NOSE OF THE CHILD WAS BLEEDING AND THE CONTACT SUFFERED A NECK INJURY. THE CHILD WAS 6 YEARS OLD AND THE CONTACT WAS 22 YEARS OLD. BOTH OF THE PASSENGERS WERE WEARING SEAT BELT. THE WEATHER WAS CLOUDY. A POLICE REPORT WAS PROCESS. THE SERVICE DEALER AND THE MANUFACTURER WERE NOT
10173065	CHEVROLET	TRAILBLAZER	2005	2006-11-08	NOTIFIED.
10178482	CHEVROLET	TRAILBLAZER	2005	2007-01-08	TL* - THE CONTACT'S 2005 CHEVY TRAILBLAZER WAS PURCHASED USED ON AUGUST 13, 2005 FROM BERGLUND CHEVROLET OF VIRGINIA, WITH 13000 MILES. THE VEHICLE WAS INVOLVED IN AN ACCIDENT ON JANUARY 8TH, 2007 WERE THERE WAS ONE FATALITY AND FIVE PEOPLE WERE INJURED. A SECOND VEHICLE, A BUICK LASABRE, FAILED TO STOP AT STOP SIGN WHILE MAKING A LEFT HAND TURN. THE CONTACTS VEHICLE STRUCK THE SECOND VEHICLE DIRECTLY ON THE DRIVERS SIDE. THE CONTACTS VEHICLE WAS TRAVELING AT 50 MPH. THE DRIVER OF THE SECOND VEHICLE WAS PRONOUNCED DEAD AT THE SCENE. THE CONTACTS VEHICLE PASSENGER AND DRIVER SIDE AIR BAGS NEVER DEPLOYED, EVEN THOUGH THERE WERE PASSENGERS IN ALL SEATS. SIX STATE TROOPERS WERE ON THE SCENE AND NO ONE WAS SITED.
					I WAS DRIVING ON AN ELEVATED INTERSTATE AND LOST CONTROL OF THE VEHICLE. I HIT THE GUARDRAIL IN A DIRECT FRONTAL IMPACT. THE ENTIRE FRONT OF THE CAR WAS CRUSHED ABOUT 40 INCHES. THE CAR IS TOTALED BUT THE AIRBAGS DID NOT DEPLOY. I SUFFERED SOME INJURIES
10205154	CHEVROLET	TRAILBLAZER	2005	2007-10-06	ON MY HEAD EVEN THOUGH I HAD MY SEATBELT ON. *JB
10221319	CHEVROLET	TRAILBLAZER	2005	2008-02-21	I WAS DRIVING ON A 2 LANE ROAD GOING 45MPH. A CAR WAS FOLLOWING CLOSE BEHIND ME SO I WENT TO GET INTO RIGHT LANE AND MY TRUCK DID 5 360 AND HIT 3 TREES HEAD ON AND AIR BAG NEVER DEPLOYED. *TR
10239994	CHEVROLET	TRAILBLAZER	2005	2008-08-25	TL*THE CONTACT OWNS A 2005 CHEVROLET TRAILBLAZER. WHILE DRIVING 60 MPH, THE CONTACT STRUCK THE GUARDRAIL. THE VEHICLE WAS DESTROYED AND THE AIR BAGS FAILED TO DEPLOY. THE CONTACT HAS PICTURES OF THE VEHICLE. SHE WAS TRANSPORTED TO THE HOSPITAL AND IS CURRENTLY IN PAIN. A POLICE REPORT WAS FILED. THE AIR BAGS WERE NOT SERVICED PRIOR TO THE CRASH. THE VIN WAS UNKNOWN. THE FAILURE MILEAGE WAS 44,000.
10241433	CHEVROLET	TRAILBLAZER	2005	2005-09-07	TL*THE CONTACT OWNS A 2005 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 45 MPH, THE CONTACT CRASHED INTO ANOTHER VEHICLE, WHICH RESULTED IN A THREE CAR PILE UP. THE FRONT END OF HER VEHICLE WENT UNDERNEATH THE PRECEDING VEHICLE. THE AIR BAGS FAILED TO DEPLOY. SHE WAS UNABLE TO RECEIVE ASSISTANCE FROM ON STAR DUE TO THE AIR BAG FAILURE. THERE WERE NO PRIOR FAILURES WITH HER VEHICLE. THE CONTACT AND THREE CHILDREN IN SAFETY SEATS SUSTAINED MINOR INJURIES. A POLICE REPORT WAS FILED. THE CURRENT AND FAILURE MILEAGES WERE 76,000.

10254382	CHEVROLET	TRAILBLAZER	2005	2008-12-16	MY DAUGHTER HAD AN ACCIDENT ON 12/16/2008. SHE HAS(HAD) A 2005 CHEVROLET TRAILBLAZER LS, 2 WHEEL DRIVE SUV. WHILE DRIVING ON THE OHIO TURNPIKE DURING A SNOW STORM SHE LOST CONTROL AND HAD A HEAD ON CRASH WITH A CEMENT RETAINING WALL WHILE TRAVELING BETWEEN 25 TO 35 MILES PER HOUR. THE AIR BAG DID NOT DEPLOY DURING THE ACCIDENT AND SHE SLAMMED HARD INTO THE STEERING WHEEL RESULTING IN A CONCUSSION, CHEST INJURIES, SORE WRIST, DIZZINESS, AND STILL HAS RINGING IN ONE EAR. SHE DID HAVE HER SAFETY BELT ON AT THE TIME OF THE ACCIDENT AND ALWAYS WEARS IT. WE ARE BAFFLED AS TO WHY THE AIR BAG DID NOT COME OUT AS IT WOULD HAVE SAVE HER MUCH PAIN. THE CAR IS A TOTAL WRECK AS DESCRIBED BY THE PONTIAC DEALER THAT HER INSURANCE COMPANY TOWED THE SUV TO FOR REPAIRS. THE TRAILBLAZER SUSTAINED MUCH DAMAGE SUCH AS A BENT FRAME, BROKEN TRANSMISSION, ALL OF THE MOTOR MOUNTS AND THE TRANSMISSION MOUNTS BROKE LOOSE FROM THE FRAME, BENT STEERING WHEEL, AND ALL PARTS FROM THE ENGINE FORWARD ARE EITHER GONE OR BENT BEYOND REPAIR. WITH THIS VIOLENT OF A CRASH NO ONE HAS BEEN ABLE TO TELL US WHY THE AIR BAGS DID NOT DEPLOY. WE BOUGHT THIS SUV USED FROM A CHEVY DEALER IN JULY OF 2005 AND IT HAD AROUND 8000 MILES ON IT AT THAT TIME. I WOULD LIKE TO KNOW IF THERE IS SOME WAY OF CHECKING THE FUNCTIONALLY OF THIS AIR BAG TO SEE IF THERE MAY BE A POSSIBLE PROBLEM WITH IT. HER CRASH WAS HEAD ON AND IN MY OPINION VIOLENT ENOUGH TO ACTIVATE THE DRIVER SIDE AIR BAG. ANY SUGGESTIONS AS TO WHAT WE SHOULD DO? *TR
10256371	CHEVROLET	TRAILBLAZER	2005	2009-01-12	TL*THE CONTACT OWNS A 2005 CHEVROLET TRAILBLAZER. THE CONTACT WAS THE PASSENGER IN A VEHICLE TRAVELING 35 MPH ON ICY ROAD CONDITIONS. ANOTHER VEHICLE PULLED OUT IN FRONT OF THEM AND CRASHED INTO THE VEHICLE. THE VEHICLE WAS DESTROYED AND THE AIR BAGS FAILED TO DEPLOY. THE CONTACT WAS TRANSPORTED TO THE HOSPITAL BY AMBULANCE. HER NECK WAS SNAPPED BACKWARDS. THE SEAT BELT PROPERLY RESTRAINED HER AT THE TIME OF THE CRASH. A POLICE REPORT WAS FILED AND THE OTHER DRIVER RECEIVED A CITATION. THE DEALER WAS UNABLE TO DETERMINE WHY THE AIR BAGS FAILED. THE FAILURE MILEAGE WAS 80,000.
			2005	2000 04 20	AIRBAGS DID NOT DEPLOY. A DRIVER PULLED OUT IN FRONT OF MY WIFE. SHE WAS TRAVELING AT NEARLY 40MPH. SHE STRUCK ANOTHER VEHICLE BROAD SIDE. THE AIRBAGS DID NOT DEPLOY. THE FRONT BUMPER FROM OUR TRAILBLAZER WAS ABOUT 30 YARDS BEHIND OUR VEHICLE. MY WIFE
10266680	CHEVROLET	TRAILBLAZER	2005	2009-04-20	EXPERIENCED SEVERE BRUISING TO ABD AND CHEST. HER SEATBELT WAS IN USE. *TR  LOST CONTROL OF CAR ON NARROW ROAD UNDER NORMAL DRIVING CONDITIONS. COLLISION
10328284	CHEVROLET	TRAILBLAZER	2005	2010-04-29	INTO TWO TREES HEAD ON. DRIVER SIDE AIRBAG NEVER DEPLOYED. *TR  I WAS IN AN ACCIDENT WHERE ANOTHER DRIVER PULLED OUT IN FRONT OF ME CROSSING  ONCOMING TRAFFIC. I HIT HIM BROADSIDE DOING APPROXIMATELY 30-35 MILES PER HOUR. MY FRONT END WAS NEARLY SHOVED ALL THE WAY UP TO THE WINDSHIELD. MY 2005 TRAILBLAZER WAS TOTALED. MY AIRBAG DID NOT DEPLOY AND IF IT WASN'T FOR MY SEATBELT I WOULD HAVE WENT THROUGH THE WINDSHIELD THE IMPACT WAS SO HARD. I SUSTAINED A HURT SHOULDER AND ARM AND PROBABLY WOULDN'T HAD SUCH A PAINFUL INJURY IF THE AIRBAG HAD OF DEPLOYED. *TR
10357310	CHEVROLET	TRAILBLAZER	2005	2010-07-09	TL* THE CONTACT OWNS A 2005 CHEVROLET TRAIL BLAZER. THE CONTACT WAS DRIVING 50 MPH ON A SLICK MOUNTAIN ROAD WHEN THE VEHICLE HYDROPLANED AND CRASHED INTO THE SIDE OF A MOUNTAIN BEFORE FALLING INTO A DITCH. THE AIR BAGS DID NOT DEPLOY AND THE CONTACT AND TWO PASSENGERS SUSTAINED INJURIES. THE VEHICLE WAS DESTROYED. THE VEHICLE WAS NOT INSPECTED FOR THE FAILURE OF THE AIR BAGS. THE CONTACT WAS ADVISED BY HIS INSURANCE ADJUSTER THAT THE AIR BAGS SHOULD HAVE DEPLOYED. A POLICE REPORT WAS AVAILABLE. THE VIN WAS NOT AVAILABLE. THE FAILURE AND CURRENT MILEAGE WAS APPROXIMATELY 100,000.
10398899	CHEVROLET	TRAILBLAZER	2005	2011-04-28	AIR BAG DID NOT DEPLOY IN HEAD-ON COLLISION. *TR
10470760	CHEVROLET	TRAILBLAZER	2005	2012-07-27	TL* THE CONTACT OWNS A 2005 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT THE DRIVER WAS TRAVELING BETWEEN 30 AND 40 MPH WHEN THE VEHICLE CRASHED INTO ANOTHER VEHICLE HEAD ON AND THE AIR BAGS FAILED TO DEPLOY. THE DRIVER SUSTAINED INJURIES TO THE HEAD, MOUTH, CHEST, LEG, AND WRIST. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE VEHICLE WAS NOT TAKEN TO THE DEALER. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE AND CURRENT MILEAGE WAS 40,000.
10475331	CHEVROLET	TRAILBLAZER	2005	2012-06-27	TL* THE CONTACT OWNS A 2005 CHEVROLET TRAILBLAZER. THE CONTACT WAS TRAVELING 45 MPH WHEN HE CRASHED AGAINST THE STREET MEDIAN, A UTILITY POLE AND THEN INTO A BUILDING. THE CONTACT STATED THAT NONE OF THE AIR BAGS IN THE VEHICLE DEPLOYED. THE CONTACT SUSTAINED LESIONS TO THE FACE, A CONTUSION TO THE RIGHT EYE AND CONTUSIONS TO THE CHEST AND LOWER ABDOMEN AREA. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE, VEHICLE WAS INSPECTED HOWEVER, THE FINDINGS WERE NOT DISCLOSED TO CONTACT. THE FAILURE AND CURRENT MILEAGE WAS 118,000.

			1		1
					TL* THE CONTACT OWNS A 2005 CHEVROLET TRAILBLAZER. THE CONTACT WAS DRIVING IN RAINY WEATHER AT VARIOUS SPEEDS WHEN HE UNEXPECTEDLY CRASHED INTO ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED FOR THE INCIDENT. THE CONTACT SUSTAINED SEVERE HEAD TRAUMA AND WAS TRANSPORTED BY AN AMBULANCE TO THE HOSPITAL. THE VEHICLE WAS DESTROYED AND TOWED TO A SAVAGE FACILITY. THE MANUFACTURER WAS NOT NOTIFIED OF THE PROBLEM. THE APPROXIMATE FAILURE MILEAGE
10477042	CHEVROLET	TRAILBLAZER	2005	2012-09-17	WAS 122,000. UPDATED 10/31/12 *BF UPDATED 11/02/12  TL* THE CONTACT OWNS A 2005 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT WHILE
10477257	CHEVROLET	TRAILBLAZER	2005	2012-05-20	DRIVING 30 MPH ATTEMPTING TO AVOID IMPACTING A DEER ON THE ROAD, HE CRASHED OFF A 9 FOOT EMBANKMENT AND NONE OF THE AIR BAGS DEPLOYED. THE CONTACT BECAME UNCONSCIOUS AFTER HIS HEAD CRASHED INTO THE STEERING WHEEL. ALSO, THE CONTACT SUFFERED SEVERE NECK INJURIES. THE VEHICLE WAS INSPECTED BY THE DEALER BUT THE RESULTS WERE INCONCLUSIVE. THE MANUFACTURER WAS NOTIFIED BUT OFFERED NO ASSISTANCE. THE FAILURE AND CURRENT MILEAGE WAS 108,429. THE VIN WAS UNAVAILABLE. UPDATED 10/31/12 *CN UPDATED 11/9/2012 *JS
10669444	CHEVROLET	TRAILBLAZER	2005	2014-11-18	HIT BLACK ICE. TRUCK SLID OFF THE ROAD AND FRONT END IMPACTED THE DITCH CAUSING HEAVY DAMAGE TO THE FRONT END. AIR BAG FAILED TO DEPLOY CAUSING INJURY. *JS
10678235	CHEVROLET	TRAILBLAZER	2005	2015-01-21	TL*THE CONTACT OWNS A 2005 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT WHILE DRIVING AT 25 MPH, ANOTHER VEHICLE CRASHED INTO THE FRONT PASSENGER SIDE OF THE CONTACT'S VEHICLE. AS A RESULT, THE CONTACT CRASHED INTO A SIGN AND THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED BACK INJURIES AND THE PASSENGER SUSTAINED NECK AND BACK INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE CONTACT WAS UNABLE TO CONFIRM IF THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 122,000. THE VIN WAS UNAVAILABLE.
10689540	CHEVROLET	TRAILBLAZER	2005	2015-02-16	TL* THE CONTACT OWNED A 2005 CHEVROLET TRAILBLAZER. WHILE DRIVING VARIOUS SPEEDS, THE VEHICLE SLID AND CRASHED. THE DRIVER SIDE AIR BAG FAILED TO DEPLOY. THE VEHICLE WAS NOT INCLUDED IN NHTSA CAMPAIGN NUMBER: 06V417000 (AIR BAGS). THE CONTACT SUSTAINED LACERATIONS TO THE FACE, STITCHES UNDER THE EYEBROWS ON BOTH EYES, AND AN INJURED NECK THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE VIN WAS NOT AVAILABLE. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS NOT AVAILABLE.
10721128	CHEVROLET	TRAILBLAZER	2005	2015-04-27	2005 CHEVY TRAILBLAZER WAS DRIVEN BY MY GRANDDAUGHTER. SHE WAS TRYING TO ENTER ONTO I-10 INTERSTATE AND WAS GOING TOO FAST ON THE ENTRANCE RAMP. ROAD CONDITIONS WERE HAZARDOUS AS IT WAS A SEVERE RAIN STORM. SHE HYDROPLANED AND HIT A VEHICLE IN FRONT OF HER WHICH CAUSED HER TO SPIN INTO ONCOMING TRAFFIC. SHE WAS HIT ON THE DRIVER'S SIDE AND THE TRUCK SPUN AROUND SEVERAL TIMES BEFORE IT STOPPPED. THE AIRBAG DID NOT DEPLOY!!! THE POLICE OFFICER AND THE TOW COMPANY DRIVER SAID SHE WAS LUCKY TO BE ALIVE. MY CONCERN IS THIS COULD HAVE BEEN A FATAL ACCIDENT AND THE AIRBAG FAILED TO DEPLOY. THE TRAILBLAZER WAS TOTALED AS THE AXLE AND THE ENGINE WERE ON THE GROUND. THE DRIVER'S SIDE FRONT WHEEL CAME OFF. I HAVE ALWAYS LIKE CHEVY VEHICLES BUT AM NOW HESITANT TO PURCHASE ANOTHER ONE B/C OF THIS ISSUE WITH THE AIR BAG.
					HEAD ON COLLISION BOTH VEHICLES TRAVELING ABOUT 30MPH ON IMPACT AND TRAILBLAZER AIR
10983668	CHEVROLET	TRAILBLAZER	2005	2016-06-20	BAGS DID NOT DEPLOY. I HAD MY SEATBELT ON AND WAS NOT INJURED.  TL* THE CONTACT OWNS A 2005 CHEVROLET TRAILBLAZER. WHILE DRIVING 35 MPH, THE CONTACT CRASHED INTO THE REAR OF ANOTHER VEHICLE. THE AIR BAGS DID NOT DEPLOY. A POLICE REPORT WAS FILED. THE DRIVER SUSTAINED VARIOUS INJURIES TO THE FACE, WHICH REQUIRED MEDICAL ATTENTION. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE VEHICLE WAS TOWED TO A TOW YARD AND WAS NOT DIAGNOSED FOR THE AIR BAG FAILURE. THE FAILURE MILEAGE WAS 140,000.
11011530	CHEVROLET	TRAILBLAZER	2005	2017-03-02	AIRBAG DID NOT WORK
10111298	GMC	ENVOY	2005	2005-01-25	COMPLAINT RECEIVED VIA E-MAIL. MY WIFE WAS IN HER 2005 GMC ENVOY WHEN IT WAS HIT ON THE DRIVER'S TIRE, AND WAS DRIVEN INTO A CONCRETE POWER POLE AT 40 MPH HEAD ON. THE POWER LINES WERE KNOCKED DOWN. DRIVER'S SIDE AIR BAG NEVER DEPLOYED, AND HER HEAD HIT THE STEERING, CAUSING A BUMP ON THE HEAD, A BLACK EYE AND A CUT LIP.*AK
10119967	GMC	ENVOY	2005	2005-04-22	SEVERE CAR CRASH WITH MY LEASED 2005 GMC ENVOY. MUCH SIDE AND FRONT DAMAGE OCCURED, BUT AIR BAGS DID NOT DEPLOY. GMC WILL BE SENDING SOMEONE FROM THE PROTECTION ALLEGATION DEPARTMENT TO PERFORM A DIAGNOSTIC TEST ON THE AIR BAGS WITHIN THE NEXT 14 DAYS. THE ACCIDENT OCCURED ON 4/22/05. I DO NOT WANT THE VEHICLE REPAIRED AND GIVEN BACK TO ME FOR THE FOLLOWING 2 REASONS: THE VEHICLE INCURRED (IN MY OPINION, POLICE REPORT, ALLSTATE INSURANCE CO., STERLING AUTO BODY REPAI SHOP) ETC EXTENSIVE DAMAGE. THE 2ND REASON IS THE AIRBAGS, AS STATED, DID NOT DEPLOY. IF ANYONE WERE TO BE SEATED IN THE PASSENGER SEAT, THEY WOULD HAVE BEEN SERIOUSLY HURT. I HAVE READILY AT MY DISPOSAL ANY AND ALL ADDITIONAL INFO. WHICH I WILL GLADLY SUBMIT WHEN NECESSARY.

40492025	CMC	FANCOV	2005	2007 02 42	TL* - THE CONTACT OWNS A 2005 GMS ENVOY. IN MID FEBRUARY 2007 THE CONTACT'S VEHICLE WAS INVOLVED IN A HEAD ON COLLISION WHILE DRIVING AT 35 MPH. THE CONTACT DROVE INTO A TREE DUE TO ICY ROAD CONDITIONS. NONE OF THE AIR BAGS DEPLOYED. THERE WERE NO PASSENGERS IN THE VEHICLE. THE CONTACT WAS WEARING A SEAT BELT. THERE WERE NO WARNING INDICATOR LIGHTS ON THE DASHBOARD BEFORE OR AFTER THE CRASH. THE VEHICLE WAS TOWED TO A THE DEALER, AND THE INSURANCE COMPANY ADVISED THE CONTACT THAT THE VEHICLE WAS TOTALED. THE CONTACT HAD REQUESTED THAT THE MANUFACTURER ISSUE A COMPUTER READ OUT INDICATING WHY THE AIR BAGS DIDN'T DEPLOY. THE DEALER SENT THE CONTACT PIOR TO THE COLLISION A DIAGNOSTIC EMAIL STATING THE VEHICLE WAS OPERATING NORMALLY. A POLICE REPORT WAS TAKEN. THE CURRENT AND FAILURE MILEAGE WERE BOTH
10183935	GMC	ENVOY	2005	2007-02-13	25000.*AK
10257735	GMC	ENVOY	2005	2009-01-28	TL*THE CONTACT OWNS A 2005 GMC ENVOY. THE CONTACT WAS INVOLVED IN A HEAD-ON CRASH. THE CONTACT WAS SEVERELY INJURED AND THE ENTIRE FRONT END OF THE VEHICLE WAS CRUSHED. ALL FOUR TIRES BLEW OUT AND THE FRONTAL AIR BAGS FAILED TO DEPLOY. THERE WERE NO OTHER PASSENGERS IN THE VEHICLE AND NO MAINTENANCE WAS PERFORMED ON THE VEHICLE PRIOR TO THE CRASH. THE VEHICLE WAS DESTROYED AND TOWED FROM THE SCENE. A POLICE REPORT WAS FILED. THE MILEAGES, SPEED, AND VIN WERE UNKNOWN.
10463248	GMC	ENVOY	2005	2011-07-15	TL* THE CONTACT OWNED A 2005 GMC ENVOY. THE CONTACT STATED WHILE DRIVING 55 MPH, HE CRASHED INTO A TREE. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED MINOR TISSUE DAMAGE ON THE UPPER BODY FROM THE IMPACT. THE VEHICLE WAS TOWED TO A REPAIR SHOP, WHERE IT WAS DECLARED DESTROYED. A POLICE REPORT WAS FILED. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE; HOWEVER, THEY PROVIDED NO ASSISTANCE. THE CURRENT AND FAILURE MILEAGE WERE UNAVAILABLE. UPDATED 09/24/2012 *JS THE CONSUMER STATED THE ACCIDENT WAS INITIATED BY A VEHICLE GOING WEST BOUND THAT CROSSED THE SOLID DOUBLE LINES, ULTIMATELY CAUSING A DOMINO EFFECT. THE CONSUMER'S VEHICLE WAS DAMAGED WHEN HE TRIED TO AVOID HITTING THE VEHICLE BY SWERVING SIDEWAYS AND SLIDING INTO THE GRASS. HE TRIED STOPPING THE VEHICLE WHILE IT WAS STILL ON THE PAVEMENT BUT HE INEVITABLY RAN INTO THE DITCH AND FLEW AIRBORNE INTO A TREE, AND THE TRUCK OVERTURNED. UPDATED 03/25/14 UPDATED 01/22/15. *JBUPDATED 03/17/16 *BF UPDATED 09/06/16.*JB UPDATED 09/18/2017*JS *JS
10503799	GMC	ENVOY	2005	2013-03-15	THE ACCIDENT HAPPENED ON 2-15-2013 ON PENNSYLVANIA AVENUE SE DURING RUSH HOUR THE OTHER CAR DID NOT YIELD TO ONGOING TRAFFIC ON PENNSYLVANIA AVENUE AND DODGED OUT FROM A SIDE STREET AND HIT MY VEHICLE ON THE FRONT SIDE AND MY SON WHO IS 13 HEAD HIT THE DASHBOARD AND MY DAUGHTERS DOG FLEW FROM THE BACK SEAT UP TO THE FRONT. THE OTHER VEHICLE AIRBAG DID DEPLOY BUT MINES DID NOT. *TR
10203/99	GIVIC	EINVUY	2005	2013-03-15	OTHER VEHICLE AIRBAG DID DEPLOT BUT MIINES DID NOT. *TK
10607728	GMC	ENVOY	2005	2008-03-16	SINGLE CAR ACCIDENT WITH CAR RUNNING OFF ROAD RAN INTO DITCH, OVERTURNED AND HITTING PHONE POLE. AIRBAG DID NOT DEPLOY. QUESTIONABLE SEAT BELT ISSUES. *TR ON SEPTEMBER 16TH, 2011, I WAS INVOLVED IN AN AUTO ACCIDENT THAT WAS A HEAD ON
10632374	GMC	ENVOY	2005	2011-09-16	CRASH. THE AIR BAGS NEVER DEPLOYED AND I SUSTAINED BACK INJURIES. ON SITE OF THE ACCIDENT MY BACK WAS HURTING SOME BUT DID NOT GO TO HOSPITAL UNTIL LATER THAT EVENING, AFTER THE ADRENALIN AND THE SHOCK WORE OFF. I NOW HAVE SEVER BACK PROBLEMS WITH A LOT OF PAIN AND WAS DECLARED DISABLED IN 2012. AT THE TIME OF DOING RESEARCH I WAS TOLD BY ON-STAR, WHICH NEVER CAME ON, THAT IF MY AIR BAGS DIDN'T DEPLOY THEY WOULDN'T COME ON BUT, THE FRAME WAS BENT SO BAD THAT THEY TOTALED THE VEHICLE, WITH A LOT OF OTHER DAMAGE. THE WHOLE FRONT WAS DAMAGED, THE BUMPER WAS DESTROYED ALONG WITH DAMAGE TO THE MOTOR. AND WE COULD NOT UNDERSTAND WHY THE AIR BAGS DID NOT DEPLOY. *TR
10908300	GMC	ENVOY	2005	2016-08-22	CAR IN FRONT OF ME PUSHING THE OTHER CARS TO HIT EACH OTHER. MY FRONT END OF MY CAR WAS SEVERELY DAMAGED BAD ENOUGH TO DAMAGE THE RADIATOR AND DESTROY MY AC UNIT. I'M NOT SURE WHAT ELSE WAS DAMAGED. IT SENT THE PERSON IN FRONT OF ME AND MYSELF TO THE EMERGENCY ROOM. " MY AIR BAGS DID NOT DEPLOY ". MY VEHICLE WAS MOVING ON A CITY STREET.

			1		
10370915	ISUZU	ASCENDER	2005	2010-12-10	I WAS DRIVING EAST ON INTERSTATE 10 IN PENSACOLA, FLORIDA. A VEHICLE TRAVELING WEST LOST CONTROL AND CAME ACROSS THE SLOPED GRASSY MEDIAN, OVERTURNED AN SLID ACROSS MY TRAFFIC LANE, CAUSING ME TO CRASH INTO THEIR ROOF. MY ODOMETER SAYS AT THE POINT OF IMPACT I WAS ONLY TRAVELING 48 MPH. ONCE I REALIZED I WAS ALIVE, I WAS IN AWE THAT THE AIRBAG DID NOT DEPLOY. I SPOKE TO A MANAGER AT ISUZU IN CALIFORNIA. HE REQUESTED THE VIN NUMBER AND SOME OTHER PERSONAL INFORMATION AND SAID IF THE INSURANCE COMPANY ADJUSTER SAW ANY MANUFACTURER DEFECTS, THEN THE INSURANCE COMPANY WOULD CONTACT ISUZU. I ALSO CONTACTED MY INSURANCE PROVIDER, THEY SAID SINCE I WAS NOT KILLED IN THE ACCIDENT, THEY WOULD NOT PURSUE ANYTHING WITH ISUZU. I THOUGHT SOMEONE SHOULD KNOW BECAUSE I WAS PINNED IN THE VEHICLE AND HAD TO BE CUT OUT. THE TOW TRUCK DRIVER ALSO MENTIONED SOMETHING ABOUT THE STEERING COLUMN HAD MALFUNCTIONED, NOT SURE WHAT THE MALFUNCTION WAS, BUT IT DID NOT DO WHAT IT WAS DESIGNED TO DO FOR SAFETY PURPOSES. I SUSTAINED A FRACTURED RIGHT FOOT, BRUISED LUNGS/RIBS, NUMEROUS LACERATIONS, BRUISED LEFT KNEE AND LEFT ELBOW. *TR
10449350	ISUZU	ASCENDER	2005	2012-02-20	THAT THE INSURANCE COMPANY DECIDED TO TOTAL THE CAR BECAUSE THE DAMAGE WAS TO BIGI AM PREGNANT AND I HAVE 2 MORE KIDS, AND I'M SO DISAPPOINTED WITH THIS EXPERIENCE THAT SOMETHING COULD HAPPENED TO ME OR MY KIDS IF WE WERE IN THE ACCIDENT. *TR
10228093	BUICK	RAINIER	2004	2008-03-20	MY FIANCE WAS IN ACCIDENT WITH MY SUV AND THE AIR BAG DIDN'T DEPLOY CAN I SUE THE COMPANY WHO SOLD ME THE VEHICLE? *TR
10266690	BUICK	RAINIER	2004	2009-04-05	WHILE TRAVELING AT A SPEED OF APPROX 50-55 ON A INTERSTATE, I WAS REARED ENDED BY A AUTO, MY AUTO WAS STRUCK THEN SHOVELED INTO A CEMENT WALL BLOCK AND THEN BOUNCED INTO ON COMING TRAFFIC TO THE OTHER CEMENT WALL BLOCK ON THE OPPOSITE SITE WHILE TRYING TO STOP, I WAS WEARING A SEAT BELT, THE VEHICLE'S AIR BAGS DIDN'T GO OFF AT ALL IN THE VEHICLE. A HEAD INJURY OCCURRED, NECK AND SHOULDER INJURIES OCCURRED. THE AUTO WAS A TOTAL LOSS! *TR
					A PERSON RAN TWO STOP SIGNS AND ENTERED VEHICLE PATH. THE TWO VEHICLES HIT HEAD ON AND THIS VEHICLE MADE IMPACT AT 40 MPH AFTER IT DECELERATED FROM 43 MPH. THE TWO VEHICLE HIT HEAD ON WITH NEAR PERFECT EVEN IMPACT, BASED UPON THIRD PARTY VISUAL DESCRIPTION OF THE FRONT END OF THE VEHICLES DAMAGE. THE VEHICLE DECELERATED AT A MAX SDM RECORDED VELOCITY CHANGE RATE OF -14.07 (MPH) AND A ALGORITHM ENABLED TO MAXIMUM SDM RECORDED VELOCITY CHANGE OF 127.5 MSEC. DRIVER OF THE VEHICLE HIT THE STEERING WHEEL WITH HEAD KNOCKING THE PERSON OUT. AIRBAGS DID NOT DEPLOY. ONSTAR WAS NOT NOTIFIED THAT THERE WAS AN ACCIDENT. COMPUTER SHOWS THE SEATBELT WAS WORN BY DRIVER. WHEN THE ONSTAR WAS MANUALLY ACTIVATED BY THE DRIVER WHEN HE CAME TOO, THE GPS SHOWED THE VEHICLE FURTHER NORTH UP THE ROAD CAUSING INCORRECT POLICE DIVISION BEING CALLED. VEHICLE WAS GOING UP HILL WHEN THE ACCIDENT OCCURRED. OTHER VEHICLE WAS GOING DOWNHILL. THE OTHER VEHICLE WAS A SUBARU. VEHICLE COMPUTER DATA WAS RETRIEVED BY A BOSCH CRASH DATA RETRIEVAL TOOL USING VERSION 8.0 SOFTWARE. I HAVE A COPY OF THIS DATA. GM REPORTS THAT THE COMPUTER WAS CORRECT NOT TO DEPLOY AIRBAGS AND NOT CALL FOR HELP USING ONSTAR. THE VEHICLE HAD A SOFTWARE MODIFICATION DUE TO A FAULT WITH THE FAN SPEED CALIBRATION SETTING OFF A WARNING LIGHT. WE HAD COMPLAINED THAT THINGS WERE NEVER CORRECT AFTER THIS MODIFICATION OF THE SOFTWARE AND TOOK THE VEHICLE TO TWO DIFFERENT DEALERSHIPS COMPLAINING THAT COMPUTERS WERE DOING STRANGE THINGS AFTER THIS FIRMWARE MODIFICATION. VEHICLE VIN: [XXX] INFORMATION REDACTED PURSUANT TO THE FREEDOM OF
10638828	BUICK	RAINIER	2004	2012-11-17	INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6). *TR

10638830	BUICK	RAINIFR	2004	2012-11-17	A PERSON RAN TWO STOP SIGNS AND ENTERED VEHICLE PATH. THE TWO VEHICLES HIT HEAD ON AND THIS VEHICLE MADE IMPACT AT 40 MPH AFTER IT DECELERATED FROM 43 MPH. THE TWO VEHICLE HIT HEAD ON WITH NEAR PERFECT EVEN IMPACT, BASED UPON THIRD PARTY VISUAL DESCRIPTION OF THE FRONT END OF THE VEHICLES DAMAGE. THE VEHICLE DECELERATED AT A MAX SDM RECORDED VELOCITY CHANGE RATE OF -14.07 (MPH) AND A ALGORITHM ENABLED TO MAXIMUM SDM RECORDED VELOCITY CHANGE OF 127.5 MSEC. DRIVER OF THE VEHICLE HIT THE STEERING WHEEL WITH HEAD KNOCKING THE PERSON OUT. AIRBAGS DID NOT DEPLOY. ONSTAR WAS NOT NOTIFIED THAT THERE WAS AN ACCIDENT. COMPUTER SHOWS THE SEATBELT WAS WORN BY DRIVER. WHEN THE ONSTAR WAS MANUALLY ACTIVATED BY THE DRIVER WHEN HE CAME TOO, THE GPS SHOWED THE VEHICLE FURTHER NORTH UP THE ROAD CAUSING INCORRECT POLICE DIVISION BEING CALLED. VEHICLE WAS GOING UP HILL WHEN THE ACCIDENT OCCURRED. OTHER VEHICLE WAS GOING DOWNHILL. THE OTHER VEHICLE WAS A SUBARU. VEHICLE COMPUTER DATA WAS RETRIEVED BY A BOSCH CRASH DATA RETRIEVAL TOOL USING VERSION 8.0 SOFTWARE. I HAVE A COPY OF THIS DATA. GM REPORTS THAT THE COMPUTER WAS CORRECT NOT TO DEPLOY AIRBAGS AND NOT CALL FOR HELP USING ONSTAR. THE VEHICLE HAD A SOFTWARE MODIFICATION DUE TO A FAULT WITH THE FAN SPEED CALIBRATION SETTING OFF A WARNING LIGHT. WE HAD COMPLAINED THAT THINGS WERE NEVER CORRECT AFTER THIS MODIFICATION OF THE SOFTWARE AND TOOK THE VEHICLE TO TWO DIFFERENT DEALERSHIPS COMPLAINING THAT COMPUTERS WERE DOING STRANGE THINGS AFTER THIS FIRMWARE MODIFICATION. VEHICLE VIN: [XXX] INFORMATION REDACTED PURSUANT TO THE FREEDOM OF INFORMATION ACT (FOIA), 5 U.S.C. 552(8)(6) *TR
10638830	BUICK	RAINIER	2004	2012-11-17	552(B)(6). *TR
11099015	BUICK	RAINIER	2004	2016-04-29	TL* THE CONTACT OWNED A 2004 BUICK RAINIER. WHILE DRIVING APPROXIMATELY 30 MPH IN THE RAIN, THE VEHICLE HYDROPLANED. THE CONTACT LOST CONTROL OF THE VEHICLE AND CRASHED INTO A WALL. AS A RESULT, THE CONTACT WAS RENDERED UNCONSCIOUS AND TRANSPORTED TO THE HOSPITAL VIA AMBULANCE. THE CONTACTS HEAD STRUCK THE DRIVER'S SIDE WINDOW AND THE CONTACT REMAINED IN A COMA FOR SEVERAL MONTHS. THE AIR BAGS DID NOT DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT SUSTAINED INJURIES TO THE RIGHT SIDE OF THE HEAD, WHICH CAUSED WALKING COMPLICATIONS AND A LOSS OF FEELING IN THE RIGHT SIDE OF THE BODY. IN ADDITION, THE CONTACT SUFFERED A LOSS OF SIGHT IN THE RIGHT EYE DUE TO A CRUSHED SKULL. THE VEHICLE WAS TOWED TO A TOW LOT AND DEEMED DESTROYED. A DEALER WAS NOT MADE AWARE OF THE AIR BAG FAILURE. THE VEHICLE WAS NOT DIAGNOSED. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS UNKNOWN.
10125145	CADILLAC	ESCALADE	2004	2005 05 11	INVOLVED IN A HORRIFIC AUTO ACCIDENT WITH OTHER VEHICLE. HIT IN FRONT PASSENGER & FRONT PART OF VEHICLE (BY RADIATOR AREA) AT HIGH SPEED. EST.SPEED APPROX. 45-55 MPH WITH NO SKID MARKS, OTHER VEHICLE STOPPED WHEN IT HIT US. NEW GM/ESCALADE-SUV/"04-WITH 11,000 MILES, BOUGHT NEW DECLARED TOTAL LOSS, WITH APPARENT SERIOUS FRAME DAMAGE/BENT 12 IN. AND FOUND STRESS CRK. SHOULD GIVE AN IDEA HIGH SPEED OTHER VEHICLE TRAVELING. 8-10 SECONDS FROM IMPACT, ONSTAR CAME ON AUTOMATICALLY, THEY RECD. EMERGENCY MESSAGE VIA SATELLITE, VEHICLE HAD BEEN IN A SERIOUS MVA AND AIR BAGS DEPLOYED. WE DIDN'T CALL ONSTAR THEY CALLED US. NEXT DAY WE CALLED ASKED HOW THEY KNEW WE WERE ACCIDENT. TOLD US DEPENDING ON THE SEVERITY, THEY GET CERTAIN SIGNALS, WHICH OURS HAD ADVISED OF SERIOUSNESS & AIRBAG DEPLOYMENT. UNBELIEVABLY, NONE OF OUR 4 AIRBAGS DEPLOYED. WE & HUNDREDS OF OUR FRIENDS ARE IN TOTAL DISBELIEF WHEN YOU SEE THE CONDITION VEHICLE WAS LEFT IN & THAT 4 AIR BAGS DIDN'T DEPLOY. WE WERE INJURED BUT BY GRACE OF GOD INJURIES WERE NOT LIFE THREATENING. HEAD, UPPERANDLOWERBACK, NECK, LEGS, SHOULDER, HIPSAND ARMS EXTREMLEY SORE. HAS BEEN 33 DAYS SINCE THE ACCIDENT AND AM STILL FEELING PAINS & SERIOUS HEADACHES BUT ALIVE. HAVE DECIDED TO BECOME ADVOCATES AND REPORT ACCIDENT/INCIDENT TO POSSIBLY SAFE A PERSON(S) LIFE AND MAKE GENERAL MOTORS AWARE THAT THEY HAVE A POSSIBLE DEFECT IN THEIR AIR BAGS, LEADING TO MASSIVE RECALL AND POSSIBLY A CLASS ACTION LAW SUIT IF NOT FIXED. THIS IS A VERY SERIOUS MATTER. ANYTIME ANYONE IS HIT AT RATE OF SPEED THAT WE WERE, TO LEAVE BRAND NEW SUV ESCALADE A TOTAL LOSS/ 12 IN. BENT FRAME & STRESS CRACK & 4 AIR BAGS NOT DEPLOY - LEADS US TO BELIEVE OF A SERIOUS PROBLEM AND A SERIOUS ONE FOR GM/CADILLAC. CALL FOR FURTHER DETAILS (956) 533-0811 (956)358-5272. THANK YOU & GOOD BLESS
10125145	CADILLAC	ESCALADE	2004	2005-05-11	GOD BLESS. THE CONSUMER WAS INVOLVED IN AN A SERIOUS ACCIDENT AND THE AIR BAGS DID NOT DEPLOY.
10127916	CADILLAC	ESCALADE	2004	2005-05-11	THERE WERE 2 INJURIES. *JB *SC

10152700	CADILLAC	ESCALADE	2004	2005 07 46	ON JULY 16TH, 2005; I WAS INVOLVED IN A LIFE CHANGING, SINGLE VEHICLE AUTO ACCIDENT. I STRUCK A HILL WITH THE FRONT RIGHT SIDE OF THE VEHICLE WITH ENOUGH EXCESSIVE FORCE TO FLIP THIS CADILLAC ESCALADE HEAD FIRST. THE ESCALADE FLIPPED TWICE, IMPACTING THE FRONT OF THE VEHICLE AND LANDING UP SIDE DOWN. ASTONISHINGLY, OUT OF THE FOUR AIR BAGS IN THIS VEHICLE, NOT ONE OF THEM DEPLOYED. I PURCHASED THIS 2004 ESCALADE BRAND NEW AND AT THE TIME OF THE ACCIDENT IT ONLY HAD 15,000 MILES. THE VEHICLE IS A TOTAL LOSS AND IT IS UTTERLY UNBELIEVABLE THAT THE AIR BAGS DID NOT DEPLOY. I WAS SO IMPRESSED WITH THE RAVED REVIEWS, CONSUMER REPORTS INCLUDING SAFETY FEATURES, AND STYLISH BODY THAT THIS CADILLAC ESCALADE BECAME THE VEHICLE OF MY DREAMS. NEEDLESS TO SAY, I AM VERY DISAPPOINTED WITH MY CADILLAC EXPERIENCE. I DO NOT TRUST THIS VEHICLE ENOUGH TO GET INTO ANOTHER ONE. I KNOW THAT I AM ONLY HERE BECAUSE GOD DECIDED THE SPARE MY LIFE. AS A DIRECT RESULT OF THIS ACCIDENT I FREQUENTLY SUFFER SEVERE MIGRAINES, DIZZY SPELLS, BLURRED VISION, MEMORY LOSS, AND ANXIETY/PANIC ATTACKS ALL WHICH KEEP ME FROM SLEEPING. IT IS EXTREMELY DIFFICULT TO COMMUTE FROM DOCTORS APPOINTMENTS AND WORK FOR FEAR OF ANOTHER ACCIDENT. THE NEXT WEEK I HAD SEVERE CHEST, SHOULDER AND LOWER BACK PAINS; ALL OF WHICH I AM BEING TREATED FOR ON A REGULAR BASIS. I ALSO SEEK TREATMENT FROM A NEUROLOGIST FOR THE HEAD INJURY. I BELIEVE THAT THIS VEHICLE HAS A SERIOUS PROBLEM WITH THE AIR BAGS AND GM SHOULD STRONGLY CONSIDER INVESTIGATING
10152700	CADILLAC	ESCALADE	2004	2005-07-16	THIS MATTER. *NM
10386829	CADILLAC	ESCALADE	2004	2010-02-10	TL* THE CONTACT OWNS A 2004 CADILLAC ESCALADE. WHILE DRIVING APPROXIMATELY 65-75 MPH, THE CONTACT FELL ASLEEP. THE VEHICLE DRIFTED OFF THE ROAD AND CRASHED INTO A BRIDGE BARRIER. THE CONTACT SUSTAINED A BROKEN WRIST AND FACIAL LACERATIONS. THE FRONT SEAT PASSENGER WAS AIR-LIFTED TO THE HOSPITLA AND SUSTAINED A BROKEN RIGHT LEG AND SEVERE FACIAL INJURIES. THE REAR SEAT PASSENGER SUSTAINED INJURIES TO THE SPINE. THE AIRBAGS FAILED TO DEPLOY WITH THE MASSIVE IMPACT. A POLICE REPORT WAS FILED AND THE VEHICLE WAS TOWED TO A COLLISION CENTER. UPDATED 10/14/11
10436436	CADILLAC	ESCALADE	2004	2011-11-01	I WAS IN AN MVA ON NOV. 1, 2011 THAT TOTALED MY 2004 ESCALADE. NONE OF THE AIRBAGS DEPLOYED, DESPITE DAMAGE TO ALL SIDES OF THE AUTOMOBILE, INCLUDING FRONT END IMPACT. THE CAR ACTUALLY ROLLED. THE FRAME WAS BENT AND THE FRONT HIT AN EMBANKMENT NOSE FIRST WITH GREAT IMPACT. I SUFFERED SEVERAL INJURIES, INCLUDING HEAD TRAUMA. *TR
10430430	CADILLAC	LICALADE	2004	2011-11-01	2004 CADILLAC SRX INVOLVED IN A FRONT END RASH ON JAN 19, 2010. SEVERE FRONT END CRASH
10324984	CADILLAC	SRX	2004	2010-01-19	HOWEVER AIRBAGS DID NOT DEPLOY. *TR
10638570	CADILLAC	SRX	2004	2014-09-17	TL* THE CONTACT OWNS A 2004 CADILLAC SRX. THE CONTACT STATED THAT A TIRE BLEW OUT CAUSING THE VEHICLE TO SPIN OUT OF CONTROL AND CRASH. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED AND ONE INJURY WAS REPORTED THAT DID NOT REQUIRE MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS 120,000.
10245434	CHEVROLET	ASTRO	2004	2008-10-10	MY WIFE WAS DRIVING A 2004 CHEVY ASTRO VAN APPROX. 35-40 MPH ON A TWO-WAY STREET. ANOTHER DRIVER FROM THE OPPOSITE DIRECTION CUT ACROSS INTO HER LANE AND HAD A HEAD-ON COLLISION. SHE SUFFERED A BROKEN WRIST & BRUISED RIBS. SHE HAD THREE OF OUR CHILDREN IN THEIR SEATS. THEY WERE SHAKEN AND HAD SEATBELT BRUISES. THE VAN WAS NOT DRIVABLE AND WAS TOWED AWAY. THE POLICE & THE TOW DRIVER REPORTED THAT THE AIRBAGS DID NOT DEPLOY. WE HAVE SOME EXPECTATION THAT THE AIRBAGS WOULD HAVE SECONDARY ROLE TO MINIMIZE INJURIES. MY COMPLIANT THAT THE HARD COLLISION WAS SUFFICIENT TO DEPLOY SAFETY EQUIPMENT BUT DID NOT WORK AS DESIGNED. WAS THERE A RECALL FOR AIRBAG FAILURES FOR THIS MODEL OF VEHICLE? *TR
10057529	CHEVROLET	SILVERADO	2004	2004-01-27	WHILE DRIVING 40 MPH VEHICLE WAS INVOLVED IN A HEAD ON COLLISION. UPON IMPACT, DUAL AIR BAGS DID NOT DEPLOY. PASSENGER SUSTAINED INJURIES TO NECK, JAW, AND A BROKEN ARM. *AK *JB
10065268	CHEVROLET	SILVERADO	2004	2004-03-30	WHILE DRIVING 60 MPH DRIVER APPLIED THE BRAKES AND PEDAL WENT TO THE FLOOR. THIS CAUSED THE DRIVER TO LOSE CONTROL OF THE VEHICLE, AND HIT ANOTHER VEHICLE ON THE PASSENGER SIDE. UPON IMPACT, BOTH AIR BAGS DID NOT DEPLOY. THERE WERE NO INJURIES. *AK
10073357	CHEVROLET	SILVERADO	2004	2004-05-10	THE CONSUMER STATED THE FRONTAL AIR BAGS DID NOT DEPLOY DURING AN ACCIDENT. THERE WERE NO INJURIES. THE DRIVER HAD THE VEHICLE TOWED TO A BODY SHOP. *JB WHILE TRAVELING AT 30 MPH AND APPROACHING AN INTERSECTION, A SECOND VEHICLE ENTERED ON THE CONSUMER'S LEFT HAND SIDE, THERE WAS NO TIME TO REACT, THE CONSUMER STRUCK THE SECOND VEHICLE ON IT'S RIGHT SIDE. THE DRIVERS SIDE AIR BAG DID NOT DEPLOY. *SC *JB
10083968	CHEVROLET	SILVERADO	2004	2004-06-19	WHILE DRIVING AT 35 MPH CONSUMER'S VEHICLE WAS INVOLVED IN A FRONTAL COLLISION. UPON IMPACT, NONE OF THE FRONTAL AIRBAGS DEPLOYED. DRIVER SUSTAINED MINOR BRUISES TO THEIR CHEST FROM THE SEAT BELT, AND THE FRONT PASSENGER SUSTAINED A BRUISED KNEE. THIS COLLISION RESULTED IN \$800.00 FRONTAL DAMAGE. *AK

10086614	CHEVROLET	SILVERADO	2004	2004-08-06	2001 CHEVROLET PICKUP INVOLVED IN A CRASH WITH A TREE AND AIR BAG DID NOT DEPLOY. DRIVE SUSTAINED SEVERE INJURY TO MOUTH BY HITTING STEERING WHEEL, DISPLACING FIVE LOWER FRONT TEETH CAUSING EXTENSIVE PAIN HAVING TEETH REPOSITIONED. *JB
10105126	CHEVROLET	SILVERADO	2004	2004-12-10	WHILE DRIVING 60 MPH VEHICLE HYDROPLANED, LOST CONTROL, AND CRASHED INTO A BUILDING HEAD ON . UPON IMPACT, DRIVER'S SIDE AIR BAG DID NOT DEPLOY, AND PASSENGER'S SIDE AIR BAG WAS DEACTIVATED. NO INJURIES REPORTED. *AK
					CONSUMER'S VEHICLE WAS INVOLVED IN A FRONTAL COLLISION WITH AN OAK TREE AT 5 MPH.  UPON IMPACT, NEITHER FRONTAL AIR BAG DEPLOYED. ALTHOUGH CONSUMER WAS PROPERLY RESTRAINED THE CRASH PUSHED THE ENGINE THROUGH THE FIREWALL AGAINST THE PASSENGER'S SEAT. DRIVER SUSTAINED INJURIES, AND AN AMBULANCE TRANSPORTED THE
10117538	CHEVROLET	SILVERADO	2004	2005-04-01	DRIVER TO THE LOCAL HOSPITAL. *AK
10134302	CHEVROLET	SILVERADO	2004	2005-08-23	DT: 2004 CHEVROLET SILVERADO. THE CONSUMER WAS IN AN ACCIDENT ON AUGUST 23, 2005. WHILE DRIVING 40 MPH. A DEER CAME ONTO THE ROAD, CONSUMER'S VEHICLE SWERVED TO AVOID IT, AND WENT INTO RAVINE. TOOK OUT TWO TREES. THIS DAMAGED THE FRONT END OF THE VEHICLE. UPON IMPACT, THE AIRBAGS DID NOT DEPLOY. THE VEHICLE WAS DRIVEN HOME, AND IS CURRENTLY AT THE AUTO BODY SHOP. THERE HAS BEEN NO DETERMINATION AS TO WHY THE AIR BAGS DID NOT DEPLOY. A POLICE REPORT TAKEN. THE CONSUMER SUSTAINED INJURIES. SHE BRUISED THE CHEST, AND SHE HAD A BULGING DISC I NECK NEAR SPINAL CORD. *AK
10134631	CHEVROLET	SILVERADO	2004	2005-08-28	DT: THE CONTAC OWNS A 2004 CHEVROLET SILVERADO. THE CONTACT'S VEHICLE WAS INVOLVED IN A FRONT END COLLISION WHILE TRAVELING 65 MPH ON AUGUST 28, 2005. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. THERE WERE NO WARNING LIGHTS ON INDICATING THERE WAS A PROBLEM WITH THE AIR BAG SYSTEM. THE CONTACT STATED ANOTHER VEHICLE LOST CONTROL OF AND HIT THE SIDE OF CONTACT'S VEHICLE, CAUSING IT TO HIT THE CENTER MEDIAN. THE CONSUMER CONTACTED THE DEALERSHIP AND THE MANUFACTURER. *AK
10141161	CHEVROLET	SILVERADO	2004	2005-10-25	DT: THE CONTACT STATED THE COMPANY TRUCK THAT HE DROVE WAS INVOLVED IN AN ACCIDENT. UPON IMPACT, THE AIRBAGS DID NOT DEPLOY. THE ENTIRE FRONT END OF THE VEHICLE WAS DESTROYED. THE CONTACT SUSTAINED INJURIES. HE BRUISED HIS CHEST, SHIN AND TORE THE TENDON IN HIS ANKLE. THERE HAD BEEN NO ACCIDENTS IN THIS VEHICLE PRIOR TO THIS. A POLICE REPORT WAS TAKEN AT THE SCENE. *AK
10149101	CHEVROLET		2004	2006-01-10	ON JAN. 10 OF 2006 I LOST CONTROL OF MY 2004 CHEVY SILVERADO WHILE I WAS DRIVING ON ICY ROAD. I HIT A CONCRETE DIVIDER HEAD ON. MY CONCERN IS THAT THE AIR BAG NEVER DEPLOYED EVEN THOUGH THE DAMAGE TO THE TRUCK WAS QUITE BIG. I WAS GIVEN A ESTIMATE OF \$9820 OF DAMAGE BECAUSE THEY HAVE TO REPLACE THE BODY FRAME. EVEN WITH ALL THIS DAMAGE MY AIRBAG NEVER DEPLOYED. *NM
10153763	CHEVROLET	SILVERADO	2004	2006-03-20	WHILE DRIVING ON SLICK ROADS MY TRUCK WENT OFF THE ROAD, DOWN A HILL AND CRASHED INTO AN EMBANKMENT. THE ENTIRE FRONT END WAS SEVERELY DAMAGED. THE FRAME WAS BENT, THE BUMPER WAS WRAPPED UP UNDER THE FENDER, GRILL GUARD PUSHED INTO THE RADIATOR. UPON IMPACT NEITHER OF THE AIRBAGS DEPLOYED. MY FACE SLAMMED INTO THE STEERING WHEEL BREAKING MY NOSE. TRUCK SALVAGED. *JB
10155380	CHEVROLET	SILVERADO	2004	2006-02-19	I HAD AN ACCIDENT IN MY 2004 CHEVY TRUCK AT A SPEED OF APPROX 80 MPH HEAD ON IMPACT. THE TRUCK WAS TOTALED BUT MY AIR BAGS DIDN'T WORK. I MADE A COMPLAINT TO GMAC, THEY HAD AN INVESTIGATION AND ACCORDING TO THEM THERE WAS NOTHING WRONG WITH THE AIR BAGS. I FIND THAT HARD TO BELIEVE WITH THAT KIND OF IMPACT, THIS IS A SAFETY ISSUE AND I HAVE 2001 CHEVY SUBURBAN THAT MY WIFE DRIVES WITH MY CHILDREN. CAN YOU PLEASE LOOK INTO THIS BECAUSE I WOULD LIKE TO KNOW GMAC IS NOT TAKEN RESPONSIBILITY FOR THE AIR BAG FAILURE. THANK GOD I WAS WEARING MY SEAT BELT, BECAUSE IT WAS THE ONLY THING THAT SAVED MY LIFE. *NM
10156562	CHEVROLET	SILVERADO	2004	2004-09-04	DT*: THE CONTACT STATED WHILE STOPPED AT A STOP SIGN, THE VEHICLE WAS HIT ON THE DRIVER'S SIDE FRONT END. THE AIR BAGS DID NOT DEPLOY. SEAT BELTS WERE IN USE HOWEVER BACK AND NECK INJURIES WERE SUSTAINED. THE IMPACT WAS SO SEVERE; BOTH PASSENGER TIRES CAME OFF THE RIMS AND DUG INTO THE PAVEMENT. THE POLICE WERE ON SCENE AND A REPORT WAS FILED. THE VEHICLE WAS TOWED TO DEALER, UPON INSPECTION NO DETERMINATION COULD BE MADE WHY THE AIR BAGS DID NOT DEPLOY. THE MANUFACTURER WAS ALERTED. UPDATED 05/16/06. *JB
10202240	CHEVROLET	SILVERADO	2004	2006-02-08	I WAS DRIVING UP TP A STOP LIGHT WHEN THE LIGHT TURNED RED THERE WAS A CAR IN FRONT OF ME THAT HAD STOPPED, I REALIZED I DIDN'T HAVE A LOT OF ROOM BUT THOUGHT IT WOULD BE ENOUGH TO STOP. I PUT THE PEDAL TO THE FLOOR AND STILL HIT THEM TWO PEOPLE WERE INJURED. *TR THEN ON 9/8/07 AND A DEER RAN OUT IIN FRONT OF ME, AGAIN MY FOOT TO THE FLOOR I HIT THE DEER. 1ST I WAS SUPRISED THAT MY AIR BAGS DIDN'T DEPLOY (REALLY TORE UP THE FRONT OF THE TRUCK) AND 2ND I SHOULD OF BEEN ABLE TO SLOW DOWN IN TIME. AFTER READING ALL OF THE ISSUES WITH THE BRAKES ON CHEVYS AND NO ONE IS DOING ANYTHING ABOUT IT, I THINK ITS TIME TO LOOK FOR A DIFFERENT CAR COMPANY.

			1		
10238395 10115547 10125146 10200729	CHEVROLET	SILVERADO SUBURBAN SUBURBAN TAHOE	2004 2004 2004 2004	2008-01-22 2004-08-03 2005-06-10 2007-08-09	TL*THE CONTACT OWNS A 2004 CHEVROLET SILVERADO. WHILE DRIVING APPROXIMATELY 58 MPH, THE CONTACT SLID ON A PATCH OF ICE AND LOST CONTROL OF THE VEHICLE. THE VEHICLE RAN OFF THE ROAD AND CRASHED INTO A TELEPHONE POLL ON THE PASSENGER SIDE. THE VEHICLE STOPPED WHEN IT CRASHED INTO A FROZEN EMBANKMENT. UPON IMPACT, THE FRONT AIR BAGS FAILED TO DEPLOY EVEN THOUGH THE CONTACT MADE IMPACT WITH THE STEERING WHEEL. THE CONTACT WAS INJURED. THE VEHICLE WAS COMPLETELY DESTROYED AND A POLICE REPORT WAS FILED. THE CONTACT FILED A COMPLAINT WITH THE MANUFACTURER, BUT THE COMPLAINT WAS DENIED. THE MANUFACTURER WAS UNABLE TO DIAGNOSE THE VEHICLE; HOWEVER, AFTER INSPECTION OF THE VEHICLE, THE MANUFACTURER CONFIRMED THAT THE AIR BAGS WERE ENABLED AT THE TIME OF IMPACT. THEY DID NOT GIVE AN EXPLANATION FOR THE DEPLOYMENT FAILURE. THE VIN WAS UNKNOWN. THE FAILURE AND CURRENT MILEAGES WERE 180,000. UPDATED 09/03/08 *BF UPDATED 09/04/08. *JB  THE CONSUMER WAS INVOLVED IN AN ACCIDENT IN HIS 2004 CHEVROLET SUBURBAN IN WHICH THE AIR BAGS DID NOT DEPLOY. *NM *SC *JB  DT: VEHICLE WAS GOING ABOUT 35-40 MPH AND THE SIDE AND FRONT AIR BAGS DID NOT DEPLOY DURING AN ACCIDENT. *AK  I WAS INVOLVED IN A HEAD ON COLLISION WITH 2 OTHER VEHICLES, AT 45 TO 50 MPH, AND MY AIR BAGS FAILED TO DEPLOY. *TR
10200723	CHEVROLLI	TAHOL	2004	2007 00 03	2004 CHEVROLET TAHOE, AFTER BEING INVOLVED IN AN ACCIDENT WITH SEVERE IMPACT TO BOTH
10409000	CHEVROLET	ТАНОЕ	2004	2011-06-16	FRONT CORNERS AND BUMPER, HARD IMPACT COLLISION, AND AFTER FLIPPING THREE TIMES, BOTH FRONT AIR BAGS DID NOT DEPLOY. SEVERE DRIVER INJURY AS A RESULT OF THE AIRBAG FAILURE. *TR MY HUSBAND AND I WAS INVOLVED IN AN ACCIDENT AND THE AIR BAGS DID NOT DEPLOY WE
10836861	CHEVROLET	TAHOE	2004	2015-02-09	WERE HIT AT 55 MPH
10314549	CHEVROLET	TRACKER	2004	2010-02-04	MYSELF AND 2 DAUGHTERS WERE IN A HEAD ON WRECK 2/04/2010 WHEN A GUY PULLED OUT IN FRONT OF US, NEITHER OF THE AIRBAGS DEPLOYED. MY DAUGHTER HIT THE WINDSHIELD AND I HIT THE STEERING WHEEL AND DASH. THE PREGNANT ONE WAS THANKFULLY IN THE BACK SEAT. *TR
10567426	CHEVROLET	TRACKER	2004	2014-02-23	TL* THE CONTACT OWNS A 2004 CHEVROLET TRACKER. THE CONTACT STATED THAT WHILE DRIVING IN THE SNOW, SHE LOST CONTROL OF THE VEHICLE AND CRASHED THE FRONT OF END INTO AN EMBANKMENT. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUFFERED CONTUSIONS AND BRUISING TO THE TORSO REGION. A POLICE REPORT WAS TAKEN. THE VEHICLE WAS NOT DIAGNOSED OR REPAIRED. THE MANUFACTURER WAS NOT NOTIFIED. THE FAILURE MILEAGE WAS APPROXIMATELY 20,000. UPDATED 04/22/14*LJ THE CONSUMER STATED SHE HIT A PATCH OF ICE WHILE DRIVING, SHE VEERED OFF THE HIGHWAY LOST CONTROL OF THE VEHICLE, AND FLIPPED OVER 3 TIMES. UPDATE 04/24/14  WHILE DRIVING AT 70 MPH DRIVER SWERVED TO LEFT TO AVOID HITTING A MOTORIST. WHEN THE
10083860	CHEVROLET	TRAILBLAZER	2004	2004-07-16	DRIVER ATTEMPTED TO STRAIGHTEN BACK THE STEERING WHEEL BY TURNING IT TO THE RIGHT IT OVERCORRECTED SEVERELY. THIS RESULTED IN THE DRIVER LOSING CONTROL OF THE VEHICLE AND CRASHING INTO A TREE. UPONIMPACT, AIR BAGS DID NOT DEPLOY. DRIVER DIED, AND FRONT PASSENGER SUSTAINED A BROKEN NECK, SEVERE LACERATION TO THEIR SCULL, AND BRUISES. THE PASSENGER IN THE REAR SUSTAINED A BROKEN ANGLE, A DISLOCATED HIP, AND TWO BROKEN RIBS. *AK
10003000	CHLVROLET	INGILDLAZEK	2004	2007-07-10	TWO DROUGH HIDS. AN
10087212	CHEVROLET	TRAILBLAZER	2004	2004-08-03	WHILE DRIVING 45 MPH CONSUMER'S VEHICLE COLLIDED INTO ANOTHER VEHICLE. UPON IMPACT, BOTH FRONTAL AIR BAGS FAILED TO DEPLOY. VEHICLE WAS TOWED TO A GARAGE. *AK THE CONSUMER SUSTAINED A HAIR LINE FRACTURE IN THE CHEST AREA. *NM
10094926	CHEVROLET	TRAILBLAZER	2004	2004-10-03	AT APPROXIMATELY 45 MPH CONSUMER'S VEHICLE WAS INVOLVED IN A COLLISION, STRIKING A BARRIER HEAD ON. UPON IMPACT, AIR BAGS DID NOT DEPLOY.*AK
10100202	CHEVROLET	TDAILDI AZED	2004	2004 10 20	I WAS GOING BETWEEN 25 AND 35 MPH I SWRIVED TO AVOID A VEHICLE BACKING UP THAT HAD MISSED A TURN. I TRIED TO STREER BACK AND LOST CONTROL HITTING A TELEPHONE POLE HEAD ON. AIRBAGS DID NOT DEPLOY NEITHER DID ONSTAR. TO THIS POINT NOTHING HAS BEEN DONE TO
10100282	CHEVKOLET	TRAILBLAZER	2004	2004-10-29	REPAIR THE FAILURE AS FOR MY DAD'S TRAILBLAZER THATS A WORK IN PROGRESS . *AK  CONSUMER WAS DRIVING 60 MPH AND LOST CONTROL, HITTING A UTILITY POLE. UPON IMPACT,
10103148	CHEVROLET	TRAILBLAZER	2004	2004-11-24	THE AIRBAGS FAILED TO DEPLOY. VEHICLE WAS TOTALED. *AK
10106552	CHEVROLET	TRAILBLAZER	2004	2004-12-29	I WAS DRIVING A CHEVY TRAILBLAZER RENTED FROM HERTZ ON DECEMBER 29, 2004. ON HIGHWAY 285 NEAR MILE MARKER 189.5, I ENCOUNTERED BLACK ICE ON A CURVE. THE VEHICLE STARTED A 4-WHEEL DRIFT INTO THE ONCOMING LANE. I ATTEMPTED TO AVOID COLLIDING WITH ANOTHER VEHICLE THAT HAD SPUN OUT. THE ABS DID NOT WORK. THERE WAS NO STABILITY CONTROL. I STRUCK AN EMBANKMENT AND THE VEHICLE FLIPPED OVER. ALTHOUGH THERE WAS BOTH FRONTAL AND SIDE IMPACT, NO AIRBAGS DEPLOYED. IT IS MY BELIEF THAT THE CHEVY TRAILBLAZER IS INHERENTLY UNSAFE. THERE IS NO WAY THIS VEHICLE SHOULD HAVE ROLLED OVER AT THE SPEED AT WHICH I WAS DRIVING. *NM
10123920	CHEVROLET	TRAILBLAZER	2004	2005-05-30	OTHER VEHICLE FAILED TO YIELD FROM A YIELD SIGN. FRONT OF TRAILBLAZER STRUCK RIGHT SIDE REAR OF OTHER VEHICLE. IMPACT DAMAGED CROSS BAR ON FRAME PUSHING RADIATOR INTO MOTOR. DRIVER AND PASSENGER AIR BAG FAILED TO DEPLOY. ESTIMATED IMPACT SPEED 45-50

10135169	CHEVROLET	TRAILBLAZER	2004	2005-01-19	MY DAUGHTER WAS DRIVING MY 2004 TRAILBLAZER ON AN ICY, SLIPPERY ROAD AT 25 -30 MILES PER HOUR, (THE SPEED LIMIT IS 30, IT WAS THE STREET WE LIVE ON) WHEN SHE LOST CONTROL, HIT A TREE AND TOTALED (\$22,000.00) THE VEHICLE. THE OFFICER AND I WALKED THE PATH IN THE STREET AND COULD NOT FIND ANY SIGNS OF SKIDDING OR BRAKING, THERE FORE LEADING ME TO BELIEVE NOW THAT THERE WAS A BRAKING FAILURE. UP UNTIL NOW, WHEN I HEARD ABOUT THE BRAKES FAILING DO TO CORROSION FROM ROAD SALT, I ALWAYS THOUGHT IT WAS JUST AN ACCIDENT IN POOR ROAD CONDITIONS. WHEN I FIRST READ THE REPORT OF THE INVESTIGATION I COULDN'T BELIVE IT WAS THE SAME SCENARIO AS HER ACCIDENT. POOR ROAD CONDITIONS, THEREFORE POSSIBLE SALT BUILDUP, A SLOW SPEED AND INABILITY TO STOP. I AM SO GRATEFULL THAT SHE WALKED AWAY WITHOUT A SCRATCH, ALSO CONSIDERING THE AIR BAGS DID NOT DEPLOY, EVEN THOUGH THE FRONT END WAS TOTALED. I AM SURE THIS IS A PROBLEM THAT MUST BE IDENTIFIED FOR THOSE LIVING IN COLDER, NORTHERN STATES.
10154051	CHEVROLET	TRAILBLAZER	2004	2005-10-23	FOIA REQUEST ALL DOCUMENTS/INFO RELATIVE TO ANY RECALLS OR KNOWN DEFECTS OF THE AIR BAG SYSTEM IN THE 2004 CHEVROLET TRAILBLAZER. *TS ATTORNEY'S CLIENTS WERE SERIOUSLY INJURED WHEN THE VEHICLE THEY WERE OPERATING WAS INVOLVED IN A HIGH SPEED, FRONT END COLLISION. THE AIR BAG SYSTEM DID NOT DEPLOY AT THE TIME OF IMPACT AND AS A RESULT THE THREE OCCUPANTS WERE INJURED. *NM ***NAR***
10158090	CHEVROLET	TRAILBLAZER	2004	2006-02-26	DT*: THE CONTACT STATED WHILE DRIVING 50 MPH THE VEHICLE WAS INVOLVED IN A HEAD ON COLLISION WITH ANOTHER VEHICLE. THE VEHICLE CONTINUED MOVING AND STOPPED BY COLLIDING WITH A STORE SIGN. THE AIR BAGS DID NOT DEPLOY AND SEAT BELTS WERE WORN. THERE WERE NO WARNING LIGHTS TO INDICATE THE AIR BAGS WOULD FAIL. THE CONTACT SUFFERED A KNEE INJURY. A POLICE REPORT WAS FILED AT THE SCENE. THE INSURANCE COMPANY DETERMINED THE VEHICLE WAS TOTALED DUE TO THE ACCIDENT. THE DEALER DOES NOT HAVE THE MEANS TO TEST FOR AIR BAG NON-DEPLOYMENT. UPDATED 1/24/2007 - *NM TL* - THE CONTACT OWNS A 2005 CHEVROLET TRAIL BLAZER. DURING A SNOW STORM THE
10177618	CHEVROLET	TRAILBLAZER	2004	2006-12-01	CONTACT'S VEHICLE WAS INVOLVED IN A HEAD ON COLLISION. THE CONTACT WAS DRIVING ON THE HIGHWAY AT 55 MPH, AND THE AIR BAGS DID NOT DEPLOY. THERE WERE NO WARNING INDICATOR LIGHTS. THE MANUFACTURER SENT AN INVESTIGATOR TO ACCESS THE DAMAGE, AND STATED THAT THERE WAS \$10,000 WORTH OF DAMAGE, AND THAT THE VEHICLE WAS ONLY TRAVELING 8 MPH. *AK
10178863	CHEVROLET	TRAILBLAZER	2004	2007-01-13	TL* - THE CONTACT STATED THAT ON 1/13/07 HE CRASHED INTO ANOTHER VEHICLE WITH HIS 2004 CHEVROLET TRAILBLAZER. THE ODOMETER READ 33,000 MILES AT THE TIME OF THE CRASH. HE WAS DRIVING AT 45 MPH AND COLLIDED WITH THE SECOND VEHICLE IN A PERPENDICULAR ANGLE "T-BONE" STRIKING IT ON THE SIDE AS IT CROSSED IN FRONT OF HIM. THE DRIVER WAS THE ONLY OCCUPANT IN THE VEHICLE AND THE DRIVER'S SIDE AIRBAG NEVER DEPLOYED. THERE WERE 5 PEOPLE INJURED IN THE SECOND VEHICLE. *NM
10218896	CHEVROLET	TRAILBLAZER	2004	2008-02-22	TL*THE CONTACT OWNS A 2004 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 35 MPH, THE CONTACT REAR ENDED A SCHOOL BUS. THE VEHICLE WAS COMPLETELY DESTROYED AND NONE OF THE AIR BAGS DEPLOYED. TWO PASSENGERS WERE INJURED AND A POLICE REPORT WAS FILED. PRIOR TO THE FAILURE, SHE NEVER EXPERIENCED ANY AIR BAG FAILURE. THE DEALER AND MANUFACTURER HAVE NOT BEEN NOTIFIED. THE CONTACT HAS PICTURES. THE VIN AND ENGINE SIZE WERE UNKNOWN. THE CURRENT AND FAILURE MILEAGES WERE 44,000.
10228023	CHEVROLET	TRAILBLAZER	2004	2006-11-06	I WAS SIDE SWIPED BY ANOTHER CAR THAT WENT THROUGH A RED LIGHT. MY TRUCK THEN PROCEEDED TO HIT ANOTHER CAR AND FINALLY THE FRONT END OF THE TRUCK GOT AIRBORNE AND LANDED WITH THE TIRES IN THE FRONT WINDSHIELD OF ANOTHER CAR. THE TRUCK SUSTAINED OVER \$6,000 IN DAMAGE AS WELL AS THE FRONT FRAME WHERE THE MOTOR SITS WAS DAMAGED. INSURANCE COMPANY SAID IT COULD BE REPLACED. NOT SURE HOW BECAUSE IT WAS WELDED IN PLACE. AND MY AIRBAGS NEVER DEPLOYED. *TR
					I WAS REAR ENDED BY A GUY DOING 40 MPH. MY TRUCK WAS LIFTED IN THE AIR AND PUSHED INTO THE REAR END OF ANOTHER VEHICLE. MY AIRBAGS NEVER DEPLOYED AND MY SEAT BROKE!!
10228026	CHEVROLET	TRAILBLAZER		2007-03-07	POSSIBLE DEFECT IN THE SEAT? I WAS STOPPED AT A RED LIGHT WHEN THE ACCIDENT HAPPENED. THE SPARE TIRE HOLDER WAS RIPPED OFF MY TRUCK. *TR  SLIGHTLY TURNED STEERING WHEEL TO LEFT TO AVOID ANOTHER MOTORIST IN FRONT OF ME. ATTEMPTED TO STRAIGHTEN OUT THE VEHICLE, VEHICLE OVER-CORRECTED SEVERELY, UNABLE TO BRAKE, VEHICLE SLAMMED HEAD-ON INTO CONCRETE HIGHWAY BARRIER 45-60MPH, AIR BAGS FAILED TO DEPLOY. DRIVER WAS WEARING SEATBELT, SUBSTANTIAL BRUISING & NECK/BACK INJURY. *TR
10313103		TRAILBLAZER		2009-10-02	TI-THE CONTACT OWNS A 2004 CHEVROLET TRAILBLAZER. WHILE THE CONTACT WAS DRIVING 35 MPH HE CRASHED INTO ANOTHER VEHICLE AND THEN INTO A LIGHT POLE WHICH DESTROYED THE VEHICLE; HOWEVER, DURING THE CRASH NONE OF THE AIR BAGS DEPLOYED. THE DRIVER AND PASSENGER WERE INJURED. NO ONE WAS INJURED IN THE OTHER VEHICLE. THE VEHICLE WAS DIAGNOSED BY THE DEALERSHIP WHO STATED THAT NO FAILURES COULD BE FOUND. THERE WERE NO PRIOR WARNINGS. THE CURRENT AND FAILURE MILEAGES WERE 95,272 UPDATED 03/30/10. *LJ ACCORDING TO GM, THE NOTICE ON THE DASH READOUT STATED THE AIR BAGS DEPLOYED. UPDATED 06/30/10.*JB

					TL* THE CONTACT OWNS A 2004 CHEVROLET TRAILBLAZER. WHILE DRIVING 35 MPH, THE
					CONTACT ATTEMPTED TO MANEUVER THE STEERING WHEEL TO AVOID CRASHING INTO A DEER
					AND LOST CONTROL OF THE VEHICLE. THE VEHICLE CRASHED INTO A TREE. THE AIR BAGS DID NOT DEPLOY UPON IMPACT. THE CONTACTS FACE HIT THE STEERING WHEEL UPON IMPACT AND
					SUSTAINED A BROKEN NOSE. THE CONTACT WAS TAKEN TO THE HOSPITAL. THE VEHICLE WAS
					DESTROYED AND WAS TOWED BY HER INSURANCE COMPANY TO AN UNKNOWN LOCATION. A
10327766	CHEVROLET	TRAILBLAZER	2004	2010-04-21	POLICE REPORT WAS AVAILABLE, IF NEEDED. THE MANUFACTURER WAS NOT CONTACTED. THE FAILURE MILEAGE WAS 80,700.
					1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
					TL* THE CONTACT OWNED A 2004 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT THE AIRBAGS DID NOT DEPLOY WHEN HIS WIFE CRASHED INTO A DEER AT APPROXIMATELY 35 MPH.
					THE DRIVER WAS ALSO INVOLVED IN ANOTHER CRASH WHEN TRAVELING APPROXIMATELY 55
					MPH. SHE LOOKED DOWN TO CHECK ON A NOISE SHE HEARD AND WHEN SHE LOOKED UP THE THE
					VEHICLE LOST CONTROL AND CRASHED HEAD ON INTO A TREE. THE DRIVER AND THREE OTHER OCCUPANTS WERE INURED. THE GEORGIA HIGHWAY PATROL RESPONDED AND FILED A REPORT.
					THE PARAMEDICS ALSO RESPONDED AND TRANSPORTED THE FOUR OCCUPANTS TO THE HOSPITAL.
10356973	CHEVROLET	TRAILBLAZER	2004	2010-09-19	THE VEHICLE WAS DESTROYED AND TOWED TO A STORAGE LOT. THE FAILURE MILEAGE WAS APPROXIMATELY 107,000.
					I HIT A DEER AT APPROXIMATELY 65 MPH AND THE AIR BAG DID NOT DEPLOY. MY SON THAT WAS
					RIDING IN THE PASSENGER SEAT ALSO WAS WEARING HIS SEAT BELT BUT THE SEAT BELT DID NOT CATCH AND HE WAS SLAMMED INTO THE DASH. I REFUSE TO BELIEVE THAT THIS IS NORMAL
10419650	CHEVROLET	TRAILBLAZER	2004	2011-08-13	BEHAVIOR FOR THOSE SAFETY DEVICES. *KB
					TL* THE CONTACT OWNS A 2004 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT WHILE
					DRIVING 35 MPH, THE DRIVER BECAME DISTRACTED AND CRASHED INTO A TREE. THE AIR BAGS
					FAILED TO DEPLOY AND THE SEAT BELT FAILED TO RESTRAIN, CAUSING THE DRIVER TO BE THROWN
					FORWARD. THE DRIVER'S HEAD IMPACTED THE WINDSHIELD AND AS A RESULT, HE SUSTAINED  BLEEDING FROM THE BRAIN. A POLICE REPORT WAS FILED. THE MANUFACTURER WAS NOT MADE
					AWARE OF THE FAILURE. THE VEHICLE WAS DESTROYED. THE VIN WAS NOT AVAILABLE. THE
10551484	CHEVROLET	TRAILBLAZER	2004	2013-10-29	FAILURE AND CURRENT MILEAGE WAS UNKNOWN. THE VIN WAS NOT AVAILABLE.
					ON THE AFTERNOON OF 6/16/08, ME IN MY FAMILY WAS TRAVELING NORTH ON 195 IN NORTH
					CAROLINA GOING TOWARD OUR DESTINATION IN BALTIMORE MD., WHEN ANOTHER VEHICLE CLICK US AND CAUSE MY SISTER TO LOSE CONTROL OF THE VEHICLE CRASHING INTO THE
					GUARDRAIL. MY TWO AUNTS AND MYSELF WERE EJECTED FROM THE VEHICLE, BOTH MY AUNTS
					DIE INSTANTLY. MY MOTHER, SISTERS AND MYSELF SURVIVED BUT HAD SEVERAL INJURIES. THE
					AIRBAGS DID NOT DEPLOY, AND THE DOORS THAT WERE INITIALLY LOCKED; BUT SOMEHOW THE REAR DOORS (MIDDLE) OPEN DURING IMPACT CAUSING MY AUNTS IN MYSELF TO BE THROWN
10576838	CHEVROLET	TRAILBLAZER	2004	2008-06-16	FROM THE VEHICLE. BE ADVISED THE VEHICLE WAS A GREEN TRAILBLAZER (EXTENDED CAB). *TR
					I WAS ON A 4 LANE HIGHWAY TRAVELING EASTBOUND GOING 50 MPH POSTED SPEED 55 MPH
					WEARING OUR SEAT BELTS, WHEN ANOTHER VEHICLE WAITING TO U - TURN IN THE CENTER
					MEDIAN DECIDED TO TURN RIGHT INTO ME-ONCOMING TRAFFIC. THIS PERSON COLLIDED WITH ME, WHICH THAT IMPACT SENT ME INTO A HEAD ON COLLISION WITH THE GUARD RAIL. THE
					CHEVROLET TRAILBLAZER IS COMPLETELY TOTALED. THERE WERE 2 INCIDENTS IN THAT SEQUENCE
					OF EVENTS THAT THE AIRBAGS SHOULD HAVE DEPLOYED, BUT DID NOT! THIS ACCIDENT CAUSED SEVERAL INJURIES TO MYSELF AND MY PASSENGER. WE DEFINITELY COULD HAVE BEEN KILLED AND
10626582	CHEVROLET	TRAILBLAZER	2004	2014-08-18	NO AIRBAGS TO HELP SAVE OUR LIVESUPDATED 09-03-14 *BF UPDATED 11/7/2014 *JS *TR
					ON SATURDAY, AUGUST 1, 2015 AT APPROXIMATELY 8:55PM MY MOTHER WAS INVOLVED IN A 1  CAR ACCIDENT ON BAUM RD LOCATED IN TALLAHASSEE, FL. SHE WAS THE ONLY PASSENGER
					DETERMINED TO BE IN THE VEHICLE AT THE TIME OF THE ACCIDENT. ACCORDING TO THE CRASH
					REPORT, D1 (DRIVER ONE) WAS TRAVELING WESTBOUND ON BAUM RD GOING THE NORMAL POSTED SPEED OF 55MPH, WHEN SHE VEERED TOWARDS THE CENTER OF THE RD AND SUDDENLY
					TURNED RIGHT VEERING OF THE RIGHT SHOULDER OF THE RD AND STRIKING SEVERAL TREES ON
					THE DRIVERS SIDE AND FRONT END. D1 WAS WEARING HER SEATBELT AND MANAGED TO EXIT OUT
					THE DRIVERS SIDE WINDOW BEFORE COMING TO HER FINAL RESTING PLACE ON THE SHOULDER OF THE RD. WHEN I WENT TO RETRIEVE MY MOTHERS THINGS FROM HER TRAILBLAZER, I NOTICED
					THAT NO AIR BAGS HAD DEPLOYED. AND AS FAST AS MY MOM WAS GOING AND THE TYPE OF
					IMPACT & DAMAGE HER SUV SUSTAINED, I WOULD THINK AND HOPE THE AIRBAGS WOULD DEPLOY IN THIS TYPE OF ACCIDENT, THUS PREVENTING SERIOUS INJURY OR DEATH. MY MOM WAS
					NOT SO LUCKY, AND MYSELF AND MY FAMILY HAVE ENDURED GREAT PAIN FROM LOOSING HER SO
10767586	CHEVROLET	TRAILBLAZER	2004	2015-08-01	SUDDENLY.  I WAS RECENTLY IN A CAR ACCIDENT DUE TO BAD WEATHER AND ROAD CONDITIONS. LEAVING
					WORK DRIVING INTERSTATE 189 9STATE NORTHBOUND. CAME UPON BLACK ICE MY CAR
					FISHTAILED OUT OF CONTROL; TRYING TO GAIN CONTROL BACK BEFORE I KNEW IT I WAS HEADING
					TORDS A GUARD RAIL. I WAS ONLY DRIVING 50 TO 55MPH. BEYOND THE GUARD RAIL I DO NOT REMEMBER. I SUFFERED UPPERBODY AND HEAD INJURY AND MY FRONT AIR BAG FAILED TO
					DEPLOY. OTHERS ARE TELLING ME AND MY HUSBAND TO LOOK INTO THIS AS MY AIRBAG FAILED
10823597 11265285	CHEVROLET	TRAILBLAZER TRAILBLAZER	2004	2016-01-19	TO DEPLOY. CAN YOU HELP WELL I HIT A TREE AN THE AIRBAGS DIDNT DEPLOYED BUT THE AIRBAG LIGHT IS ON
	,				

		1		1	
10128270	GMC	ENVOY	2004	2005-07-08	DT: CONSUMER STATES THAT SHE WAS IN A HEAD ON COLLISION ON JULY 8, 2005 AND THE AIR BAGS DID NOT DEPLOY. SHE WAS GOING 55 MPH WHEN HIT. THERE WAS DAMAGE TO THE VEHICLE AND A POLICE REPORT WAS TAKEN. CONSUMER STATES SHE HAS NECK AND BACK INJURIES, SHE IS GOING TO THE DOCTOR FOR A FOLLOW UP VISIT TODAY. HER DAUGHTER HAS SEAT BELT BURNS ON HER NECK. THE VEHICLE IS CURRENTLY BEING INSPECTED BY THE INSURANCE COMPANY; IT HAD TO BE TOWED TO A BODY SHOP. SHE HAS NOT CONTACTED THE DEALERSHIP OR MANUFACTURER, THE ATTORNEY GENERAL ADVISED HER TO CALL US FIRST. *NM
10152802	GMC	ENVOY	2004	2006-03-13	AVOIDING TO HIT AN UPCOMING VEHICLE IN A CURVE, I LOST CONTROL OF MY GMC ENVOY SUV 2004 AND HIT A CONCRETE DRIVEWAY AND STOPPED WITH AN ELECTRICAL UTILITY POST FRONT SIDE. THE AIRBAGS DID NOT DEPLOY CAUSING MYSELF TO HIT THE STEERING WHEEL AND INJURED MY NECK, MY HEAD, LOWER BACK, KNEES AND LEFT ARM. THE INSURANCE COMPANY TOLD ME THAT IF THE AIR BAGS WOULD DEPLOYED THEY WOULD DECLARED MY VEHICLE TOTAL LOSS DUE TO THE EXTENSIVE DAMAGE. I TOLD THEM I DON'T WANT MY VEHICLE REPAIRED IF THE AIR BAGS ARE NOT CHANGED. I INTEND TO GO AGAINST GMC LEGALLY. *JB
10182098	<b>G</b> MC	ENVOY	2004	2007-01-03	IN ROUTE TO WORK DRIVING MY 2004 GMC ENVOY I WAS INVOLVED IN WHAT I WOULD CONSIDERED A HEAD ON COLLISION WITH A TELEPHONE POLE. THE IMPACT WAS GREAT ENOUGH TO SPILT THE POLE IN TWO, TOP HALF JUST MISSING THE ROOF OF THE VEHICLE. UPON IMPACT THE AIRBAGS DID NOT DEPLOY NOR DID MY SEAT BELTS LOCK ME IN CAUSING ME TO FLY FORWARD HITTING MY HEAD ON THE STEERING WHEEL, I HAD TO BE EXTRACTED FROM VEHICLE BY FIRE DEPARTMENT AND TRANSPORTED TO ER. I NOW HAVE PERMANENT SCAR APPROXIMATELY 5 INCHES IN LENGTH ACROSS MY FOREHEAD. I FILED A COMPLAINT WITH GMC LATER TO BE INFORMED THAT AFTER THEIR INVESTIGATION THEY CONCLUDED THAT SINCE THE PASSENGER SIDE TOOK THE GREATER OF THE IMPACT THE IMPACT WAS NOT GREAT ENOUGH TO WARRANT AIRBAG DEPLOYMENT. PLEASE NOTE THAT DRIVERS NOR PASSENGER SIDE AIRBAG DEPLOYED. *JB
					TL*THE CONTACT OWNS A 2004 GMC ENVOY. WHILE DRIVING APPROXIMATELY 55 MPH, THE VEHICLE STRUCK A GATE, WENT AIRBORNE, DROPPED APPROXIMATELY 35 FEET DOWN AN EMBANKMENT, STRUCK SOME TREES, BOULDERS, AND LANDED IN A SWAMP. THE AIR BAGS FAILED TO DEPLOY AND THE VEHICLE SUSTAINED MAJOR DAMAGE. BOTH THE DRIVER AND PASSENGER SUSTAINED MULTIPLE INJURIES. THE VEHICLE HAD TO BE LIFTED FROM THE EMBANKMENT WITH A CRANE AND WAS TOWED AWAY. A POLICE REPORT WAS FILED. THE
10237647	GMC	ENVOY	2004	2008-08-10	CURRENT AND FAILURE MILEAGES WERE 51,000.
10266307	GMC	ENVOY	2004	2009-04-20	I WAS TRAVELING NORTHBOUND ON RT 251 FROM PERU TO MENDOTA IL WHEN IT BEGAN RAINING AND HAILING VERY HARD. 251 IS FULL OF POT HOLES. I WAS TRAVELING ABOUT 40 M.P.H. I HIT A POT HOLE AND MY CAR STARTED TO HYDROPLAN. I WENT INTO THE SOUTHBOUND LANE AND THEN INTO DITCH HEAD ONI HIT THE DITCHES WALL ALMOST HEAD ON AND MY AIRBAGS DID NOT COME OUT. *TR
10272370	GMC	ENVOY	2004	2009-05-02	TL*THE CONTACT OWNS A 2004 GMC ENVOY. WHILE DRIVING 60 MPH WITH THE CRUISE CONTROL ACTIVATED, THE CONTACT PASSED OUT DUE TO A SEVERE MEDICAL ISSUE. HE LOST CONTROL OF THE VEHICLE AND CRASHED INTO A TREE. UPON IMPACT, BOTH FRONTAL AIR BAGS FAILED TO DEPLOY. THE CONTACT AND PASSENGER WERE SEVERELY INJURED. THE DRIVER SUSTAINED A BROKEN CLAVICLE AND HIS TEETH WERE KNOCKED OUT OF HIS MOUTH. THE PASSENGER SUSTAINED A LACERATION TO THE HEAD AND ABDOMINAL INJURIES. THE VEHICLE WAS INSPECTED BY AN INSURANCE ADJUSTER, WHO WAS UNABLE TO DETERMINE WHY THE AIR BAGS DID NOT DEPLOY. THE VEHICLE WAS DESTROYED. THE CONTACT CALLED THE MANUFACTURER AND WAS INFORMED THAT AN INVESTIGATION WAS IMPLEMENTED AND A REPRESENTATIVE WILL CALL HIM BACK IN FIVE BUSINESS DAYS. THE FAILURE MILEAGE WAS 42,600. UPDATED 6/5/09 *CN UPDATED 06/09/09.*JB
					TL*THE CONTACT OWNS A 2004 GMC ENVOY. WHILE DRIVING 35 MPH, THE CONTACT REAR ENDED ANOTHER VEHICLE. HIS VEHICLE WAS DESTROYED. THE AIR BAGS FAILED TO DEPLOY AND THE SEAT BELTS DID NOT RETRACT FOR BOTH OCCUPANTS SEATED IN THE FRONT. THE CONTACT AND THE PASSENGER STRUCK THE STEERING WHEEL WITH THEIR CHESTS AND SHOULDERS. BOTH WERE SEVERELY INJURED. THE CONTACT, PASSENGER, AND OTHER DRIVER WERE TRANSPORTED TO THE HOSPITAL. THE VEHICLE WAS TOWED TO A REPAIR SHOP AND IS AWAITING AN
10275464	GMC	ENVOY	2004	2009-06-29	INVESTIGATION. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 60,000.
10286793	GMC	ENVOY	2004	2009-10-07	WHILE TRAVELING DOWN I-95 AT APPX. 60MPH THE CAR IN FRONT OF ME STOPPED SHORT. I SLAMMED INTO THE BACK OF IT. MY AIRBAGS DID NOT DEPLOY, NOR DID ONSTAR CALL TO CHECK ON ME (SO MUCH FOR BELIEVING IN THOSE ADS!) THE ENTIRE FRONT END NEEDS TO BE REPLACED. FLUIDS WERE SPILLING FROM THE VEHICLE. 2 WITNESSES ARE CAPITOL HILL POLICE OFFICERS WHO WERE SHOCKED THAT THE AIRBAGS DID NOT DEPLOY. THE SEATBELT DID RESTRAIN ME CAUSING IRRITATION AT THAT SITE. MY BACK, NECK AND HEAD WERE ACHING. I WAS CHECKED OUT BY THE ER. *TR
10302345	GMC	ENVOY	2004	2010-01-26	TL*THE CONTACT OWNS A 2004 GMC ENVOY. WHILE DRIVING 65 MPH IN SNOWY CONDITIONS, HE ATTEMPTED TO PASS A VEHICLE AND WHILE RETURNING BACK INTO THE LANE THE VEHICLE SLID AND HE CRASHED INTO A CONCRETE BARRIER FRONT-END FIRST. THE FRONTAL AIR BAGS DID NOT DEPLOY AT THE TIME OF THE CRASH. THE CONTACT DID NOT SUFFER ANY INJURIES. THE POLICE ARRIVED SHORTLY AFTER AND A POLICE REPORT WAS FILED. THE FAILURE AND CURRENT MILEAGES WERE UNDER 97,000.

10594270	GMC	ENVOY	2004	2014-03-12	CAR SLID INTO RIGHT GUARDRAIL AND THEN SLID TO LEFT IN DITCH ON EXPRESSWAY. THE AIRBAGS DID NOT DEPLOY. IMPACT WAS SIGNIFICANT ENOUGH TO BEND THE FRONT PASSENGER CORNER OF FRAME. THE FRAME IS ALSO CRACKED UNDERNEATH THE MIDDLE OF VEHICLE AS RESULT OF CRASH. CAR IS NO LONGER DRIVEABLE. DRIVER SUFFERED WHIPLASH. *TR
10596479	GMC	ENVOY	2004	2014-03-31	I HAD AN ACCIDENT ON A MAJOR HIGHWAY DUE TO WEATHER CONDITIONS. I ENDED UP SPINNING THE VEHICLE AROUND WHILE IN THE TRAVEL LANE AND HIT THE CAR IN THE PASSING LANE. MY AIRBAGS NEVER DEPLOYED. ALTHOUGH NO ONE WAS INJURED THANKFULLY. I WONDERED WHY THE AIRBAGS DIDN'T GO OFF. SHOULD I BE WORRIED? HAS ANYONE MADE THIS SAME COMPLAINT? THANK YOU. *TR
10631914	GMC	ENVOY	2004	2009-08-25	MY WIFE WAS IN THE CAR ALONE. VEHICLE RAN OFF ROAD, CRASHED INTO PARKED TRUCK, AIR BAG DID NOT DEPLOY. WIFE DIED OF "CLOSED CHEST TRAUMA", *TR
11378518	GMC	ENVOY	2004	2020-12-03	TL-THE CONTACT OWNS A 2004 GMC ENVOY. THE CONTACT STATED THAT WHILE DRIVING AT 50 MPH HE HAD THE SWERVE TO AVOID A HEADON COLLISION FROM A VEHICLE THAT WAS IN HIS LANE. THE VEHICLE WENT OFF THE ROAD AND CRASHED INTO A CONCRETE BARRIER. THE CONTACT HAD A FRACTURED STERNUM AND A BRUISED RIGHT ANKLE, KNEE AND ELBOW. THE CONTACT VISITED THE EMERGENCY ROOM ON HIS OWN WITHOUT BEING TRANSPORTED BY AN AMBULANCE. THE CONTACT STATED THAT NONE OF THE AIR BAGS IN THE FRONT DEPLOYED. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOTALED BY THE INSURANCE COMPANY AND TOWED FROM THE CRASH SITE. THE ENTIRE FRONT OF THE VEHICLE WAS SMASHED IN INCLUDING THE FRAME. THE BACK AXEL DROPPED AFTER THE COLLISION AND BOTH RIMS ON THE BACK TIRES WERE SHATTERED. THE FRONT RIMS WERE ALSO CRACKED. THE DEALER AND MANUFACTURER HAD NOT BEEN CONTACTED YET. THE FAILURE MILEAGE WAS 180,000. TF
11376316	GIVIC	ENVOT	2004	2020-12-03	WHILE DRIVING CONSUMER APPLIED THE BRAKES AND WITHOUT WARNING CONSUMER'S VEHICLE COLLIDED WITH THE VEHICLE IN FRONT. UPON IMPACT, AIR BAGS DID NOT DEPLOY. DRIVER SUSTAINED MINOR INJURIES AND WAS TRANSPORTED TO THE HOSPITAL FOR EXAMINATION. VEHICLE WAS TOWED TO THE DEALER FOR INSPECTION, AND DEALER WAS
10067417	GMC	YUKON	2004	2004-04-16	UNABLE TO DUPLICATE OR RESOLVE THE PROBLEM. *AK
					TL* THE CONTACT OWNS A 2004 GMC YUKON. THE CONTACT WAS DRIVING APPROXIMATELY 40 MPH WHEN THE VEHICLE WAS INVOLVED IN A HEAD ON CRASH IN WHICH THE AIR BAGS DID NOT DEPLOY. THE POLICE APPEARED ON THE SCENE AND A REPORT WAS AVAILABLE. THE DRIVER AS WELL AS THE FRONT PASSENGER WAS INJURED AND TRANSPORTED VIA AMBULANCE TO THE HOSPITAL TO TREAT INJURIES. THE VEHICLE WAS TOWED TO AN INSURANCE COMPANY LOT BUT DID NOT HAVE THE FAILURE DIAGNOSED. THE VEHICLE WAS NOT REPAIRED. THE FAILURE AND
10372063	GMC	YUKON	2004	2010-11-12	CURRENT MILEAGE WAS 134,000.
					WHILE TRAVELING AT 40 MPH, CONSUMER STATES ANOTHER VEHICLE TRAVELING IN FRONT CAME TO A SUDDEN STOP. CONSUMER REAR ENDED THAT VEHICLE, AND NONE OF CONSUMER AIRBAGS
8023949	CHEVROLET	BLAZER	2003	2002-11-19	DEPLOYED. PLEASE PROVIDE ANY FURTHER INFORMATION. PH
					TWO EMPLOYEES WERE INVOLVED IN A CRASH WHERE THEY WERE THE ONES THAT STRUCK A STOPPED CAR AT 50 MPH. THE AIR BAGS DID NOT DEPLOYIS THIS A PROBLEM. IS THIS A POSSIBLE
10023373	CHEVROLET	RI A7FR	2003	2003-06-11	RECALL SITUATION. WHO DO I CONTACT ABOUT THIS A CHEVROLET??? DOES YOUR AGENCY GET INVOLVED. *NLM
10023373	CHEVROLET	DLAZEN	2003	2003-00-11	CONSUMER STATED WHILE TRAVELING 45 MPH OR OVER ON WET PAVEMENT VEHICLE LOST CONTROL, AND TRAVELED OFF THE ROAD. REAR HATCH GLASS EXPLODED, BUT AIR BAGS DID NOT
10040503	CHEVROLET	BLAZER	2003		DEPLOY AT ANY TIME. *AK
					WHILE TRYING TO AVOID HITTING A PEDESTRIAN VEHICLE WENT OF THE ROAD AND HIT A TREE.
10044264	CHEVROLET	BLAZER	2003	2003-08-30	UPON IMPACT, FRONT AIR BAGS DID NOT DEPLOY. VEHICLE COULD NO LONGER BE DRIVEN DUE TO THE EXTENSIVE DAMAGE DONE TO THE FRONT END. *AK
10160753	CHEVROLET		2003	2006-06-19	DT*: THE CONTACT STATED THAT BOTH FRONT AIRBAGS OF THE VEHICLE DID NOT DEPLOY DURING A CRASH WHICH OCCURRED WHILE TRAVELING 45 MPH. THE VEHICLE WAS HEADED EAST ON A NARROW, ROUGH, BUMPY ROAD WHEN IT APPROACHED AN INTERSECTION AND STRUCK ANOTHER VEHICLE HEADING NORTH. THE OTHER VEHICLE BRIEFLY STOPPED AT THE STOP SIGN AND PULLED OUT INTO THE INTERSECTION 15 FEET BEFORE THE CONTACT'S VEHICLE REACHED THE INTERSECTION. THIS RESULTED IN THE CONTACT'S VEHICLE CRASHING INTO THE FRONT DRIVER SIDE DOOR OF THE OTHER VEHICLE. BOTH OCCUPANTS WERE WEARING THEIR SEAT BELTS. THE AIRBAG WARNING LIGHT WAS NOT ON PRIOR TO THE CRASH. THE POLICE TOOK PICTURES AND A REPORT WAS FILED. THE VEHICLE WAS TAKEN TO THE DEALER FOR INSPECTION.

		1	1	T	
10537593	CHEVROLET	BLAZER	2003	2013-08-13	I WAS TRAVELING SOUTHBOUND WHEN I EXPERIENCED A SEIZURE AND LOST CONTROL OF MY VEHICLE. I PROCEEDED TO VEER TO THE LEFT WHERE I CLIPPED SEVERAL CARS THAT WERE HEADED NORTHBOUND AND HAD STOPPED DUE TO THE REALIZATION THAT MY VEHICLE WAS NOT UNDER CONTROL. I THEN PROCEEDED OVER A TREE LAWN AND INTO A PARKING LOT. I HIT A DODGE RAM PICKUP WITH THE RIGHT FRONT CORNER OF MY VEHICLE AND PUSHED THAT VEHICLE INTO ANOTHER PARKED CAR THAT WAS NEXT TO IT. BOTH VEHICLES ENDED UP SIDEWAYS AND MY VEHICLE ENDED UP SPUN AROUND 180 DEGREES. AT THIS TIME MY VEHICLE CAME TO A STOP. POLICE WERE CALLED AN PARAMEDICS ARRIVED. THE JAWS OF LIFE WERE USED TO EXTRACT ME FROM MY VEHICLE. I WAS TAKEN TO A LOCAL HOSPITAL WHERE IT WAS DETERMINED THAT I SUFFERED BURST FRACTURES OF L1, L2, AND L3. I ALSO SUFFERED AN EVULSION FRACTURE OF MY LEFT ANKLE. THE POLICE REPORT STATES THAT I WAS TRAVELLING AT A HIGH RATE OF SPEED AND THAT THE VEHICLES WHICH WERE NORTHBOUND WERE JUST CLIPPED. THE AIRBAGS ARE BOTH STILL WITHIN THEIR CASES AS NEITHER DEPLOYED. I WOULD EXPECT THIS OF THE PASSENGER AIRBAG AS THAT SEAT WAS UNOCCUPIED BUT THE DRIVER BAG SHOULD HAVE DEPLOYED. THE INSURANCE INVESTIGATOR EVEN EXPRESSED TO MY WIFE THAT HE WAS SURPRISED THAT THE AIR BAG DID NOT DEPLOY. I WAS HAVING A SEIZURE AND WAS NOT CONSCIOUS SO I CANNOT PROVIDE ANY INFORMATION OTHER THAN WHAT IS IN THE POLICE REPORT. THE REPORT IS #370763 ISSUED BY THE TOWNSHIP OF CLINTON, MICHIGAN.  THE VEHICLE IS CURRENTLY LOCATED AT COPARD AUTO SALVAGE, 21000 HAYDEN, WOODHAVEN, MI 48183. THE PHONE NUMBER IS 734-365-0070. IT WILL BE HELD THERE FOR BETWEEN 7 AND 10 DAYS FROM 8/26/2013. THANK YOU *TR
					REAR ENDED A STOPPED PICK UP AT 45 MPH AND AIR BAGS DID NOT DEPLOY. IT WAS ON A HIGHWAY WHERE THE SPEED LIMIT IS 55. THE WHOLE FRONT END WAS DAMAGED BUT MOST WAS ON DRIVER SIDE.
8017964			2003	2016-02-16	THE VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AT HIGHWAY SPEED. UPON IMPACT THE PASSENGER SIDE AIR BAG DID NOT DEPLOYED. MANUFACTURER HAS BEEN CONTACTED. PLEASE PROVIDE FURTHER INFORMATION.*JB
10030725	CHEVROLET	SILVERADO	2003	2003-07-31	2003 CHEVROLET SILVERADO EXT. CAB 4X4 WITH ONSTAR, WRECKED. HIT TREES. TRUCK TOTALLED, FRONT-END DAMAGE, SIDE AND REAR END DAMAGE. AIR BAG DID NOT INFLATE. ONSTAR DID NOT WORK. *AK
10032581	CHEVROLET	SILVERADO	2003	2003-08-01	AIR BAGS FAILED TO OPEN ON HEAD END COLLISION. SPEED APPROX. 40 MPH. 2003 CHEVY SILVERADO - NEW CONDITION
10050872	CHEVROLET	SILVERADO	2003	2003-10-18	INVOLVED IN A 45 MPH COLLISION WITH ANOTHER VEHICLE. AIRBAGS IN MY 2003 CHEVROLET SILVERADO DID NOT DEPLOY.*AK
10055994	CHEVROLET	SILVERADO	2003	2004-01-24	WHILE DRIVING 25 MPH THE VEHICLE WAS INVOLVED IN A FRONTAL COLLISION. UPON IMPACT, THE FRONT AIR BAGS DID NOT DEPLOY. THE DRIVER SUSTAINED NECK AND BACK INJURIES. *AK *SC
10056087	CHEVROLET	SILVERADO	2003	2004-01-24	WHILE DRIVING AT 65 MPH ON THE HIGHWAY, THE DRIVER LOST CONTROL OF THE VEHICLE, RESULTING IN A FRONTAL COLLISION. THE VEHICLE WENT INTO AN EMBANKMENT. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. THE DRIVER SUSTAINED INJURIES. *AK BROKEN STERNUM, SPINE AND RIBS. THE CONSUMER WAS WEARING HIS SEAT BELT. THE SDM CRASH DOWN LOAD FROM THE CRASH WAS SENT TO ODI WITH PICTURES OF THE VEHICLE. CW *MR *JB
10066690	CHEVROLET	SILVERADO	2003		WHIEL DRIVING AT 40 MPH VEHICLE WAS HIT HEAD ON AND THE AIR BAGS FAILED TO DEPLOY.*MR

					AIR BAGS NOT DEPLOYING ON A NEW CHEVY SILVERADO PICK-UP/ FOLLOWING A VEHICLE CRASH. DRIVER WAS INJURED, AND SCARRED. WAS HOSPITLIZED AND STILL HAVING PROBLEMS AND WILL HAVE A LIFETIME SCAR ON FACE AREA. ALSO LEGS AND THIGHS ARE SCARRED. OUR SON WAS TRAVELING AT A HIGH RATE OF SPEED PASSING, LOST CONTROL WENT OFF HIGHWAY HEAD ON INTO DEEP DITCH, FLIPPED OVER, WENT SIDE TO SIDE COMING TO REST SIDEWAYS ON TIRES THAT WERE NOW FLAT AND STILL NO AIRBAG DEPLOYMENT. SENT A COMPLAINT AND PICTURES, POLICE REPORT AND MEDICAL RECORDS TO GM, NO SATISFACTION FROM THERE. WHAT DOES A VEHICLE HAVE TO HAVE DONE TO HAVE AN AIRBAG DEPLOY???? VEHICLE WAS TOTALED. SON IS PERMANTLY SCARRED, AND PARENTS HAVE LOST FAITH IN CHEVY TRUCKS, AND AIRBAGS. HIS OLDER BROTHER CO-SIGNED SO HE WOULD HAVE A "NEW, SAFER" VEHICLE AND AM NOW SO VERY UPSET WITH GM AS TO AN EXPLANATION AS TO WHY THESE AIR BAGS DID NOT DEPLOY TO PROTECT OUR SON. THIS VEHICLE (HE WAS SPEEDING PASSING) WENT OFF THE ROAD HEAD ON INTO A DEEP DITCH, OVERTURNED SEVERAL TIMES, HIT SIDE TO SIDE IN DITCH, FLATTENED TIRES AND CAME TO REST ON SHOULDER OF ROAD. NOW HOW MUCH MORE DOES IT TAKE TO DEPLOY AN AIR BAG????? I THINK IF WE WERE WEALTHY AND COULD AFFORD A LAWYER THEY MAYBE WOULD OF LISTENED AND CHECKED THIS MORE, BUT AS WE ARE JUST "COMMON" HARD WORKING US CITIZENS, WE DON'T REALLY COUNT. ALSO OUR SON WAS DRINKING AT THE TIME OF THE INCIDENT, ( SHOULD NOT MATTER TO SAFETY OF VEHICLE EQUIPMENT) I WAS TOLD IT WAS NOT "CATASTROPIC ENOUGH" OF AN ACCIDENT TO WARRENT ANY DAMAGES. ?? THEN THEY TRIED TO SAY THE "ACCIDENT" (MEANING VEHICLE) WASN'T. I THINK WE ALL KNOW WHAT THEY MEANT. WE WERE NOT LOOKING FOR "MILLIONS" (STRETCHING IT), JUST HIS MEDICAL BILLS AND THE PROBLEM CORRECTED IN OTHER CHEVY'S SO THIS WOULD NOT HAPPEN TO SOMEONE ELSE. AS USUAL THE HONEST PEOPLE, AND HARD WORKING MIDDLE CLASS CAN GET NO HELP. PRAYERS GO OUT TO ANYONE ELSE THIS HAS HAPPENED TO AND THAT IT WON'T HAPPEN TO SOMEONE ELSE'S
10072429	CHEVROLET	SILVERADO	2003	2003-05-25	CHILD.
10000011	CUEVADOLET	CILVEDADO	2002	2004 00 44	WHILE DRIVING 55 MPH CONSUMER'S VEHICLE WAS INVOLVED IN A FRONT COLLISION. UPON IMPACT, DUAL AIR BAGS DID NOT DEPLOY. DRIVER SUSTAINED HEAD INJURIES DUE TO HIS HEAD HITTING THE STEERING WHEEL.*AK THE CHEVROLET TESTERS CAME TO INSPECT THE VEHICLE. THEY CONCLUDED THAT THE IMPACT WAS NOT HARD ENOUGH NOR WAS THE VEHICLE GOING
10089611	CHEVROLET	SILVERADO	2003	2004-08-14	FAST ENOUGH FOR THE AIR BAG TO DEPLOY. *NM  AIR BAGS DID NOT INFLATE WITH A FRONT END CRASH THAT PUSHED THE MOTOR IN THE DASH.
10137033	CHEVROLET	SILVERADO	2003	2005-08-14	SON RECEIVED HEAD INJURIES WOULD LIKE TO KNOW WHAT YOU ARE GOING TO DO ABOUT THIS. PICKUP WAS A TOTAL LOSS. FRAME WAS BENT. OUR ATTORNEY WOULD LIKE TO PUSH THIS BUT I WOULD LIKE TO KNOW WHAT YOU WILL DO FOR US FIRST. I HAVE PICTURES IF YOU WOULD LIKE TO SEE THEM. *JB
10154224	CHEVROLET	SILVERADO	2003	2006-03-23	DIRECT FRONTAL IMPACT WITH SIDE OF CAR THAT RAN RED LIGHT. AIR BAG DID NOT DEPLOY.  SPEED WAS APPROXIMATELY 40-50 MPH. *JB
					I HIT A DEER HEAD ON AND TOTALED MY SILVERADO. I HIT IT AT 55 MPH AND NEITHER OF THE
10577089	CHEVROLET	SILVERADO	2003	2013-11-14	AIRBAGS DEPLOYED. *TR  TRUCK COLIDED WITH GUARD RAIL. BOUNCED OFF, HIT VEHICLE 1, THEN INTO VEHICLE 2 THEN STOPPED AFTER HITTING VEHICLE 3 A SEMI TRUCK. ALL DAMAGE WAS DONE TO FRONT OF THE CHEVY SILVERADO. AT NO TIME DID THE AIRBAGS DEPLOY. SILVERADO WAS DETERMINED TO BE
10592423	CHEVROLET	SILVERADO	2003	2014-05-08	TOTALED DUE TO THE EXCESSIVE DAMAGE ON THE FRONT. AIRBAGS SHOULD HAVE DEPLOYED DURING ONE OF THE IMPACTS. *JS
10082050	CHEVROLET	SUBURBAN	2003	2004-07-14	THE CONSUMER WAS INVOLVED IN AN ACCIDENT WHERE IT WAS HIT FROM THE FRONT DRIVER SIDE, THE IMPACT CAUSED THE VEHICLE TO HIT A TELEPHONE POLE HEAD ON. THE AIR BAGS DID NOT DEPLOY. *JB
11360703	CHEVROLET	SUBURBAN	2003	2020-08-07	TL* THE CONTACT OWNED A 2003 CHEVROLET SUBURBAN. THE CONTACT STATED THAT WHILE TOWING HIS DAUGHTERS VEHICLE AT ABOUT 60 MPH, ANOTHER VEHICLE CRASHED INTO THE VEHICLE BEING TOWED. THE AIR BAGS DID NOT DEPLOY. THE CONTACT SUSTAINED A HEAD AND LOWER BACK INJURY. THE FRONT PASSENGER (HIS DAUGHTER) SUSTAINED A BACK INJURY. THE TWO WENT TO THE DOCTOR THREE DAYS LATER. THERE WAS NO POLICE REPORT. THE VEHICLE BEING TOWED WAS DAMAGED AND WAS DRIVEN TO THE DAUGHTERS DORM WHERE IT WAS TOTALED BY THE INSURANCE COMPANY. THE DEALER AND THE MANUFACTURER WERE NOT CONTACTED. THE CONTACT STATED THAT THE OTHER DRIVERS INSURANCE DENIED ANY COMPENSATION TO THE CONTACT, STATING THAT THE CONTACTS VEHICLE (THE VEHICLE TOWING THE DAMAGED VEHICLE) WAS NOT HIT. THE CONTACT STATED THAT AFTER THE ACCIDENT, A LOUD NOISE WAS HEARD WHENEVER THE VEHICLE WAS TURNED ON. THE CONTACT ALSO STATED THAT THE DASHBOARD WAS CRACKED. THE VEHICLE WAS NOT REPAIRED. THE FAILURE MILEAGE WAS APPROXIMATELY 173,000.
					TL* THE CONTACT OWNED A 2003 CHEVROLET TAHOE. THE CONTACT STATED THAT WHILE DRIVING APPROXIMATELY 45 MPH, THE CONTACT LOST CONTROL OF THE VEHICLE AND CRASHED INTO A GUARD RAIL. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED. THE FRONT SEAT PASSENGER SUSTAINED 12 BROKEN RIBS AND 2 COLLAPSED LUNGS THAT REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS TOWED TO AN INDEPENDENT TOWING FACILITY. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE
10899484	CHEVROLET	TAHOE	2003	2016-04-14	WAS UNKNOWN. THE VIN WAS UNAVAILABLE.

					I RENTED A CHEVROLET TRACKER 2003 AND WAS HIT HEAD ON BY ANOTHER DRIVER AND
10008283	CHEVROLET	TRACKER	2003	2003-02-28	EVERYONE THERE NOTICE THAT THE AIRBAG DID NOT OPEN. THIS WAS A HEAD ON ACCIDENT. I WILL BE FILING THIS TO A LAWYER SHORT AS I WAS HURT. *JB
					I WAS DRIVING ON I-190 IN THE RIGHT HAND LANE ON DEC 19, 2003. A CAR COMING UP AN
					ENTRANCE RAMP MERGED INTO MY LINE ALMOST HITTING ME. I SWERVED TO AVOID THE CRASH
					BUT SUBSEQUENTLY HIT SOME BLACK ICE AND WAS UNABLE TO RECOVER CONTROL. I HIT THE
					CONCRETE BARRIER HEAD ON. THE INSURANCE COMPANY'S (PROGRESSIVE) CLAIMS AGENT FIGURES I WAS GOING ABOUT 50 MPH AT IMPACT. THE IMPACT SO EXTREME THAT MY TRACKER
					SHIFTED ITSELF INTO 4WD AND TURNED ON THE HIGHBEAMS. BASICALLY ANYTHING THAT COULD
					GO FORWARD DID. THE WHOLE FRONT OF THE VEHICLE WAS PUSHED BACK 6" AND MY LISCENCE
					PLATE WAS RIPPED OFF, BUT YET MY AIRBAGS NEVER DEPLOYED. IF IT WEREN'T FOR MY SEATBELT, I MAY NOT BE HERE TO TYPE THIS. I HAD SEVERE WHIPLASH, AS WELL AS, PUTTING MY LEFT KNEE
					THROUGH MY DASH BOARD. THE IMPACT OF THE CRASH SHOULD HAVE HIT AT LEAST ONE, IF NOT
					ALL, SENSORS. I FEEL THIS IS A MAJOR PROBLEM. I WILL BE FILING A FORMAL COMPLAINT WITH
10052731	CHEVROLET	TRACKER	2003	2003-12-19	CHEVY REGARDING THIS ISSUE.*AK WHILE DRIVING 37 MPH THE VEHICLE WAS INVOLVED IN A HEAD ON COLLISION. THE AIR BAGS DID
					NOT DEPLOY UPON IMPACT. THE PASSENGER SUSTAINED SEVERE WHIPLASH. PLEASE PROVIDE
10097100	CHEVROLET	TRACKER	2003	2004-03-20	ADDITIONAL INFORMATION. *JB
					I WAS DRIVING HOME FROM WORK WHEN MY CAR SWERVED TO THE RIGHT AND WENT OF THE
					ROAD AND HIT A GROVE OF TREES HEAD ON. MY CAR WAS TOTALED AND NONE OF MY AIRBAGS WENT OFF. WHY DOES THIS HAPPEN I COULD HAVE BEEN KILLED. ALSO I RECEIVED A SAFETY
					NOTICE ABOUT MY CHEVEROLET TRACKER 4 DAYS BEFORE THIS HAPPENED HAVING A PROBLEM
					WITH THE FRONT SUSPENSION CROSSMEMBER DOE SOMEONE HAVE TO DIE BEFORE A RECALL IS
					DONE AND WHY DIDN'T MY AIR BAGS GO OFF SOMEONE PLEASE LOOK AT THIS CAR BEFORE IT  GETS HAULED OFF BY THE ADJUSTER!!!!! I WAS AIRLIFTED TO THE HOSPITAL THE FIRE DEPARTMENT
10216640	CHEVROLET	TRACKER	2003	2008-01-27	CUT THE ROOF OF MY CAR OFF TO GET ME OUT NO AIRBAGS WHAT HAPPENED!!! *TR
					CONSUMER STATES THAT WHILE DRIVING APPROXIMATELY 35-40MPH SLID OFF ROAD AND
8023281	CHEVROLET	TRAILBLAZER	2003	2002-11-19	CRASHED INTO A DITCH HEAD-ON. BOTH DRIVER AND PASSENGER AIR BAGS DID NOT DEPLOY. TS
10040870	CHEVROLET	TRAILBLAZER	2003	2003-09-25	TRAVELING 55 MPH WHEN ANOTHER VEHICLE CROSSED THE ROAD CAUSING ME TO HIT THE SIDE OF HIS VEHICLE HEAD ON. NO AIR BAGS DEPLOYED.
10040870	CHEVROLET	TRAILBLAZER	2003	2003-09-23	LOSING CONTROL OF MY VEHICLE ON ICY PAVEMENT, VEHICLE SLID OFF OF THE ROAD, HEAD-ON
					INTO A TREE. DRIVERS SIDE AND PASSENGER SIDE AIR BAGS FAILED TO DEPLOY. SERIOUS INJURIES
					OCCURED , WHICH MAY HAVE BEEN LESSENED IF THE SAFETY FEATURES WE PAY FOR ACTUALLY WORK.*AK ER DOCTORS AND STATE POLICE WERE TERRIBLY ANNOYED , SINCE THERE HAVE BEEN
					SEVERAL REPORTS OF SAME FAILURE IN DESIGN. NO RESPONSE FROM DEALER OR
10054479	CHEVROLET	TRAILBLAZER TRAILBLAZER	2003	2004-01-16 2004-01-11	MANUFACTURER, AS OF YET !!!*AK  AFTER HITTING A TREE HEAD ON AIR BAGS DID NOT DEPLOY. *AK
10033334	CHEVROLLI	THAILDLAZEN	2003	2004 01 11	WITELLING WITH CONTROL OF THE CONTRO
					WHILE DRIVING AT 40 MPH CONSUMER'S VEHICLE WAS INVOLVED IN A FRONTAL COLLISION.  CONSUMER WAS WEARING SEAT BELTS, BUT NONE OF THE AIR BAGS DEPLOYED. CONSUMER
10065438	CHEVROLET	TRAILBLAZER	2003	2004-03-24	SUSTAINED A BROKEN NOSE, SCRAPES, AND BRUISES TO CHEST AND WRIST. *AK
40442264	CUEV/DOLET	TDAIL DI 475D	2002	2004 00 04	CHEVROLET TRAILBLAZER 2003 UPON IMPACT AIRBAG DID NOT DEPLOY. *BF THE CONSUMER
10113264	CHEVROLET	TRAILBLAZER	2003	2004-08-01	REAR ENDED ANOTHER VEHICLE. *JB
					2003 CHEVY TRAILBLAZER AIR BAGS NEVER CAME OUT AFTER HAVING IMPACT INTO TWO TREES
10174616	CHEVROLET	TRAILBLAZER	2003	2006-11-22	FORCING THE DRIVER INTO THE STEERING WHEEL. NOTHING AT THIS TIME HAS BEEN CORRECTED TO REPAIR THE SUV. GM NEED TO BE ALERTED OF THIS FAILURE TO CORRECT THE PROBLEM! *NM
1017 1010	CHEVITO ZE	110 (1252) (221)	2000	2000 11 22	
					TI*THE CONTACT OWNS A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING 40 MPH, THE CONTACT
					SWERVED TO AVOID AN ANIMAL AND CRASHED INTO A TREE. THE FRONT AIR BAGS FAILED TO DEPLOY. THE VEHICLE IS CURRENTLY AT A TOW YARD AND WILL BE TOWED TO THE INSURANCE
					COMPANY FOR INVESTIGATION. THE MANUFACTURER FILED A REPORT AND THE CONTACT IS
10208796	CHEVROLET	TRAILBLAZER	2003	2007-11-10	AWAITING A CALL BACK. THE CURRENT AND FAILURE MILEAGES WERE 60,000.
					TL*THE CONTACT OWNS A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING 32 MPH, THE CONTACT
					CRASHED INTO A BUILDING. THE VEHICLE WAS DESTROYED. THE AIR BAGS FAILED TO DEPLOY.  THE CONTACT SUSTAINED INJURIES TO HER MOUTH AND EYE. THE AMBULANCE ARRIVED ON THE
					SCENE AND TRANSPORTED THE CONTACT TO THE HOSPITAL. A POLICE REPORT WAS FILED.
4024000=	CHE SECTION	TDAUSTIC	2005	2000 02 55	CHEVROLET HAS NOT BEEN NOTIFIED. THE VIN, ENGINE SIZE, AND NUMBER OF CYLINDERS WERE
10219898	CHEVROLET	TRAILBLAZER	2003	2008-02-08	UNKNOWN. THE CURRENT AND FAILURE MILEAGES WERE 71,000.  TL*THE CONTACT OWNS A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING 45 MPH, THE CONTACT
					REAR ENDED ANOTHER VEHICLE. THE FRONT AIR BAGS FAILED TO DEPLOY. THERE WERE NO
10223723	CHEVROLET	TRAILBLAZER	2003	2008-03-13	INJURIES AND A POLICE REPORT WAS FILED. THE VIN AND ENGINE SIZE WERE UNKNOWN. THE FAILURE AND CURRENT MILEAGES WERE 77,000.
					THE AIRBAG DID NOT DEPLOY IN A FRONT-END COLLISION THAT WILL MOST LIKELY TOTAL THE
10220227		i			
10229337	CHEVROLET	TRAILBLAZER	2003	2008-05-28	VEHICLE. THE OTHER VEHICLE'S DID DEPLOY. *TR  HAD CAR ACCIDENT WAS HIT BY ANOTHER VEHICLE AND HIT A RETAINING WALL GOING ABOUT 45

			1		
10313800	CHEVROLET	TRAILBLAZER	2003	2009-12-26	TL*THE CONTACT OWNS A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING 45-50 MPH IN INCLEMENT WEATHER, THE CONTACT CRASHED INTO A RETAINER WALL. SHE STATED THAT OTHER PASSING VEHICLES PUSHED HER VEHICLE INTO THE RETAINER WALL. THE AIR BAG DID NOT DEPLOY. SHE WAS ALSO INJURED WHEN THE CRASH OCCURRED. THE MANUFACTURER STATED THAT THEY WOULD TAKE PICTURES OF THE VEHICLE. THE VEHICLE HAS NOT BEEN REPAIRED. A POLICE REPORT WAS FILED. THE FAILURE AND THE CURRENT MILEAGES WERE 82,000. THE CONSUMER STATED IT WAS A HIT AND RUN ACCIDENT. UPDATED 04/07/10.*JB
10315428	CHEVROLET		2003	2008-06-03	2003 CHEVROLET TRAILBLAZER. S10 COMEBACK FWD LTR TO POTUS RE COMPLAINT AGAINST GM REGARDING DEFECTIVE AIRBAG, INVOLVE IN CAR ACCIDENT AND THE AIRBAG DID NOT DEPLOY.  *TGW THE CONSUMER STATED ANOTHER VEHICLE HIT A DEER, CROSSED THE CENTER LANE AND HIT THEIR VEHICLE HEAD ON. THE CONSUMER STATED THE SEAT BELTS DID NOT RESTRAIN THEM.  *JB UPDATED PHONE NUMBER 05/28/10. *JB
10392644	CHEVROLET	TRAILBLAZER	2003	2011-01-23	TL*THE CONTACT OWNS A 2003 CHEVROLET BLAZER. THE CONTACT STATED THAT WHILE DRIVING APPROXIMATELY 45 TO 50 MPH IN THE RAIN HE CRASHED HEAD ON INTO ANOTHER VEHICLE. THE AIR BAGS DID NOT DEPLOY. THERE WERE NO AIR BAG WARNING INDICATIONS PRIOR TO THE CRASH. THE DRIVER SUSTAINED A CONCUSSION AND INJURIES TO HIS NECK, KNEE, AND FEET. A POLICE REPORT WAS FILED. THE DRIVER WAS TRANSPORTED TO THE HOSPITAL BY AMBULANCE. THE MANUFACTURER WAS CONTACTED AND OFFERED NO ASSISTANCE. THE FAILURE COULD NOT BE DIAGNOSED SINCE THE INSURANCE COMPANY DEEMED THE VEHICLE AS BEING DESTROYED. THE FAILURE AND CURRENT MILEAGE WAS APPROXIMATELY 130,000. THE VIN WAS UNAVAILABLE. UPDATED 5/2/11 *CN UPDATED 1/11/11 *CN
					MY WIFE AND I WERE INVOLVED IN A HEAD ON COLLISION (HIT BY A DRUNK DRIVER) OUR AIR BAGS DID NOT DEPLOY, I SUSTAINED A C7 FRACTURE, SCALPED BY THE REAR VIEW MIRROR (22 STITCHES TO HOLD MY SCALP) 6 STITCHES ON MY NOSE AND BRUISED KNEES. MY WIFE HAS A BROKEN NOSE
10425103	CHEVROLET	TRAILBLAZER	2003	2011-09-03	ALL THE BONES IN HER RIGHT FOOT BROKEN AND BRUISED KNEES. *TR  TL* THE CONTACT OWNS A 2003 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT HE  CRASHED INTO A LIGHT POLE WHILE DRIVING AT UNKNOWN SPEEDS AND THE AIR BAGS DID NOT  DEPLOY. THE CONTACT SUSTAINED INJURIES BUT WAS NOT TRANSPORTED TO THE HOSPITAL. THE  POLICE WAS NOTIFIED OF THE CRASHED AND A REPORT WAS FILED. THE VEHICLE WAS DESTROYED.  THE MANUFACTURER WAS NOT NOTIFIED. THE VIN WAS NOT AVAILABLE. THE FAILURE MILEAGE  WAS 170,000.
10523466			2003	2013-07-04	WHILE TRAVELING IN SLOW TRAFFIC, THE CAR IN FRONT OF MY WIFE STOPPED. BY THE TIME SHE NOTICED THEY STOPPED IT WAS TOO LATE AND SHE HIT THE BACK OF THEIR FORD EXPLORER MOVING AT AROUND 20-30MPH. THE FRONT END OF OUR TRAILBLAZER WAS CRUSHED. MY DAUGHTER AND WIFE WERE WEARING THEIR SEAT BELTS. THE OFFICERS AND PARAMEDICS ON THE SCENE WERE SHOCKED THAT THE AIRBAGS DID NOT COME OUT WITH THE AMOUNT OF FRONT END DAMAGE. THEY HAD TO CUT THE BATTERY WIRES TO PREVENT THE AIRBAG FROM COMING OUT LATER WHEN SHE CLEANED OUT THE TRAILBLAZER. AN EXAMPLE OF HOW MUCH DAMAGE WAS TAKEN TO THE FRONT END, THE CORNER FENDERS WERE PUSHED BACK SO FAR THEY COULDN'T OPEN WITHER FRONT DOOR. THE FENDERS WERE CRUSHED INTO THE DOORS KEEPING THEM SHUT. I WOULD THINK WITH AN IMPACT LIKE THAT THE AIRBAGS WOULD HAVE CAME OUT, IT WAS A SQUARE HIT MEANING EVEN DAMAGE ACROSS THE FRONT END. *TR
10551243	CHEVROLET	TRAILBLAZER	2003	2013-09-26	DRIVING APPROXIMATELY 40 TO 43 MPH WHEN ANOTHER VEHICLE TURNED DIRECTLY IN FRONT OF ME. TOTAL FRONTAL DAMAGE BUCKLING UP HOOD ON MY CAR AS I HIT OTHER VEHICLE IN FRONTEND PASSENGER SIDE. THEIR AIRBAG DEPLOYED BUT MINE DIDN'T, EVEN WITH TOTAL FRONT END DAMAGE TO MY CAR. HAD SEATBELT ON, BUT DUE TO IMPACT STILL PULLED MY WHOLE BODY FORWARD (LIKE CRASH TEST DUMMY). THIS WAS A VERY HARD CRASH TOTALING MY CAR. *TR
10568108	CHEVROLET	TRAILBLAZER	2003	2008-02-14	TL* THE CONTACT OWNS A 2003 CHEVROLET TRAIL BLAZER. THE WAS DRIVING 40 MPH, AND CRASHED INTO THE SIDE OF ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED INJURIES TO THE RIGHT SHOULDER, SPINAL STENOSIS AND FRACTURED KNEES. A POLICE REPORT WAS FILED OF THE INCIDENT. THE CONTACT STATED THAT SHE HAD ALSO BEEN INVOLVED IN TWO PRIOR CRASHES IN WHICH THE AIR BAGS FAILED TO DEPLOY. THE PREVIOUS CRASHES DID NOT RESULT IN ANY INJURIES AND A POLICE REPORT WAS NOT FILED. THE VEHICLE WAS INSPECTED BY A REPRESENTATIVE SENT BY THE MANUFACTURER BUT THEY WERE UNABLE TO DETERMINE THE CAUSE OF THE AIR BAG FAILURE. THE FAILURE MILEAGE WAS 80,000. *TR
10596289	CHEVROLET	TRAILBLAZER	2003	2007-11-11	TL* THE CONTACT OWNS A 2003 CHEVROLET TRAIL BLAZER. THE CONTACT STATED THAT WHILE DRIVING AN UNKNOWN SPEED, THE CONTACT ABRUPTLY APPLIED THE BRAKES TO AVOID A CRASH. THE CONTACT LOST CONTROL OF THE VEHICLE AND CRASHED INTO A CEMENT BARRIER. THE VEHICLE THEN ROLLED OVER AND LANDED IN AN EMBANKMENT. THE DRIVER'S SIDE AIR BAG FAILED TO DEPLOY. THE CONTACT SUFFERED INJURIES TO THE NECK AND A BROKEN LEG. THE CONTACT ALSO STATED THAT THE IGNITION SWITCH WAS REPLACED TWICE PRIOR TO THE CRASH. THE VIN WAS NOT AVAILABLE. THE VEHICLE WAS DESTROYED. THE CAUSE OF THE FAILURE WAS UNKNOWN. THE FAILURE AND CURRENT MILEAGE WAS 70,000.
10606954	CHEVROLET	TRAILBLAZER	2003	2006-08-08	AIRBAGS DID NOT DEPLOY DURING ACCIDENT. VEHICLE WENT THROUGH A GUARD RAIL, SUSTAINED FRONT END DAMAGE. *TR

					2003 CHEVROLET TRAILBLAZER. CONSUMER STATED HER HUSBAND WAS INVOLVED IN AN
10654364	CHEVROLET	TRAILBLAZER	2003	2002-10-26	ACCIDENT, AND THE AIR BAGS DID NOT DEPLOY. CONSEQUENTLY, HE DIED FROM HIS INJURIES. *SS UPDATED 02/09/15. *JB
10660781	CHEVROLET	TRAILBLAZER	2003	2014-11-23	TL* THE CONTACT OWNED A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 70 MPH, A DEER JUMPED IN FRONT OF THE VEHICLE CAUSING THE CONTACT TO CRASH. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED A NECK AND BACK INJURY THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 170,000.
10681428	CHEVROLET	TRAILBLAZER	2003	2015-01-24	TL* THE CONTACT OWNS A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 35 MPH, THE VEHICLE SLID ON ICE AND CRASHED INTO A CEMENT WALL. THE AIR BAGS DID NOT DEPLOY AND THE SEAT BELT DID NOT RESTRAIN THE CONTACT. THE CONTACT SUSTAINED CHEST, NECK, AND KNEE INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS DRIVEN TO THE CONTACT'S RESIDENCE. THE VEHICLE WAS THEN TAKEN TO AN INDEPENDENT MECHANIC, BUT WAS NOT DIAGNOSED OR REPAIRED. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 70,000.
10694201	CHEVROLET	TRAILBLAZER	2003	2013-05-06	TL* THE CONTACT OWNED A 2003 CHEVROLET TRAILBLAZER. THE CONTACT STATED THAT WHILE DRIVING AT 50 MPH DURING INCLEMENT WEATHER CONDITIONS, THE CONTACT LOST CONTROL OF THE VEHICLE AND CRASHED INTO AN EMBANKMENT. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED SPINE INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 90,000. UPDATED 5/11/15*CN
10721783	CHEVROLET	TRAILBLAZER	2003	2015-05-12	TL* THE CONTACT OWNS A 2003 CHEVROLET TRAILBLAZER EQUIPPED WITH BF GOODRICH RUGGED TRAIL T/A TIRES, SIZE: P245/65R17. WHILE DRIVING AT 65 MPH, THE CONTACT HEARD A VIBRATION COMING FROM THE TIRES. THE CONTACT LOST CONTROL OF THE VEHICLE AND CRASHED INTO A POLE. THE VEHICLE ROLLED OVER MULTIPLE TIMES AND THE AIR BAGS FAILED TO DEPLOY. IN ADDITION, THE CONTACT NOTICED THAT THE THREADS FROM THE REAR DRIVER SIDE TIRE HAD SEPARATED. THE CONTACT SUSTAINED HEAD, SHOULDER, ELBOW, AND HIP INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE VEHICLE AND TIRE MANUFACTURERS WERE NOT NOTIFIED OF THE FAILURE. THE VEHICLE FAILURE MILEAGE WAS 116,000 AND THE TIRE FAILURE MILEAGE WAS 40,000. THE DOT NUMBER WAS UNAVAILABLE.
10787837	CHEVROLET	TRAILBLAZER	2003	2015-10-29	TL* THE CONTACT OWNED A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 20 MPH UPHILL, A VEHICLE TRAVELING DOWNHILL CRASHED HEAD ON INTO THE CONTACT'S VEHICLE. THE FRONTAL AIR BAGS DID NOT DEPLOY. THE PASSENGER SUSTAINED WHIPLASH AND BRUISES TO THE ELBOW, CHEST, AND STOMACH THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE PASSENGER WAS ALSO INJURED AND TAKEN TO THE HOSPITAL, BUT WAS RELEASED THE SAME DAY. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE VIN WAS INVALID. THE APPROXIMATE FAILURE MILEAGE WAS 141,000.
10850437	CHEVROLET		2003	2016-02-03	TL* THE CONTACT OWNED A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING 50 MPH, THE VEHICLE SLID ON BLACK ICE AND CRASHED INTO A DITCH. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT SUSTAINED A CUT TO THE HEAD AND A SEVERE BACK INJURY THAT REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED AND TOWED. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS 186,000.
10863408	CHEVROLET	TRAILBLAZER	2003	2016-05-03	TL* THE CONTACT OWNS A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING 25 TO 35 MPH, AN ANIMAL APPEARED IN THE ROAD. THE CONTACT SWERVED AND CRASHED INTO A TELEPHONE POLE. THE AIR BAGS DEPLOYED. THE VEHICLE WAS TOWED TO THE CONTACT'S RESIDENCE. THE MANUFACTURER WAS NOT AWARE OF THE FAILURE. A POLICE REPORT WAS NOT FILED. THE CONTACT SUSTAINED HEAD, NECK, AND CHEST INJURIES THAT REQUIRED MEDICAL ATTENTION. THE FAILURE MILEAGE WAS 135,000UPDATED 06/15/16 *BF *CN
10927873	CHEVROLET	TRAILBLAZER	2003	2016-11-22	TL* THE CONTACT OWNED A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 78 MPH, A TIRE BLEW OUT. THE CONTACT LOST CONTROL OF THE VEHICLE AND CRASHED. THE VEHICLE WAS DESTROYED AND TOWED. THE AIR BAGS FAILED TO DEPLOY. THE DRIVER SUSTAINED AN INJURED LEFT SHOULDER AND NECK, AND A HEAD ABRASION, WHICH REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 115,000.
10934115		TRAILBLAZER	2003	2016-11-29	TL* THE CONTACT OWNED A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING 40 MPH IN WET WEATHER, THE VEHICLE HYDROPLANED, DROVE OFF A CLIFF, AND CRASHED INTO A TREE. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT SUSTAINED CHEST, KNEE AND ARM INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS NOT FILED. THE VEHICLE WAS TOWED TO A TOWING AGENCY WHERE IT WAS DEEMED DESTROYED. THE FAILURE MILEAGE WAS 160,000. UPDATED 03/01/17*LI *JS

			1		
10969901	CHEVROLET	TRAILBLAZER	2003	2017-03-25	I WAS INVOLVED IN A HEAD-ON COLLISION, I WAS GOING AROUND 10-15 MPH AND THE VEHICLE THAT CAUSED THE ACCIDENT WAS GOING FASTER THAN I WAS GOING. MY AIRBAGS DID NOT DEPLOY. THEY SHOULD DEPLOY BETWEEN 8-14 MPH. IS ANYONE HOLDING GENERAL MOTORS ACCOUNTABLE FOR THEIR NEGLIGENCE? WE WERE ON A TWO LANE CITY STREET.
					TL* THE CONTACT OWNS A 2003 CHEVROLET TRAILBLAZER. WHILE DRIVING 35 MPH, THE VEHICLE WAS INVOLVED IN A HEAD ON COLLISION. THE CONTACT'S VEHICLE WAS STRUCK FROM THE FRONT END BY ANOTHER VEHICLE. THE AIR BAGS DID NOT DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT SUSTAINED INJURIES TO THE LEFT LEG AND LEFT ARM, WHICH REQUIRED MEDICAL
					ATTENTION. THE VEHICLE WAS TOWED. IT WAS NOT DETERMINED WHETHER OR NOT THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE
10970795	CHEVROLET	TRAILBLAZER	2003	2017-03-25	MILEAGE WAS 150,000.
					MY WIFE WAS IN AN ACCIDENT WITH OUR NEW 2003 GMC ENVOY SLT, PURCHASED IN NOVEMBER OF 2003. TO AVOID REAR ENDING THE CAR IN FRONT OF HER, SHE SWERVED THE ENVOY OFF OF THE ROAD, DOWN A HILL AND AND HIT A TREE IN THE RIGHT FRONT OR PASSENGER SIDE OF THE VEHICLE. SHE HIT THE TREE WITH SUCH FORCE THAT THE DAMAGE TO THE FRONT OF THE VEHICLE RESULTED IN A TOTAL LOSS. MY CONCERN IS THE AIR BAGS NEVER NEVER DEPLOYED IN THIS
40005004		5111/01/	2000	2004.04.05	ACCIDENT. I WOULD LIKE TO KNOW WHY? AND I WOULD LIKE TO KNOW MORE INFORMATION AS
10065821	GMC	ENVOY	2003	2004-04-05	TO THE OPERATION OF THE AIR BAG SYSTEM IN A GMC ENVOY.*AK  CONSUMER'S VEHICLE REAR ENDED ANOTHER VEHICLE AT 25 MPH. UPON IMPACT, AIR BAGS DID
10076184	GMC	ENVOY	2003	2004-05-20	NOT DEPLOY. DEALERSHIP WAS NOTIFIED, BUT DID NOT RESOLVE THE PROBLEM. *AK THE MANUFACTURER DID NOT EXCEPT RESPONSIBILITY. *SC
					WHILE DRIVING, UPON IMPACT THE AIR BAGS DID NOT DEPLOY AFTER BEING STRUCK IN A
10101930	GMC	ENVOY	2003	2004-11-01	SERIOUS FRONT END COLLISION. *BF *SC
					CONSUMER'S VEHICLE WAS INVOLVED IN A HEAD ON COLLISION AT 35 MPH. UPON IMPACT, AIR BAGS DID NOT DEPLOY. CONSUMER WILL NOTIFY MANUFACTURER.*AKPOLICE REPORT
10103710	GMC	ENVOY	2003	2004-11-22	INCLUDED
					VEHICLE WAS INVOLVED IN A FRONT COLLISION ACCIDENT AT 15 MPH DUE TO WEATHER. UPON
					IMPACT, AIR BAGS DID NOT DEPLOY. DEALER WAS INFORMED BY CONSUMER. *AK THE
40402004	CNAC	ENIVOV	2002	2004.04.40	CONSUMER STATED THAT THE VEHICLE COULD ONLY BE TURNED OFF BY CUTTING THE BATTERY
10103904	GMC	ENVOY	2003	2004-01-18	CABLES. *TC  ACCIDENT ON 2/17/2009 FRONT CRASH TO OTHER VEHICLE AND AIR BAG DID NOT DEPLOY HOOD
					DAMAGE, WINDSHIELD DAMAGE, ALL FRONT DAMAGE, DOORS COULD NOT OPEN RADIATOR
10259161	GMC	ENVOY	2003	2009-02-17	DAMAGE, ENGINE DAMAGE. *TR
10281810	GMC	ENVOY	2003	2009-08-25	MY HUSBAND FELL ASLEEP AT THE WHEEL ON HIS WAY TO WORK AND HIT SEVERAL TREES. THE CAR IS TOTALED BUT THE AIRBAGS DIDN'T GO OFF. I DO UNDERSTAND THAT THE ACCIDENT WAS 100% MY HUSBANDS FAULT BUT I DON'T UNDERSTAND WHY THE AIR BAGS DIDN'T GO OFF. *TR
10554787	GMC	ENVOY	2003	2013-11-25	TL* THE CONTACT OWNS A 2003 GMC ENVOY. THE CONTACT STATED THAT WHILE DRIVING AT AN UNKNOWN SPEED, HE SLIGHTLY CRASHED INTO A CURB AND THE VEHICLE TURNED OVER IN A DITCH. THE AIR BAGS DID NOT DEPLOY AND THE CONTACT SUSTAINED NECK AND LOWER BACK INJURIES. A POLICE REPORT WAS FILED OF THE INCIDENT. THE VEHICLE WAS DEEMED DESTROYED AND TOWED TO A SALVAGE YARD. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS UNAVAILABLE.
10560852	GMC	ENVOY	2003	2014-01-16	TL* THE CONTACT OWNS A 2003 GMC ENVOY. THE CONTACT STATED THAT WHILE DRIVING AT VARIOUS SPEEDS, THE CONTACT WAS INVOLVED IN A CRASH. THE VEHICLE TRAVELED DOWN AN EMBANKMENT AND CRASHED INTO A TREE. THE AIR BAGS FAILED TO DEPLOY AND THE CONTACT SUSTAINED INJURIES TO THE ARMS. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE VIN WAS NOT AVAILABLE. THE APPROXIMATE FAILURE AND CURRENT MILEAGE WAS 100,000.
10300032	GIVIC	LIVVUI	2003	2014-01-10	MY DAUGHTER WAS DRIVING THE ENVOY AT ABOUT 45 MPH WHEN A DRUNK DRIVER PULLED OUT
10592465	GMC	ENVOY	2003	2014-04-14	IN FRONT OF TRAFFIC, CAUSING EVERYONE TO SLAM ON THEIR BRAKES, AND MY DAUGHTER WAS NOT ABLE TO STOP IN TIME BEFORE REAR-ENDING ANOTHER VEHICLE. THE CAR IS TOTALED BUT THE AIRBAGS NEVER DEPLOYED. *JS
10615166	GMC	ENVOY	2003	2012-06-04	I WAS DRIVING ABOUT 40 MPH WHEN I WENT THREW A YELLOW LIGHT WHEN A OLDER LADY TURN IN FRONT OF ME, I HIT HER ON THE PASSENGER SIDE BETWEEN THE FRONT N BACK DR, , PUSHING N ROLLING N TOTALING HER SMALL SUV. SHE WAS NOT SERIOUS HURT. MY AIRBAGS DID NOT DEPLOY. MY ENVOY WAS STILL DRIVEABLE . I TOOK MY ENVOY TO MY LOCAL GMC DEALER TO HAVE THEM FIND PROB WHY THE AIRBAGS DIDN'T GO OFF, THEY OR I CALLED A REP FOR GMC, TO COME TO SIOUX FALLS TO INVESTIGATE AND HE TOLD ME THAT THE REASON THEY DIDN'T DEPLOY WAS BECAUSE I WASN'T GOING FAST ENOUGH FOR IMPACT FOR DEPLOY. I THINK THAT IS BUNCH OF BULL. CAN SOMEONE HELP ME ,IS THERE ANYTHING I CAN DO .I HEAR THAT A PERSON CAN RECEIVE CASH FROM GMC IF A PERSON S AIRBAGS DON'T GO OFF. *TR
					•

					TL*THE CONTACT OWNS A 2003 GMC ENVOY. THE CONTACT STATED THAT WHILE DRIVING AT 5
					MPH, THE CONTACT DEPRESSED THE ACCELERATOR PEDAL INSTEAD OF THE BRAKE PEDAL WHICH
					CAUSED THE VEHICLE TO CRASH INTO A TREE. AS A RESULT, THE AIR BAG FAILED TO DEPLOY. THE
					CONTACT SUSTAINED INJURIES TO THE NECK AND LEFT SHOULDER WHICH REQUIRED MEDICAL
					ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS NOT REPAIRED. THE VIN WAS NOT
					AVAILABLE. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE APPROXIMATE
10682693	GMC	ENVOY	2003	2015-02-10	FAILURE MILEAGE WAS 189,325.
					FRONT AIR BAG DID NOT DEPLOY, DRIVING IN SNOW SLID AN HIT A TREE WAS DRIVING ON A
10816234	GMC	ENVOY	2003	2015-12-19	HIGHWAY.
					TL* THE CONTACT OWNED A 2003 GMC ENVOY. WHILE DRIVING APPROXIMATELY 25 MPH AND
					ATTEMPTING TO MAKE A LEFT TURN, THE CONTACT CRASHED INTO THE FRONT END OF ANOTHER
					VEHICLE. THE AIR BAGS DID NOT DEPLOY. THERE WERE NO WARNING INDICATORS ILLUMINATED.  THE CONTACT SUSTAINED INJURIES THAT DID NOT REQUIRE MEDICAL ATTENTION. A POLICE
					REPORT WAS FILED. THE VEHICLE WAS DECLARED TOTALED BY THE INSURANCE COMPANY AND
					TOWED FROM THE SCENE. THE DEALER AND MANUFACTURER WERE NOT MADE AWARE OF THE
					FAILURE. THE VEHICLE WAS NOT DIAGNOSED. THE FAILURE MILEAGE WAS APPROXIMATELY
11093358	GMC	ENVOY	2003	2018-04-20	300,000.
					WHILE DRIVING ON A RESIDENTIAL STREET CONSUMER FELL ASLEEP BEHIND THE WHEEL AND HIT
					ANOTHER VEHICLE ON THE FRONT DRIVER'S SIDE. SLIGHT INJURIES WERE SUSTAINED BY THE PASSENGERS OF THE OTHER VEHICLE. CONSUMER SUFFERED RIB CONTUSIONS EVEN THOUGH
					SEAT BELTS WERE WORN. NONE OF THE AIR BAGS DEPLOYED. CONSUMER WAS GIVEN A
10037631	GMC	YUKON	2003	2003-08-17	CITATION BY THE POLICE THAT ARRIVED ON THE SCENE.*AK
					DT*: THE CONTACT STATED THE VEHICLE WAS INVOLVED IN A T-BONE COLLISION AT 10MPH AND
					THE AIRBAGS DID NOT DEPLOY. THERE WAS NO PRE-BRAKING PRIOR TO IMPACT. ALTHOUGH THE
					OCCUPANTS WERE WEARING SEATBELTS, MINOR INJURIES WERE SUSTAINED. THE VEHICLE WAS
40453567	CNAC	WI II/ON	2002	2006 02 40	TOTALED BY THE INSURANCE AGENCY. THE POLICE WERE ON THE SCENE AND A REPORT WAS
10152567	GMC	YUKON	2003	2006-03-10	TAKEN. THE VEHICLE WAS NOT SEEN BY A DEALER FOR INSPECTION.  DT: THE CONTACT STATED WHILE DRIVING ON THE INTERSTATE DURING RUSH HOUR AT 55 MPH, A
					VEHICLE HIT THE WALL AND TAIL SPINNED IN FRONT OF CONTACT'S VEHICLE. THE CONTACT HIT
					THE VEHICLE WITH A FRONTAL IMPACT CAUSING SEVERE DAMAGE. UPON IMPACT, THE NONE OF
					THE CONTACT'S AIR BAGS DEPLOYED. THE CONTACT WAS WEARING A SEATBELT HOWEVER
					INJURIES WERE SUSTAIN TO THE SHOULDERS, BACK AND NECK. WHEN THE VEHICLE WAS TAKEN TO
					THE DEALERSHIP, THEY DETERMINED THE VEHICLE WAS OPERATING PROPERLY HOWEVER THE
					AIRBAGS DID NOT DEPLOY. THE MANUFACTURER HAS BEEN ALERTED. A POLICE REPORT WAS
10160618	ISUZU	ASCENDER	2003	2006-03-21	FILED AT THE SCENE.
					TL*THE CONTACT OWNS A 2003 ISUZU AXIOM. WHILE DRIVING LESS THAN 20 MPH, THE CONTACT
					REAR-ENDED THE PRECEDING VEHICLE. THE FRONT END OF HER VEHICLE WAS DAMAGED. THE AIR BAGS FAILED TO DEPLOY. THE DRIVER SUSTAINED MINOR NECK, LEG, AND BACK INJURIES. THE
					VEHICLE WAS TOWED TO A REPAIR SHOP AND COULD POSSIBLY BE LABELED AS DESTROYED. A
					POLICE REPORT WAS FILED. THE CURRENT AND FAILURE MILEAGES WERE 135,850 UPDATED
					05/08/09 *BF THE CONSUMER STATED THE DRIVER IN FRONT OF HIM/HER PULLED HIS
					EMERGENCY BRAKE BECAUSE THE DRIVER IN FRONT OF HIM STOPPED SUDDENLY AND THE
					CONSUMER NEVER SAW THE DRIVERS BRAKE LIGHTS. UPDATED 05/12/09. *JB UPDATED
10266207	ISUZU	AXIOM	2003	2009-04-11	06/09/09.*JB
					DRIVING IN A LARGE PARKING LOT, HIT A LARGE CEMENT POLE DOING 20 MILES PER HOUR.AIR
					BAGS DID NOT DEPLOY, HAD NOT PUT MY SEAT BELT ON YET & HIT & SHATTERED THE WINDSHIELD
11325218	ISUZU	AXIOM	2003	2020-05-15	KNOCKING OUT ALL OF MY FRONT UPPER TEETH. FRACTURED MAXILLA .WHY DID AIR BAGS NOT DEPLOY? *TR
11373710	13020	ANIOW	2003	2020-03-13	WHILE DRIVING 40 MPH VEHICLE VEERED AND HIT A TELEPHONE POLE, AND AIR BAGS DIDNOT
					DEPLOY. DRIVER AND PASSENGER WERE INJURED. DEALER CONTACTED. HAD FRONTAL IMPACT.
8003267	CADILLAC	ESCALADE	2002	2001-07-19	*AK
					WHILE DRIVING 40 MPH VEHICLE WAS INVOLVED IN A FRONTAL COLLISION. UPON IMPACT, DUAL
10064975	CHEVROLET	ASTRO	2002	2004-02-15	AIRBAGS DID NOT DEPLOY. NO INJURES WERE REPORTED. *AK
					HICH COEFD CAD ACCIDENT ON 1/2/07 DRIVED CEAT BELT DID NOT WORK CORDECTLY BELT DID
					HIGH SPEED CAR ACCIDENT ON 1/3/07 DRIVER SEAT BELT DID NOT WORK CORRECTLY, BELT DID  NOT LOCK UPON HARD BRAKING OR UPON CAR CRASH I HIT MY CHEST ON STEERING WHEEL AND
10178492	CHEVROLET	ASTRO	2002	2007-01-03	MY KNEES ON DASHBOARD, MY AIRBAG DID NOT DEPLOY EITHER. *JB
_01,0432	O. L. VINOLET		2002		CONSUMER STATES THAT WHILE DRIVING AT 35MPH. VEHICLE WAS IN A COLLISION. CONSUMER
10026532	CHEVROLET	BLAZER	2002	2003-06-20	STATES THAT BOTH FRONT AIRBAGS DID NOT DEPLOY.DEALER NOTIFIED.*AK
					VEHICLE RAN INTO THE BACK OF A SEMI-TRACTOR TRAILER AND AIR BAGS DID NOT DEPLOY
					BECAUSE IT DIDN'T CONSUMER SUSTAINED INJURIES, PAIN AND SUFFERING. DEALER NOTIFIED.
10031954	CHEVROLET	BLAZER	2002	2003-06-20	*MR *CB
					THE VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AND THE FRONT AIR BAGS DID NOT DEPLOY.
10049597	CHEVROLET	DIAZED	2002	2002 10 20	THE DRIVER SUFFERED NECK AND BACK INJURIES. THE FRONT PASSENGER SUFFERED CHEST INJURIES. PLEASE PROVIDE FURTHER DETAILS. *JB
10048587	CHEVROLET	DLAZEK	2002	2003-10-29	INJUNIES. FELASE PROVIDE FUNTHER DETAILS. JD

			1		
10347200	CHEVROLET	BLAZER	2002	2010-07-30	TL* THE CONTACT OWNS A 2002 CHEVROLET BLAZER. THE CONTACT WAS DRIVING APPROXIMATELY 35 MPH, AND CRASHED INTO AN UNOCCUPIED PARKED VEHICLE. THE AIR BAGS WOULD NOT DEPLOY WITH THE LEVEL OF IMPACT IN THE CRASH. WHILE THE FRONT DRIVER SIDE SHOULDER SEAT BELT WAS BEING WORN, IT FAILED TO FUNCTION AND CAUSED THE CONTACT TO MOVE IN A FORWARD POSITION AS A RESULT HER FACE STRUCK THE STEERING WHEEL. THE CONTACT SUSTAINED A BROKEN NOSE, BRUISES ON BOTH ARMS AND SHOULDER AREA. THE AMBULANCE, FIRE AND POLICE DEPARTMENT WERE CALLED TO THE SCENE. A POLICE REPORT WAS FILED OF THE INCIDENT. THE VEHICLE WAS TOWED TO A COLLISION FACILITY LOT. THE VEHICLE WAS COMPLETELY DESTROYED. THE FAILURE MILEAGE WAS APPROXIMATELY 130,000. UPDATED 10/13/10*BF UPDATED 10/14/10*JB
10402642	CHE/DOLET	DI AZED	2002	2011 05 22	MY 2002 CHEVY BLAZER X-TREME AIR BAGS DIDN'T DEPLOY ON A FRONT END COLLISION AT THE
10402643	CHEVROLET	BLAZER	2002	2011-05-23	SPEED OF 45 MPH, MY CAR HAS TOTAL DAMAGE. *TR  CONSUMER WAS INVOLVED IN AN ACCIDENT WHERE SHE WAS HIT HEAD ON THE RIGHT FRONT
					SIDE. THE AIRBAGS FAILED TO DEPLOY. CONSUMER WAS TOLD THE AIRBAGS DIDNT HAVE TO DEPLOY BECAUSE THE VEHICLE WAS STATIONARY DURING BOTH HITS, CONSUMER WAS INJURED IN
567453 767453	CHEVROLET	SILVERADO	2002	2002-08-18	THE ACCIDENT. *JG  IN DIRECT FRONTAL IMPACT AT 45 MPH, AIRBAGS FAILED TO DEPLOY.*AK
707455	CHEVROLET	SILVERADO	2002	2002-09-01	THIS TRUCK WAS INVOLVED IN A HEAD ON CRASH. I WAS RUNNING ABOUT 55 MPH AND THE
767929	CHEVROLET	SILVERADO	2002	2002-05-08	OTHER VEHICLE WAS RUNNING APPROXIMATELY 35 MPH. THE TRUCK WAS A TOTAL LOSS WITH MOST OF THE DAMAGE DONE TO THE FRONT END.THE DRIVERS SIDE AIR BAG OR THE PASSENGER AIR BAG DID NOT DEPLOY. MR  THIS VEHICLE WAS INVOLVED IN A HEAD-ON COLLISION WHILE TRAVELING AT 50 MPH. BOTH THE
767963	CHEVROLET	SILVERADO	2002	2002-09-26	DRIVER SIDE AND PASSENGER SIDE AIR BAGS DID NOT DEPLOY. MR
0000074	CUEV/DOLET	CILLYEDADO	2002	2004 42 40	VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AT 25MPH. UPON IMPACT, AIRBAGS DID NOT
8000974	CHEVROLET	SILVERADO	2002	2001-12-10	DEPLOY. *AK *YH
8003037	CHEVROLET	SILVERADO	2002		VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AT 40-45MPH. UPON IMPACT AIR BAGS DID NOT DEPLOY. DEALER HAS BEEN CONTACTED. PLEASE PROVIDE ADDITIONAL INFORMATION.*AK
8010265	CHEVROLET	SILVERADO	2002	2002-05-21	WHILE DRIVING AT 35 MPH, THE VEHICLE WAS HIT BY AN AMBALANCE, THE AIR BAGS DIDN'T DEPLOY RESULTING IN MAJOR INJURIES TO DRIVER.*AK *MJ
0010203	CHEVILOLET	SILVLIVIDO	2002	2002 03 21	VEHICLE WAS INVOLVED IN A FRONTAL IMPACT GOING 35MPH. AIR BAG DIDN'T DEPLOY, AND
					LIGHT NEVER ILLUMINATED. CHEVROLET WAS CONTACTED, AND WILL BE SENDING AN INSPECTOR
8011057	CHEVROLET	SILVERADO	2002	2002-05-19	OUT FOR VEHICLE. PLEASE PROVIDE MORE INFORMATION.*AK  VEHICLE WAS INVOLVED IN A 30-40 MPH FRONTAL COLLISION IN WHICH DRIVER'S AND
					PASSENGER'S AIR BAGS DID NOT DEPLOY, CAUSE UNKNOWN. PLEASE GIVE ANY FURTHER
8011088	CHEVROLET	SILVERADO	2002	2002-05-12	DETAILS.*AK
8016806	CHEVROLET	SILVERADO	2002	2002-08-19	CONSUMER WAS TRAVELING ABOUT 20MPH ON A SIDE STREET AND THERE WAS A CONCRETE PIPE LAYING ON THE ROAD, AND WITHOUT PRIOR WARNING SHE HIT THE PIPE. AIRBAGS DIDN'T GO OFF. AT DEALERSHIP IS AWARE OF PROBLEM.THE PIPE WAS A BROKE OFF LIGHT POLE. THE FRAME ON THE VEHICLE IS BENT. *JG
0047004	0.15.40.01.57	SULVED 4 D O	2000	2002 00 10	VEHICLE WAS INVOLVED IN A FRONTAL COLLISION WITH A TREE TRAVELING APPROXIMATLY 30-
8017234	CHEVROLET	SILVERADO	2002	2002-08-19	40MPH, AND AIR BAGS DID NOT DEPLOY.*AK WHILE DRIVING AT 72 MPH CONSUMER HIT ANOTHER VEHICLE HEAD ON AND NONE OF THE AIR
					BAGS DEPLOYED. CONTACTED DEALER, AND DEALER STATED THAT THE VEHICLE ACTED LIKE IT
8019177	CHEVROLET	SILVERADO	2002	2002-08-23	SHOULD HAVE.AK
8021266	CHEVROLET	SILVERADO	2002	2002-07-19	CONSUMER STATES WHILE DRIVING 45MPH HAD A HEAD ON COLLISION AIR BAG DID NOT DEPLOY.  TS
8024161	CHEVROLET	SILVERADO	2002	2002-11-19	CONSUMER STATES THAT WHEN HIT AT 55 MPH IN THE FRONT CENTER OF THE VEHICLE THE AIR BAG DID NOT DEPLOY CAUSING MINOR INJURIES TO THE CONSUMER. DEALER NOTIFIED. MR CONSUMER COMPLAINED ABOUT HAVING PROBLEMS WITH THE AIR BAG DEPLOYMENT. ALSO,
10004706	CHEVROLET	SILVERADO	2002	2002-12-16	WHILE DRIVING VEHICLE WAS INVOLVED IN A COLLISION, AND AIR BAGS DID NOT DEPLOY  .PASSENGER WAS DRIVING AT 50 MPH WHEN PASSING OVER A BRIDGE ON A RAINY DAY, AND  WATER FROM THE RIVER WAS SPLASHED ON THE FRONT WINDSHIELD WHICH CAUSED THE DRIVER TO LOOSE CONTROL OF THE VEHICLE. MANUFACTURE WAS NOT CONTACTED AT THE TIME OF THIS PHONE CALL. *AK
	C. IZ VIIOLET				WHILE DRIVING VEHICLE WAS IN A FRONTAL COLLISION, BUT NONE OF THE AIR BAGS DEPLOYED
10005976	CHEVROLET	SILVERADO	2002	2003-01-29	UPON IMPACT. THE DRIVER WAS NOT INJURED BECAUSE THEY WERE WEARING THERE SEAT BELTS.*AK
10003970	CHEVROLET	SILVERADO	2002	2003-01-29	THE VEHICLE HIT A TREE, AND NONE OF THE AIR BAGS DEPLOYED.*JB *TS
					THE VEHICLE WAS INVOLVED IN A FRONT END COLLISION YET NEITHER FRONTAL AIR BAGS
10015548	CHEVROLET	SILVERADO	2002		DEPLOYED. *NLM  THE VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AND NONE OF THE AIR BAGS DEPLOYED.
10019853	CHEVROLET	SILVERADO	2002		*JB
10042035	CHEVROLET	SILVERADO	2002		WHILE DRIVING AT 43 MPH VEHICLE WAS INVOLVED IN A LEFT FRONT COLLISION. UPON IMPACT, FRONT AIR BAGS DID NOT DEPLOY, AND PASSENGER SUSTAINED INJURIES. *AK

					I WAS AT A COMPLETE STOP AT A RED LIGHT WHEN A YOUNG LADY RAN THE LIGHT FROM THE OPPOSITE DIRECTION. SHE HIT ANOTHER TRUCK THEN CROSSED OVER INTO MY LANE HITTING ME
					ON MY RIGHT FRONT BUMPER. LESS THAN 3 SECONDS LATER THE OTHER TRUCK HIT ME HEAD ON AT 35-40 MPH HEAD ON. THE IMPACT WAS HARD ENOUGH TO THROW ME BACKWARDS INTO
10073268	CHEVROLET	SILVERADO	2002	2002-08-11	SOME MOTORCYCLES BEHIND ME. MY FRONTAL AIRBAGS DID NOT DEPLOY DURING EITHER HIT. *MR
10073208	CHEVROLET	SILVERADO	2002	2002-08-11	WHILE DRIVING 45 MPH THE DRIVER ATTEMPTED TO AVOID A DEER IN THE STREET. AS A RESULT
					THE DRIVER LOST CONTROL OF THE VEHICLE AND HIT A TREE HEAD ON. THE CONSUMER STATED
10080276	CHEVROLET	SILVERADO	2002	2004-06-27	THAT,"NEITHER FRONTAL AIR BAG DID DEPLOYED ON IMPACT". THE CONSUMER WILL CONTACT THE DEALER. *NM
10080270	CHEVROLLI	SILVERADO	2002	2004-00-27	THE DEALER. NWI
					A PIECE OF FURNITURE WAS LOCATED IN THE MIDDLE OF THE HIGHWAY WHILE DRIVING, CAUSING
					THE DRIVER TO HIT THE FURNITURE. DRIVER LOST CONTROL OF A VEHICLE, AND IT CRASHED INTO A CONCRETE WALL. DRIVER'S SIDE SEAT BELT FAILED, AND THE AIRBAGS DID NOT DEPLOY. DRIVER
					REFUSED MEDICAL ATTENTION AT THAT TIME AND WENT TO THE HOSPITAL ON HIS OWN. VEHICLE
10115806	CHEVROLET	SILVERADO	2002	2005-03-24	WAS TOWED BY THE INSURANCE COMPANY. *AK
10127515	CHEVROLET	SILVERADO	2002	2005-07-05	DT: CONTACT STATES WHILE DRIVING APPROXIMATELY 45 MPH THERE WAS A FRONT END COLLISION. UPON IMPACT, NEITHER AIR BAG DEPLOYED. *AK
1012/313	CHEVIOLET	SILVERADO	2002	2003 07 03	COLLINION OF ON INTERCENT OF DELECTED. AN
					TL*THE CONTACT OWNS A 2002 CHEVROLET SILVERADO. WHILE DRIVING 30 MPH, THE CONTACT
					STRUCK A DEER AND SWERVED INTO A DITCH. HIS CHEST SLAMMED INTO THE STEERING WHEEL  AND WAS INJURED. THE AIR BAGS FAILED TO DEPLOY AND THE SEAT BELT DID NOT RETRACT. THE
					DRIVER'S SIDE BUMPER WAS CRUSHED INTO THE FRONT GRILL ALL THE WAY ACROSS TO THE
					PASSENGER SIDE OF THE VEHICLE. THE CONTACT CALLED THE INSURANCE AGENT, BUT NO POLICE
					REPORT WAS FILED. HE WAS THE ONLY OCCUPANT IN THE VEHICLE AND THE SEAT BELT WAS WORN PROPERLY AT THE TIME OF THE CRASH. THERE WAS NO MAINTENANCE PERFORMED ON
					THE AIR BAGS OR SEAT BELT PRIOR TO THE FAILURES. THE CONTACT FILED A COMPLAINT WITH GM
					CONCERNING HIS AIR BAGS AND SEAT BELT (COMPLAINT NUMBER 71-670143505). GM IS NOT
10246829	CHEVROLET	SILVERADO	2002	2008-10-13	TAKING RESPONSIBILITY FOR THE AIR BAG FAILURE. IN ADDITION, NO ONE CAME OUT TO INSPECT THE VEHICLE. THE FAILURE MILEAGE WAS 61,752.
					TL*THE CONTACT OWNS A 2002 CHEVROLET SILVERADO. WHILE DRIVING APPROXIMATELY 45 MPH
					ON NORMAL ROAD CONDITIONS, A VEHICLE CRASHED INTO THE FRONT OF THE DRIVER SIDE. THE CONTACT WAS TRANSPORTED TO THE HOSPITAL AFTER SUSTAINING INJURIES TO THE HEAD, NECK
					AND LIP. THE AMBULANCE AND POLICE ARRIVED AND A POLICE REPORT WAS FILED. THE AIR BAGS
					FAILED TO DEPLOY WITH THE MASSIVE LEVEL OF IMPACT. THERE WERE NO WARNING LIGHT
					INDICATORS ILLUMINATED ON THE INSTRUMENT PANEL AFTER THE CRASH. THE FRONT END OF THE VEHICLE SUSTAINED SEVERE DAMAGE. THE VEHICLE WAS TOWED TO A COLLISION CENTER
					AND THE VEHICLE WAS REPAIRED. THE CONTACT HAD CONCERNS OF THE SAFETY RISK INVOLVED.
10281236	CHEVROLET	SILVERADO	2002	2007-11-29	THE FAILURE MILEAGE WAS 40,000 AND THE CURRENT MILEAGE WAS 55,000.  I T-BONED A MINI VAN THAT FAILED TO TO YIELD ON A TURN AT 35 MPH, MY AIRBAGS DID NOT
10679097	CHEVROLET	SILVERADO	2002	2015-01-16	DEPLOY. *TR
					MANUE DONAING AT AS AND LAST WAS CODED OF OF THE BOAD INTO ONCOMING TRAFFIC
					WHILE DRIVING AT 45 MPH VEHICLE WAS FORCED OFF OF THE ROAD INTO ONCOMING TRAFFIC.  CONSUMER SWERVED TO AVOID A HEAD ON COLLISION WITH ANOTHER VEHICLE. THIS ACTION
					CAUSED THE VEHICLE TO CRASH THROUGH A FENCE, RUN INTO A DITCH, AND COLLIDE HEAD ON
					WITH AN OAK TREE. SEAT BELTS WERE WORN, BUT AT THE TIME OF THE IMPACT, THE LATCH
					CAME APART. VEHICLE WAS EQUIPPED WITH FRONT AND SIDE AIR AIR BAGS. UPON IMPACT, THEY DID NOT DEPLOY. CONSUMER'S KNEE WAS BROKEN, AND HE SUFFERED A CONCUSSION.
					POLICE AND MEDICAL HELP DID ARRIVE ON THE SCENE. MANUFACTURER AND THE DEALER HAVE
10039711	CHEVROLET	SUBURBAN	2002	2003-08-27	BEEN NOTIFIED OF THE INCIDENT. *AK  I WAS HIT ON THE HEAD INSIDE MY 2002 SUBURBAN, WEARING MY SEAT BELT AT 48 MPH BY AN
					ONCOMING MAZDA MIATA. MY STEERING COLUMN COLLAPSED, I WENT INTO ONCOMING 3
					LANES OF TRAFFIC, WENT UP A CURB, WENT THROUGH A BRICK RETAINING WALL, AND HIT A
10041031	CHEVROLET	SUBURBAN	2002	2003-01-07	TELEPHONE POLE. MY AIRBAG DID NOT DEPLOY ON ANY OF THE 3 IMPACTS. WHY? ALSO, MY DRIVER?S SEAT CAME OFF THE TRACK. *LA
_00 /1001	J. L. VILOLET	SOSONDAN		2003 01 07	THE CONSUMER WAS INVOLVED IN AN ACCIDENT. THE CONSUMER WAS DRIVING ABOUT 60 MPH
					AND REAR ENDED ANOTHER VEHICLE AND THE AIR BAGS FAILED TO DEPLOY. ALSO THE SEAT BELTS
10108747	CHEVROLET	SUBURBAN	2002	2004-11-11	DID NOT HOLD THE DRIVER AND PASSENGER CAUSING THEM TO GO FORWARD INTO THE WINDSHIELD. PROVIDE FURTHER DETAILS. *JB
10121922	CHEVROLET	SUBURBAN	2002	2005-05-14	DT: HUSBAND HAD AN ACCIDENT, CAR PULLED OUT IN FRONT OF HIM AND HIT THEM ON DRIVER AND BACK SEAT PASSENGER SIDE HEAD. UPON IMPACT, AIR BAG DID NOT DEPLOY.*AK
10121322	CHEVIOLET	JOBORDAN	2002	2003-03-14	ON TWO OCCASIONS THE FRONT AIR BAGS FAILED TO DEPLOY UPON FRONT IMPACT. THE VEHCILE
					WAS INSPECTED BY A CRASH INVESTIGATOR WHO TOLD THE CONSUMER THAT THE VEHICLE
568470	CHEVROLET	TAHOE	2002	2002-06-05	OPERATED AS DESIGNED. *NLM
					THE TRUCK HIT A WALL HEAD ON BETWEEN 33-35 MPH. THE AIR BAGS FAILED TO DEPLOY UPON
					IMPACT ALLOWING THE DRIVER TO HIT THE WINDSHIELD WITH HIS HEAD SHATTERING IT.
8022842	CHEVROLET	TAHOF	2002	2002-10-10	GENERAL MOTORS SENT SOMEONE TO DIAGNOSE THE TRUCKS' CONDITION WHICH THE CONSUMER WAS TOLD "EXCEPTIBLE STANDARDS". PLEASE DESCRIBE DETAILS TS
0022042	CHEVROLET	TATIOE	2002	2002-10-10	CONSONIER WAS TOLD EXCEPTIBLE STAINDARDS. PLEASE DESCRIBE DETAILS 15

10050631	CHEVROLET	ТАНОЕ	2002	2003-12-04	HAD A FRONT END COLLISION INTO THE SIDE OF ANOTHER VEHICLE WHOM RAN A RED LIGHT. WE ESTIMATED OUR IMPACT SPEED AT 30 MPH UPON COLLIDING TOGETHER. NEITHER FRONT AIRBAGS DEPLOYED. SUFFERED NECK AND BACK BRUISING AND MUSCLE STRAIN.*AK
					ON JANURAY 23. 2004, I WAS REAR-ENDED ON THE FREEWAY. I WAS GOING ABOUT 65-70 MPH. A PERSON HIT ME FROM THE REAR, HE WAS TRAVELLING AROUND 100-110 MPH. I LOST CONTROL OF MY TAHOE, I WENT SIDEWAYS, THEN I SHOT FORWARD AND HIT THE CENTER DIVIDER( ON THE CENTER RIGHT SIDE OF MY CAR) AT ABOUT 65 MPH OR FASTER, I WAS SHOT BACKWARDS INTO A GUARD RAIL AND CAME OFF OF THAT AND THEN THE TAHOE ROLLED ON TO ITS SIDE, SKID FOR ABOUT 30 FEET AND THEN IT FINALLY STOPPED. MY AIR BAGS(FRONT NOR SIDE) NEVER DEPOLYED. I FEEL THAT IF THEY HAD MY WIFE NOR I WOULD HAVE BEEN INJURED. I KNOW THAT THEY ARE
10057036	CHEVROLET	TAHOE	2002	2004-01-23	DESIGNED TO DEPLOY WHEN YOU HIT SOMETIME LIKE A BRICK WALL AT ABOUT 10-15 MPH. WHAT DO YOU CALL HITTING A CEMENT DIVIDER AT OVER 65 MPH.*AK
					I WAS TRAVELING DOWN TO FREEWAY, DOING ABOUT 65-70 MPH. I WAS REAR ENDED BY A GUY GOING BETWEEN 100-110 MPH, I WAS THROWN OUT OF CONTROL. I HIT THE CENTER DIVIDER ALMOST HEAD ON AT ABOUT 70 MPH. I THEN BOUNCED OFF THE DIVIDER, CAME CLEAR AGCROSS ALL LANES AND HIT THE REAR GUARD RAIL, I BOUNDED OFF THAT AND ROLLED ON ITS SIDE. IN ALL
10080735	CHEVROLET	TAHOE	2002	2004-01-23	MY AIR BAGS NEVER DEPLOYED.*AK  I WAS DRIVING MY 2002 TAHOE ABOUT 30-35 MPH WHEN I BLACKED OUT AND LOST CONTROL OF THE VEHICLE. I HIT A COLUMN OUTSIDE A HOTEL WHICH WAS ABOUT 2X2 FEET WITH STEEL WITHIN THE CENTER OF THE COLUMN. MY TRUCK WAS A TOTAL LOST AND THE FRONT AIRBAGS DID NOT
10143613	CHEVROLET	TAHOE	2002	2005-11-15	DEPLOY AS THEY WERE SUPPOSED TO. *JB
10152394	CHEVROLET	TAHOE	2002	2006-03-09	DT*: THE CONTACT STATED WHILE DRIVING 55 MPH, THE FRONT DRIVER SIDE TIRE HAD A BLOW OUT, CAUSING THE VEHICLE TO HIT BOTH GUARD RAILS WITH THE FRONT END. THE AIRBAGS DID NOT DEPLOY. ALTHOUGH THE SEATBELT WAS WORN, THE CONTACT SUSTAINED A CONCUSSION. THERE WAS A POLICE REPORT TAKEN AT THE SCENE. THE VEHICLE WAS TOWED TO AN AUTO BODY SHOP, WHERE IT WAS DEEMED A TOTAL LOSS BY THE INSURANCE COMPANY.
10155306	CHEVROLET	ТАНОЕ	2002	2006-03-24	ON MY WIFE'S WAY HOME FORM WORK SHE WAS INVOLVED IN AN ACCIDENT, WERE SHE REAR ENDED ANOTHER VEHICLE, THE CRASH WAS AT ABOUT 35 TO 45 MILES PER HOUR AND IT AFFECTED THE FRONT DRIVER SIDE OF OUR 2002 CHEVY TAHOE. THE IMPACT WAS SO SIGNIFICANT THAT THE FRAME OF THE TAHOE WAS BENT. THE CRASH PRETTY MUCH MIMICKED THE SAME OFF CENTER FRONT CRASH THAT THE INSURANCE INSTITUTE FOR HIGHWAY SAFETY CONDUCTS ON THEIR TESTING. THE PROBLEM WAS THAT THE FRONT AIRBAGS NEVER DEPLOYED ALTHOUGH THE ACCIDENT HAPPENED UNEXPECTEDLY, MY WIFE WAS WEARING HER SEAT BELT AND DIDN'T SUSTAINED SERIOUS INJURIES. OUR CONCERN IS THAT THE BAGS NEVER DEPLOYED AND THAT THEY MIGHT DEPLOY AT ANYTIME. THE AUTO BODY SHOP RECOMMENDED BY OUR INSURANCE COMPANY TOLD US THAT BECAUSE THE CRASH IMPACT WAS OFF CENTERED THE AIRBAG SENSOR WERE NEVER TRIGGERED. AFTER SEEING SO OF THE INSURANCE INSTITUTE FOR HIGHWAY SAFETY TEST THE BAGS SHOULD HAVE DEPLOYED. ALSO IT WAS DETERMINED THAT THE FRAME HAS TO BE REPLACED AND ALL THE BODY PARTS FIXED AND REPLACED. IF THE FRAME HAS TO BE REPLACED HOW SAFE WOULD THAT VEHICLE BE? I AM OPEN FOR ANY FARTHER CONVERSATIONS ABOUT THIS TOPIC. THANK YOU. *JB
					I WAS DRIVING MY 2002 CHEVY TAHOE, A GENTLEMAN RAN A STOP SIGN, I HIT HIM AT 39 MPH, HEAD ON IN MY TAHOE, T-BONED HIS TRUCK. NEITHER AIRBAG DEPLOYED, NOR DID MY SEATBELT KEEP ME FROM HITTING THE STEERING WHEEL AND MY HEAD KNOCKING ME OUT. GM SENT SOMEONE TO LOOK AT MY CAR WHICH HAS BEEN DEEMED A TOTAL LOSS. I HAVE YET TO HEAR BACK FROM GM ON THIS INCIDENT. I PURCHASED THIS CAR BRAND NEW THINKING IT WAS SAFE. THE ONE TIME I NEEDED MY SEATBELT TO WORK, IT FAILED. THE COMPUTER IN MY CAR SHOWED BOTH SEATBELTS WERE ON AND IN WORKING ORDER, IT SHOWED THE CRASH WAS AT 39 MPH YET THE AIRBAGS DID NOT DEPLOY AND THEY WERE IN PROPER WORKING ORDER. WHATEVER ANSWER GM GIVES ME WILL NOT BE GOOD ENOUGH UNLESS THEY ADMIT TO FAULTINESS IN THEIR
10353935	CHEVROLET	TAHOE	2002	2010-07-28	REAR ENDED A VEHICLE GOING APPROX. 70 MPH AND HAD EXTENSIVE FRONT END DAMAGE
10458444	CHEVROLET	TAHOE	2002	2012-04-08	HOWEVER THE AIR BAGS FAILED TO DEPLOY. DRIVER HIT HEAD ON STEERING WHEEL AND PASSENGER SUFFERED SEVER HEAD INJURY. *JS
10498415	CHEVROLET	TAHOE	2002	2013-02-14	TRAFFIC STOPPED IN FRONT OF ME UNEXPECTEDLY, I SWERVED TO AVOID CAR IN FRONT OF ME AND HIT CONCRETE WALL. AIR BAGS DID NOT WORK. MY FACE HIT STEERING WHEEL, CAUSING INJURY TO NOSE AND MOUTH. *TR
10615602	CHEVROLET		2002	2014-07-08	TL* THE CONTACT OWNS A 2002 CHEVROLET TAHOE. WHILE DRIVING 45 MPH, THE CONTACT'S VEHICLE WAS REAR ENDED BY ANOTHER VEHICLE. AND CRASHED INTO A GUARD RAIL. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED AND THE VEHICLE WAS DESTROYED. THE CONTACT'S HEAD STRUCK THE STEERING WHEEL AND HE WAS TRANSPORTED TO THE HOSPITAL BY AMBULANCE. THE CONTACT SUSTAINED SPINAL CORD AND NECK INJURIES. THE DOCTOR X-RAYED THE CONTACT AND DIAGNOSED HIM WITH BURNING PARESTHEGIC, HYPER-ESTHESIA, AND CENTRAL CORD SYNDROME. THE CONTACT WAS RELEASED FROM THE HOSPITAL TWO DAYS AFTER THE CRASH. THE FAILURE MILEAGE WAS 285,000.

			1	T	
10641399	CHEVROLET	ТАНОЕ	2002	2011-06-07	TL - THE CONTACT OWNS A 2002 CHEVROLET TAHOE. THE CONTACT STATED THAT WHILE THE DRIVER WAS DRIVING AT 45 MPH AND ATTEMPTED TO AVOID A CRASH WITH ANOTHER VEHICLE. AS A RESULT, THE DRIVER CRASHED INTO A GUARDRAIL AND THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT WAS TAKEN TO A HOSPITAL AND SUSTAINED INJURIES TO THE RIBS, THE COLLAR BONES, A BRAIN TRAUMA AND A COLLAPSED LUNG. THE DRIVER SUFFERED FROM FATAL INJURIES. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 73,000. DR
10041399	CHEVROLET	TARUE	2002	2011-06-07	TL* THE CONTACT OWNS A 2002 CHEVROLET TAHOE. THE CONTACT STATED THAT THE DRIVER
10667110	CHEVROLET	TAHOE	2002	2011-06-07	CRASHED INTO A GUARD RAIL AND THE AIR BAGS FAILED TO DEPLOY. THE DRIVER SUSTAINED MASSIVE HEAD TRAUMA, BROKEN RIBS AND BLEEDING FROM THE BRAIN, RESULTING IN A FATALITY. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE CONTACT WAS UNAWARE IF THE VEHICLE WAS DIAGNOSED OF THE FAILURE. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 72,000.
10668043	CHEVROLET	ТАНОЕ	2002	2014-11-07	TL* THE CONTACT OWNS 2002 CHEVROLET TAHOE. THE CONTACT STATED THAT WHILE DRIVING 45 MPH, ANOTHER VEHICLE CRASHED INTO THE CONTACT'S VEHICLE CAUSING THE VEHICLE TO SPIN AND BECOME UNCONTROLLABLE. IN ADDITION, ANOTHER VEHICLE CRASHED INTO THE VEHICLE CAUSING IT TO ROLL OVER SEVERAL TIMES BEFORE CRASHING INTO A GUARD RAIL. THE AIR BAGS FAILED TO DEPLOY. THE DRIVER SUSTAINED CRITICAL INJURIES AND THE FRONT PASSENGER SUSTAINED FATAL INJURIES. BOTH THE CONTACT AND FRONT PASSENGER REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 130,000.
10746000	CHEVROLET	TAHOE	2002	2011 06 07	TL* THE CONTACT OWNED A 2002 CHEVROLET TAHOE. WHILE DRIVING AT APPROXIMATELY 45 MPH, THE CONTACT CRASHED INTO A GUARD RAIL. THE AIR BAGS DID NOT DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT SUSTAINED A FRACTURED COLLAR BONE, SEVERAL BROKEN RIBS, HEAD TRAUMA, BRAIN BLEEDING, AND STROKES. THE CONTACT WAS PLACED INTO A MEDICALLY INDUCED COMA AND ON A RESPIRATORY MACHINE, BUT LATER DIED. THE VEHICLE WAS TOWED TO A SAVAGE YARD. THE VEHICLE WAS DESTROYED. THE MAIL FACE WAS TOWED TO A SAVAGE THE ADDROXIMATE EARL USE THE FAIL USE AND FACE WAS 73 000
10746088	CHEVROLET	TAHOE	2002	2011-06-07	NOTIFIED OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 73,000.
11382901	CHEVROLET	ТАНОЕ	2002	2020-11-17	TL- THE CONTACT OWNS A 2002 CHEVROLET TAHOE. THE CONTACT STATED THAT WHILE DRIVING APPROXIMATELY 25 MPH WHEN THE VEHICLE RAN ACROSS BLACK ICE CAUSING THE CONTACT TO LOSE CONTROL OF THE VEHICLE. THE VEHICLE BEGAN TO SPEND UNCONTROLLABLY EVENTUALLY CRASHING INTO A CONCRETE WALL WITH THE FRONT-END OF THE VEHICLE. NO AIR BAGS DEPLOYED. THE CONTACT RECEIVED INJURIES TO THEIR KNEE, SHOULDER, NECK, BACK, AND EYE. MEDICAL ATTENTION WAS NEEDED. A POLICE REPORT WAS FILED. THE VEHICLE TOWED AND DEEMED TOTALED. THE DEALER WAS NOT CONTACTED. THE MANUFACTURER WAS NOT MADE AWARE OF THE ISSUE. THE APPROXIMATE FAILURE MILEAGE WAS 150,000. GL
					WHILE DRIVING AT 45 MPH CONSUMER T-BONED ANOTHER VEHICLE HEAD ON AND NONE OF THE AIR BAGS DEPLOYED. CONTACTED DEALER, AND THE DEALER WAS AWARE OF THE PROBLEM, BUT
8017394	CHEVROLET	TRACKER	2002	2002-08-09	THEY HAD NO SOLUTION. *AK
10087309	CHEVROLET	TRACKER	2002	2004-07-20	WHILE DRIVING AT 40 MPH CONSUMER'S VEHICLE COLLIDED WITH THE LEFT SIDE OF ANOTHER VEHICLE RUNNING A STOP SIGN. CONSUMER WAS WEARING SEAT BELTS, BUT AIR BAGS DID NOT DEPLOY. CONSUMER AND A PASSENGER SUSTAINED VARIOUS BONE FRACTURES AND BRUISES. THE POLICE AND AN AMBULANCE DID ARRIVED ON THE SCENE.*AK
10007003	0.12 11.0221	TTO TOTAL	2002	2001.07.20	THE TOLICE AND ANALYSIS AND ANALYSIS OF THE SOCIAL TIME
10264048	CHEVROLET	TRACKER	2002	2009-03-29	TL*THE CONTACT OWNS A 2002 CHEVROLET TRACKER. WHILE DRIVING AT AN UNKNOWN SPEED, THE VEHICLE LEFT THE ROAD, AND STRUCK A TREE WITH THE FRONT PASSENGER SIDE AND FENDER. THE FRAME WAS BENT IN TWO PLACES, BUT THE AIR BAGS FAILED TO DEPLOY. THERE WERE NO INJURIES. THE SEAT BELT WAS NEVER SERVICED AND WAS WORKING FINE PRIOR TO THE CRASH. A POLICE REPORT WAS FILED. THE FAILURE MILEAGE WAS 95,000.
					AFTER A COLLISION WHERE MY TRACKER HIT ANOTHER VEHICLE AT AROUND 55 MPH ON A
10970730	CHEVROLET	TRACKER	2002	2017-04-05	HIGHWAY, MY VEHICLE HIT DEAD ON TO THE SIDE OF ANOTHER (T-BONE) AND MY SENSOR SHOULD HAVE TRIGGERED MY AIRBAGS AND DID NOT.
103/0/30	CHEVROLET	INACKER	2002	2017-04-03	WHILE BEING DRIVEN APPROXIMATELY 20 TO 25 MPH VEHICLE WENT OFF THE ROAD AND
					CRASHED INTO A LARGE OAK TREE. BOTH FRONTAL AIR BAGS FAILED TO DEPLOY DURING THE CRASH. BODY SHOP STATED THAT AIR BAGS SHOULD HAVE DEPLOYED DUE TO DAMAGE VEHICLE RECEIVED. DEALERSHIP HAS NOT EXAMINED VEHICLE TO DETERMINE IF THERE WAS A PROBLEM WITH THE AIR BAG SYSTEM. PLEASE PROVIDE ANY ADDITIONAL INFORMATION /
8002085	CHEVROLET	TRAILBLAZER	2002	2002-01-03	DOCUMENTATION.**AK
8010014	CHEVROLET	TRAILBLAZER	2002	2002-04-08	CONSUMER STATES THAT DURING A VEHICLE CRASH THE SIDE AIRBAG DID NOT DEPLOY.*JB WHILE TRAVELING ABOUT 40MPH THE VEHICLE WAS INVOLVED WITH A FRONTAL COLLISION. NEITHER AIRBAG DEPLOY PLEASE PROVIDE ADDITIONAL INFORMATION. DEALER IS AWARE OF THE
8022437 10011300	CHEVROLET	TRAILBLAZER TRAILBLAZER	2002	2002-11-01 2003-03-04	PROBLEM. TS  THE VEHICLE WAS INVOLVED IN A COLLISION, AND THE AIR BAGS DID NOT DEPLOY.*JB
					HYDROPLANED HEAD ON INTO A TREE DOING ABOUT 40 MPH. HIT THE TREE HARD ENOUGH TO BREAK THE ENGINE MOUNTS AND SHIFT THE ENGINE FORWARD INTO THE FAN, PLUS SOME TRANSMISSION DAMAGE. THE AIR BAGS DID NOT DEPLOY. *NLM
10013828	CHEVRULEI	TRAILBLAZER	2002	2003-03-19	THANSINISSION DAINAGE. THE AIR BAGS DID NOT DEFECT. NEIN

			l	1	ON FEB 5TH, 2003 I REAR ENDED A STOPPED VEHICLE WHILE GOING 45 MILES AN HOUR. MY CHIN
					HIT THE STEERING WHEEL BUT NO AIRBAG DEPLOYED. THE BODY SHOP WAS UNABLE TO
10014453	CHEVROLET	TRAILBLAZER	2002	2003-02-05	DETERMINE WHY THE AIR BAG DID NOT DEPLOY. *NLM
					CONSUMER WAS HIT TWICE IN A SIDE AND FRONTAL COLLISION WHILE TRAVELING
10015367	CHEVROLET	TRAILBLAZER	2002	2003-04-02	APPROXIMATELY 30MPH. NEITHER THE FRONTAL OR SIDE AIR BAGS DEPLOYED. *NLM
10027280	CHEVROLET	TRAILBLAZER	2002	2003-07-12	THE VEHICLE WAS INVOLVED IN A COLLISION, AND THE AIR BAGS FAILED TO DEPLOY. *AK THE CONSUMER SUFFERED INJURIES. *JB
10027280	CHEVROLET	TRAILBLAZER	2002	2003-07-12	CONSONIER SOFFERED INJORIES. JB
					WHILE CONSUMER WAS DRIVING 25-28 MPH VEHICLE WAS T-BONED FROM ANOTHER VEHICLE AT
10044550	CHEVROLET	TRAILBLAZER	2002		ESTIMATED SPEED OF 30 MPH. UPON IMPACT, FRONTAL AIR BAGS FAILED TO DEPLOY. *AK
					VEHICLE WAS INVOLVED IN A FRONTAL COLLISION WHILE DRIVING BETWEEN 50-55MPH. UPON
40443400	CUE) (DOLET	TD 4 11 D1 4 7 FD	2002	2004 42 42	IMPACT, THE AIR BAGS FAILED TO DEPLOY. AS A RESULT, DRIVER SUSTAINED CHEST INJURIES
10113109	CHEVROLET	TRAILBLAZER	2002	2004-12-12	WHEN IT IMPACTED THE STEERING WHEEL.*AK
10114818	CHEVROLET	TRAILBLAZER	2002	2005-03-24	CRASH AT 35 MPH (FRONT END SQUARE) DRIVER AND PASSENGER AIR BAGS FAILED TO DEPLOY.
					DURING A 30 MPH VEHICLE FRONTAL COLLISION FRONT AIR BAGS DID NOT DEPLOY. CONSUMER
					SUSTAINED MINOR INJURIES. THE VEHICLE WAS TOWED. DEALERSHIP WAS NOTIFIED, BUT DID NOT
10115000	0.15,450,57		2000	2005 00 00	RESOLVE THE PROBLEM. *AKPROBLEM WA SDISCUSSED WITH THE DEALER IN DETAIL BUT DID
10115232	CHEVROLET	TRAILBLAZER	2002	2005-02-09	NOT KNOW HOW TO RESOLVE PROBLEM. *AK
					WHILE DRIVING 55-60 MPH, VEHICLE HIT AN SUV THAT DROVE INTO LANE. VEHICLE THEN HIT BY
					TRACTOR TRAILER. VEHICLE CRASHED WITH GREAT FORCE INTO HIGHWAY DIVIDER AND LOST
					FRONT LEFT WHEEL, CAUSING VEHICLE TO CONTINUE TO CRASH ALONG DIVIDER. BOTH FRONT
					AIRBAGS AND BOTH SIDE AIRBAGS FAILED TO DEPLOY. PASSENGER IN VEHICLE SUSTAINED
					FRACTURES TO ORBITAL BONES AND MAXILLARY BONE IN SKULL. MAJOR RECONSTRUCTIVE
10118790	CHEVROLET	TRAILBLAZER	2002	2005-04-22	SURGERY WAS REQUIRED. THE VEHICLE WAS DETERMINED TO BE A TOTAL LOSS.
					DT: AIR BAG DID NOT DEPLOY IN A OFF CENTER FRONTAL COLLISION. WHILE TRAVELING ABOUT
					35-40 MPH CONSUMER'S VEHICLE HIT THE REAR OF ANOTHER VEHICLE. IT WAS AT A GARAGE
					NEAR THE ACCIDENT SITE. NO ONE LOOKED AT THE VEHICLE BUT THE RESCUE SERVICES WERE
					SURPRISED THAT THE AIRBAGS DID NOT DEPLOY. INTERMITTENTLY THE SRS LIGHT WOULD COME
10122088	CHEVROLET	TRAILBLAZER	2002	2005-05-24	ON. TOOK VEHICLE TO DEALER AND IT WAS REPAIRED IN JULY 2004. *AK *JB
					DT: CONSUMER'S VEHICLE WAS INVOLVED IN AN ACCIDENT ON SEPTEMBER 15, 2005. UPON
					IMPACT, NONE OF THE AIR BAGS DEPLOYED. BACK IN SEPTEMBER OF 2002 CONSUMER'S WAS
					INVOLVED IN A HEAD ON COLLISION WITH THIS SAME VEHICLE, AND THE AIR BAGS NEVER
10136929	CHEVROLET	TRAILBLAZER	2002	2005-09-15	DEPLOYED AT THAT TIME EITHER. HAD THE VEHICLE REPAIRED AT THE GMC DEALERSHIP. *AK
					DT: THE CONTACT STATED VEHICLE WENT OFF THE ROAD AND HIT TREES AT 50-55 MPH. UPON
					IMPACT, THE AIRBAGS DID NOT DEPLOY. THE VEHICLE WAS TOTALED. THE FRONT END COLLAPSED, THE ENGINE WAS IN THE FIREWALL, AND THE BODY WAS PUSHED OFF OF THE FRAME.
					THE CONTACT SUSTAINED MINOR BRUISES AND ABRASIONS. A POLICE REPORT WAS TAKEN AT
10144322	CHEVROLET	TRAILBLAZER	2002	2005-11-08	THE SCENE. THE DEALERSHIP STATED THEY HAVE NEVER HEARD OF THIS HAPPENING. *AK
					DT*: THE CONTACT STATED WHILE TRAVELING 35 MPH WITH PRIOR BRAKING, THE VEHICLE
					VEERED OFF THE ROAD AND SLID INTO A DITCH. THERE WAS FRONT END DAMAGE; THE FRAME
					RAIL AND HOOD BENT. THE AIRBAGS DID NOT DEPLOY WHEN THIS OCCURRED. THE CONTACT WAS
					NOT IN THE VEHICLE AND THE DRIVER WAS UNAWARE OF WHAT CAUSED THE VEHICLE TO VEER
					OFF THE ROAD. THE DRIVER SUSTAINED HEAD TRAUMA AND THE SEAT BELT WAS NOT WORN.  THERE WAS A POLICE REPORT TAKEN AT THE SCENE. THE VEHICLE WAS TOWED TO AN
					INDEPENDENT REPAIR SHOP, BUT HAS NOT BEEN INSPECTED BY A MECHANIC. UPDATED
10157599	CHEVROLET	TRAILBLAZER	2002	2006-05-15	06/16/06. *JB
					DT*: THE CONTACT STATED WHILE DRIVING 40 MPH ON A GRAVEL ROAD, CONTROL OF THE
					VEHICLE WAS LOST AND IT CRASHED INTO A TREE HEAD ON. THE AIR BAGS DID NOT DEPLOY.
					THERE WAS NO PRIOR BRAKING AND SEAT BELTS WERE WORN. THE DRIVER SUSTAINED MINOR
10172513	CHEVROLET	TRAILBLAZER	2002	2006-07-01	INJURIES. THE VEHICLE WAS LATER TOWED TO AN INDEPENDENT REPAIR SHOP. THE DEALER WAS ALERTED.
101/2010	CHEVIOLET	MAILDLAZEN	2002	2000 07-01	MEMILE.
					TL*THE CONTACT OWNS A 2002 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 15
					MPH, THE CONTACT STRUCK A PATCH OF ICE AND THE VEHICLE CRASHED INTO A LIGHT POLE. THE
					VEHICLE WAS COMPLETELY DESTROYED AND NONE OF THE AIR BAGS DEPLOYED. A POLICE REPORT
10254230	CHEVROLET	TRAILBLAZER	2002	2009-01-08	WAS FILED AND THERE WERE NO INJURIES. THE FAILURE AND CURRENT MILEAGES WERE 56,000.

		1		1	,
10257808	CHEVROLET	TRAILBLAZER	2002	2009-01-21	WELL SERVICED 90K MILES. TRAVELING AT 35MPH PUSHED BREAKS ALL THE WAY DOWN (FRACTURING RIGHT ANKLE) SLOWED ME DOWN BUT FAILED TO STOP AT UPCOMING RED LIGHT. STRUCK MEDIUM SIZE VEHICLE INJURING OTHER DRIVER AND CAUSING CONSIDERABLE DAMAGE TO BOTH VEHICLES. CHEVY DEALER COLLISION/SERVICE CENTER ESTIMATED \$8K IN REPAIRS. IN OTHER WORDS IT COSTS MORE TO REPAIR IT THAN WHAT THE VEHICLE IS WORTH. ALSO: "MASTER CYLINDER IS BAD" AND AIR BAGS DID NOT DEPLOY. CHEVY TECH. SAID "IMPACT WAS NOT BIG ENOUGH". AFTER READING SOME EIGHT OTHER COMPLAINTS VERY SIMILAR TO THIS. I AM CONCERNED ABOUT DRIVING THIS OR GETTING INTO ANOTHER ONE. IS THERE NOT A BREAK LIGHT SERVICE SENSOR THAT I SHOULD HAVE NOTED.? SERVICE MANUAL FOR SCHEDULED MAINTENANCE SAYS TO CHECK FRONT AND REAR AXLE FLUID AND ADD FLUID AS NEEDED EVERY 5K TO 7K MILES AFTER 67.5K MILES. *TR
					I WAS IN A CAR ACCIDENT, WHERE I WAS TRAVELING AT ABOUT 35 MPH. AN AGGRESSIVE DRIVER
					SPEED AROUND ME AND CUT ME OFF AND THAN STOMPED ON THIS BRAKES IN FRONT OF ME. DUE TO THAT I SWERVED TO MISS HIM CLIPPING HIS RIGHT BACK LIGHT AD BUMPER WITH MY LEFT HEADLIGHT AND BUMPER. AS I WAS SWERVING I HIT A TREE JUST ABOUT DEAD ON WITH MY AR. THE MAJORITY OF THE IMPACT OCCURRED JUST ABOUT 6 INCHES TO THE LEFT (IF LOOKING AT THE CAR) OF THE CENTER OF THE FRONT OF THE CAR. I HIT THE TREE AT A SPEED OF ABOUT 28-30 MPH. AFTER INITIAL IMPACT I WAS RUSHED TO THE HOSPITAL DUE TO UNCONSCIOUS AND FACIAL CONTUSIONS. DURING THE FIRST MOMENTS AFTER THE ACCIDENT, ONE OF THE FIRST THINGS OFFICERS, EMTS AND WITNESSES SAID WAS "I CAN'T BELIEVE THE AIRBAGS DIDN'T GO OFF". IN THE RECENT DAYS AFTER THE ACCIDENT I HAVE HAD SEVERAL MECHANICS AND SUCH APPRAISE THE CAR, THE ONE COMMON THEME THEY ALL SHARE IS THAT THEY SUSPECT THERE MIGHT NOT BE AN
10263896	CHEVROLET	TRAILBLAZER TRAILBLAZER	2002	2009-03-26 2009-11-20	AIRBAG WHERE IT BELONGS. OR THE LACK THERE OF. *TR  HIT HEAD ON BY ANOTHER CAR TOTALING MY CAR, AIRBAGS DID NOT DEPLOY. *TR
10314643	CHEVROLET	TRAILBLAZER	2002	2010-01-07	INFORMATION REDACTED PURSUANT TO THE FREEDOM OF INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6) I WAS TRAVELING SOUTHBOUND ON KY HWY 1531 (EASTWOOD FISHERVILLE RD). WHEN I APPROACHED A SHARP CURVE IN THE ROADWAY, I OBSERVED A HONDA ODYSSEY MINIVAN TRAVELING NORTHBOUND TOO FAST FOR THE ICY, SNOWY ROAD CONDITIONS. THE MINIVAN DRIVER LOST CONTROL OF HER VEHICLE AND STRUCK MY 2002 TRAILBLAZER HEAD-ON IN THE SOUTHBOUND LANE. AT THE TIME OF IMPACT, MY TRAILBLAZER WAS COMPLETELY STOPPED WITH MY RIGHT FOOT PRESSED FIRMLY ON THE BRAKE PEDAL. THE HONDA ODYSSEY AIRBAGS FULLY DEPLOYED. MY TRAILBLAZERS AIRBAGS DID NOT DEPLOY. BOTH VEHICLES WERE TOTAL LOSS. MY TRAILBLAZER WAS TOWED TO GM REPAIR SHOP BAUCHMAN CHEVROLET IN LOUISVILLE KY. IT REMAINS STORED IN ITS ORIGINAL POST-ACCIDENT CONDITION. I HAVE RETAINED OWNERSHIP TITLE OF THIS VEHICLE. GM REPAIR SHOP NOTED EXTENSIVE FRAME DAMAGE AND BROKEN AIRBAG SENSOR. THIS IS THE SECOND FRONT END INJURY CRASH INVOLVING THIS TRAILBLAZER WHERE THE AIRBAGS FAILED TO DEPLOY. SEE ALSO ODI CASE # 10314629. GM WAS NOTIFIED OF INCIDENT AND AGAIN I OPENED AN INVESTIGATION WITH GM AS TO WHY THE AIRBAGS FAILED TO DEPLOY. AS OF THIS DATE (2/26/2010) GM INVESTIGATORS HAVE NOT INSPECTED THE VEHICLE. (GM CASE [XXX]). I SUFFERED LOW BACK INJURIES AS A RESULT OF THIS ACCIDENT. THIS INJURY OCCURRED 8 WEEKS AFTER SPINAL FUSION SURGERY. I HAVE BEEN IN PHYSICAL THERAPY SINCE THE ACCIDENT FOR JOINT DAMAGE IN THE SACRAL ILLIUM AREA. *TR
10343917	CHEVROLET	TRAILBLAZER	2002	2009-12-04	TL*THE CONTACT OWNS A 2002 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 70 MPH THE VEHICLE WAS INVOLVED IN A CRASH IN WHICH THE AIR BAGS DID NOT DEPLOY. A POLICE REPORT WAS FILED. THE CONTACT WAS INJURED. THE VEHICLE WAS DESTROYED AND TOWED TO AN INDEPENDENT REPAIR SHOP. THE MANUFACTURER EXAMINED THE VEHICLE BUT DID NOT INFORM THE CONTACT OF THE CAUSE OF FAILURE; HOWEVER, THEY DID OFFER HIM A SETTLEMENT. THE FAILURE AND CURRENT MILEAGES WERE 150,000. THE VIN WAS UNAVAILABLE.
10378297	CHEVROLET	TRAILBLAZER	2002	2011-01-19	AIRBAGS DIDN'T DEPOLY AND ROOF CAVED. *TR
10386658	CHEVROLET	TRAILBLAZER	2002	2007-03-06	TL* THE CONTACT OWNS A 2002 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 70 MPH IN RAINY WEATHER, THE CONTACT DROVE OVER A PUDDLE OF WATER AND LOST CONTROL OF THE VEHICLE. SHE THEN ENGAGED THE BRAKES AND THE VEHICLE SWERVED ABNORMALLY. THE VEHICLE SPUN AROUND AND CRASHED INTO THE OUTER MEDIAN. THE AIR BAGS DID NOT DEPLOY AND THE CONTACT SUSTAINED A SHOULDER INJURY. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE APPROXIMATE FAILURE MILEAGE WAS 152,000.
10587773	CHEVROLET	TRAILBLAZER	2002	2014-05-10	I WAS DRIVING AND A GUY IN A CAR CAME OVER IN MY LANE AND HIT ME HEAD ON CAUSING ME TO FLIP MY VEHICLE 4 TIMES, MY AIRBAGS DIDN'T COME OUT AND THE GUY THAT HIT ME WAS UNDER THE INFLUENCE, MY VEHICLE WAS TOTALED. *TR

		T	1	1	
10626676	CHEVROLET	TRAILBLAZER	2002	2008-03-10	I STRUCK A VEHICLE THAT BROADSIDE WHEN HE RAN A STOP SIGN. I WAS GOING APPROXIMATELY 30 TO 35 MPH WHEN I STRUCK HIS VEHICLE. THE AIR BAGS DID NOT DEPLOY. I WAS TAKEN AWAY IN AN AMBULANCE AND HAD DAMAGE TO MY CERVICAL SPINE, STOMACH AND MID SPINE. I DID INQUIRE WHERE I HAD THE VEHICLE REPAIRED, ABOUT \$8K IN DAMAGES, ABOUT WHY THE AIRBAGS DIDN'T DEPLOY. THEY SAID THEY DIDN'T KNOW BUT CHECKED AND SAID THE AIRBAG SYSTEM WAS FUNCTIONING? I SEE MANY SUCH "STORIES" ABOUT TRAILBLAZER AIRBAGS NOT DEPLOYING ON THIS SITE. IT REALLY BE NICE TO SEE SOMETHING DONE ABOUT THIS SITUATION. THIS VEHICLE HAS BEEN IN SEVERAL WRECKS AND THE AIRBAGS HAVE NEVER DEPLOYED!!!!! NOTE, I HAVE WRITTEN TO CHEVROLET/GM ABOUT THIS ISSUE BUT DON'T REALLY EXPECT THEM TO RESPOND! SOME SUPPORT FROM THE NHTSA WOULD REALLY BE APPRECIATED AND IS NEEDED BEFORE ANYONE ELSE GET HURT WHEN THE AIRBAGS DON'T DEPLOY! *TR
					TL* THE CONTACT OWNED A 2002 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 15 MPH ON A RAINY ROAD, THE CONTACT CRASHED INTO ANOTHER VEHICLE AND THE AIR BAGS
10758946	CHEVROLET	TRAILBLAZER	2002	2014-10-15	FAILED TO DEPLOY. THE CONTACT SUSTAINED A HEAD INJURY THAT REQUIRED MEDICAL ATTENTION. THE DRIVER AND PASSENGER OF THE OTHER VEHICLE SUSTAINED UNKNOWN INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE AND VIN WERE UNAVAILABLE.
10761168	CHEVROLET	TRAILBLAZER	2002	2014-10-04	TL* THE CONTACT OWNS A 2002 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 10 MPH ON AN INCLINE DURING INCLEMENT WEATHER CONDITIONS, THE CONTACT'S VEHICLE VEERED INTO ANOTHER VEHICLE. THE AIR BAGS DID NOT DEPLOY. THERE WERE NO WARNING INDICATORS ILLUMINATED. THE MANUFACTURER WAS NOT MADE AWARE OF THE ISSUE. A POLICE REPORT WAS FILED. THE CONTACT SUFFERED A HEAD CONCUSSION THAT REQUIRED MEDICAL ATTENTION. THE FAILURE MILEAGE WAS NOT PROVIDED.
					THE VEHICLE WAS INVOLVED IN A HEAD ON CRASH INTO A TELEPHONE POLE AND THE AIR BAGS DID NOT DEPLOY. THE FRONT SEAT PASSENGER WAS INJURED AND THE DRIVER STRUCK THE STEERING WHEEL AND DIED AT THE HOSPITAL FROM INTERNAL INJURIES. WE ARE TRYING TO DETERMINE WHY THE AIRBAGS DID NOT DEPLOY. THE PASSENGER WAS NOT WEARING A SEAT
10825823	CHEVROLET	TRAILBLAZER	2002	2016-01-09	BELT AND IT ALSO APPEARS THAT THE DECEASED DRIVER WAS NOT WEARING A SEAT BELT.
10872510	CHEVROLET	TRAILBLAZER	2002	2016-05-26	DRIVING APPROXIMATELY 30 MILES PER HOUR, WOMAN PULLED OUT IN FRONT OF ME TO TURN ONTO THE FREEWAY. A VEHICLE NEXT TO ME HONKED THEIR HORN AND MISSED HITTING HER BUT I HIT HER ON THE PASSENGER REAR PANEL OF HER CAR, DAMAGING HER VEHICLE AND BENDING THE REAR TIRE AT AN ANGLE. THE AIRBAG DID NOT DEPLOY AND WAS ON. I WAS TRAVELING ON A CITY STREET, GOING WESTBOUND, THE OTHER DRIVER WAS TURNING TO GO NORTHBOUND.
10899776	CHEVROLET	TRAILBLAZER	2002	2016-08-29	TL* THE CONTACT OWNS A 2002 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 25 MPH, THE CONTACT'S VEHICLE CRASHED INTO A BUS AND SUSTAINED SIGNIFICANT DAMAGE TO THE FRONT END. THE AIR BAGS DID NOT DEPLOY. THE VEHICLE WAS TOWED. THE DRIVER SUSTAINED INJURIES TO THE NECK, HEAD, TORSO, AND A DISLOCATED FINGER. MEDICAL ATTENTION WAS REQUIRED. A POLICE REPORT WAS FILED. THE CAUSE OF THE FAILURE WAS NOT DIAGNOSED. THE VEHICLE WAS NOT REPAIRED. THE MANUFACTURER WAS NOT NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 122,000.
10957467	CHEVROLET	TRAILBLAZER	2002	2017-02-26	MY WIFE WAS IN A HEAD ON COLLISION WHERE SHE HIT A TREE GOING APPROXIMATELY 45 MILES AN HOUR. SHE WAS ON A COUNTY ROAD AND LOST CONTROL OF THE VEHICLE, HITTING THE TREE ON PRIVATE PROPERTY. THE AIRBAGS DID NOT DEPLOY, WHEN THEY SHOULD HAVE. SHE HIT HER HEAD ON THE STEERING WHEEL AT IMPACT. I HAVE UPLOADED PICTURES OF THE DAMAGE TO THE VEHICLE AND A PICTURE SHOWING THE AIRBAGS DID NOT DEPLOY.
11042967	CHEVROLET	TRAILBLAZER	2002	2016-11-22	TL* THE CONTACT OWNED A 2002 CHEVROLET TRAILBLAZER. WHILE DRIVING APPROXIMATELY 60 MPH, THE CONTACT SWERVED TO AVOID ANOTHER VEHICLE AND CRASHED INTO A MEDIAN FACING ONCOMING TRAFFIC. THE VEHICLE FLIPPED OVER EIGHT TIMES AND LANDED IN A DITCH ON THE OPPOSITE SIDE OF THE HIGHWAY. THE AIR BAGS DID NOT DEPLOY. THE VEHICLE WAS TOWED AND DEEMED TOTALED. A POLICE REPORT WAS FILED. THE CONTACT PASSED OUT AND RECEIVED INJURIES TO THE HEAD, NECK, BACK, AND SHOULDER. MEDICAL ATTENTION WAS REQUIRED. THE DEALER WAS NOT CONTACTED. THE VEHICLE WAS INCLUDED IN NHTSA CAMPAIGN NUMBER: 04V201000 (SEAT BELTS). THE VEHICLE WAS NOT REPAIRED. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE APPROXIMATE FAILURE MILEAGE WAS 100,000.

			1		
11289369	CHEVROLET	TRAILBLAZER	2002	2019-11-29	TL* THE CONTACT OWNED A 2002 CHEVROLET TRAILBLAZER. WHILE DRIVING AND TURNING, THE VEHICLE HYDROPLANED AND STRUCK A CONCRETE WALL HEAD ON. THE VEHICLE THEN VEERED TO THE LEFT AND STRUCK THE CENTER DIVIDER TWICE. THE AIR BAGS DID NOT DEPLOY. THE VEHICLE WAS TOTALED AND TOWED. MOST OF THE DAMAGE WAS TO THE FRONT END OF THE VEHICLE AND THE DRIVER'S DOOR COULD NOT BE CLOSED. THE DRIVER SUSTAINED BRUISES WHERE THE SEAT WAS LOCATED. THE DRIVER WAS TRANSPORTED TO THE EMERGENCY ROOM FOR MEDICAL ATTENTION. THE DRIVER'S FACE WAS BRUISED AND A CAT SCAN WAS PERFORMED TO DETERMINE IF THERE WERE ANY BROKEN BONES, BUT THE TESTS WERE NEGATIVE. THE DRIVER ALSO TWISTED HER ANKLE AND THERE WAS A LITTLE BIT OF SWELLING ON HER KNEE. A POLICE REPORT WAS FILED. THE MANUFACTURER WANTED TO VISIT THE CONTACT'S HOME TO EXAMINE THE VEHICLE AND FIND OUT WHY THE AIR BAGS DID NOT DEPLOY. THE DEALER WAS NOT CONTACTED. THE CAUSE OF THE FAILURE WAS NOT DETERMINED. THE FAILURE MILEAGE WAS UNKNOWN.
564451	GMC	ENVOY	2002	2001-01-13	SENDING THE VEHICLE OFF THE ROAD HITTING A STONE RETAINING WALL HEAD ON, NEITHER PASSENGER NOR DRIVERS SIDE AIR BAGS DEPLOYED. NLM
566612	GMC	ENVOY	2002	2002-01-14	ALL OF THE EIGHT (8) AIR BAG EQUIPPED IN THE VEHICLE FAILED TO DEPLOY DURING FRONTAL IMPACT, ALTHOUGHT PROPERLY RESTRAINED THE CONSUMER STILL SUSTAINED SERIOUS INTERNAL INJURIES, INCLUDING A LACERATED LIVER. (ATTORNEY ON BEHALF OF CLIENTO NLM VEHICLE WAS INVOLVED IN FRONTAL COLLISION WITH POINT OF IMPACT JUST A LITTLE LEFT OF
8016732	GMC	ENVOY	2002	2002-07-17	THE CENTER BUMPER. FRONT END, INCLUDING FRAME WAS TOTALLED. UPON IMPACT, NEITHER AIR BAGS DEPLOYED. PLEASE DESCRIBE DETAILS. *AK
8023505	GMC	ENVOY	2002	2002-11-22	CONSUMER COLLIDED IN THE REAR OF A TRACTOR TRAILER TRAVELLING APPROXIMATELY 60- 70MPH. BOTH THE DRIVER AND PASSENGER AIR BAGS DID NOT DEPLOY. TS
10002513	GMC	ENVOY	2002	2002-11-22	WHILE TRAVELING AT 70 MPH ANOTHER VEHICLE WAS TRAVELING EAST BOUND CROSSED CONSUMERS PATH UNEXPECTANTLY, CAUSING CONSUMER TO HIT A TREE. CONSUMER STATES NONE OF THE AIRBAGS DEPLOYED. PLEASE PROVIDE ANY FURTHER INFORMATION.*JB
					CONSUMER LOST CONTROL OF VEHICLE AND HIT A LEDGE, AND NONE OF THE AIR BAGS DEPLOYED. *JB THE DEALER STATED THAT IF THE VEHICLE HIT 6 INCHES TO THE RIGHT, THEN THE AIR BAGS
10009390	GMC	ENVOY	2002	2003-02-21	WOULD HAVE DEPLOYED. *SCC WHILE DRIVING 50 MPH VEHICLE WAS INVOLVED IN A FRONTAL COLLISION, BUT AIR BAGS DID NOT
10029726	GMC	ENVOY	2002	2003-07-03	DEPLOY. DEALER NOTIFIED.*AK
10029894	GMC	ENVOY	2002	2003-07-15	CONSUMER STATED WHILE SHE AND HER HUSBAND WERE TRAVELING ON THE HIGHWAY AT APPROXIMATELY 40-50 MPH, THE VEHICLE IN FRONT OF THEM DECIDED TO MAKE A QUICK TURN, WHICH CAUSED HER HUSBAND TO HIT THE VEHICLE IN THE SIDE. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. BOTH SHE AND HER HUSBAND SUSTAINED INJURIES. HIS KNEES WENT INTO THE DASH AND HE WAS SORE FROM HEAD TO TOE. THIS IMPACT CAUSED HER HEAD TO SNAP BACK, RESULTING IN A CHEST WALL INJURY/A STIFF NECK, AND BACK. THIS WAS A MALFUNCTION BECAUSE THE AIR BAGS SHOULD HAVE DEPLOYED BECAUSE OF THE RATE OF SPEED. *AK *CB THE CONSUMER ALSO FELT THE SEAT BELT DID NOT REALLY PERFORM AS DESIGNED. *JB
10063773	GMC	ENVOY	2002	2004-03-21	2002 GMC ENVOY SER#[XXX] AIR BAGS DID NOT DEPLOY DRIVER TAKEN BY LIFESTAR TO HARTFORD HOSPITAL THE WHOLE LEFT SIDE OF THE VEHICLE WAS CAVED IN ALL THE WAY TO THE FRONT SEAT. *NM UPDATED 07/30/2012 *JS INFORMATION REDACTED PURSUANT TO THE FREEDOM OF INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6)
10075683	GMC	ENVOY	2002	2004-05-14	WHILE DRIVING 30 MPH, THE CONSUMER WAS INVOLVED IN AN EIGHT VEHICLE PILE UP. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. AS A RESULT, THE DRIVER SUSTAINED SEVERE BACK AND LEG INJURIES. *AK *SC
10079342	GMC	ENVOY	2002	2004-06-16	WHILE DRIVING 55 MPH DRIVER APPLIED THE BRAKES TO SLOW DOWN THE SPEED AND CONSUMER LOST CONTROL, CAUSING THE VEHICLE TO HIT A GUARD RAIL AND ROLL OVER THREE TIMES. VEHICLE LANDED UPSIDE DOWN. UPON IMPACT, THE AIRBAG DID NOT DEPLOY, AND SEAT BELT DID NOT HOLD THE PASSENGER. *AK
10099326	GMC	ENVOY	2002	2004-11-01	AFTER BEING STRUCK HEAD ON BY A SEMI TRAILER AT 40 MPH AIR BAGS DID NOT DEPLOY. THE VEHICLE WAS TOTALED.*AK
10101068	GMC	ENVOY	2002	2004-11-11	WHILE DRIVING 20 MPH CONSUMER'S VEHICLE COLLIDED WITH THE VEHICLE IN FRONT. UPON IMPACT, BOTH FRONTAL AIR BAGS FAILED TO DEPLOY. DRIVER TO SUSTAINED MINOR INJURIES, AND WAS TRANSPORTED TO A HOSPITAL. THE VEHICLE WAS TOWED TO THE DEALER FOR INSPECTION. *AK
10120252	CMC	ENVO):	2062	2005 07 10	I WAS TRAVELLING AT APPROXIMATELY 35MPH AND AS I WAS HEADING TOWARD A SIGNAL LIGHT WHEN A VAN TURNED LEFT IN THE OPPOSITE DIRECTION OF TRAVEL. MY VEHICLE'S FRONT END STRUCK THE VAN'S PASSENGER SIDE DOOR. AIR BAGS DID NOT DEPLOY UPON IMPACT ALTHOUGH VAN'S BOTH FRONTAL AIR BAGS DID DEPLOY.MY FACE HIT THE STEERING WHEEL AND KNEES HIT
10129259	GMC	ENVOY	2002	2005-07-18	THE BOTTOM OF THE DASHBOARD. PASSENGER WAS ALSO BRUISED ON KNEES

10211793	GMC	ENVOY	2002	2007-12-05	TL*THE CONTACT OWNS A 2002 GMC ENVOY. WHILE DRIVING 20 MPH UPHILL IN ICY WEATHER, THE VEHICLE SLID OFF THE ROAD. NONE OF THE AIR BAGS DEPLOYED AND THE VEHICLE WAS COMPLETELY DESTROYED. THE PASSENGER WAS SEVERELY INJURED. THE CONTACT FILED A FORMAL COMPLAINT WITH THE MANUFACTURER. HE HAS A COPY OF THE POLICE REPORT. THE CURRENT AND FAILURE MILEAGES WERE 115,000. UPDATED 01/07/08 *BF UPDATED *JB
					MY WIFE AND I WERE HEADED SOUTHBOUND ON 685 IN ROUND ROCK, TX IN OUR 2002 GMC ENVOY AT APPROX. 9:35 PM WHEN A DRIVER IN A MINI VAN RAN A RED LIGHT AT THE INTERSECTION OF 685 AND GATTIS SCHOOL RD. OUR VEHICLE STRUCK THEM IN THE REAR PASSENGER QUADRANT. THE SPEED LIMIT IS 60 MPH AT THIS INTERSECTION AND WE DID NOT HAVE TIME TO BRAKE. EVEN THOUGH THE FRONT OF OUR VEHICLE WAS CRUSHED INTO THE ENGINE COMPARTMENT, NO AIRBAGS DEPLOYED. MY WIFE, WHO IS IN THE HABIT OF WEARING
					HER SEATBELT (ALTHOUGH WE STILL CANNOT CONFIRM ONE WAY OR THE OTHER) STRUCK THE REAR VIEW MIRROR WITH HER HEAD WITH ENOUGH FORCE TO BREAK A HOLE IN THE WINDSHIELD WHERE IT WAS ATTACHED AND BREAK THE WINDSHIELD AROUND IT. SHE WAS TRANSPORTED TO THE HOSPITAL WITH A CONCUSSION AND HAD FOR A TIME GONE INCOHERENT AND UNRESPONSIVE WITH SHORT TERM MEMORY LOSS. SHE HAS HAD DAILY HEADACHES SINCE WITH SOME EXTREMELY SEVERE. SHE ALSO HAD MULTIPLE SEVERE CONTUSIONS DOWN HER LEFT SIDE, PARTICULARLY IN HER UPPER LEFT THIGH WITH A LARGE HEMOTOMA THAT IS STILL GIVING HER
					PROBLEMS. OUR VEHICLE WAS SUBSEQUENTLY TOTALED BY THE INSURANCE COMPANIES. WE HAVE CONTACTED GM ABOUT THE FAILURE OF THE AIRBAGS TO DEPLOY AND THEY ARE CURRENTLY INVESTIGATING AND SENT AN INVESTIGATOR TO DOWNLOAD THE COMPUTER
10246849	GMC	ENVOY	2002	2008-10-03	INFORMATION LAST WEEK. THERE IS A POLICE REPORT THAT WAS FILED BY THE TEXAS DPS INVESTIGATING OFFICER. *TR
10437615	GMC	ENVOY	2002	2011-11-16	CAR HAD A HEAD ON COLLISION WITH ANOTHER CAR THAT JUMP FROM THE OPPOSITE TRAFFIC.  BOTH CARS WERE TOTALED BECAUSE OF THIS ACCIDENT, BUT MY AIRBAGS DID NOT DEPLOY AT THE TIME OF THE ACCIDENT. *KB
					MY SON (17) WAS COMING HOME AND CRASHED INTO A LIGHT POLE, WE DON'T KNOW WHAT CAUSED HIM TO CRASH NO ALCOHOL OR DRUGS WERE INVOLVED AND THE AIRBAGS DID NOT DEPLOYHE WAS TRAPPED IN THE CAR AND DIED FROM BLUNT FORCE TRAUMA TO THE HEAD.
10667172	GMC	ENVOY	2002	2013-07-07	*TR
10723011	GMC	ENVOY	2002	2014-06-28	I AND MY PASSENGER WERE IN AN ACCIDENT ABOUT A YEAR AGO, A VERY HARD FRONT END IMPACT, AND NONE OF THE AIR BAGS DEPLOYED. WE WERE BOTH TRANSPORTED TO THE ER BY AMBULANCE, I HIT THE STEERING WHEEL HARD SO HARD THAT IT BENT INWARDS AND BROKE MY NOSE ALSO HAD A CONCUSSION. HE WAS IN THE FRONT PASSENGER SEAT AND HIT THE FRONT DASH, WHERE THE AIR BAG SHOULD HAVE DEPLOYED, HE BROKE HIS FRONT TEETH AND ALSO HAD A CONCUSSION. I'VE ALSO HAD MANY OF THE SAME ISSUES THAT EVERY OTHER 02 OR 03 ENVOY HAS YET MY VIN PULLS NO RECALLS. THIS NEEDS TO BE INVESTIGATED!!! THANKS.
					I WAS ON MY WAY HOME ON HWY/US 151 GOING APPROX. 55-60 MPH (65 MPH ZONE) WHEN I HIT A DEER WHICH CAUSED MY VEHICLE TO LOSE CONTROL AND SLAMMED INTO THE START OF A GUARDRAIL AT NO LESS THAN 45 MPH BRINGING MY 2002 GMC ENVOY TO A COMPLETE STOP, AT MOST 2-3 FEET FROM INITIAL IMPACT TO BE EXACT. THE AIRBAGS DID NOT DEPLOY. FRONT DASH NOR SIDE IMPACT BAGS, NOTHING. N I HIT HARD. LUCKILY I WASNT SERIOUSLY INJURED ONLY MINOR BRUISING AND QUITE SORE FROM WHIPLASH AND BEING THROWN INTO THE DOOR AN A BIT SHAKEN N LUCKILY HAD NO PASSENGERS. AS FOR MY ENVOY, IT IS A TOTAL LOSS AND UNFORTUNATELY I ONLY HAD LIABILITY INSURANCE SO NOW IM SCREWED WITHOUT A VEHICLE
11179980	GMC	ENVOY	2002	2019-02-12	AND AFTER ALL OTHER PROBLEMS IVE FACED WITH MY GMC ENVOY I WILL NEVER OWN A GM AGAIN. TAKE GM PRODUCTS TO THE DUMP.
8021614	GMC	YUKON	2002	2002-10-13	CONSUMER STATES THAT AT 50 MPH UNDER RAINY CONDITIONS, CONSUMER LOSS CONTROL OF VEHICLE AND HIT A TREE. VEHICLE WAS TOTALLED. NONE OF THE VEHICLES AIRBAGS DEPLOYED. PLEASE PROVIDE ANY FURTHER INFORMATION. TS
10004394	GMC	YUKON	2002	2002-12-09	WHILE DRIVING AT 25 MPH THE VEHICLE WAS INVOLVED IN AN ACCIDENT WHERE AIRBAGS DID NOT DEPLOY. DEALER NOTIFIED. PLEASE PROVIDE ADDITIONAL INFORMATION. TS
10126105	GMC	YUKON	2002	2005-06-13	DT: CONSUMER GOT IN AN ACCIDENT AND TOTALED THE VEHICLE, THE FRONT AND SIDE AIR BAGS NEVER DEPLOYED. CONSUMER WAS GOING ABOUT 70 MPH AND HIT HEAD ON AND THE VEHICLE ROLLED 4 TIMES. *AK *SB
10132894	GMC	YUKON	2002	2005-07-15	DT: WHILE DRIVING DOWN THE MAIN ROAD AT 45 MPH, THE CONSUMER TOOK HIS EYES OFF THE ROAD AND WENT INTO THE GRAVEL AND THEN INTO A DITCH AND HIT A MAILBOX. THE CONSUMER WENT THROUGH THE PASSENGER SIDE WINDSHIELD. THE RIGHT WHEEL FELL OFF AND THE FRONT BUMPER SMASHED INTO THE ENGINE AND THE FRAME WAS BENT. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. THE VEHICLE WAS EQUIPPED WITH FRONT AND SIDE AIR BAGS. THE AIR BAG LIGHT WAS NOT ON AND NEVER HAD BEEN ON. THERE WERE NO PROBLEMS WITH VEHICLE BEFORE THIS INCIDENT. THERE WERE NO OTHER VEHICLES INVOLVED. THE VEHICLE HAS NEVER BEEN IN AN ACCIDENT THERE WERE NO RECALLS ON THE AIR BAGS. THE MANUFACTURER HAS NOT BEEN CONTACTED, BUT WILL BE CONTACTED TODAY. THERE WAS A POLICE REPORT WAS TAKEN. *AK

10261762	GMC	YUKON	2002	2009-02-23	TL*THE CONTACT OWNS A 2002 GMC YUKON. WHILE DRIVING APPROXIMATELY 55 MPH, THE CONTACT CRASHED INTO ANOTHER VEHICLE. HIS VEHICLE WAS COMPLETELY DESTROYED AND NONE OF THE AIR BAGS DEPLOYED. THE DRIVER SUSTAINED MODERATE BODILY INJURIES. IT HAS NOT YET BEEN DETERMINED WHY THE AIR BAGS FAILED TO DEPLOY. THE CONTACT HAS PICTURES OF THE FAILED INCIDENT AND A COPY OF THE POLICE REPORT. HE FILED A COMPLAINT WITH THE MANUFACTURER. THE FAILURE AND CURRENT MILEAGES WERE 107,000.
10261762	GIVIC	YUKUN	2002	2009-02-23	WAINDFACTURER. THE FAILURE AND CORRENT WILLEAGES WERE 107,000.
10544196	CMC	YUKON	2002	2013-09-12	TL* THE CONTACT OWNS A 2002 GMC YUKON. THE CONTACT STATED THAT WHILE DRIVING 45 MPH, HE CRASHED INTO THE PASSENGER'S SIDE OF ANOTHER VEHICLE AND THE AIR BAGS FILED TO DEPLOY WITH THE IMPACT. IN ADDITION, THE SEAT BELT FAILED TO SECURE AS DESIGNED. THE CONTACT SUSTAINED A BRUISED RIB AND AN INJURY TO THE LEFT LEG. A POLICE REPORT WAS NOT FILED. THE VEHICLE WAS DESTROYED AND TOWED TO A SALVAGE FACILITY. THE MANUFACTURER
10544196	GMC	YUKUN	2002	2013-09-12	WAS NOT NOTIFIED OF THE DEFECT. THE APPROXIMATELY FAILURE MILEAGE WAS 142,000.  TL*THE CONTACT OWNS A 2002 GMC YUKON. THE CONTACT STATED THAT AFTER BEING INVOLVED
					IN A COLLISION, THE AIR BAGS FAILED TO DEPLOY. THE DETAILS OF THE COLLISION WERE NOT AVAILABLE. THE VEHICLE WAS DESTROYED. A POLICE REPORT WAS FILED. THE CONTACT SUSTAINED BACK INJURIES THAT DID NOT REQUIRE MEDICAL ATTENTION. THE MANUFACTURER WAS MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS 225,000. THE VIN WAS
10690133	GMC	YUKON	2002	2015-01-06	UNAVAILABLE.
					I SWERVED TO MISS A DEER AND I HIT A TREE RUNNING 47 MPH AND MY AIR BAGS DIDN'T DEPLOY AND NO ONE CAN TELL ME WHY. MY HUSBAND AND I WERE VERY LUCKY BUT WHY DIDN'T THE AIR BAGS DEPLOY? MY HUSBAND WAS OUT OF WORK FOR 5 MONTHS DUE TO TORN LIGAMENTS IN HIS
11298082	GMC	YUKON XL	2002	2019-02-05	SHOULDERS AND STILL HAS TO HAVE SURGERY.  THE TRUCK IMPACTED A TREE WHILE DRIVING 40 MPH AND AS A RESULT THE TRUCK'S FRONT
					BUMPER WRAPPED AROUND THE TREE. NEITHER THE DRIVER'S SIDE NOR PASSENGER'S SIDE AIR BAG DEPLOYED UPON IMPACT. THE DRIVER SUSTAINED SEVERE INJURIES, BUT NO BROKEN BONES. THE CAUSE OF THE AIR BAG FAILURE IS YET TO BE DETERMINED. PLEASE PROVIDE ANY ADDITIONAL
10048726	ISUZU	AMIGO	2002		INFORMATION. *NLM WE WERE INVOLVED IN AN ACCIDENT ON 1270 IN ST.LOUIS. MO. A SEMI-TRUCK DOING
					APPROXIMATELY 35 MPH STRUCK US IN THE REAR AND FORCED US INTO THE PICK UP TRUCK IN FRONT OF US. THE AIR BAGS DID NOT DEPLOY, DESPITE THE SQUARE FRONT TO REAR IMPACT.  THE FRONT PASSENGER SEAT IN MY VEHICLE BROKE, TWISTING THE PASSENGER TO THE SIDE,
764947	ISUZU	AXIOM	2002	2002-07-02	FACING THE STEERING WHEEL.*AK
10033920	ISUZU	AXIOM	2002	2003-08-13	CONSUMER STATED WHILE DRIVING AT 50 MPH CONSUMER'S VEHICLE REARENDED ANOTHER VEHICLE. UPON IMPACT, AIR BAGS FAILED TO DEPLOY. *AK
10050524	ISUZU	AXIOM	2002	2003-12-15	WHILE DRIVING AT 25 MPH LEFT FRONT TIRE BLEW OUT, DRIVER LOST CONTROL AND HIT A GUARD RAIL. UPON IMPACT, NONE OF THE AIR BAGS DEPLOYED. GOODYEAR, SIZE P235/65R17, DOT# UNKNOWN. CONSUMER STATED THERE WAS NOT AN ISSUE WITH THE TIRE, BUT HIS SON RAN OVER SOMETHING AND BLEW THE TIRE. *AK
					DT: ON JULY 3RD THE CONSUMER RECEIVED A RECALL LETTER IN REFERENCE TO THE PASSENGER SIDE AIR BAG, RECALL # 03V113000. THE VEHICLE WAS TAKEN TO GALLES MOTOR CO. TO HAVE
					THE RECALL REPAIRED AT NO COST TO THE CONSUMER. ON JULY 11, 2005 THE CONSUMER'S WIFE HAD AN ACCIDENT IN WHICH SHE WAS INJURED. SHE REAR ENDED A CAR SITTING AT A RED LIGHT WHILE SHE WAS GOING 45 MPH. SHE WAS WEARING A SEAT BELT AT THE TIME BUT THE AIR BAGS DID NOT DEPLOY. THE WEATHER WAS DRY AND THE ROAD CONDITIONS WERE GOOD. THE VEHICLE HASN'T BEEN TAKEN TOT HE DEALER YET FOR INSPECTION. THE DEALER WAS CONTACTED AND THEY SAID FOR HIM TO TAKE IT TO A MECHANIC. HE HASN'T BEEN ABLE TO GET A HOLD OF
10128420	ISUZU	AXIOM	2002	2005-07-11	THE MFR. AT PRESENT, HIS CAR IS STILL AT THE WRECKING YARD. *NM  DT*: THE CONTACT STATED ON DECEMBER 23, 2005 WHILE DRIVING AT 60 MPH ON A DRY HIGHWAY THE CONTACT WAS RUN OFF THE ROAD BY A TRUCK. THE VEHICLE THEN COLLIDED WITH
4044055	10	A)// 01 -	2005	2005 42 55	THE ROAD PARTITION, AND CRUSHED THE ENTIRE FRONT END OF THE VEHICLE. THE AIR BAGS DID NOT DEPLOY, AND THE DRIVER SUFFERED BRUISING FROM THE SAFETY BELT. THERE IS A RECALL, #02V213000 BUT THE CONTACT WAS NOT NOTIFIED OF THE RECALL WHEN THE VEHICLE WAS
10148582	ISUZU	AXIOM	2002	2005-12-23	PURCHASED. UPDATED 02/28/06. *JB VEHICLE WAS INVOLVED IN A FRONTAL COLLISION WITH A POLE AT 35-40MPH AND NEITHER
8023834	ISUZU	RODEO	2002	2002-10-25	AIRBAG DEPLOYED. VEHICLE IS TOTALED DRIVER IN A COMA DEALER IS AWARE OF THE PROBLEM.  TS
					WHILE MERGING ONTO THE INTERSTATE VEHICLE DROVE OVER SOME BLACK ICE, VEHICLE THEN SPUN AROUND, HIT A CONCRETE BARRIER, AND A GUARD RAIL. UPON IMPACT, FRONT AIR BAGS
10049812	ISUZU	RODEO	2002	2003-11-28	DID NOT DEPLOY. THE DRIVER AND PASSENGER SUSTAINED MINOR INJURIES. *AK  CAR WAS INVOLVED IN AN ACCIDENT WHERE IT STRUCK THE BACK OF ANOTHER VEHICLE. THE
10184163	ISUZU	RODEO	2002	2006-11-19	COLLISION WAS ENOUGH TO CAUSE OVER \$4000.00 IN DAMAGE TO THE ISUZU BUT THE AIR BAGS FAILED TO DEPLOY. *JB

	1	1			
10443695	ISUZU	RODEO	2002	2011-05-18	TL* THE CONTACT OWNS A 2002 ISUZU RODEO. THE CONTACT WAS DRIVING APPROXIMATELY 35 MPH WHEN THE VEHICLE BEGAN TO ERRONEOUSLY DRIFT TO ONE SIDE. THE CONTACT LOST CONTROL OF THE VEHICLE AND THE VEHICLE MOVED INTO THE SHOULDER, CRASHING INTO THE BARRIER WALL ABRUPTLY. THE CONTACT WAS KNOCKED UNCONSCIOUS AND THE CONTACTS FOOT LANDED ON THE ACCELERATOR PEDAL AS HE LOST CONSCIOUSNESS. THE CONTACT WAS NOT AWARE AS THE VEHICLE CONTINUED TO ACCELERATE INTO ONCOMING TRAFFIC. THE VEHICLE THEN CRASHED INTO A TREE BEFORE FLIPPING. THE SEAT BELTS DETACHED FROM ITS HOUSING UNIT AND THE AIR BAGS NEVER DEPLOYED. THE CONTACT SUSTAINED SEVERE INJURIES TO THE HEAD, FACE, PELVIS AND SPINE. A PASSENGER WAS ALSO INJURED AND BOTH THE CONTACT AND THE PASSENGER WERE TRANSPORTED TO THE HOSPITAL. A POLICE REPORT WAS FILED OF THE INCIDENT AND THE VEHICLE WAS DESTROYED. THE FAILURE AND THE CURRENT MILEAGE WAS 150,000.
10553570	ISUZU	RODEO	2002	2013-11-24	WHILE TRAVELING ON A ROAD, A HORSE RAN ACROSS AND CAUSED A COLLISION. THE FRONT OF THE VEHICLE IS DAMAGED, AS WELL AS, BOTH SIDE WINDOWS AND THE RADIATOR. NONE OF THE AIRBAGS DEPLOYED CAUSING INJURIES TO TWO PEOPLE IN THE VEHICLE. THE OFFICER AT THE SCENE SAID THE AIRBAGS SHOULD HAVE DEFINITELY DEPLOYED. *TR
745117	CHEVROLET	ASTRO	2001	2001-04-19	VEHICLE WAS IN AN OFFSET FRONTAL CRASH, STRIKING THE REAR OF A FULL SIZE PICKUP TRUCK WITH THE LEFT HALF OF THE FRONT OF THE VAN. UPON IMPACT, FRONTAL AIR BAGS FAILED TO DEPLOY. *AK
0000422	CUEVIDOLET	ACTRO	2001	2002 02 06	WHILE DRIVING 35 MPH THE VEHICLE REAR ENDED A BUS YET THE AIRBAGS DID NOT DEPLOY, THE
8006423	CHEVROLET	ASTRO	2001	2002-03-06	VEHICLE WAS A TOTAL LOSS. NLM *JG  WHILE TRAVELING 30-35 MPH AND AS A RESULT OF AN ACCIDENT AIR BAGS DID NOT DEPLOY.
886165	CHEVROLET	BLAZER	2001		PLEASE PROVIDE FURTHER INFORMATION.*AK
894582	CHEVROLET	BLAZER	2001	2001-08-10	VEHICLE WAS INVOLVED IN A FRONTAL COLLISION. SPEED WAS NOT DETERMINED, UPON IMPACT, BOTH AIR BAGS DID NOT DEPLOY, DEALER WAS NOTIFIED. *AK *YH
8015457	CHEVROLET	BLAZER	2001	2002-07-05	WHILE IN A FRONTAL IMPACT NONE OF THE AIR BAGS DEPLOYED. DEALER CONTACTED.*AK
0047255	CUEV/DOLET	DI 475D	2004	2002 07 07	VEHICLE WAS INVOLVED IN A FRONTAL COLLISION INTO A DIRT WALL. UPON IMPACT, NEITHER
8017355	CHEVROLET	BLAZER	2001	2002-07-07	AIR BAG DEPLOYED. FEEL FREE TO PROVIDE ANY FURTHER INFROMATION.*AK  WHILE DRIVING AT 35MPH AND WITH NO WARNING WHEN VEHICLE WAS HIT IN FRONT CENTER
8017786	CHEVROLET	BLAZER	2001	2002-08-16	AIR BAGS DID NOT DEPLOY. DEALER NOTIFIED.*AK
8020006	CHEVROLET	BLAZER	2001	2002-09-14	CONSUMER STATES THAT WHEN HIT AT 40MPH IN THE FRONT CENTER OF THE VEHICLE THE AIR BAG DID NOT DEPLOY. DEALER NOTIFIED. NLM
0020000	CHEVROLLI	DEAZER	2001	2002 03 14	WHILE TRAVELING ABOUT 55MPH ON THE HIGHWAY WITHOUT PRIOR WARNING SHE HIT AN
					ENBANKMENT. AND THE VEHICLE FLIP AND THE DRIVER SIDE AIRBAG DIDN'T DEPLOY. PLEASE FILL
8023471	CHEVROLET	BLAZER	2001	2002-07-01	IN ADDITIONAL INFORMATION DEALER IS AWARE OF THE PROBLEM. PH
	0.15,450,55		2004		CONSUMER STATES WHILE DRIVING 30MPH HAD FRONT END COLLISION AND NEITHER PASSENGER
10002341	CHEVROLET	BLAZER	2001		OR DRIVES AIR BAG DEPLOYED. PLEASE PROVIDE ANY ADDITIONAL INFORMATION. TS  DRIVER SIDE AIR BAG FAILED TO DEPLOY IN A CRASH THROUGH: 1. A SIX FOOT TALL WOODEN
10060150	CHEVROLET	BLAZER	2001	2004-02-24	FENCE AT ALMOST 30MPH, THEN 2. THE EXTERIOR SIDE OF A 2-STORY HOME THAT CONTAINED THE KITCHEN SINK AND PLUMBING FIXTURES, WHILE SMASHING UP AND OVER THE FIFTEEN-INCH CONCRETE FOUNDATION, FRONT-END FIRST.*AK
10072173	CHEVROLET	BLAZER	2001	2004-04-30	WHILE DRIVING AT 53 MPH, THE CONSUMER'S VEHICLE REAR ENDED ANOTHER VEHICLE. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. THE CONSUMER SUSTAINED MINOR INJURIES. THE DEALERSHIP WAS NOTIFIED, BUT DID NOT RESOLVE THE PROBLEM. *AK *SC
10101364	CHEVROLET	BLAZER	2001	2004-11-11	CONSUMER'S VEHICLE WAS AT A COMPLETE STOP AND ANOTHER VEHICLE WAS COMING HEAD ON WHICH RESULTED IN A HEAD ON COLLISION. THERE WAS A VEHICLE BEHIND CONSUMER'S VEHICLE WHICH SHE WAS PUSHED INTO DUE TO THE HEAD ON COLLISION. HOWEVER, UPON IMPACT, AIR BAGS DID NOT DEPLOY. CONSUMER SUSTAINED MAJOR INJURIES. *AK
10105341	CHEVROLET	RI A7ED	2001	2004-12-22	CONSUMER'S VEHICLE WAS INVOLVED IN A FRONT COLLISION AT 40 MPH DUE TO INCLEMENT WEATHER. UPON IMPACT, AIR BAGS DID NOT DEPLOY. CONSUMER CONTACTED THE MANUFACTURER. *AK
					VEHICLE SLIPPED WHILE TRAVELING ON ICE AT 55 MPH, CAUSING THE VEHICLE TO STRIKE A CONCRETE RETAINING WALL, AND IT ROLLED OVER. UPON IMPACT, AIR BAGS DID NOT
10106657	CHEVROLET	BLAZER BLAZER	2001	2004-12-25	DEPLOY.*AK  DT: CONTACT STATED THE AIR BAGS DID NOT DEPLOY IN A HEAD ON CRASH. WHILE TRAVELING AT ABOUT 60 MPH THE VEHICLE HYDRO PLANED. THE CONTACT LOST CONTROL OF THE VEHICLE AND CRASHED. THREE PEOPLE SUSTAINED INJURIES. A POLICE REPORT WAS TAKEN. THE DEALER WAS CONTACTED BUT OFFERED NO ASSISTANCE. THE MANUFACTURER INFORMED HER THEY HAVE A BUYER FOR THE VEHICLE, AND THEY OFFERED NO FREE REMEDY. VEHICLE WAS TOTALED.*AK
10174898	CHEVROLET		2001	2006-11-05	DT*: THE CONTACT STATED WHILE DRIVING 55 MPH, THERE WAS A MOMENTARY LOSS OF VEHICLE CONTROL, THE VEHICLE STRUCK A NEARBY TREE STUMP, AND THE AIRBAGS DID NOT DEPLOY. THE CONTACT WAS WEARING A SEAT BELT, BUT NO INJURIES WERE SUSTAINED. THERE WAS MODERATE DAMAGE TO THE FRONT OF THE VEHICLE. THE POLICE WERE ALERTED, AND A REPORT WAS TAKEN. THE MANUFACTURER WAS ALERTED.
		1			•

					MY DAUGHTER WAS IN A CAR CRASH. UNFORTUNATELY MY DAUGHTER WAS AT FAULT. SHE WAS
					GOING 55 MPH AND HIT A CAR THAT WAS STOPPED AT A LIGHT HER AIR BAG DID NOT DEPLOY.
10175892	CHEVROLET	BLAZER	2001	2001-12-04	SHE HAS NECK AND BACK PAINS. *JB
					A FRONTAL IMPACT OCCURRED AT 40 MPH AS ANOTHER MOTORIST PULLED OUT IN FRONT OF ME.  THE AIR BAGS DID NOT DEPLOY. THE FRONT DRIVER SEAT BELT DID NOT PROPERLY RESTRAIN ME
					AND I WAS FORCED INTO THE ROOF AT THE TRIM EDGE OF THE WINDSHIELD, SUSTAINING A
					MINOR SCALP LACERATION, CERVICAL DISC DAMAGE, AND A CONCUSSION. THE VEHICLE WAS
10184395	CHEVROLET	BLAZER	2001	2005-05-19	TOTALED BY NATIONWIDE INSURANCE. *JB
					TL* THE CONTACT OWNS A 2001 CHEVROLET BLAZER. THE CONTACT STATED THAT WHILE DRIVING
					40 MPH, THE CONTACT CRASHED INTO THE SIDE OF ANOTHER VEHICLE. THE CONTACT STATED
					THAT THE FORCE OF THE IMPACT CAUSED THE VEHICLE TO BOUNCE OFF THE SECOND VEHICLE. THE
					AIR BAGS DID NOT DEPLOY. THE PASSENGER SUSTAINED INJURIES TO THE LEFT ANKLE AND KNEES,
					AS WELL AS A BROKEN THUMB. THE CONTACT WAS TRANSPORTED TO THE HOSPITAL AS A PRECAUTIONARY MEASURE. THE VEHICLE WAS NOT INSPECTED FOR THE CAUSE OF FAILURE NOR
10454988	CHEVROLET	BLAZER	2001	2012-04-06	REPAIRED. THE FAILURE AND THE CURRENT MILEAGES WERE 122,000.
10 15 1500	01121110221	DE ILEX	2002	2012 01 00	CRASHED INTO 14FOOT UHAUL GOING ABOUT 65MPH AIR BAGS NEVER WORKED. PLEASE ADVISE!
752662	CHEVROLET	SILVERADO	2001	2001-09-22	*AK
754465	CHEVROLET	SILVERADO	2001	2001-08-04	A TWO IMPACT WRECK, WITH THE SECOND AT 55 MPH HIT HEAD ON, NO AIRBAG OR ONSTAR DEPLOYMENT. *AK
					DRIVER'S SIDE AIRBAG DID NOT DEPLOY DURING A FRONTAL IMPACT CRASH AT APPROXIMATELY
757639	CHEVROLET	SILVERADO	2001	2002-01-16	40 MPH.*AK
					NO AIRBAGS DEPLOYED DURING FRONTAL COLLISION AT 40 MPH CRASH. OCCUPANT OF OTHER VEHICLE HAD TO BE EXTRACATED FROM HER VEHICLE AND LIFE FLIGHTED TO MEDICAL
765623	CHEVROLET	SILVERADO	2001	2002-07-24	FACILITY.*AK
					CONSUMER'S VEHICLE REAR ENDED A BIG WEIGHT TRUCK AT APPORXIMATELY 65 MPH, AND
					NEITHER DRIVER'S SIDE NOR PASSENGER'S SIDE AIRBAGS DEPLOYED. DEALER HAS BEEN
894462	CHEVROLET	SILVERADO	2001	2001-08-04	EXAMINING THE VEHICLE.*AK  WHILE TRAVELING APPROXIMATELY 55 MPH, VEHICLE REAR ENDED A U-HAUL TRUCK THAT WAS
					ALSO IN MOTION. APPROXIMATELY \$4600.00 DAMAGE WAS DONE TO THE FRONT END OF
					VEHICLE, AND AIR BAGS FAILED TO DEPLOY. DEALERSHIP STATED THAT AIR BAGS FAILED TO
					DEPLOY BECAUSE BOTH VEHICLES WERE IN MOTION. PLEASE PROVIDE ANY ADDITIONAL
000075	CUEVDOLET	CHALDO	2001	2004 00 22	INFORMATION / ATTACHMENTS. *NOTE: DRIVER OF VEHICLE SUFFERED ARM, WRIST, AND LEG
896975	CHEVROLET	SILVERADO	2001	2001-09-22	INJURIES.*AK
					WHILE OPERATING VEHICLE IN WET ROAD CONDITIONS, AND TRAVELING APPROXIMATELY 50 TO
					55 MPH VEHICLE HYDROPLANED AND CRASHED INTO A CEMENT BARRIER. BOTH FRONTAL AIR
					BAGS FAILED TO DEPLOY. NO EXAMINATION OF THE VEHICLE HAS TAKEN PLACE TO DETERMINE A
899261	CHEVROLET	SILVERADO	2001	2001-10-11	CAUSE FOR THIS PROBLEM. *NOTE: DRIVER RECEIVED SEVERE FACIAL INJURIES. PLEASE PROVIDE ANY ADDITIONAL INFORMATION / DOCUMENTATION. *AK
					VEHICLE WAS INVOLVED IN 20-25 MPH FRONTAL COLLISION IN WHICH DRIVERS AND PASSENGERS
8001948	CHEVROLET	SILVERADO	2001	2002-01-07	AIR BAGS DID NOT DEPLOY, CAUSE UNKNOWN, DEALER HAS BEEN NOTIFIED. *AK*SLC FRONTAL IMPACT AT 65MPH TOTALLED VEHICLE; UPON IMPACT, AIR BAGS DIDN'T DEPLOY. DELAER
8002768	CHEVROLET	SILVERADO	2001	2002-01-16	WAS NOTIFIED.*AK
					CONSUMER HAD A HEAD-ON COLLISION AT 55 MPH AND NEITHER AIRBAG DEPLOYED. DRIVER AND
8004056	CHEVROLET	SILVERADO	2001	2002-02-05	PASSENGER SUFFERED CHEST/NECK AND LEG INJURIES. VEHICLE WAS TOTALLED.*AK CONSUMER STATES THAT A PERSON FROM THE OTHER VEHICLE WAS KILLED IN THE ACCIDENT. *SLC
0004030	CHEVROLET	SIEVERNIDO	2001	2002 02 03	WHILE DRIVING AT 55 MPH CONSUMER'S VEHICLE RAN INTO ANOTHER VEHICLE HEAD-ON, BUT
8004268	CHEVROLET	SILVERADO	2001	2002-02-17	NONE OF AIR BAGS DEPLOYED. HAS NOT CONTACTED DEALER.*AK
					VEHICLE WAS INVOLVED IN A FRONTAL COLLISION OF APPROXIMATELY 50 MPH, AND NEITHER FRONTAL AIR BAG DEPLOYED. DEALER / MANUFACURER WERE NOTIFIED. FEEL FREE TO PROVIDE
8005327	CHEVROLET	SILVERADO	2001	2002-02-27	ANY FURTHER INFORMATION.*AK
					CONSUMER STATES WHILE DRIVING 30-35 MPH WITHOUT WARNING OCCURRED IN A FRONTAL
8006559	CHEVROLET	SILVERADO	2001	2002-03-23	COLLISION THE AIR BAGS NOT DEPLOY CAUSING MINOR INJURIES. NLM
					WHILE TRAVELING ON HIGWAY HIT ANOTHER VEHICLE/ VEHICLE IN ANOTHER LANDE TO OVOID CAR HE HIT AND RAN INTO MERIDIAN STRIP. UPON IMPACT, DUAL AIRBAGS DIDN'T DEPLOY.
8009248	CHEVROLET	SILVERADO	2001	2002-03-06	DEALERSHIP WASAWARE OF PROBLEM.*AK
					WHILE DRIVING TRUCK AT 40 MPH VEHICLE INVOLVED IN A FRONTAL COLLISION WITH ANOTHER
					SPEEDING VEHICLE. UPON IMPACT, AIR BAGS FAILED TO DEPLOY. TRUCK WAS TAKEN TO
8012069	CHEVROLET	SILVERADO	2001	2002-06-08	DEALERSHIP ,AND THEY INFORMED OWNER THAT "THERE WAS NO REASON FOR AIR BAGS NOT TO DEPLOY". PLEASE DESCRIBE DETAILS. *AK
5012003	CHEVIOLET	SILVLIADO	2001	2002 00-00	IN A FRONTAL COLLISON WHILE DRIVING AT 60MPH NONE OF THE AIR BAGS DEPLOYED. VEHICLE
8012818	CHEVROLET	SILVERADO	2001	2002-06-08	HAD MAJOR DAMAGE. *AK
0017440	CHEVES: ==	CILVEDAGG	2001	2002 00 12	IN A FRONTAL COLLISION NONE OF THE AIR BAGS DEPLOYED ON IMPACT, CAUSING INJURIES TO
8017140	CHEVROLET	SILVERADO	2001	2002-08-18	DRIVER.*AK. ALSO THE PASSENGER WAS INJURED.*JB  CONSUMER STATES: WHILE DRIVING AT THE SPEED OF 45MPH WAS INVOLVED IN A FRONTAL
					COLLISION NEITHER AIR BAG DEPLOYED. DEALER HAS BEEN NOTIFIED. PLEASE PROVIDED ANY
10001355	CHEVROLET	SILVERADO	2001		ADDITIONAL IN FORMATION. TS
			-		•

	1				WHILE TRAVELING AT 65 MPH, CONSUMER STATES' ANOTHER DRIVER PULLED INFRONT AND
					CONSUMER HIT THAT VEHICLE ON ITS SIDE. NONE OF THE VEHICLES ARE BAGS DEPLOYED.
					CONSUMER FEELS THAT THIS COLLISION WAS A HARD IMPACT AND AIRBAGS SHOULD HAVE
10001771	CHEVROLET	SILVERADO	2001		DEPLOYED.
					CONSUMER WAS IN A ACCIDENT AND HIT A WALL AND THE AIR BAGS DIDN'T DEPLOY UPON
10006756	CHEVROLET	SILVERADO	2001	2003-01-30	CONTACT. PH
10020745	CHEVROLET	SILVERADO	2001	2003-05-23	FRONTAL IMPACT ON FREEWAY AT 45 MPH CHEVROLET, SILVERADO 4X4 TOTALED. AIRBAGS DID NOT DEPLOY UPON IMACT.*AK
10020743	CHEVROLLI	SILVLINADO	2001	2003-03-23	PROBLEM WITH AIRBAG SYSTEM ON 2001 CHEVROLET PICK UP TRUCK. *MR THE VEHICLE
					COLLIDED WITH A MOVING ANIMAL AND THE AIRBAG(S) DIDN'T DEPLOY. (THE ANIMAL WAS
					ABOUT SIX HUNDRED POUNDS AND THE CONSUMER HAD DRIVEN THE VEHICLE AT A NORMAL
10024534	CHEVROLET	SILVERADO	2001	2002-03-12	SPEED) *SCC *JB
					A 2001 CHEVY SILVERADO WAS STRUCK ON THE SIDE AND SENT INTO A TREE AT BETWEEN 30-35
10041290	CHEVROLET	SILVERADO	2001	2003-10-17	MPH. THERE WAS SIGNIFICANT FRONT END DAMAGE AND THE AIR BAGS DID NOT DEPLOY. *LA
10041290	CHEVROLLI	SILVLINADO	2001	2003-10-17	WHILE DRIVING AT 55 MPH CONSUMER LOST CONTROL OF VEHICLE WHILE TRAVELING UP A HILL.
					THEN VEHICLE STRUCK A WOODEN FENCE. ONE BEAM OF THE FENCE CAME THROUGH THE
					WINDSHIELD, STRIKING THE CONSUMER IN THE HEAD, EVENTUALLY KILLING HIM. ALSO, TWO
					PASSENGERS SUSTAINED INJURIES. IN THE CONFUSION, CONSUMER DEPRESSED THE GAS PEDAL
					INSTEAD OF THE BRAKES AND STRUCK A FIRE HYDRANT. ALL PASSENGERS AND THE CONSUMER
					WERE WEARING SEAT BELTS. HOWEVER, THE AIR BAGS DID NOT DEPLOY. POLICE ARRIVED ON THE
10042759	CHEVROLET	SILVERADO	2001	2000-12-31	SCENE AND MADE A REPORT. MANUFACTURER AND DEALER HAD BEEN NOTIFIED OF THE INCIDENT. *AK
10042733	CHEVILOLET	SILVENADO	2001	2000 12 31	LAWYER REPRESENTING CONSUMER WHO WAS INJURED WHEN THE DRIVER'S SIDE AIRBAG FAILED
10059656	CHEVROLET	SILVERADO	2001	2001-12-19	TO DEPLOY. *LA (LAWYER CLYDE JACKSON ON BEHALF OF CLIENT)* JB
					I WAS DRIVING EAST ON F.M. 356 AT ABOUT NOON. I WAS TRAVELLING ABOUT 50 MPH. A CAR
					TURNED IN FRONT OF ME AND I ATTEMPTED TO PASS THE CAR. I WAS UNABLE TO DUE TO
					ONCOMING TRAFFIC, SO I QUICKLY RETURNED TO MY LANE. ONE OF MY TIRES WENT OFF ONTO THE UNPAVED SHOULDER AND I WENT DOWN A SMALL EMBANKMENT. IT WAS MUDDY SO I
					COULD NOT STOP. I HIT A LARGE PINE TREE HEAD ON AND STOPPED. BOTH OF US WERE WEARING
					OUR SEATBELTS. MY AIRBAG FAILED TO DEPLOY CAUSING MY HEAD AND TORSO TO STRIKE THE
					STEERING WHEEL. I SUFFERED 6TH NERVE PAULSEY AND AN ANUERISM DEVELOPED ON MY
					AORTA. THE AORTA HAD TO BE SURGICALLY REPAIRED. MY GRANDDAUGHTER'S AIRBAG HAD
					BEEN TURNED OFF DUE TO HER SMALL SIZE. SHE SUFFERED A BROKEN LEG AND A SLIGHT
10072926	CHEVROLET	SILVERADO	2001	2001-12-19	CONCUSSION. THE TRUCK WAS TOTALLED. *AK
					WHILE DRIVING CONSUMER WAS TOWING A TRAILERTHE DRIVER'S SIDE REAR TIRE TREADS
					SEPARATED FROM THE TRAILER. CONSUMER WAS NOT ABLE TO MAINTAIN CONTROL OF THE
					VEHICLE, AND COLLIDED INTO A CONCRETE BARRIER. UPON IMPACT, BOTH FRONTAL AIR BAGS DID
					NOT DEPLOY. PASSENGER SUSTAINED HEAD INJURIES, AND WAS TRANSPORTED TO A HOSPITAL BY
10079979	CHEVROLET	SILVERADO	2001	2004-06-25	AN AMBULANCE. VEHICLE AND TRAILER WERE TOTALED. *AK *NM
					CONCUMENTS VEHICLE WAS DEAD ENDED WHILE DRIVING TO MAIL THE VEHICLE WAS FORCE INTO
					CONSUMER'S, VEHICLE WAS REAR ENDED WHILE DRIVING 50 MPH. THE VEHICLE WAS FORCE INTO A SPIN AND THEN, IT HIT A CONCRETE ROAD DIVIDER. UPON IMPACT, NEITHER FRONTAL AIR BAGS
					DEPLOYED. DRIVER SUSTAINED INJURIES, AND HAD TO BE TRANSPORTED TO A LOCAL HOSPITAL.
					DEALER AND MANUFACTURER WERE NOTIFIED. *AK THE CONSUMER STATED THAT THE SEAT
					BELT DID NOT KEEP HER FROM HITTING HER CHEST ON THE STEERING WHEEL. AFTER THE FRONT
10103512	CHEVROLET	SILVERADO	2001	2004-12-05	AND THE BACK OF THE VEHICLE HIT THE CONCRETE DIVIDER THE AIR BAGS DID NOT DEPLOY. *TC
					AIR BAGS FAILED TO DEPLOY IN A 45 MPH FRONT END COLLISION ON MY 2001 CHEVROLET
10107706	CHEVROLET	SILVERADO	2001	2004-12-29	SILVERADO. *NM
					WHILE TRAVELING AT 55 MPH CONSUMER LEFT THE FREEWAY AND STRUCK A LARGE PILE OF DIRT.
					UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. CONSUMER SUSTAINED HEAD AND BACK
10109017	CHEVROLET	SILVERADO	2001	2005-01-04	INJURIES. WAS TAKEN TO THE EMERGENCY ROOM. THE VEHICLE WAS TOTALED.*AK *AK
				1	THERE WAS AN ACCIDENT ON JUNE 1, 2005. UPON IMPACT, THE DRIVER'S SIDE FRONTAL AIRBAG
				1	FAILED TO DEPLOY. THE PASSENGER SIDE AIRBAG HAD BEEN TURNED OFF. THE DRIVER SUSTAINED
10120204	CHEVANOLET	CILVEDADO	2004	2005 00 01	MINOR INJURIES. THE CONSUMER REAR ENDED A TRAILER A POLICE REPORT WAS TAKEN. NO
10138394	CHEVROLET	SILVERADO	2001	2005-06-01	AIRBAG WARNING LIGHT CAME ON.*AK UPDATED 11/02/05. *JB

10553271 10627738 560449		SILVERADO SILVERADO SUBURBAN	2001 2001 2001	2013-11-14 2014-01-01	MY FIANCE AND I WERE DRIVING HOME AND AS WE ENTERED TOWN GOING APPROXIMATELY 35-45 MPH THE VEHICLE SWERVED OFF THE ROAD AND COLLIDED INTO A TELEPHONE POLE BREAKING IT IN HALF CAUSING THE TOP HALF OF THE TELEPHONE POLE TO SWING DOWN AND SMACK INTO THE WINDSHIELD. HE SMACKED HIS FACE OFF OF THE STEERING WHEEL AND I WAS LAYING DOWN ON THE SEAT AND ROLLED OFF AND BROKE THE ASHTRAY HOLDER WITH MY FACE. DURING THE IMPACT NOT A SINGLE AIRBAG DEPLOYED EVEN THOUGH THE AIRBAGS WERE ALL IN WORKING ORDER. THE IMPACT WAS SO SEVERE THAT THE TAILGATE OF THE TRUCK BENT OUTWARD, THE RADIATOR WAS RIPPED OUT FROM BENEATH THE VEHICLE AND THE FRONT PASSENGER SIDE WAS TOTALED. I WAS THEN PUT INTO A NECK BRACE, STRAPPED TO A GURNEY AND RUSHED TO THE HOSPITAL. I WILL REITERATE THE FACT THAT NONE OF THE AIRBAGS DEPLOYED CAUSING THE BOTH OF US TO BE INJURED. WE LUCKILY SURVIVED THE CRASH BUT HAD THE AIRBAGS DEPLOYED THE BOTH OF US WOULD HAVE SUFFERED MINIMAL INJURIES. *TR  I REAR ENDED SOMEONE GOING ABOUT 70 MPH AND MY AIR BAGS DID NOT DEPLOY. *TR  NO DEPLOYMENT OF THE AIR BAG DURING ACCIDENT CAUSING THE CONSUMER TO JAM HIS HAND ON THE STEERING WHEEL AND TO INJURE HIS BACK. NLM  FRONT AIRBAGS FAILED TO DEPLOY DURING A HEAD ON COLLISION AT 30 MPH. FINAL DAMAGE
747375	CHEVROLET	SUBURBAN	2001	2001-05-24	ESTIMATE UNKOWN DUE TO PENDING SAFETY INVESTIGATION. *AK
879983 8004064	CHEVROLET		2001	2000-12-27	COSNUMER WAS DRIVING AT APPROXIMATELY 35-40 MPH, WENT OFF ROAD TO AVOID ONCOMING VEHICLE, RAN INTO DITCH HEAD ON, AND HIT A TREE. VEHICLE WAS TOTALED. UPON IMPACT, DUAL AIRBAGS DID NOT DEPLOY, CAUSING MINOR INJURIES.*AK  CONSUMER HAD A FRONT COLLISION AT 35-40 MPH, AND NEITHER AIRBAG DEPLOYED.  CONSUMER SUFFERED NECK/ BACK AND KNEE INJURIES. VEHICLE AT DEALERSHIP AT THIS TIME. PLEASE ADD FURTHER DETAILS.*AK
8007135	CHEVROLET		2001	2001-11-26	WHILE DRIVING AT 45 MPH CONSUMER T BONED ANOTHER VEHICLE, AND THEN SPUN OUT OF CONTROL, AND RAN INTO A DITCH. UPON IMPACT, NONE OF THE AIR BAGS DEPLOYED. CONTACTED DEALER, AND THE DEALER WAS NOT WILLING TO DO ANYTHING. *AK *YH
8014347	CHEVROLET	SUBURBAN	2001	2002-07-10	AT 45MPH VEHICLE CRASHED. UPON IMPACT, AIRBAGS DID NOT DEPLOY. CAUSE UNKNOWN.  DEALER NOTIFIED.*AK
10017673	CHEVROLET	SUBURBAN	2001		THE VEHICLE WAS INVOLVED IN A FRONTAL COLLISION, AND THE NONE OF THE AIR BAGS DEPLOYED. *JB
10042734	CHEVROLET	SUBURBAN	2001	2003-09-27	WHILE DRIVING 60 MPH VEHICLE WAS INVOLVED IN A HEAD ON COLLISION AND AIR BAGS DID NOT DEPLOY. *AK
10046437	CHEVROLET	SUBURBAN	2001	2003-10-08	WHILE DRIVING, ANOTHER MOTORIST FAILED TO STOP AT A RED LIGHT AND THE CONSUMER HIT HIM ON THE PASSENGER'S SIDE AND THE AIR BAGS DID NOT DEPLOY. *AK *SC *JB  TL*THE CONTACT OWNS A 2001 CHEVROLET SUBURBAN. ON NOVEMBER 6, 2008, THE CONTACT
10248294	CHEVROLET	SUBURBAN	2001	2008-11-06	WAS INVOLVED IN A SERIOUS CRASH. THE AIR BAGS FAILED TO DEPLOY AND THE ENTIRE FRONT END AND PASSENGER SIDE OF THE VEHICLE WERE DAMAGED. THE VEHICLE WAS DESTROYED. THE CONTACT HAS PICTURES AND A POLICE REPORT. THERE WERE NO OTHER PASSENGERS IN THE VEHICLE AND THE CONTACT WAS WEARING HER SEAT BELT AT THE TIME. THERE WAS NO MAINTENANCE PERFORMED ON THE AIR BAGS PRIOR TO THE CRASH. THE SPEED WAS UNKNOWN. THE FAILURE MILEAGE WAS 100,000.  TL*THE CONTACT OWNS A 2001 CHEVROLET SUBURBAN. THE CONTACT STATED THAT ON MAY 18, 2010, WHILE DRIVING AT 45 MPH, THE VEHICLE COLLIDED WITH AN ONCOMING VEHICLE. THE AIR
10335493	CHEVROLET	SUBURBAN	2001	2010-05-18	BAGS DID NOT DEPLOY. THE VEHICLE SUSTAINED EXTENSIVE DAMAGES AND WAS TOWED FROM THE SCENE. THE CONTACT AND PASSENGERS SUSTAINED INJURIES AND WERE TAKEN TO THE HOSPITAL. A POLICE REPORT WAS FILED. THE CONTACT HAD NOT CALLED THE DEALERSHIP OR THE MANUFACTURER AT THE TIME OF THE COMPLAINT. THE FAILURE AND CURRENT MILEAGES WERE APPROXIMATELY 105,000.  MY SON WAS DRIVING AND REAR ENDED A MAN GOING APPROXIMATELY 50 MPH. THE FRONT
10731769	CHEVROLET	SUBURBAN	2001	2015-06-15	END SUSTAINED A GREAT DEAL OF DAMAGE, INCLUDING, BUT NOT LIMITED TO, THE ENGINE BEING PUSHED BACK SEVERAL INCHES. THE AIR BAGS DID NOT DEPLOY. MY SON SUSTAINED MINOR WHIPLASH TYPE INJURIES TO HIS NECK AND BACK.
10731772	CHEVROLET	SUBURBAN	2001	2015-06-18	TL* THE CONTACT OWNED A 2001 CHEVROLET SUBURBAN. WHILE DRIVING AT 55 MPH UPHILL, THE CONTACT DEPRESSED THE BRAKE PEDAL AND THE VEHICLE HYDROPLANED. AS A RESULT, THE CONTACT CRASHED INTO THE REAR OF A PICK-UP TRUCK. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED. THERE WAS ONE INJURY THAT REQUIRED MEDICAL ATTENTION. THE VEHICLE WAS DESTROYED AND TOWED TO AN INDEPENDENT MECHANIC. THE MANUFACTURER WAS NOT MADE AWARE OF THE FAILURE. THE FAILURE MILEAGE WAS 270,000.
					TAHOE WAS TRAVELING UPHILL ON PRIVATE GRAVEL DRIVE WHEN HIT BY TRUCK TRAVELING DOWNHILL AROUND BLIND CURVE. TRUCK WAS TRAVELING AT BETWEEN 20 AND 25 MPH WHEN IT HIT TAHOE. BOTH OF TRUCK'S AIRBAGS INFLATED. MY AIRBAGS DID NOT INFLATE, AND I HIT
764291	CHEVROLET	TAHOE	2001	2002-07-10	THE STEERING WHEEL WITH MY STOMACH AND CHEST.*AK

					LUT DV A DED LIGHT DUNNED (AF FOMADI) ON DRIVERS CORE WITH A SECOND CO. T. T. T.
					HIT BY A RED LIGHT RUNNER (45/50MPH) ON DRIVER'S SIDE, HIT A SECOND CAR, THEN A CONCRETE POST HEAD ON. NOT ONE OF THE FOUR AIR BAGS ENGAGED AT ANYTIME. THE CAR
					WAS TOTALED. I HAVE DOCUMENTATION, PICTURES, POLICE REPORT, AND HAVE CONTACTED
					CHEVY, THEY HAVE NO CLEAR RESPONSE ON WHY? IF YOU WOULD LIKE MORE DETAIL ON INJURES
					OR HAVE ANY QUESTION PLEASE FILL FREE TO CONTACT ME. THANK YOU FOR YOUR TIME,
766175	CHEVROLET	TAHOE	2001	2002-07-19	DANIELLE HURST-STONE. *AK
					VEHICLE WAS INVOLVED IN AN ACCIDENT WHILE TRAVELING AT 50 MPH WHEN VEHICLE T-BONED
					A VEHICLE CROSSING AN INTERSECTION. AIRBAGS FAILED TO DEPLOY. DEALERSHIP COULD NOT
					PROVIDE A REASON FOR FAILURE OF AIRBAGS TO DEPLOY. *AK THE MAUFACTURER INDICATED THAT THE VEHICLE SKIDDED 20 TO 25 FEET AFTER IMPACT AND THE AIR BAG FAILED TO DEPLOY
884576	CHEVROLET	TAHOE	2001	2001-03-21	FOR THIS REASON. THE CONSUMER DISAGREES. *YH
884370	CHEVROLET	TAHOL	2001	2001-03-21	DRIVER'S SIDE AND PASSENGER'S SIDE AIRBAGS FAILED TO DEPLOY IN A FRONT END COLLISION.
899507	CHEVROLET	TAHOE	2001	2001-11-01	DEALER HAS YET TO BE CONTACTED. PLEASE PROVIDE FURTHER DETAILS.*AK
					DRIVER AND PASSENGER FRONTAL AIRBAGS FAILED TO DEPLOY WHEN CONSUMER WAS INVOLVED
					IN A 40MPH FRONTAL COLLISION. DEALER HAS YET TO BE CONTACTED. PLEASE PROVIDE FURTHER
8000772	CHEVROLET	TAHOE	2001	2001-12-01	DETAILS.*AK
					WHILE TRAVELING ONTO ON INTERSECTION ANOTHER VEHICLE RAN THE RED LIGHT AND HIT
0047020	CUEVIDOLET	TALLOF	2004	2004 00 40	CONSUMER'S VEHICLE. UPON IMPACT, DUAL AIRBAGS DIDN'T DEPLOY. DEALERSHIP WAS AWARE OF
8017829	CHEVROLET	TAHOE	2001	2001-09-19	PROBLEM.*AK *YH  WHILE TRAVELING AT 35 MPH CONSUMER WAS HIT HEAD-ON, AND VEHICLE ALMOST TIPPED
					OVER. UPON IMPACT, FRONT AIR BAGS FAILED TO DEPLOY. PLEASE PROVIDE ANY FURTHER
8018113	CHEVROLET	TAHOE	2001	2002-04-05	INFORMATION.*AK
					THE VEHICLE WAS INVOLVED IN A FRONTAL COLLISION, AND NONE OF THE AIR BAGS DEPLOYED.
10018205	CHEVROLET	TAHOE	2001	2003-05-05	*NLM *PH *JB
					WHILE DRIVING 50 MPH, THE CONSUMER'S VEHICLE WAS INVOLVED IN A HEAD ON COLLISION.
					UPON IMPACT, THE AIRBAGS DID NOT DEPLOY. THE DRIVER SUSTAINED SEVERE HEAD INJURIES
10044753	CHEVROLET	TAHOE	2001	2003-10-12	AND WAS TAKEN TO A HOSPITAL. *AK *JB *NM
					WHILE DRIVING 40 MPH DRIVER HIT THE BRAKES SUDDENLY AND VEHICLE HIT THE CURB AND ROLLED TWICE. UPON IMPACT, AIRBAGS DID NOT DEPLOY. PEOPLE WERE EJECTED FROM THE
10046166	CHEVROLET	TAHOE	2001	2003-08-03	VEHICLE. AS A RESULT, THEY DIED. *AK
10046100	CHEVROLET	TAHOE	2001	2003-08-03	FRONTAL AIRBAGS DID NOT DEPLOY IN COLLISION. *AK
					I WAS DRIVINEG ON THE FREEWAY. THE CRUISE CONTROL WAS SET AT 70 MPH. IT WAS RAINING I
					WENT THROUGH A PUDDLE AND THE CAR HYDROPLANED AND HEADED TOWRD THE CONCRETE
					MEDIAN, IT WOULD NOT STRAIGHTEN AND I HIT THE MEDIAN HEAD ON. THE AIRBAGS DID NOT
10072577	CHEVROLET	TAHOE	2001	2004-04-30	DEPLOY.*AK
10148912	CHEVROLET	TAHOE	2001	2004-12-06	HEAD-ON COLLISION AT 50 MPH AND AIRBAGS DID NOT INFLATE.*AK
					DDIVING IN LARGE DARVING FOT ARREDOV 25 MARIA FIGUR DOLE WITH CONCRETE RASE WAS IN
					DRIVING IN LARGE PARKING LOT APPROX 25 MPH, LIGHT POLE WITH CONCRETE BASE WAS IN BLIND SPOT AS I WAS TURNING. HIT THE CONCRETE HEAD ON, \$12,000 WORTH OF DAMAGE TO
					MY TRUCK, FRAME BENT, FRONT END REPLACED AND THE AIR BAGS FAILED TO DEPLOY. THE
					DEALER HAD NO EXPLANATION OTHER THAN THE DAMAGE MUST HAVE BEEN IN JUST THE WRONG
10197689	CHEVROLET	TAHOE	2001	2003-11-03	SPOT. I WENT TO THE HOSPITAL WITH HEAD AND NECK INJURIES. *JB
10223626	CHEVROLET	TAHOE	2001	2008-03-28	AIRBAGS FAILED TO DEPLOY IN HEAD-ON CRASH. *TR
					I WAS INVOLVED IN A COLLISION IN MY 2001 CHEVROLET TAHOE WHERE I REAR ENDED A CAR. MY
					VEHICLE WAS TRAVELING 54 MPH AND THE OTHER VEHICLE WAS SLOWING TO TURN WITHOUT
10365882	CHEVROLET	TAHOE	2001	2010-11-12	BLINKERS OR BRAKE LIGHTS. MY AIRBAGS DID NOT DEPLOY. *TR
					A VEHICLE PULLED IN FRONT OF US AND OUR VEHICLE T BONED THAT VEHICLE. NONE OF ARE AIR BAGS DEPLOYED. WE WERE INJURED. THAT PERSON'S INSURANCE COMPANY CONTACTED US THE
					DAY AFTER THE ACCIDENT AND QUESTIONED WHY THE AIR BAGS DID NOT COME OUT? WE
10607227	CHEVROLET	TAHOE	2001	2007-07-04	WANTED TO KNOW WHY ALSO. *TR
					THE VEHICLE AIRBAGS FAILED TO DEPLOY IN ACCIDENT WERE IT RECEIVED SEVERE FRONT END
10783656	CHEVROLET	TAHOE	2001	2015-10-16	DAMAGE.
					TL* THE CONTACT OWNS A 2001 CHEVROLET TAHOE. WHILE DRIVING AT 45 MPH, ANOTHER
					VEHICLE FAILED TO YIELD AND THE CONTACT CRASHED INTO THE DRIVER SIDE OF THAT VEHICLE.
					THE AIR BAGS FAILED TO DEPLOY. THE CONTACT DID NOT SUSTAIN ANY INJURIES. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOWED TO AN AUTO BODY REPAIR CENTER FOR BODY REPAIRS, BUT
					WAS NOT DIAGNOSED FOR THE AIR BAG FAILURE. THREE YEARS LATER, WHILE DRIVING 25 MPH,
					THE CONTACT CRASHED INTO AN ANIMAL AND THEN INTO A GUARDRAIL. THE AIR BAGS FAILED TO
					DEPLOY. THE CONTACT SUSTAINED BACK INJURIES THAT REQUIRED MEDICAL ATTENTION. A POLICE
					REPORT WAS FILED. THE VEHICLE WAS TOWED TO AN AUTO BODY REPAIR CENTER, BUT WAS NOT
					DIAGNOSED OR REPAIRED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE
10820375	CHEVROLET	TAHOE	2001	2014-01-18	MILEAGE WAS 120,000. THE VIN WAS UNAVAILABLE.
					WHILE TRAVELING AT 45 TO 50 MPH ANOTHER VEHICLE IN FRONT SLAMMED ON VEHICLE'S
					BRAKES, AND CONSUMER'S VEHICLE REAR ENDED THE OTHER VEHICLE. NONE OF AIRBAGS
					DEPLOYED, AND DRIVERS SIDE SEATBELT FAILED TO LOCK. CONSUMER WAS INJURED BY STEERING
891862	CHEVROLET	TRACKER	2001	2001-07-02	WHEEL. CONSUMER HAD VEHICLE TOWED TO DEALER. PLEASE PROVIDE ANY FURTHER INFORMATION.*AK
03100Z	CHEVNOLET	INACKER	2001	2001-07-02	IN AN ACCIDENT, VEHICLE HIT A POLE AND UPON IMPACT AIRBAGS DID NOT DEPLOY, CAUSING
8011220	CHEVROLET	TRACKER	2001	2002-05-28	MINOR INJURIES TO DRIVER.*AK *YH
					<u> </u>

					CONSUMER STATED WHILE DRIVING AT NORMAL SPEED AND WEARING SEAT BELT HAD A FRONT COLLISION ,AND NEITHER OF THE AIR BAGS DEPLOYED. NO WARNING LIGHT APPEARED PRIOR TO
10033620	CHEVROLET	TRACKER	2001	2003-08-11	THE CRASH. POLICE REPORT AND PICTURES ARE AVAILABLE. *AK
10000020	0.127110221	THE CONTENT	2001	2000 00 11	WHILE DRIVING 50 MPH DRIVER STRUCK A DEER HEAD ON. UPON IMPACT, DRIVER SIDE AIRBAG
					DIDN'T DEPLOY. THE DRIVER SUSTAINED SLIGHT INJURIES FROM MAKING CONTACT WITH THE
10033912	CHEVROLET	TRACKER	2001		STEERING WHEEL. *AK
					TL*THE CONTACT OWNS A 2001 CHEVROLET TRACKER. WHILE DRIVING 40 MPH ON A MAJOR
					HIGHWAY, THE CONTACT CRASHED INTO ANOTHER VEHICLE THAT WAS STOPPED IN THE ROAD.
					THE AIR BAGS FAILED TO DEPLOY. THE VEHICLE WAS DESTROYED. THE CONTACT WAS INJURED
					AND TRANSPORTED TO THE HOSPITAL. A POLICE REPORT WAS FILED. THE CURRENT AND FAILURE
10226797	CHEVROLET	TRACKER	2001	2008-04-17	MILEAGES WERE 130,000.
					DRIVER OF VEHICLE WHILE TRAVELING 35 MPH HIT A FORD F150 THAT MADE A U-TURN FROM THE
					RIGHT SHOULDER OF THE ROAD. DRIVER DID NOT HAVE TIME TO HIT BRAKES. AIRBAG DID NOT
10263033	CHEVROLET	TRACKER	2001	2009-02-01	DEPLOY. DRIVER WAS INJURED. *TR
					AIRBAG DID NOT DEPLOY ON CHEVY TRACKER 2001 AFTER BEING REAR ENDED AT 100 MPH WHILE
10298267	CHEVROLET	TRACKER	2001	2010-01-03	TRAVELING AT A SPEED OF 69 MPH AND HIT THE CENTER DIVIDER HEAD ON. *TR
					AT A 25MPH VEHICLE CRASHED AND AIRBAGS DID NOT DEPLOY. CAUSE UNKNOWN DEALER
8014453	CHEVROLET	TRAILBLAZER	2001		NOTIFIED.*AK
					WHILE DRIVING APPROXIMATELY 58 MPH IN RAINY WEATHER WITH A TRAILER ATTACHED, TRAILER
					STARTED TO FISHTAIL WHILE GOING DOWN HILL. TRAILER HAD SWUNG AROUND AND BROKE
					FREE OF THE HITCH AND HIT THE SIDE OF TRUCK. TRUCK GRAZED AN ENBANKMENT, AND WENT INTO THE MEDIUM STRIP, HITTING ANOTHER VEHICLE HEAD ON. VEHICLE WAS TOTALED, AND
					DRIVER SUFFERED A HEAD INJURY AND FRACTURED VERTEBRATE. NEITHER AIR BAG DEPLOYED
8018335	CHEVROLET	TRAILBLAZER	2001		UPON THE FRONTAL IMPACT. PLEASE DESCRIBE DETAILS. *AK
0010333	CHEVROLET	INAILDLAZEK	2001		THE VEHICLE HAS BEEN INVOLVED IN TWO ACCIDENTS IN WHICH NEITHER TIME DID THE AIR BAGS
					DEPLOY, DURING ONE ACCIDENT THE CONSUMER SAYS SHE ALSO DOESN'T REMEMBER THE SEAT
					BELT TIGHTENING CAUSING HER TO STRICK HER HEAD ON THE STEERING WHEEL AND KNEES TO HIT
566304	GMC	YUKON	2001		THE DASH. *MJ
					VEHICLE INVOLVED IN A FRONTAL COLLISION AT APPROXIMATELY 75 MPH WITH A FORD ESCORT.
					UPON IMPACT, BOTH AIR BAGS DID NOT DEPLOY. PASSENGER SUSTAINED A BACK INJURY, AND
					DRIVER RECEIVED BRUISES TO NECK AND HEAD. DEALER NOTIFIED. FEEL FREE TO PROVIDE ANY
878870	GMC	YUKON	2001	2000-12-23	FURTHER DETAILS ON THIS MATTER. *AK
					VEHICLE INVOLVED IN A FRONTAL COLLISION WITH A DODGE, NEON , SPEED WAS UNDETERMINED.
					UPON IMPACT, BOTH AIR BAGS DID NOT DEPLOY. DEALER / MANUFACTURER NOTIFIED, AND NO
					RESPONSE WAS RECEIVED. PLEASE FEEL FREE TO PROVIDE ANY FURTHER DETAILS ON THIS MATTER.
883017	GMC	YUKON	2001	2000-10-17	*AK
					WHILE DRIVING VEHICLE WAS INVOLVED IN AN ACCIDENT, AIR BAGS DID NOT DEPLOY. *AK THE
					CONSUMER STATED THAT THE VEHICLE WAS HIT VERY HARD. THE IMPACT DAMAGED THE
					INSTRUMENT PANEL, BROKE THE WINDSHIELD, AND THE FRONT AND REAR PASSENGER DOORS
6900594	GMC	YUKON	2001	2001-09-18	NEEDED REPAIR. *YH
0004440	CNAC	WIII/ON	2004		CONSUMER WAS INVOLVED IN A FRONT END COLLISION AT 70MPH, AND FRONTAL AIR BAGS DID  NOT TO DEPLOY. PASSENGER SUSTAINED MAJOR BODY INJURIES.*AK
8004110	GMC	YUKON	2001		NOT TO DEPLOT. PASSENGER SUSTAINED WAJOR BODY INJURIES. AK
					WHILE DRIVING 2 MPH VEHICLE WAS STRUCK ON DRIVER'S DOOR, CAUSING EXTENSIVE DAMAGE
					TO FRONT END AS WELL. NEITHER AIRBAG DEPLOYED. CONSUMER SUFFERED HEAD INJURIES.
					DAMAGE TO VEHICLE WAS \$ 10000.00. PRIOR TO THIS, CONSUMER OWNED ANOTHER VEHICLE
8004365	GMC	YUKON	2001	2001-12-04	JUST LIKE THIS ONE. IT ALSO HAD A FRONT CRASH AND AIRBAGS DID NOT DEPLOY. *AK
					WHILE TURNING LEFT AT 15 MPH\ ANOTHER VEHICLE TRAVELING AT 45 HIT CONSUMER'S VEHICLE
					ON FRONT DRIVER'S SIDE . UPON IMPACT, AIRBAGS DID NOT DEPLOY. PLEASE PROVIDE ANY
8006721	GMC	YUKON	2001	2002-03-30	FURTHER INFORMATION.*AK
					THE CONSUMER WAS APPROACHING AN INTERSECTION AND WITHOUT WARNING, ANOTHER
					DRIVER CUT IN FRONT OF THE CONSUMER VEHILCE. THE DRIVER APPLIED THE BRAKES, BUT THE
					PEDAL WENT TO THE FLOOR. THIS CAUSED THE OTHER VEHICLE TO COLLIDE INTO ON THE
					PASSENGER 'S SIDE AND PUSHED THE VEHICLE INTO A TREE. BOTH FRONTAL AIR BAGS DID NOT
					DEPLOY. THE DRIVER SUSTAINED INJURIES AND WAS TRANSPORTED BY AMBULANCE TO THE
					HOSPITAL. THE VEHICLE WAS TOWED TO THE DEALER. PLEASE FILL IN ADDITIONAL INFORMATION.
10099161	GMC	YUKON	2001	2004-11-01	*JB
					TL* - THE CONTACT OWNS A 2001 GMC YUKON WITH A CURRENT AND FAILURE MILEAGE OF
					110,000 MILES. THE CONTACT'S VEHICLE WAS INVOLVED IN A CRASH WHILE DRIVING AT 35 MPH,
					AND THE AIR BAGS DID NOT DEPLOY. THE CRASH TOOK PLACE ON A DRY DAY. THE DRIVER BEGAN
					CHOKING AND PASSED OUT. THE VEHICLE THEN RAN INTO THE BACK OF A TRUCK SITTING AT A
10107003	CMC	VIIKON	2001	2007 02 20	STOP LIGHT. THE FRONT OF THE CONTACTS VEHICLE WAS DAMAGED. THE VEHICLE WAS TOWED
10187683	GMC	YUKON	2001	2007-03-29	TO DEALER. *AK
					LETTER FROM SENATOR SCOTT ON BEHALF OF CONSTITUENT RE GMC YUKON. *SMD THE
10587988	GMC	YUKON	2001	2011-05-04	CONSUMERS HUSBAND WAS KILLED IN AN ACCIDENT, AND THE AIR BAG DID NOT DEPLOY. *JB
10307300	CIVIC	IORON	2001	2011 03-04	CONSUMERS HOSDAND WAS KILLED IN AN ACCIDENT, AND THE AIR DAG DID NOT DEFECT. JB

		1		1	
					INITIALLY TRAVELING AT 75 MPH N/B ON HWY 99 IN FRESNO COUNTY, LOST VISION (MEDICAL
					INCIDENT), WIFE INSISTED I PULL OVER. STRUCK GUARD RAIL ON RIGHT SIDE OF ROAD. SECOND
					TRY TO PULL OVER CAUSED MY VEHICLE TO IMPACT A VERIZON JUNCTION BOX AND THEN150 FEET
					OF SIX-FOOT CHAIN-LINK FENCING WITH ANTI-CLIMB GUARDS THAT CAME OFF THE FENCE AND
					SHATTERED THE WINDSHIELD. THE AIR BAGS DID NOT DEPLOY. MY INSURANCE AGENT TOLD ME
					HE WAS GOING TO REPORT THIS INCIDENT TO YOU, BUT SINCE I HAVEN'T HEARD ANYTHING FROM
					YOU FOLK I'VE ASSUMED MY AGENT DID NOT FOLLOW THROUGH. MY WIFE AND I SUSTAINED
10706540	GMC	YUKON XL	2001	2014-10-17	
10706540	GIVIC	YUKUN XL	2001	2014-10-17	ONLY MINOR INJURIES FROM FLYING GLASS. WE HAVE PHOTO'S OF THE VEHICLE. *TR  DT: THERE WAS AN ACCIDENT AND NO AIRBAGS DEPLOYED. THE CAR WAS EQUIPPED WITH FRONT
					AIR BAGS. THERE WAS NO WARNING LIGHTS ON TO INDICATE A PROBLEM, LAST TIME THE CAR
					WAS CHECKED THERE WAS NO INDICATION OF A PROBLEM. THE DRIVER WAS THE ONLY PERSON
10127108	ISUZU	RODEO	2001	2005-06-30	INJURED WITH A TOOTH KNOCKED OUT.*AK
1012/108	13020	KODEO	2001	2003-00-30	I HAD A BLOW OUT ON MY 2001 ISUZU RODEO, CAUSING MY VEHICLE TO GO OFF THE ROAD TO
					THE RIGHT RUNNING INTO ANOTHER VEHICLE. THE SEAT BELT CAME OFF, THE AIRBAGS DID NOT
					WORK. I SUSTAINED HEAD INJURIES CAUSING SEIZURES, A DISPLAYED SHOULDER, AND A
					FRACTURED JAW. DUE TO THE HEAD INJURIES I WAS UNCONSCIOUS AND UNABLE TO KEEP
10155648	ISUZU	RODEO	2001	2006-03-11	CONTROL OF THE VEHICLE. *NM
10133046	13020	KODEO	2001	2000-03-11	TL*THE CONTACT OWNS A 2001 ISUZU RODEO. WHILE DRIVING 65 MPH WITH THE CRUISE
					CONTROL ACTIVATED, THE CONTACT WAS INVOLVED IN A HIGH IMPACT VEHICLE CRASH. THE
					MEDIAN ON THE HIGHWAY SUSTAINED PROPERTY DAMAGE. THE VEHICLE WAS DESTROYED. THE
					AIR BAGS FAILED TO DEPLOY. THE DEALER HAS NOT BEEN NOTIFIED. THE CONTACT SUSTAINED
					MODERATE INJURIES TO HIS NECK AND SHOULDERS. A POLICE REPORT WAS FILED. THE CURRENT
					AND FAILURE MILEAGES WERE 97,000. THE CONSUMER PROVIDED PICTURES OF THE VEHICLE.
10106917	1011711	PODEO	2001	2007 07 12	UPDATED 09/06/07 *TR
10196817	ISUZU	RODEO	2001	2007-07-12	I WAS TURNING ONTO A STREET. THE STREET WAS COVERED IN OIL OR SOME TYPE OF SLICK
10569283	ISUZU	RODEO	2001	2014-03-13	ELEMENT. I SKIDDED AND FELL INTO A DITCH. MY AIRBAG DID NOT DEPLOY. *TR
10309283	13020	RODEO	2001	2014-03-13	ELEMENT. I SKIDDED AND FELL INTO A DITCH. WIT AIRBAG DID NOT DEPLOT. TR
					WHILE DRIVING AT 30 MPH VEHICLE WAS INVOLVED IN A HEAD ON COLLISION AND AIRBAGS DID
10001710	CADILLAC	ESCALADE	2000	2002-12-05	NOT DEPLOY. DEALER CONTACTED. PLEASE PROVIDE ADDITIONAL INFORMATION. TS
10001710	CADILLAC	ESCALADE	2000	2002-12-03	THE CONSUMER HAD AN ACCIDENT THE AIR BAG DIDN'T DEPLOY. *DT
10004423	CADILLAC	ESCALADE	2000	2002-12-11	CONSUMER WAS TRAVELING 30MPH WHILE IT WAS RAINING THAT EVENING, AND THERE WAS A
					SCHOOL BUS IN FRONT OF CONSUMER'S VEHICLE. CONSUMER APPLIED BRAKES AND HIT THE
					SCHOOL BUS FROM BEHIND. THE COLLISION IMPACT WAS SO HARD THAT VEHICLE MOVED THE
859836	CHEVROLET	ASTRO	2000	2000-04-04	SCHOOL BUS. ALSO, THE DUAL AIRBAGS DIDN'T DEPLOY AT ALL. *AK
033030	CHEVROLLI	ASTRO	2000	2000 04 04	WHILE DRIVING 55 MPH AND MAKING A TURN HAD A FRONTAL IMPACT. FRONT BUMPER WAS
					SMASHED AND FELL OFF. ALSO, DRIVER'S AND PASSENGER'S AIRBAGS DID NOT DEPLOY, WHICH
					DID NOT PROTECT OCCUPANTS IN THIS CRASH. DEALER WAS NOT WILLING TO ASSIST
870742	CHEVROLET	ASTRO	2000	2000-09-01	CONSUMER. PLEASE PROVIDE FURTHER INFORMATION.*AK
070742	CHEVROLET	risine	2000	2000 03 01	WHILE DRIVING ABOUT 30 MPH CRASHED INTO ANOTHER VEHICLE THAT CROSSED IN FRONT.
					UPON IMPACT, BOTH AIR BAGS FAILED TO DEPLOY. CURRENTLY, COMPANY WAS CONCERNED
878344	CHEVROLET	ASTRO	2000	2001-01-17	ABOUT PROBLEM WITH AIR BAGS. *AK
0,0011	GIIZ TITOLE I	7.511.6	2000	2002 01 27	A FRONTAL COLLISION AT 20 MPH IMPACT WITH A TREE, AND BOTH AIR BAGS DID NOT DEPLOY.
					DRIVER SUSTAINED CHEST INJURY. VEHICLE AT BODY SHOP. PLEASE FEEL FREE TO PROVIDE ANY
879113	CHEVROLET	ASTRO	2000	2000-12-11	FURTHER DETAILS ON THIS MATTER. *AK
0/3113	CHEVROLLI	ristite	2000	2000 12 11	CONSUMER WAS INVOLVED IN A FRONTAL COLLISION IN WHICH DRIVER'S AND PASSENGER'S AIR
882467	CHEVROLET	ASTRO	2000		BAGS DID NOT DEPLOY. PLEASE GIVE ANY FURTHER DETAILS.*AK
002 107	CHETHOLE:	7.511.6	2000		WHILE TRAVELING AT 65 MPH, CONSUMER RAN INTO THE SIDE OF ANOTHER VEHICLE, HEAD-ON,
					UPON IMPACT NEITHER AIR BAG DEPLOYED, CONSUMER CONTACTED DEALER, AND THEY WERE
8000775	CHEVROLET	ASTRO	2000	2001-12-12	NOT WILLING TO DO ANYTHING. *AK *JG
					CONSUMER HAD A HEAD ON COLLISION AND AIR BAGS DID NOT DEPLOY. CONSUMER WAS
8001716	CHEVROLET	ASTRO	2000	2002-01-01	INJURED. *AK *JB
			1.550		CONSUMER STATES THAT WHILE ON AN EXPRESS WAY, CONSUMER REAR ENDED A TANKER TRUCK.
					CONSUMERS VEHICLE WAS TOTALLED. CONSUMER STATES' NONE OF THE VEHICLES AIRBAGS
8022460	CHEVROLET	ASTRO	2000	2002-11-07	DEPLOYED. PLEASE PROVIDE ANY FURTHER INFORMATION. TS
			2000		CHECY ASTRO CARGO VAN 2000, FRONTAL COLLISION RESULTING IN TOTAL LOSS BY INSURANCE
10051329	CHEVROLET	ASTRO	2000	2003-12-16	CARRIER. NEITHER FRONT AIR BAG OPERATED.
	O. I. FRIOLET				
736342	CHEVROLET	BLAZER	2000	2000-07-21	IN A HEAD-ON COLLISION WITH A GUARDRAIL, BOTH FRONT AIR BAGS FAILED TO DEPLOY.*AK
					CONSUMER WAS DRIVING AT APPROXIMATELY 30-35 MPH ,AND TO AVOID A CRASH CONSUMER
					RAN INTO A TREE HEAD-ON. UPON IMPACT, DUAL AIRBAGS DID NOT DEPLOY, CAUSING
877186	CHEVROLET	BLAZER	2000		INJURIES.*AK
	5				
					CONSUMER STATES AT A 25MPH VEHICLE CRASHED, HOWEVER THE AIRBAGS DID NOT DEPLOY.
					CAUSE UNKNOWN. DEALER NOTIFIED.*JB CONSUMER ADDS VEHICLE WAS STRUCK HEAD ON BY
					AN OUT OF CONTROL VEHICLE TRAVELING 45 MILES. THE RIGHT FRONT FENDER CONTACTED
					SQUARELY AGAINST CONSUMERS FRONT BUMPER. RESULTING IMPACT TOTALLED CONSUMERS
8013283	CHEVROLET	BLAZFR	2000	2002-07-02	BLAZER. INSPECTORS WERE AMAZED THAT AIR BAGS DID NOT DEPLOY. *TT
		1	2000	111111111111111111111111111111111111111	
					WHILE DRIVING 25-30 MPH AND WITHOUT WARNING INVOLVED IN A HEAD-ON COLLISION. UPON
8014195	CHEVROLET	BLAZER	2000		IMPACT, AIR BAGS DID NOT DEPLOY. DEALER HAS BEEN NOTIFIED.*AK THERE WERE 2 INJURIES. *YH
			12000		,

					WHILE DRIVING 25 MPH ANDWITHOUT WARNING A HEAD ON COLLISION OCCURRED. UPON
8015817	CHEVROLET	BLAZER	2000		IMPACT, AIR BAGS DID NOT DEPLOY, AND DRIVER SUSTAINED MINOR INJURIES.*AK
8022825	CHEVROLET	BLAZER	2000	2002-11-01	FRONT CRASH AT 40 MPH, VEHICLE HIT A TREE. NEITHER AIRBAG DEPLOYED, DRIVER SUFFERED MINOR INJURIES. AMOUNT OF DAMAGE UNKNOWN AT THIS TIME. TS
10006273	CHEVROLET	BLAZER	2000	2003-02-01	VEHICLE WAS IN A FRONTAL COLLISION, BUT NONE OF THE AIRBAG DEPLOYED UPON IMPACT. THE DRIVER SUSTAINED HEAD, NECK AND BACK INJURIES. PLEASE PROVIDE MORE DETAILS.
					THE VEHICLE WAS INVOLVED IN A FRONTAL ACCIDENT, AND NONE OF THE AIR BAGS DEPLOYED.
10014969	CHEVROLET	BLAZER	2000	2003-03-15	*JB WHILE DRIVING 45 MPH THE VEHICLE WAS INVOLVED IN A COLLISION BUT THE AIR BAGS DID NOT
10015762	CHEVROLET	BLAZER	2000	2003-04-12	DEPLOY. *NLM
					HEAD ON COLLISION WITH SOLID CEMENT BRIDGE AT 40+ MPH. AIR BAGS DID NOT DEPLOY, SEAT BELTS DID NOT LOCK IN PLACE ON IMPACT NOR DURING ROLL OVER ON MY 2000 CHEVY BLAZER.
10016961	CHEVROLET	BLAZER	2000	2003-04-08	*JB
10059300	CHEVROLET	BLAZER	2000	2004-02-07	WHILE DRIVING 45 MPH THE DRIVER DROVE OVER SOME BLACK ICE AND LOST CONTROL OF THE VEHICLE. THE VEHICLE RAN INTO AN EMBANKMENT HEAD ON. THE CONSUMER STATED THAT NEITHER OF THE FRONTAL AIR BAGS DEPLOYED. THE CONSUMER CONTACTED THE DEALER. *NM
10106730	CHEVROLET	BLAZER	2000	2004-12-14	WHILE DRIVING 55 MPH THE CONSUMER WAS INVOLVED IN FRONTAL COLLISION. UPON IMPACT, THE AIR BAGS DID NOT DEPLOY. THE DRIVER SUSTAINED MAJOR NECK,BACK, AND HIP INJURIES. THE VEHICLE WAS TOTALED. *AK (SEE ALSO ODI REF. NO. 10106755 - SAME VEHICLE) *MJJ *TC
10108627	CHEVROLET	BLAZER	2000	2005-01-18	THE TRUCK SLID ON A PATCH OF ICE 100 YARDS AFTER MERGING ONTO THE INNER STATE. THIS RESULTED IN THE CONSUMER LOSING CONTROL OF THE TRUCK. THE TRUCK FRONT DRIVER SIDE IMPACTED A CONCRETE BRIDGE; THEN SWUNG AROUND; THE REAR DRIVER SIDE HIT THE BRIDGE; THIS THREW THE TRUCK INTO THE RIGHT HAND LANE, INTO THE GUARD RAIL, IMPACTING THE FRONT PASSENGER SIDE; THEN THE TRUCK BOUNCED TO THE LEFT HAND LANE AND IMPACTED THE GUARD RAIL HEAD ON. NONE OF THE AIR BAGS DEPLOYED UPON IMPACT. THE DRIVER SUSTAINED SEVERE INJURIES TO THEIR NECK, BACK, AND LEFT SHOULDER. *NM
					T-BONE COLLISION, APPROXIMATELY 45 MPH. FRONT END OF VEHICLE BADLY DAMAGED. NO
10132243	CHEVROLET	BLAZER	2000	2005-08-06	AIRBAG DEPLOYMENT. *NM
10226626	CHEVROLET	BI AZER	2000	2008-04-30	THE CONTACT'S SPOUSE OWNS THE 2000 CHEVROLET BLAZER. THE CONTRACT STATE THAT THIS DAUGHTER WAS DRIVING APPROXIMATELY 30 MPH, THEN SHE HIT A DIVIDER AND THE VEHICLE ROLLED OVER SEVERAL TIMES LANDING ON THE DRIVERS SIDE OF THE VEHICLE. NEITHER AIR BAR DEPLOYED. THE DRIVER WAS INJURIES AND THE VEHICLE WAS TOTALED BY THE INSURANCE COMPANY. THE CURRENT AND FAILURE MILEAGE IS 85210. JP
10220020	CHEVILOLET	DEVIEEN	2000	2000 04 30	HAD A FRONT END COLLISION. THE FRONT END WAS DESTROYED. NO AIR BAGS WENT OFF. BOTH VEHICLES CAME OFF A RED LIGHT, ALL VEHICLES STOPPED SUDDENLY AND MY TEUCK REAR ENDED
10609197	CHEVROLET	BLAZER	2000	2013-07-10	A TOYOTA PICKUP. *TR
10693647	CHEVROLET	BLAZER	2000	2015-01-31	TL* THE CONTACT OWNED A 2000 CHEVROLET BLAZER. WHILE DRIVING AT APPROXIMATELY 45 MPH, THE VEHICLE CRASHED HEAD ON INTO ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. A POLICE REPORT WAS FILED AND NO INJURIES WERE REPORTED. THE VEHICLE WAS DESTROYED. THE MANUFACTURER WAS NOTIFIED OF THE FAILURE. THE FAILURE MILEAGE WAS 120,650.
					A CAR ATTEMPTED TO TURN IN FRONT OF US, HE DID NOT MAKE IT. WE WERE TRAVELING BETWEEN 38-40 MPH WHEN WE HIT THE OTHER VEHICLE HEAD ON. AIRBAGS DID NOT DEPLOY ON EITHER SIDE OF THE VEHICLE. THE TRUCK WAS TOTAL LOSS. THE OTHER PARTY'S VEHICLE ALSO
731125	CHEVROLET	SILVERADO	2000	1999-10-23	WAS A. *AK
77460-				2000 03 13	I CONTACTED SARAH SCHILLE OF GENERAL MOTORS ABOUT THIS FAILURE.SHE SENT AN INVESTIGATOR TO TOM BENSON TO LOOK AT THE TRUCK. HE DID WHATEVER HE DOES TO COLLECT DATA FROM THE VEHICLE AND THEN TAKES PICTURES ETC. AND SENDS ALL OF THE INFORMATION TO GM FOR EVALUATION. I FEEL THIS ACCIDENT WAS SEVERE ENOUGH FOR THE AIRBAGS DEPLOY AND I'M NOT SATISFIED AT ALL WITH GM'S RESPONSE TO THE SITUATION. I REQUESTED THE REPORT AND A COPY OF THE DEPLOYMENT CRITERIA FOR THE AIRBAGS I WAS TOLD THAT INFORMATION WILL NOT BE SUPPLIED. HOW AM I TO KNOW IF THIS IS A FAILURE OR NOT. THIS INFORMATION SHOULD NOT BE PRIVATE TO THE MANUFACTURER ONLY. I WANT SOMEONE TO
734605	CHEVROLET	SILVERADO	2000	2000-09-19	LOOK INTO THIS PROBLEM.
739117	CHEVROLET	SILVERADO	2000	2001-01-02	HIT A GUARD RAIL HEAD ON, WENT OVER IT AND NOSE DIVED INTO A 10FT. DEEP DITCH, FLIPPING ONTO THE ROOF. NEITHER AIRBAG DEPLOYED AFTER HITTING THE FRONT END TWICE.*AK
					MY 2000 CHEVROLET SILVERADO TRUCK WAS INVOLVED IN A HEAD-ON COLLISION ON MAY 19, 01. VEHICHLE WAS TRAVELING AT APPROXIMATELY 40 MPH. WHEN VEHICHLE WAS STRUCK HEAD-ON AND KNOCKED APPROXIMATELY 23 FT. BACKWARDS ONTO THE SHOULDER OF ROADWAY. UPON IMPACT DRIVER SIDE AIRBAG DID NOT DEPLOY. DRIVER OF TRUCK RECIEVED CONTUSIONS, ABRASIONS, AND BRUISING RESULTING FROM CONTACT WITH STEERING COLUMN AND DASH
745943	CHEVROLET	SILVERADO	2000	2001-05-19	PANEL. BOTH VEHICHLES INVOLVED IN CRASH WERE DETERMINED TO BE TOTAL LOSSES.*AK

THE DRIVER, DAKOTA KANETZKY, HAD NUMERO	EAD ON INTO A TREE, THE AIRBAGS DID NOT DEPLOY. COUS FACIAL FRACTURES CAUSED WHEN HIS HEAD HOSPITALIZED FOR 5 DAYS AND IS STILL UNDER A
766686 CHEVROLET SILVERADO 2000 2002-08-22 DOCTOR'S CARE.*AK 767253 CHEVROLET SILVERADO 2000 AIR BAGS DID NOT DEPLOY ON RIGHT FRONT C	HOSPITALIZED FOR 5 DAYS AND IS STILL UNDER A
767253 CHEVROLET SILVERADO 2000 AIR BAGS DID NOT DEPLOY ON RIGHT FRONT C	
HEADING SOUTH ON HIGHWAY US 1, TRAVELIN	•
VEHICLE COMING NORTH TURNED IN FRONT A	NG 55MPH WITH CRUISE CONTROL ON, ANOTHER AND CONSUMER HIT VEHICLE ON THE SIDE. UPON
	PLOY. CONTACTED DEALER, AND HE WAS NOT ABLE
860353 CHEVROLET SILVERADO 2000 2000-01-19 TO HELP. *AK	EGIT CONTINETED DEFICEIN, FIND THE WIGHT NOT TIBLE
DRIVER HAD LOST CONTROL OF VEHICLE HIT A	A TELEPHONE POLE HEAD-ON WITH A 50-65 MPH
	ON IMPACT, DUAL AIRBAGS DID NOT DEPLOY, BUT
SEATBELTS WERE ON AT THE TIME. AS A RESUIT	•
871368 CHEVROLET SILVERADO 2000 2000-09-08 DRIVER HAD MILD WHIPLASH.PLEASE PROVIDE CONSUMER WAS INVOLVED IN 55 MPH FRONT	
	O, FRONT END WAS HEAVILY DAMAGED. PLEASE
872110 CHEVROLET SILVERADO 2000 GIVE ANY FURTHER DETAILS.*AK	o,
VEHICLE WAS INVOLVED IN A FRONTAL COLLIS	SION WITH A TREE AT 20 MPH, AND BOTH AIR BAGS
DID NOT DEPLOY. DEALER/MANUFACTURER W	VERE NOT NOTIFIED AT THIS TIME. PLEASE FEEL FREE
872528 CHEVROLET SILVERADO 2000 2000-04-29 TO PROVIDE ANY FURTHER DETAILS. *AK	
	REAR ENDED ANOTHER VEHICLE. UPON IMPACT,
878288 CHEVROLET SILVERADO 2000 DRIVER'S AIR BAG DID NOT DEPLOY. *AK  CONSLIMER WAS TRAVELING AT APPROXIMATE	ELY 60 MPH WHEN A TRAFFIC JAM AHEAD OF HIM
	D ATTEMPTED TO SLOW DOWN. BRAKES FAILED TO
	EHICLE IN FRONT OF HIM ON FRONT DRIVERS SIDE
OF VEHICLE. BOTH FRONTAL AIRBAGS FAILED	TO DEPLOY. PLEASE PROVIDE ANY ADDITIONAL
886000 CHEVROLET SILVERADO 2000 2001-04-08 INFORMATION/ATTACHMENTS.*AK	
WAS TRAVELING 60MPH AND LOST CONTROL	
	LE WENT AIR BORNE AFTER STRADDLING. DRIVEWAY R, THEN FLIPPED ON TOP. AIR BAGS FAILED TO
887723 CHEVROLET SILVERADO 2000 2001-04-23 DEPLOY, DRIVER SUFFERED INJURIES AND WAS	
	o noon meneral na
WHILE TRAVELING AT APPROXIMATELY 45 TO 5	50 MPH VEHICLE IMPACTED ANOTHER VEHICLE,
	ONT OF TRUCK. UPON IMPACT, DRIVER'S AIR BAG
	AG WAS TURNED OFF. INSURANCE COMPANY WAS
	E ANY ADDITIONAL INFORMATION/ATTACHMENTS.
891918 CHEVROLET SILVERADO 2000 2001-06-13 *DRIVER EXPERIENCED NECK INJURIES AND ST	IFF NECK : AK
HEAD COLLISION AT 60-65MPH, AND AIR BAGS	S DID NOT DEPLOY. THERE WAS NO PRIOR WARNING.
892771 CHEVROLET SILVERADO 2000 2001-06-28 CONTACTED MANUFACTURER, AND MANUFA	ACTURER WAS NOT WILLING TO DO ANYTHING.*AK
	AND AIRBAGS DID NOT DEPLOY. DAMAGED FRONT
893040 CHEVROLET SILVERADO 2000 2001-06-25 END OF TRUCK. CONTACTED DEALER. *AK	ON THE HAVANA AND THERE WAS ON ON THE HAVE
	ON HIGHWAY AND THERE WAS OIL ON HIGHWAY.  AND IT HIT A GUARDRAIL. UPON IMPACT, DRIVER'S
· ·	/AS AWARE OF PROOBLEM. *AK DRIVER RECEIVED
895573 CHEVROLET SILVERADO 2000 2001-08-29 BACK AND NECK INJURIES. *SLC	ASTRONOMY AND
CONSUMER STATED VEHICLE WAS INVOLVED IT	IN A FRONTAL CRASH OF 30 MPH, AND THE AIR BAGS
DID NOT DEPLOY, DEALER DID NOT CHECK VEH	HICLE, BECAUSE GM WOULD NOT GIVE THEM
8001868 CHEVROLET SILVERADO 2000 2001-12-18 PERMISSION. *AK *JG	
WHILE DRIVING, VEHICLE WAS INVOLVED IN AN	the state of the s
8001872 CHEVROLET SILVERADO 2000 2001-12-11 DRIVER/PASSENGER SIDE DID NOT DEPLOY, DR	MIVER WAS INJURED. 'AK 'IT
WHILE DRIVING WAS HIT HEAD-ON BY ANOTHE	ER VEHICLE AND BOTH DRIVER AND PASSENGERS
	DRIVING APPROXIMATELY 30MPH ,AND THE OTHER
8014186 CHEVROLET SILVERADO 2000 2002-07-03 VEHICLE WAS DRIVING APPROXIMATELY 40-50	
IN A FRONTAL COLLISION, VEHICLE ROLLED 4 T	TIMES. UPON IMPACT, NONE OF THE AIR BAGS
8016756 CHEVROLET SILVERADO 2000 2002-08-04 DEPLOYED.*AK	SION WITH A TREE LIDON IN ADACT AID DACC DID NOT
	SION WITH A TREE, UPON IMPACT AIR BAGS DID NOT IATELY 40MPH.*AK CONSUMER STATED THE ROAD
	S CAUGHT IN A WASHOUT, CONSUMER TRIED TO
	ERCORECTED, THE VEHICLE THEN BEGAN TO FISHTAIL
	OSS THE HIGHWAY AND HIT A TREE, THE DRIVER
8017393 CHEVROLET SILVERADO 2000 2002-08-25 SUFFERED INJURIES.*JB	
	OF VEHICLE AND HIT A CONCRETE DIVIDER, VEHICLE
WAS AIRBORNE AND LANDED ON DRIVER'S SID   8017521   CHEVROLET   SILVERADO   2000   2002-08-01   CONSUMER SUSTAINED LEG INJURY. PLEASE P	
CONSCIPLINATE PREVENTED 2000 2002-00-01 CONSCIPLINATION LLG INJUNT. FLEASE P	THOUSE AND FORTHER IN ORIVIATION. AR
UPON A FRONTAL IMPACT AT ESTIMATED SPEE	ED OF 55 MPH, NEITHER DUAL AIR BAG DEPLOYED.
	DEPLOY IN CERTAIN SITUATIONS. OWNER HAS
8018038 CHEVROLET SILVERADO 2000 RECEIVED A RECALL NOTICE FOR AIR BAGS. PL	LEASE DESCRIBE DETAILS. *AK

10137048	CHEVROLET	SILVERADO	2000	2005-09-11	DT: CONSUMER'S VEHICLE WAS INVOLVED IN A CAR ACCIDENT ON SEPTEMBER 11, 2005 WHILE DRIVING 50-55 MPH. IT WAS A HEAD ON COLLISION. UPON IMPACT, DRIVER'S SIDE AIR BAG DID NOT DEPLOY. THE CONSUMER HAD NOT CONTACTED THE DEALER OR MANUFACTURER. *AK
10170031	CHEVROLET	JILVENADU	2000	2003-07-01	
10122067 10128831	CHEVROLET	SILVERADO SILVERADO	2000	2005-03-19 2005-07-01	REPORT) NO AIRBAG DEPLOYMENT OF EITHER VEHICLE.  AIR BAGS DID NOT DEPLOY UPON IMPACT
					TRUCKS. ESTIMATED IMPACT SPEED 90 MPH ( 60 MPH VEHICLE 2, 30 MPH VEHICLE 1 PER CHP
10120946	CHEVROLET	SILVERADO	2000	2005-05-06	YARD AND WE ARE AWAITING THE RESPONSE FROM THE INSURANCE ADJUSTOR.  OFF CENTER HEAD ON CRASH WITH 2 SIMILAR 2000 CHEVY SILVERADO EXTENDED CAB PICK UP
					DO NOT UNDERSTAND WHY WE WERE NEVER NOTIFIED OF THIS. THE TRUCK IS NOW IN A STORAGE
					FOR THE AIRBAG MODULE ON THE YEAR OF MY 2000 CHEVROLET SILVERADO TRUCK. WE WERE NEVER NOTIFIED OF THIS BEFORE THE INCIDENT, BUT ARE CURRENTLY RECEIVING UPDATES TODAY.
					WHEEL. MY WIFE CHECKED THE INTERNET AFTER THE INCIDENT AND FOUND THERE WAS A RECALL FOR THE AIRRAG MODULE ON THE YEAR OF MY 2000 CHEVROLET SUVERADO TRUCK WE WERE
					PASSENGER AIRBAG MODULES, ALSO THE STEERING WHEEL BENT RESEMBLING AN AIRPLANE
					I WAS IN A HEAD ON COLLISION AND RECEIVED A COMPOUND FRACTURE TO MY RIGHT FEMUR BONE, 2 BLACK EYES AND FRACTURED RIBS DUE TO THE INACTIVATION OF THE DRIVERS AND
					LWAS IN A HEAD ON COLLISION AND RECEIVED A COMMODING SO ACTURE TO ANY RIGHT SET WAS
10113830	CHEVROLET	SILVERADO	2000	2005-03-08	PROVIDED BY RICKY'S WIFE KAREN FLIMP. *AK
					IMPACT, BOTH FRONTAL AIR BAGS FAILED TO DEPLOY. VEHICLE WAS TOWED TO A GARAGE FOR INSPECTION. THE CAUSE HAD NOT BEEN DETERMINED AT THIS TIME. THIS INFORMATION WAS
					WHILE DRIVING 20 MPH CONSUMER'S VEHICLE WAS INVOLVED IN A FRONTAL COLLISION. UPON
10111181	CHEVROLET	SILVERADO	2000	2004-12-23	MANUFACTURER WERE NOTIFIED. *AK
					AND WAS TRANSPORTED TO THE LOCAL HOSPITAL BY AMBULANCE. DEALER AND
					WAS INVOLVED IN A REAR END COLLISION, IT CRASHED INTO ANOTHER VEHICLE IN FRONT AT 50 MPH. UPON IMPACT, NEITHER FRONTAL AIR BAG DEPLOYED. CONSUMER SUSTAINE DINJURIES,
					RECALL CAMPAIGN 02V078 00 CONCERNING AIR BAG SENSING MODULE. CONSUMER'S VEHICLE
10108404	CHEVROLET	SILVERADO	2000	2005-01-11	LOCATION OF THE TRUCK SO IT CAN BE INSPECTED.*AK
					SOFTWARE SCREWUP SOMETHING NOT HOOKED UP RIGHT IN THE AIRBAG SYSTEM ETC). I HAVE PICS OF THE TRUCK AND THE CRASH SITE I CAN SEND IF NECESSARY. I CAN ALSO PROVIDE THE
					WILL AT LEAST BE INVESTIGATED TO MAKE SURE THIS IS NOT A SYSTEMIC PROBLEM (I.E.
					LATER 7 WEEKS PREMATURE. AS FOR WHAT WAS DONE TO CORRECT THE PROBLEM I'M HOPING IT
					IN THE LOWER LEG/ANKLE. AS A RESULT OF THE WATER BREAKING MY SON WAS BORN 3 DAYS
					BLOOD AROUND THE BRAIN, A BROKE CHEEK BONE, AND FRACTURED HIP. MY WIFE WAS 33 WEEKS PREGANANT AT THE TIME AND HER WATER BROKE AND SHE GOT A COMPOUND FRACTURE
					DEPLOYED (THE TRUCK IS TOTALLED). I HIT THE STEERING WHEEL AND GOT A CONCUSSION WITH
					THAN 30 MPH INTO A DIRT WALL IN WHICH NEITHER THE DRIVER'S NOR PASSENGER'S AIRBAGS
					VEHICLE (2000 CHEVY SILVERADO). THEN MY TRUCK HAD A FULL FRONTAL IMPACT AT GREATER
					THE EVENT WAS A CAR PULLED OUT IN FRONT OF ME WHICH STILL HIT THE DRIVER'S SIDE OF MY
10101301	CHEVROLET	SILVERADO	2000	2004-11-02	WAS NOT WILLING TO ASSIST THE CONSUMER. *AK
					UPON IMPACT, AIR BAGS DID NOT DEPLOY. RECALL 02V178000 WAS ISSUED. MANUFACTURER
100101	CHETROLLI	SIEVENADO	2000	2007 00 22	CONSUMER'S VEHICLE WAS INVOLVED IN A HEAD ON COLLISION WHILE DRIVING AT 25-30 MPH.
10081392	CHEVROLET	SILVERADO	2000	2004-06-22	SHOULDER, CHEST, BACK AND HIPS.
					AIR BAGS DID NOT DEPLOY. *AK BOTH THE DRIVER AND THE PASSENGER SUSTAINED INJURIES.  THE DRIVER INJURED HIS NECK, BACK, HIPS AND PELVIS. THE PASSENGER INJURED HER RIGHT
					PUSHING CONSUMER'S VEHICLE OFF ROAD AND INTO A DITCH, FRONT END FIRST. UPON IMPACT,
				33 20	WHILE DRIVING 45-55 MPH CONSUMER'S VEHICLE WAS REAR-END BY A TRACTOR TRAILER.
10045511	CHEVROLET	SILVERADO	2000	2003-09-28	ABOUT 40-45 MPH, AND NEITHER AIR BAG DEPLOYED. I WAS SHIFTED IN THE VEHICLE AND HAVE KNEE AND BACK PROBLEMS. *LA
					I REARENDED A VEHICLE THAT WAS SITTING STILL IN THE MIDDLE OF THE ROAD, I WAS TRAVELING
10044432	CHEVROLET	SILVERADO	2000		40 MPH. DRIVER WAS INJURED. *AK
	CHETROLLI	SIEVEI (ADO	2000	2003 07 17	AIR BAGS DID NOT DEPLOY WHEN VEHICLE STRUCK A TREE HEAD ON. VEHICLE WAS TRAVELING AT
10029556	CHEVROLET	SILVERADO	2000	2003-07-17	WHILE DRIVING AT 45MPH CONSUMER HAD A FRONT COLLISION ,AND NEITHER OF THE FRONT BAGS DEPLOYED. *AK
10027230	CHEVROLET	SILVERADO	2000	2003-06-16	SIDE SEAT BELT DIDN'T RETRACT.*AK *PH *JB
					THE AIR BAGS DEPLOYED UPON IMPACT. DRIVER IMPACTED THE STEERING WHEEL, AND DRIVER'S
10022039	CHEVROLET	SILVEKADU	2000	2003-04-11	CONSUMER WAS INJURED. *AK *TS *JB  THE VEHICLE WAS INVOLVED IN A FRONTAL COLLISION WHILE DRIVING AT 40 MPH AND NONE OF
10022039	CHEADOLET	CILVEDADO	2000	2002 04 14	THE VEHICLE WAS INVOLVED IN FRONTAL COLLISION, AND THE AIR BAGS FAILED TO DEPLOY. THE
10008151	CHEVROLET	SILVERADO	2000	2003-02-16	THE VEHICLE WAS INVOLVED IN AN ACCIDENT, AND THE AIR BAG FAILED TO DEPLOY.*JB
10003902		SILVERADO	2000	2003-01-26	AIR BAGS FAILED TO DEPLOY FROM FRONTAL IMPACT DURING MOTOR VEHICLE ACCIDENT
8023044 10005962	CHEVROLET		2000	2002-11-06	PROVIDE MORE DETAILS. TS  AIR BAGS FAILED TO DEPLOY IN A COLLISION, RESULTING IN A FATALITY. *AK *JB
8033044	CHEVAOUET	SILVEDADO	2000	2002-11 06	OF THE OCCUPANTS IN THE VEHICLE WERE SERIOUSLY INJURED AT TIME OF THE ACCIDENT. PLEASE PROVIDE MORE DETAILS. TS
					VEHICLE WAS IN A FRONT COLLISON AND NONE OF THE AIR BAGS DEPLOYED UPON IMPACT. NONE
8022592	CHEVROLET	SILVERADO	2000	2002-09-28	VEHICLE. CONSUMER STATES VEHICLE SLAMMED INTO A TREE AND NONE OF THE AIRBAGS DEPLOYED. PLEASE PROVIDE ANY FURTHER INFORMATION. MR

	1	1		T	
10139984	CHEVROLET	SILVERADO	2000	2005-06-17	DT: THE CONTACT'S SON WAS INVOLVED IN AN ACCIDENT ON 6-17-05. THE CONTACT RECEIVED A COPY OF THE CRASH REPORT. UPON IMPACT, NEITHER AIR BAG DEPLOYED. THE VEHICLE HIT SEVERAL TREES. THE POLICE REPORT STATED THE SPEED LIMIT WAS 55 MPH. THE PASSENGER'S HEAD WENT THROUGH THE WINDSHIELD, BUT PASSENGER WAS NOT SERIOUSLY HURT. NEITHER THE DRIVER NOR THE PASSENGER HAD TO GO TO THE HOSPITAL. THE CONTACT REPORTED THAT AIR BAG LIGHT ILLUMINATED IN THE CAR PRIOR TO THE INCIDENT. THE INSURANCE COMPANY HAS BEEN NOTIFIED. THE TRUCK WAS TOTALED. THE CONTACT TOOK PICTURES OF THE PINE TREE THAT WAS EMBEDDED IN THE HOOD. UPDATED 11/15/05. *JB  TL*THE CONTACT OWNS A 2000 CHEVROLET SILVERADO. WHILE DRIVING 30 MPH HE DEPRESSED THE BRAKES AND CRASHED INTO THE VEHICLE IN FRONT OF HIM. THE AIR BAGS DID NOT DEPLOY. THE FRONT SEAT PASSENGER SUSTAINED A LACERATED SPLEEN AND CONTUSION OF THE HEART. A COMPLAINT WAS SUBMITTED TO THE MANUFACTURER (COMPLAINT # 71-546827970). THE CURRENT AND FAILURE MILEAGES WERE 128,000. UPDATED 02-01-08 *BF UPDATED 02/01/08 *TR
			2000		CONSUMER STATES THAT AIRBAGS DID NOT DEPLOY DURING ACCIDENT IN A 2000 CHEVROLET
10328507	CHEVROLET	SILVERADO	2000	1901-01-01	SILVERADO CAUSING SERIOUS INJURY. *GR
878851	CHEVROLET	SUBURBAN	2000	2000-12-11	VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AT 60MPH. UPON IMPACT, AIRBAGS DID NOT DEPLOY. VEHICLE ROLLED OVER, AND VEHICLE EXPLODED. THERE WERE MINOR INJURIES.*AK
676631	CHEVROLLI	JOBORDAN	2000	2000-12-11	WHILE DRIVING AT 25 MPH AN ACCIDENT OCCURRED, AND SEATBELT DID NOT TIGHTEN/ AIRBAG
8002321	CHEVROLET	SUBURBAN	2000		DID NOT DEPLOY PLEASE PROVIDE ANY FURTHER INFORMATION, AND IDENTIFICATION NUMBER.*AK
8017775	CHEVROLET		2000		A TIRE SHEARED OFF, ANOTHER TRUCK CROSSING MEDIAN BEGAN HEADING STRAIGHT TO CONSUMER'S VEHICLE. DRIVER ATTEMPTED TO MANUEVER, BUT RAN OFF THE ROAD. UPON FRONTAL OFF CENTERED IMPACT AT 60 MPH, AND DUAL AIR BAGS FAILED TO DEPLOY.*AK
557967 563859	CHEVROLET	ТАНОЕ	2000	2000-09-01	RIGHT FRONT TIRE (NO MAKE OR MODEL PROVIDED) EXPERIENCED A BLOWOUT, CAUSING THE VEHICLE TO GO OFF THE ROAD, COME BACK ONTO THE ROADWAY, AND CRASH INTO A CEMENT WALL, THE CONSUMER STATED THAT HE BELIEVED THE BACK RIGHT TIRE EXPERIENCED A BLOWOUT AS WELL, DURING THE CRASH THE AIRBAG EXPERIENCED A NO DEPLOYMENT, ONE PERSON WAS INJURED DUE TO THE INCIDENT. (OHIO TRAFFIC CRASH REPORT) *SLC  THE CONSUMER WAS INVOLVED IN A MAJOR ACCIDENT BUT THE DRIVER SIDE AIR BAGS FAILED TO DEPLOY. THE CONSUMER SUFFERED INJURIES. *YH
567545 740413	CHEVROLET	TAHOE	2000	2000-11-11	CONSUMER WAS IN TWO ACCIDENTS. ONE IN NOVEMER OF 2000 AND THE OTHER IN SEPTEMBER OF 2002. THE AIR BAGS DID NOT DEPLOY IN EITHER INCIDENT. CONSUMER DESCRIBED THE INCIDENTS TO A REPRESENTATIVE OF GENERAL MOTORS. CONSUMER WAS INFORMED THAT THE AIR BAGS SHOULD NOT HAVE DEPLOYED, IN THE FIRST ACCIDENT THERE WAS ONE INJURY, IN THE SECOND ACCIDENT, THERE WERE TWO INJURIES. *JG  HEAD ON COLLISION, IMPACT ON FRONT RIGHT SIDE, HIT AND SHEARED IN HALF A WOODEN UTILITY POLE, NO AIR BAG DEPLOYMENT ON EITHER SIDE, BUMPER IS CURLED UNDER FRONT END OF VEHICLE. *AK
767411 8018021	CHEVROLET	TAHOE TAHOE	2000	2001-11-11	ON NOVEMBER 11,2000 I HAD A HEAD ON COLLISION (NOT MY FAULT) AND THE AIRBAGS DIDN'T DEPLOY. THEN ON SEPT 1,02 WE HAD A ACCIDENT ON INTERSTATE 95 THAT WE TOTALED THE TAHOE AND THE BODY SHOP CALLED GM SINCE THE AIRBAGS DIDN'T DEPLOY AGAIN. MR. LATTERMERE FROM GM CALLLED ME AND TOLD ME OVER THE PHONE AFTER I DESCRIBE THE ACCIDENT TO HIM THAT, AS HE DREW A PICTURE ON PAPER, "THAT THE AIR BAGS SHOULDN'T HAVE DEPLOYED". I FIND IT VERY DIFFICULT THAT A PERSON CAN DRAW A PICTURE AND TELL ME THIS. I WOULD LIKE FOR YOUR ORGANIZATION TO INSPECT THIS VECHILE AND RETRIEVE THE COMPUTER INFORMATION AND LET ME KNOW WHAT YOU THINK. GM SENT AN "INDEPEDENT" INSPECTOR OUT TO DO A REPORT BUT I HAVE NOTHING FROM HIM OR GM ON THE FINDING. I HAVE LEFT MESSAGES FOR MR. LATTERMERE TO CALL ME TO NO AVAIL.*AK  CONSUMER STATES WHILE DRIVING 55MPH HIT CONCRETE DIVIDER AND AIR BAGS DID NOT DEPLOY.*B
3013021	CHEVROLLI	7,1101	2000	2002 05 01	
10111305	CHEVROLET	TAHOE	2000	2005-01-02	WHILE DRIVING CONSUMER HIT A PATCH OF ICE WHICH SENT THE VEHICLE SLIDING, AND CAUSING AN ACCIDENT. HOWEVER, THE AIR BAGS DID NOT DEPLOY, AND CONSUMER WAS INJURED. CONSUMER CONTACTED THE DEALER, AND MANUFACTURER. *AK CONSUMER FEELS THAT MUCH OF THE PAIN AND SUFFERING MIGHT HAVE BEEN PREVENTED BY THE PROTECTION OF THE 4 AIR BAGS IN THIS TAHOE-NONE OF WHICH DEPLOYED UPON AN IMPACT THAT CRUSHED THE FRONT OF THE VEHICLE. JAMMED TH EFRONT PASENGER DOOR WHICH CONSUMER COULD NOT OPEN, AND BENT THE CAR'S FRAME BEYOND REPAIR. *BF
10150002	CHEVROLET	TAHOE	2000	2006-02-08	I WAS RECENTLY IN AN ACCIDENT AND MY 2 CHILDREN WERE IN THE VEHICLE WITH ME. I WAS IN A 5 CAR WRECK IN WHICH MY VEHICLE, AND THE ONE IN FRONT OF ME WERE TOTALED. UPON IMPACT ON THE FRONT OF MY TRUCK, MY AIR BAGS DIDN'T DEPLOY NOR DID MY SEAT BELTS LOCK. MY 11 YR OLD HIT HIS HEAD ON THE DASH, REQUIRING IMMEDIATE MEDICAL ATTENTION FOR A SEVERE LACERATION WHICH REQUIRED STITCHES. I LEARNED FROM GMC THERE WAS A RECALL ON MY TRUCK FOR AIR BAG MALFUNCTIONS AND I WAS NEVER NOTIFIED. *NM

11.1 THE CONTACT OWNS A 2000 CREVROLET TARIOE. WHILE THE CONTACT'S SON WAS DRIVING AD MMH, HE CREAMED BITO A VEHICLE THAT RAY A RED LIGHT. THE ARE BASE DID NOT DEPOTY. THE CONTACT'S SON WISTAND TO THE EMBREACY SOON TWO SEPARATE TIMES. A POLUCE REPORT WAS PIELD. THE VEHICLE WAS TOWN ENCY EARLY THE REQUIRED MEDICAL ATTENTION. THE CONTACT'S SON WENT TO THE EMBREACY GOOD TWO SEPARATE TIMES. A POLUCE REPORT WAS PIELD. THE VEHICLE WAS TOWN END TO A TOW YARD THE REQUIRED MEDICAL ATTENTION. THE CONTACT'S SON WENT TO THE EMBREACY GOOD TWO SEPARATE TIMES. A POLUCE REPORT WAS PIELD. THE VEHICLE WAS TOWN END TO TOWN YARD THE OTHER THE VEHICLE WAS TOWN END TO TOWN YARD THE OTHER THE VEHICLE WAS TOWN END TO TOWN YARD THE PIELD THE AUGUST WHICH WHICH CAN SHAPE THE PIELDER MILE AND THE WAS UNKNOWN.  11.1904777 CHEVROLET TRACKER  2000 200-06-28  2000-06-28  2000-06-28  2000-06-29  2000-07-22  2000-06-29  2000-07-29  2000-		1			1	
MPH, HE CRASHED INTO A VEHICLE THAT RAN A RED IJENT. THE AR RAGES DID OF DEPLOY, THE CONTACT'S SON SUSTAINED CHEST, LOWER BEACK, AND INCESS THAT REQUIRED MEDICAL ATTENTION. THE CONTACT'S SON WENT TO THE EMERICAN THAT REQUIRED MEDICAL ATTENTION. THE CONTACT'S SON WENT TO THE EMERICAN TOWN TWO STAPE THE CONTACT WAS WAITING FOR HABLIZED INFORMATION FROM THE INSURANCE COMPANY TO DETERMINE IT THE VEHICLE WESTOTIALD. THE PERLIP EMERICAN TO TOWN THE MEDICAL COMPANY TO DETERMINE IT THE VEHICLE WESTOTIALD. THE PERLIP EMERICAN TOWN THE MEDICAL COMPANY TO THE CAUSE OF THE FAILURE WAS TOTALD. THE PERLIP EMERICAN FOR THE MEDICAL COMPANY TO THE CAUSE OF THE FAILURE WAS TOTALD. THE PERLIP EMERICAN THE MEDICAL COMPANY TO THE CAUSE OF THE FAILURE WAS TOTALD. THE PERLIP EMERICAN THE MEDICAL COMPANY THE CRASH. NO PRIOR PROGREMS WITH THE RIBAGE SYSTEM. "AN" "MIL."  DRIVING AT APPROXIMATELY 50 MPH DRIVER SWERVED TO AVOID HITTING ANOTHER VEHICLE AND LOSS TOWNTON. VEHICLE WEST NOOTHER FOR FOR ARE DON'S THE TOWN THE RESPONSIVE THE WORLD AND LOSS TOWN THE CRASH. THE PERLIP HAS TO AVOID HITTING ANOTHER VEHICLE WAS INVOICED IN A FRONTAL COLLISION WITH A 1395 S28, DRIVE, SYSTEM AND LOSS TOWNTON. AND SON THE CRASH TO AVOID HITTING ANOTHER VEHICLE WAS INVOICED IN A FRONTAL COLLISION WITH A 1395 S28, DRIVE, SYSTEM AND AVOID THE PERLIP HAS TOWN THE PERLIP	10249443	CHEVROLET	TAHOE	2000	2008-11-05	THE VEHICLE CRASHED INTO A LAMP POST THAT WAS SURROUNDED BY CEMENT. THE FRONT END WAS PUSHED IN, WHICH CAUSED THE ENGINE TO SHIFT. THE AIR BAGS FAILED TO DEPLOY AND THE DRIVER SUSTAINED INJURIES TO HIS BACK AND NECK. THE VEHICLE WAS TOWED TO A LOCAL REPAIR SHOP AND THE MECHANIC STATED THAT THE AIR BAGS SHOULD HAVE DEPLOYED. THE DEALER WAS NOT NOTIFIED. THE MANUFACTURER FILED A CASE AND STATED THAT THEY WOULD
WATING FOR FINALIZED INFORMATION FROM THE INSURANCE COMPANY TO DETERMINE IF THE VEHICLE WAS TOTALED. THE CAUSE OF THE FAILURE WAS NOT DETERMINED. THE FAILURE WAS NOT DETERMINED. THE FAILURE WAS UND CONTROL OF THE FAILURE WAS NOT DETERMINED. THE FAILURE WAS UND WITHOUT ON THE PROPERTY AND PASSENGER SHARED DO NOT DETERMINED. THE FAILURE WAS NOT PROVIDED FROM THE RIBAGE OF THE FAILURE WAS NOT DETERMINED. THE FAILURE WAS NOT PROVIDED FROM THE RIBAGE OF THE FAILURE WAS NOT PROVIDED FROM THE RIBAGE OF THE FAILURE WAS NOT DETERMINED. AND DETERMINED. THE BEAT THE RIGHT FRONT PASSENGER'S SIDE, AND CONTINUED ON FOR A BLOCK WAS NOT TOTED. VEHICLE WAS A TOTAL LOSS. THE WAS NOT THE RIGHT FRONT PASSENGER'S SIDE, AND CONTINUED ON FOR A BLOCK WAS NOT DETERMINED. AND BOTH PASSENGER'S SIDE, AND CONTINUED ON FOR A BLOCK WAS NOT DETERMINED. AND BOTH PASSENGER'S SIDE, AND CONTINUED ON FOR A BLOCK WAS NOT DETERMINED. AND BOTH PASSENGER'S SIDE, AND CANDED AND THE PASSENGER'S SIDE AND PASSENGER'S SIDE						MPH, HE CRASHED INTO A VEHICLE THAT RAN A RED LIGHT. THE AIR BAGS DID NOT DEPLOY. THE CONTACT'S SON SUSTAINED CHEST, LOWER BACK, AND NECK PAINS THAT REQUIRED MEDICAL ATTENTION. THE CONTACT'S SON WENT TO THE EMERGENCY ROOM TWO SEPARATE TIMES. A
THE FAILURE WAS NOT DETERMINED. THE FAILURE MAS INTO DETERMINED. THE FAILURE MILEAGE WAS UNKNOWN.  HAD A DISCEST FORMAL IMPACT, AND DRIVER AND PASSENGER AIRBAG DID NOT DEPLOY WHICH DID NOT PROTECT THE OCCUPANTS IN THE CRASH. NO PRIOR PROBLEMS WITH THE AIRBAG SYSTEM. **AK.**MI.  DRIVING AT APPROXIMATELY SO MPH DRIVER SWERVED TO AVOID HITTING ANOTHER VEHICLE AND LOST CONTROL. VEHICLE WERN TARGOS PREFAVE AND HIT A STEEL BARRIER WITH THE RIGHT FRONT PASSENGER'S SIDE. AND CONTROLLED ON 16Th A BLOCK HEW SHET THE ADDIT HE ROST PASSENGER'S SIDE. AND CONTROLLED ON 16Th A BLOCK HEW SHET THE ADDIT HE ROST PASSENGER'S SIDE. AND CONTROLLED ON 16Th A BLOCK HEW SHET THE ADDIT HE ROST PASSENGER'S SIDE. AND CONTROLLED ON 16Th A BLOCK HEW SHET THE ADDIT HE ROST PASSENGER'S SIDE. AND CONTROLLED ON 16TH A BLOCK HEW SHET THE ADDIT HE ROST PASSENGER'S SIDE AND CONTROLLED ON 16TH A BLOCK HEW SHET THE ADDIT HE ROST PASSENGER'S SIDE AND CONTROLLED ON 16TH A BLOCK HEW SHET THE ADDIT HE ROST PASSENGER'S SIDE AND CONTROLLED ON 16TH ADDIT HE ROST PASSENGER'S SIDE AND CONTROLLED ON 16TH A BLOCK HEW SHET THE ADDIT HE ROST PASSENGER'S SIDE AND CONTROLLED ON 16TH ADDIT HE ROST PASSENGER'S SIDE AND THE						WAITING FOR FINALIZED INFORMATION FROM THE INSURANCE COMPANY TO DETERMINE IF THE
DID NOT PROTECT THE OCCUPANTS IN THE CRASH. NO PRIOR PROBLEMS WITH THE AIRBAG  DRIVING AT APPROXIMATELY 50 MPH DRIVER SWERVED TO AVOID HITTING ANOTHER VEHICLE AND LOST CONTROL. VEHICLE WENT ACROSS FREWAY AND HIT A STEEL BARRIER WITH THE RIGHT FRONT PASSENGERS SDE, AND CONTINUED ON LOST ACRO. THEN WENT AND A DITCH, NOSE FIRST UPON IMPACT, DUAL ARRAGO BION DOT DEPLOY, CAUSING MINDRO INJURIES IN STERIUM AND  DETERMINED, AND BOTH AN BAGS DID NOT DEPLOY, CAUSING MINDRO INJURIES IN STERIUM AND  DETERMINED, AND BOTH AN BAGS DID NOT DEPLOY, CAUSING MINDRO INJURIES IN STERIUM AND  DETERMINED, AND BOTH AN BAGS DID NOT DEPLOY, DEALER / MANUACATURES WERE MOTHED,  AND INJURIES OF LOSS STEEL AND CONTINUED ON LOSS AND INJURIES IN STERIUM AND  DETERMINED, AND BOTH AN BAGS DID NOT DEPLOY. DEALER / MANUACATURES WERE MOTHED,  AND INJURIES OF LOSS STEEL AND CONTINUED ON LOSS AND INJURIES IN STERIUM AND  DETERMINED, AND BOTH AN BAGS DID NOT DEPLOY. DEALER / MANUACATURES WERE MOTHED,  AND INJURIES OF LOSS STEEL AND CONTINUED ON LOSS AND INJURIES. IN STEEL AND INJURIES OF LOSS AND INJURIES. THE DEPLOY DEALER / MANUACATURES WERE MOTHED,  AND INJURIES OF LOSS AND INJURIES. THE PROPERS OF LOSS AND INJURIES. THE PROPERS OF LOSS AND INJURIES. THE DEPLOY DEALER / MANUACATURES WERE MOTHED.  BRIDGE OF LOSS AND INJURIES OF LOSS AND INJURIES.	11190477	CHEVROLET	TAHOE	2000	2019-03-17	THE FAILURE WAS NOT DETERMINED. THE FAILURE MILEAGE WAS UNKNOWN.
DRIVING AT APPROXIMATELY 50 MPH DRIVER SWERVED TO AVOID HITTING ANOTHER VEHICLE AND LOST CONTROL. VEHICLE WENT ACROSS FREEWAY AND HIT A STEEL BARRIER WITH THE RIGHT FRONT PASSENGER'S SIDE, AND CONTROLED ON FOR A BLOCK. THEN, WEN'T INTO A DITCH, NOSE PIRST UPON IMPACT, DUAL ARRAGE DID NOT DEPLOY, CAUSING MINOR INJURES IN STERIUM AND LOTER AND LOSS. "AK WITH A STEEL BARRIER WITH THE RIGHT FRONT PASSENGER'S SIDE, AND CONTROLLED ON FOR A BLOCK. THEN, WEN'T INTO A DITCH, NOSE PIRST UPON IMPACT, DUAL ARRAGE DID NOT DEPLOY, CAUSING MINOR INJURES IN STERIUM AND LOTER WITH A DITCH WAS A TOTAL LOSS." AK WITH A DITCH WAS A TOTAL LOSS." AK WITH A DITCH WAS A TOTAL LOSS." AND LOSS." AND LOTER AND LOSS." AND LOSS WITH A THE ADDRESS WAS NOT DETERMINED, AND BOTH AIR BAGS DID NOT DEPLOY. DEALER, MANUFACTURER WERE NOTHERD AND LOWILLING TO LOSSISTIR IN THIS ACCIDING WAS INVOLVED IN A DIRECT FRONTAL COLLISION. UPON IMPACT, NEITHER DRIVER'S SIDE NOR PASSENGER'S SIDE AIR BAGS DEPLOYED. DEPLOY BE AND LOSS." AND LOSS WAS AND LO	064050	CUEV (BOLET	TD A CIVED	2000	2000 05 20	DID NOT PROTECT THE OCCUPANTS IN THE CRASH. NO PRIOR PROBLEMS WITH THE AIRBAG
AND LOST CONTROL VEHICLE WEST AGROSS PREEWAY AND HIT A STEEL BARRIER WITH THE RIGHT FOROTT PASSENGER'S SIDE, AND CONTINUED ON TOO ROCK. THEN, WEN'T INTO A DITCH, NOSE PIRST UPON IMPACT, DUAL AIRBAGS DID NOT DEPLOY, CAUSING MINOR INJURIES IN STERIUM AND WEN'T DEVELOP A PROPERTY OF THE WEST OF T	864850	CHEVROLET	TRACKER	2000	2000-06-28	SYSTEM. *AK *ML
R70591 CHEVROLET TRACKER 2000 200-07-22 HEAD. NO INDICTATION OF AIRBAG BEING DEFECTIVE. VEHICLE WAS A TOTAL LOSS. "AK VEHICLE WAS INVOLVED IN A FRONTAL COLLISION WITH A 1985 5281, BMW, SPEED WAS NOT DETERMINED, AND BOTH AIR BAGS DID NOT DEPLOY. DEALER / MANUFACTURER WERR NOTIFIED, AND UNWILLING TO ASSIST IN THIS MATTER. "FELL FREE TO PROVIDE AWY FURTHER DETAILS ON THIS MATTER." AK WHITE DRIVING AT 45 MHH CONSUMER'S VEHICLE WAS INVOLVED IN A DIRECT FRONTAL COLLISION. UPON IMPACT, HERT DRIVER'S SIDE NOR PASSENGER'S SIDE AIR BAGS DEPLOYED. DEALER WILL INSPECT VEHICLE. PLEASE PROVIDE ANY FURTHER DETAILS." AK CHEVROLET TRACKER 2000 2001-06-16 DEALER WILL INSPECT VEHICLE. PLEASE PROVIDE ANY FURTHER DETAILS." AK ROMTAL AIRBRAGS DID NOT DEPLOY WHEN VEHICLE WAS INVOLVED IN A HEAD-ON ACCIDENT AT 30-35 MPH. CONSUMER COLLIDED WITH ANOTHER VEHICLE WHILE MAKING A TURN. VEHICLE HAD FRONTAL AIRBRAGS DID NOT DEPLOY WHEN VEHICLE WHILE MAKING A TURN. VEHICLE HAD FRONTAL AIRBRAG SID NOT DEPLOY WHEN VEHICLE WHILE MAKING A TURN. VEHICLE HAD FRONTAL AIRBRAG SID NOT DEPLOY WHEN VEHICLE WHILE MAKING A TURN. VEHICLE HAD FRONTAL COLLISION AT 40-45 MPH, NETTHER AIRBRAG DEPLOYED. DRIVER SUFFERED HEAD INJURY.  **AK****YO******************************						AND LOST CONTROL. VEHICLE WENT ACROSS FREEWAY AND HIT A STEEL BARRIER WITH THE RIGHT FRONT PASSENGER'S SIDE, AND CONTINUED ON FOR A BLOCK. THEN, WENT INTO A DITCH, NOSE
DETERMINED, AND BOTH AIR BAGS DID NOT DEPLOY, DEALER / MANUFACTURER WERE NOTHED, AND UNWILLING TO ASSIST IN THIS MATTER. FEEL FREE TO PROVIDE ANY FURTHER DETAILS ON THIS MATTER. *AX  WHILE DRIVING AT 45 MPH CONSUMERS VEHICLE WAS INVOLVED IN A DIRECT FRONTAL COLLISION, UPON IMPACT, NETHER DRIVER'S SIDE NOR PASSENGER'S SIDE AIR BAGS DEPLOYED.  DEALER WILL INSPECT VEHICLE. PLEASE PROVIDE ANY FURTHER DETAILS. *AX  WHILE DRIVING AT 45 MPH CONSUMERS VEHICLE WAS INVOLVED IN A DIRECT FRONTAL COLLISION, UPON IMPACT, NETHER DRIVER'S SIDE NOR PASSENGER'S SIDE AIR BAGS DEPLOYED.  DEALER WILL INSPECT VEHICLE. PLEASE PROVIDE ANY FURTHER DETAILS. *AX  FRONTAL ALREAGS DID NOT DEPLOY WHEN YELLE WAS INVOLVED IN A HEADON ACCIDENT AT 30-35 MPH. CONSUMER COLLIDED WITH ANOTHER VEHICLE WAS INVOLVED IN A HEADON ACCIDENT AT 30-35 MPH. CONSUMER COLLIDED WITH ANOTHER VEHICLE WAS INVOLVED IN A HEADON ACCIDENT AT 30-35 MPH. CONSUMER COLLIDED WITH ANOTHER VEHICLE WHILE MAKING A TURN. VEHICLE HAD FRONTAL COLLISION AT 40-45 MPH, NEITHER AIRBAG DEPLOYED. DRIVER SUFFERED HEAD INJURY.  **AX SILO**  **AYO**  DT: THE CONTACT STATED THAT WHILE TRAVELING 31 MPH ON A GRAVEL ROAD IN DRY CONDITIONS THE CONTACT LOST CONTROL OF THE VEHICLE AND IT STRUCK A TREE. UPON IMPACT, THE AIRBAGS DID NOT DEPLOY IN A HEAD ON COLLISION AGO BE EXTRACTED FROM THE VEHICLE. THE DASHBOARD COLLARSED INTO THE FRONT TSEAT ALONG WITH THE RIREWALL THE REWALL THE AIRBAGS SHOULD HAVE DEPLOYED. GM PURCHASED THE SALVAGED VEHICLE FROM THE INSURANCE COMPANY AND DESTROYED IT. **AX  **AYO**  DETERMINED THAT THE AIRBAGS SHOULD HAVE DEPLOYED. GM PURCHASED THE SALVAGED VEHICLE FROM THE INSURANCE COMPANY AND DESTROYED IT. **AX  **AYO**  **AYO**  **AYO**  **DETERMINED THAT THE AIRBAGS SHOULD HAVE DEPLOYED. GM PURCHASED THE SALVAGED VEHICLE FROM THE INSURANCE COMPANY AND DESTROYED IT. **AX  **AYO**  **DETERMINED THAT THE AIRBAGS SHOULD HAVE DEPLOYED. GM PURCHASE AT A POPOXIMATERLY 25 MPH. NEITHER AIRBAGS SHOULD HAVE DEPLOYED. THE SAME OF 31 MPH, AND DETERMINED THAT THE AIRBAGS SHOULD HAVE D	870591	CHEVROLET	TRACKER	2000	2000-07-22	HEAD. NO INDICTATION OF AIRBAG BEING DEFECTIVE. VEHICLE WAS A TOTAL LOSS.*AK
WHILE DRIVING AT 45 MPH CONSUMER'S VEHICLE WAS INVOLVED IN A DIRECT FRONTAL COLLISION. UPON IMPACT, NEITHER DRIVER'S VISE NOR PASSENGER'S SIDE AIR BAGS DEPLOYED. DEALER WILL INSPECT VEHICLE. PLEAS FORVIDE ANY FURTHER DETAILS. *AX  FRONTAL AIRBAGS DID NOT DEPLOY WHEN VEHICLE WAS INVOLVED IN A HEAD-ON ACCIDENT AT 30-35 MPH. CONSUMER COLLIDED WITH A NOTHER VEHICLE WAS INVOLVED IN A HEAD-ON ACCIDENT AT 30-35 MPH. CONSUMER COLLIDED WITH A NOTHER VEHICLE WHILE MAKING A TURN. VEHICLE HAD FRONTAL DAMAGE. *AK 8SLC  FRONTAL DAMAGE. *AK 8SLC  FRONTAL COLLISION AT 40-45 MPH, NEITHER AIRBAG DEPLOYED. DRIVER SUFFERED HEAD INJURY.  *AK *YD  DT: THE CONTACT STATED THAT WHILE TRAVELING 31 MPH ON A GRAVEL ROAD IN DRY CONDITIONS THE CONTACT LOST CONTROL OF THE VEHICLE AND IT STRUCK A TREE. UPON IMPACT, THE AIRBAGS DID NOT DEPLOY. THE FRONT SEAT ALONG WITH THE RIEWALL. THERE WERE 3 INJURIES, AND A POLUCE BOTTO THE FRONT SEAT ALONG WITH THE RIEWALL. THERE WERE 3 INJURIES, AND A POLUCE BOTTO THE FRONT SEAT ALONG WITH THE RIEWALL. THERE WERE 3 INJURIES, AND A POLUCE BOTTO THE SEAT SET. THE VEHICLE AD GRAVE THE VEHICLE. THE DASHBOARD COLLAPSED INTO THE FRONT SEAT ALONG WITH THE RIEWALL. THERE WERE 3 INJURIES, AND A POLUCE BOTTO THE FRONT SEAT ALONG WITH THE RIEWALL. THERE WERE 3 INJURIES, AND A POLUCE BOTTO THE SEAT SET. THE VEHICLE AND THE SHE SHE VEHICLE AND THE SHE SHE VEHICLE AND THE SHE SHE VEHICLE AT THE SHE AND THE SHE SHE VEHICLE AT APPROXIMATELY 25 MPH. NEITHER AIR BAG DEPLOYED NO DID THE SEAT BELT SHE THE SAME THE SHE WHICH THE VEHICLE WADE CONTACT WITH THE FRONT SHE SAME TIME. THE DRIVER SHATE AND HOOD UP INTO THE REGINE COMPANDED AND THE SHATE SHE SAME TIME. THE SAME THE PROPE THE SHATE AND THE SHATE SHOW THE VEHICLE SHE DAY THE SHATE AND THE PROPE THE SHATE AND THE YOUR THROUGH THE SHATE SHE SHATE AND THE YOUR THROUGH THE SHATE SHOW THE SHATE AND THE SHATE AND THE SHATE AND THE YOUR SHATE AND THE Y						DETERMINED, AND BOTH AIR BAGS DID NOT DEPLOY. DEALER / MANUFACTURER WERE NOTIFIED,
COLLISION, UPON IMPACT, NEITHER DRIVER'S SIDE NOR PASSENGER'S SIDE AIR BAGS DEPLOYED.  DEALER WILL INSPECT VEHICLE. PLEASE PROVIDE ANY FURTHER DETAILS. "AK  B897476 CHEVROLET TRACKER 2000 2001-09-29  FRONTAL AIRBAGS DID NOT DEPLOY WHEN VEHICLE WAIS INVOLVED IN A HEAD-ON ACCIDENT AT 30-35 MPH. CONSUMER COLLIDED WITH ANOTHER VEHICLE WHILE MAKING A TURN. VEHICLE HAD 558644 GMC YUKON 2000 2000-12-16  THE AIRBAGS DID NOT DEPLOY WHEN VEHICLE WHILE MAKING A TURN. VEHICLE HAD FRONTAL ADMAGE. "AK 8SLC  THE AIRBAG DID NOT DEPLOY IN A HEAD ON COLLISION RESULTING IN INJURIES. NLM FRONTAL COLLISION AT 40-45 MPH, NEITHER AIRBAG DEPLOYED. DRIVER SUFFERED HEAD INJURY.  THE VEHICLE. THE DAHBAGS DID NOT DEPLOY. THE FRONT PASSENGER HAD TO BE EXTRACTED FROM IMPACT, THE AIRBAGS DID NOT DEPLOY. THE FRONT PASSENGER HAD TO BE EXTRACTED FROM IMPACT, THE AIRBAGS DID NOT DEPLOY. THE FRONT PASSENGER HAD TO BE EXTRACTED FROM IMPACT, THE AIRBAGS DID NOT DEPLOY. THE FRONT PASSENGER HAD TO BE EXTRACTED FROM IMPACT, THE AIRBAGS DID NOT DEPLOY. THE RONT PASSENGER HAD TO BE EXTRACTED FROM IMPACT, THE AIRBAGS DID NOT DEPLOY. THE FRONT PASSENGER HAD TO BE EXTRACTED FROM THE VEHICLE. THE DAHBAGS DID NOT DEPLOY. THE RONT PASSENGER HAD TO BE EXTRACTED FROM IMPACT, THE AIRBAGS DID NOT DEPLOY. THE RONT PASSENGER HAD TO BE EXTRACTED FROM THE VEHICLE. THE DAHBAGS DID NOT DEPLOY. THE RONT PASSENGER HAD TO BE EXTRACTED FROM THE VEHICLE HAD AIRBAGS SHOUND BE AIRBAGS SHOUND SEAT ALLONG WITH THE FREWALL. THERE WERE 3 INJURIES, AND A POLICE REPORT WAS TAKEN. THE VEHICLE WAS TOTALED. A GM REPRESENTATIVE RETRIEVED THE BLACK DETECTION BOD, VEHICLE THE SEAT DELT DAHBAGS.  MY WIFE AND DAUGHTER WERE INVOLVED IN A CRASH WITH OUR 2000 ISUZU AMIGO. MY WIFE IMPACTED A VEHICLE WHICH HAD CRASHED INTO AND THER VEHICLE AT APPROXIMATELY 25 MPH. NEITHER AIR BAG DEPLOYED NOR DID THE SEAT BELT TIGHTEN UP TO RESTRACH WHICH HAD CHARLED A BRAGE SHOUND HAD BY A BRAGE SHOUND	883185	CHEVROLET	TRACKER	2000	2001-01-31	
891375 CHEVROLET TRACKER 2000 2001-06-16 DEALER WILL INSPECT VEHICLE. PLEASE PROVIDE ANY FURTHER DETAILS. *AK  897476 CHEVROLET TRACKER 2000 2001-09-29 FRONTAL AIRBAGS DID NOT DEPLOY WHEN VEHICLE WAIS INVOLVED IN A HEAD-ON ACCIDENT AT 30-35 MPH. CONSUMER COLLIDED WITH ANDTHER VEHICLE WHILE MAKING A TURN. VEHICLE HAD FRONTAL DAMAGE. *AK 85LC  8009240 GMC YUKON 2000 2000-12-16 THE AIRBAG DID NOT DEPLOY IN A HEAD ON COLLISION RESULTING IN INJURIES. NLM  8009240 GMC YUKON 2000 2002-05-05 FRONTAL DAMAGE. *AK 85LC  8009240 DT: THE CONTACT STATED THAT WHILE TRAVELING 31 MPH ON A GRAVEL ROAD IN DRY CONDITIONS THE CONTACT LOST CONTROL OF THE VEHICLE AND IT STRUCK A TREE. UPON IMPACT, THE AIRBAGS DID NOT DEPLOY IN THE FRONT PASSENGER HAD TO BE EXTRACTED FROM THE VEHICLE. THE DASHBOARD COLLAPSED INTO THE FRONT SEAT ALDONG WITH THE FIREWALL. THERE WERE 31 INJURIES, AND A POLICE REPORT WAS TAKEN. THE VEHICLE WAS TOTALED. A GM REPRESENTATIVE RETRIEVED THE BLACK DETECTION BOX, VERIFIED THE SPEED OF 31 MPH, AND DETERMINED THAT THE AIRBAGS SHOULD HAVE DEPLOYED. GM PURCHASED THE SALVAGED VEHICLE WHICH HAD CRASHED INTO ANOTHER VEHICLE AT APPROXIMATELY 25 MPH. METHER AIR BAG DEPLOYED ON R DID THE SEAT BELT TIGHTEN UP TO RESTRAIN MY WIFE IMPACTED A VEHICLE WHICH HAD CRASHED INTO ANOTHER VEHICLE AT APPROXIMATELY 25 MPH. METHER AIR BAG DEPLOYED ON R DID THE SEAT BELT TIGHTEN UP TO RESTRAIN MY WIFE, WHICH RESULTED IN HER IMPACTING THE STEERING WHEEL. AT THE SAME TIME, THE DAVISES SEAT MOVED FORWARD AND DID NOT REMAIN STATIONARY.  10052346 ISUZU RODEO 2000 2000-08-29 DOWN AND HER PRONT AND BURNER FRONT AREA, CAUSING EXTENSIVE DAMAGE. INCLUDING PUSHING BURNER, GRILLE, HEADLIGHTS AND HOOD UP INTO THE ENGINE COMPARTMENT. TO MY SHOCK THE AIRBAGS DID NOT DEPLOY. WHAT IS UP WITH THES? DO THEY VEHICLE MADE CONTACT WITH THE FRONT AND DRIVER FRONT ABOUT DEPLOY. WHAT IS UP WITH THE SO THEY VEHICLE MADE CONTACT WITH THE FRONT AND DRIVER FRONT AREA, CAUSING EXTENSIVE DAMAGE. INCLUDING PUSHING BURNER, GRILLE, HEADLIGHTS AND HOOD UP INTO THE ENGINE						
30-35 MPH. CONSUMER COLLIDED WITH ANOTHER VEHICLE WHILE MAKING A TURN. VEHICLE HAD FRONTAL DAMAGE. *AK 85LC.  558644 GMC YUKON 2000 2001-29-16 THE AIRBAG DID NOT DEPLOY IN A HEAD ON COLLISION RESULTING IN INJURIES. NLM  8009240 GMC YUKON 2000 2002-05-05 **AK 85LC.  57 THE CONTAL COLLISION AT 40-45 MPH, NEITHER AIRBAG DEPLOYED. DRIVER SUFFERED HEAD INJURY.  *AK *YD  *AK *YD  *AT	891375	CHEVROLET	TRACKER	2000	2001-06-16	DEALER WILL INSPECT VEHICLE. PLEASE PROVIDE ANY FURTHER DETAILS. *AK
### STATE CHEVROLET TRACKER 2000 2001-09-29 FRONTAL DAMAGE. *AK SSLC ### STATE ALONG						
FRONTAL COLLISION AT 40-45 MPH, NEITHER AIRBAG DEPLOYED. DRIVER SUFFERED HEAD INJURY.  ### **YD    DT: THE CONTACT STATED THAT WHILE TRAVELING 31 MPH ON A GRAVEL ROAD IN DRY CONDITIONS THE CONTACT LOST CONTROL OF THE VEHICLE AND IT STRUCK A TREE. UPON IMPACT, THE AIRBAGS DID NOT DEPLOY. THE FRONT PASSENGER HAD TO BE EXTRACTED FROM THE VEHICLE. THE DASHBOARD COLLAPSED INTO THE FRONT SEAT ALONG WITH THE FIREWALL. THERE WERE 31 INJURIES, AND A POLICE REPORT WAS TAKEN. THE VEHICLE WAS TOTALED. A GM REPRESENTATIVE RETRIEVED THE BLACK DETECTION BOX, VERIFIED THE SPEED OF 31 MPH, AND DETERMINED THAT THE AIRBAGS SHOULD HAVE DEPLOYED. GM PURCHASED THE SALVAGED VEHICLE FROM THE INSURANCE COMPANY AND DESTROYED IT. *AK    MY WIFE AND DAUGHTER WERE INVOLVED IN A CRASH WITH OUR 2000 ISUZU AMIGO. MY WIFE IMPACTED A VEHICLE WHICH HAD CRASHED INTO ANOTHER VEHICLE AT APPROXIMATELY 25 MPH. NEITHER AIR BAG DEPLOYED NOR DID THE SEAT BELT TIGHTEN UP TO RESTRAIN MY WIFE, WHICH RESULTED IN HER IMPACTING THE STEERING WHEEL. AT THE SAME TIME, THE DRIVERS SEAT MOVED FORWARD AND DID NOT REMAIN STATIONARY.    DURING A 40 MPH CRASH INTO A CONCRETE CENTER DIVIDER ON A INTERSTATE IN WHICH THE VEHICLE MADE CONTACT WITH THE FRONT AND DRIVER FRONT AREA, CAUSING EXTENSIVE DAMAGES. INCLUDING PUSHING BUMPER, GRILLE, HEADLIGHTS AND HOOD UP INTO THE ENGINE COMPARTMENT. TO MY SHOCK THE AIRBAGS DID NOT DEPLOY. WHAT IS UP WITH THIS? DO THEY JUST TELL YOU THEY ARE THERE AND THEY DON'T WORK WHEN YOU NEED THEM??? I WILL NOT PURCHASE ANOTHER ISUZU PRODUCT AND AM SEEKING A CLAIM AGAINST ISUZU TO FIND OUT WHAT THE PROBLEM MIGHT BE. THANK YOU FOR YOUR TIME!! *LA  AIR BAGS ON 2000 ISUZU RODEO ARE DEFECTIVE.*MR THE CONSUMER WAS INVOLVED IN A FRONT END COLUSION YET NONE OF THE RRESENTATE DID NOT SEEM TOO CONCERNED ABOUT THE SITUATION. THE CONSUMER BELIEVES THE AIR BAGS SHOULD HAVE	897476	_				FRONTAL DAMAGE. *AK 8SLC
DT: THE CONTACT STATED THAT WHILE TRAVELING 31 MPH ON A GRAVEL ROAD IN DRY CONDITIONS THE CONTACT LOST CONTROL OF THE VEHICLE AND IT STRUCK A TREE. UPON IMPACT, THE AIRBAGS DID NOT DEPLOY. THE FRONT PASSENGER HAD TO BE EXTRACTED FROM THE VEHICLE. THE OASHBOAD COLLAPSED INTO THE FRONT SEAT ALONG WITH THE FIREWALL. THERE WERE 3 INJURIES, AND A POLICE REPORT WAS TAKEN. THE VEHICLE WAS TOTALED. A GM REPRESENTATIVE RETRIEVED THE BLACK DETECTION BOX, VERIFIED THE SPEED OF 31 MPH, AND DETERMINED THAT THE AIRBAGS SHOULD HAVE DEPLOYED. GM PURCHASED THE SALVAGED VEHICLE FROM THE INSURANCE COMPANY AND DESTROYED IT. *AK  MY WIFE AND DAUGHTER WERE INVOLVED IN A CRASH WITH OUR 2000 ISUZU AMIGO. MY WIFE IMPACTED A VEHICLE WHICH HAD CRASHED INTO ANOTHER VEHICLE AT APPROXIMATELY 25 MPH. NEITHER AIR BAG DEPLOYED. NOR DID THE SEAT BELT TIGHTEN UP TO RESTRAIN MY WIFE, WHICH RESULTED IN HEI IMPACTING THE STEERING WHEEL. AT THE SAME TIME, THE DRIVERS SEAT MOVED FORWARD AND DID NOT REMAIN STATIONARY.  DURING A 40 MPH CRASH INTO A CONCRETE CENTER DIVIDER ON A INTERSTATE IN WHICH THE VEHICLE MADE CONTACT WITH THE FRONT AND DRIVER FRONT AREA, CAUSING EXTENSIVE DAMAGES. INCLUDING PUSHING BUMPER, GRILLE, HEADLIGHTS AND HOOD UP INTO THE ENGINE COMPARTMENT. TO MY SHOCK THE AIRBAGS DID NOT DEPLOY. WHAT 1S UP WITH THIS? DO THEY JUST TELL YOU THEY ARE THERE AND THEY DON'T WORK WHEN YOU NEED THEM??? I WILL NOT PURCHASE ANOTHER ISUZU PRODUCT AND AM SEEKING A CLAIM AGAINST ISUZU TO FIND OUT WHAT THE PROBLEM MIGHT BE. THANK YOU POR YOUR TIME! "LA AIR BAGS ON 2000 ISUZU RODEO ARE DEFECTIVE. "MR THE CONSUMER WAS INVOLVED IN A FRONT END COLLISION YET NONE OF THE AIR BAGS DEPLOYED. THE CONSUMER CONTACTED THE MANUFACTURER ABOUT THE AIR BAGS BUT THE AIR BAGS DEPLOYED. THE CONSUMER CONTACTED THE MANUFACTURER ABOUT THE AIR BAGS BUT THE AIR BAGS BOOULD HAVE	558644	GMC	YUKON	2000	2000-12-16	
CONDITIONS THE CONTACT LOST CONTROL OF THE VEHICLE AND IT STRUCK A TREE. UPON IMPACT, THE AIRBAGS DID NOT DEPLOY. THE FRONT PASSENGER HAD TO BE EXTRACTED FROM THE VEHICLE. THE DASHBOARD COLLAPSED INTO THE FRONT SEAT ALONG WITH THE FIREWALL. THERE WERE 3 INJURIES, AND A POLICE REPORT WAS TAKEN. THE VEHICLE WAS TOTALED. A GM REPRESENTATIVE RETRIEVED THE BLACK DETECTION BOX, VERIFIED THE SPEED OF 31 MPH, AND DETERMINED THAT THE AIRBAGS SHOULD HAVE DEPLOYED. GM PURCHASED THE SALVAGED VEHICLE FROM THE INSURANCE COMPANY AND DESTROYED IT. *AK  MY WIFE AND DAUGHTER WERE INVOLVED IN A CRASH WITH OUR 2000 ISUZU AMIGO. MY WIFE IMPACTED A VEHICLE WHICH HAD CRASHED INTO ANOTHER VEHICLE AT APPROXIMATELY 25 MPH. NEITHER AIR BAG DEPLOYED NOR DID THE SEAT BELT TIGHTEN UP TO RESTRAIN MY WIFE, WHICH RESULTED IN HER IMPACTING THE STEERING WHEEL. AT THE SAME TIME, THE DRIVERS SEAT MOVED FORWARD AND DID NOT REMAIN STATIONARY.  DURING A 40 MPH CRASH INTO A CONCRETE CENTER DIVIDER ON A INTERSTATE IN WHICH THE VEHICLE MADE CONTACT WITH THE FRONT AND DRIVER FRONT AREA, CAUSING EXTENSIVE DAMAGES. INCLUDING PUSHING BUMBER, GRILLE, HEADLIGHTS AND HOOD UP INTO THE ENGINE COMPARTMENT. TO MY SHOCK THE AIRBAGS DID NOT DEPLOY. WHAT IS UP WITH THIS? DO THEY JUST TELL YOU THEY ARE THERE AND THEY DON'T WORK WHEN YOU NEED THEM???? I WILL NOT PURCHASE ANOTHER ISJUZU PRODUCT AND AM SEEKING A CLAIM AGAINST ISJUZU TO FIND OUT WHAT THE PROBLEM MIGHT BE. THANK YOU FOR YOUR TIME!! *LA  AIR BAGS ON 2000 ISJUZU RODEO ARE DEFECTIVE.*MR THE CONSUMER WAS INVOLVED IN A FRONT END CONCRETED ABOUT THE AIR BAGS BUT THE REPRESENTATIVE DID NOT SEEM TO BE TOO CONCERNED ABOUT THE SITUATION. THE CONSUMER BELIEVES THE AIR BAGS SHOULD HAVE	8009240	GMC	YUKON	2000	2002-05-05	
IMPACTED A VEHICLE WHICH HAD CRASHED INTO ANOTHER VEHICLE AT APPROXIMATELY 25 MPH. NEITHER AIR BAG DEPLOYED NOR DID THE SEAT BELT TIGHTEN UP TO RESTRAIN MY WIFE, WHICH RESULTED IN HER IMPACTING THE STEERING WHEEL. AT THE SAME TIME, THE DRIVERS SEAT MOVED FORWARD AND DID NOT REMAIN STATIONARY.  DURING A 40 MPH CRASH INTO A CONCRETE CENTER DIVIDER ON A INTERSTATE IN WHICH THE VEHICLE MADE CONTACT WITH THE FRONT AND DRIVER FRONT AREA, CAUSING EXTENSIVE DAMAGES. INCLUDING PUSHING BUMPER, GRILLE, HEADLIGHTS AND HOOD UP INTO THE ENGINE COMPARTMENT. TO MY SHOCK THE AIRBAGS DID NOT DEPLOY. WHAT IS UP WITH THIS? DO THEY JUST TELL YOU THEY ARE THERE AND THEY DON'T WORK WHEN YOU NEED THEM??? I WILL NOT PURCHASE ANOTHER ISUZU PRODUCT AND AM SEEKING A CLAIM AGAINST ISUZU TO FIND OUT 10052346 ISUZU RODEO 2000 2004-01-04 WHAT THE PROBLEM MIGHT BE. THANK YOU FOR YOUR TIME!! *LA AIR BAGS ON 2000 ISUZU RODEO ARE DEFECTIVE.*MR THE CONSUMER WAS INVOLVED IN A FRONT END COLLISION YET NONE OF THE AIR BAGS DEPLOYED. THE CONSUMER CONTACTED THE MANUFACTURER ABOUT THE AIR BAGS BUT THE REPRESENTATIVE DID NOT SEEM TO BE TOO CONCERNED ABOUT THE SITUATION. THE CONSUMER BELIEVES THE AIR BAG SHOULD HAVE	10141369	GMC	YUKON	2000	2005-09-23	CONDITIONS THE CONTACT LOST CONTROL OF THE VEHICLE AND IT STRUCK A TREE. UPON IMPACT, THE AIRBAGS DID NOT DEPLOY. THE FRONT PASSENGER HAD TO BE EXTRACTED FROM THE VEHICLE. THE DASHBOARD COLLAPSED INTO THE FRONT SEAT ALONG WITH THE FIREWALL. THERE WERE 3 INJURIES, AND A POLICE REPORT WAS TAKEN. THE VEHICLE WAS TOTALED. A GM REPRESENTATIVE RETRIEVED THE BLACK DETECTION BOX, VERIFIED THE SPEED OF 31 MPH, AND DETERMINED THAT THE AIRBAGS SHOULD HAVE DEPLOYED. GM PURCHASED THE SALVAGED
VEHICLE MADE CONTACT WITH THE FRONT AND DRIVER FRONT AREA, CAUSING EXTENSIVE DAMAGES. INCLUDING PUSHING BUMPER, GRILLE, HEADLIGHTS AND HOOD UP INTO THE ENGINE COMPARTMENT. TO MY SHOCK THE AIRBAGS DID NOT DEPLOY. WHAT IS UP WITH THIS? DO THEY JUST TELL YOU THEY ARE THERE AND THEY DON'T WORK WHEN YOU NEED THEM??? I WILL NOT PURCHASE ANOTHER ISUZU PRODUCT AND AM SEEKING A CLAIM AGAINST ISUZU TO FIND OUT 10052346 ISUZU RODEO 2000 2004-01-04 WHAT THE PROBLEM MIGHT BE. THANK YOU FOR YOUR TIME!! *LA AIR BAGS ON 2000 ISUZU RODEO ARE DEFECTIVE.*MR THE CONSUMER WAS INVOLVED IN A FRONT END COLLISION YET NONE OF THE AIR BAGS DEPLOYED. THE CONSUMER CONTACTED THE MANUFACTURER ABOUT THE AIR BAGS BUT THE REPRESENTATIVE DID NOT SEEM TO BE TOO CONCERNED ABOUT THE SITUATION. THE CONSUMER BELIEVES THE AIR BAG SHOULD HAVE	729997	ISUZU	AMIGO	2000	2000-08-29	IMPACTED A VEHICLE WHICH HAD CRASHED INTO ANOTHER VEHICLE AT APPROXIMATELY 25 MPH.  NEITHER AIR BAG DEPLOYED NOR DID THE SEAT BELT TIGHTEN UP TO RESTRAIN MY WIFE, WHICH RESULTED IN HER IMPACTING THE STEERING WHEEL. AT THE SAME TIME, THE DRIVERS SEAT
FRONT END COLLISION YET NONE OF THE AIR BAGS DEPLOYED. THE CONSUMER CONTACTED THE MANUFACTURER ABOUT THE AIR BAGS BUT THE REPRESENTATIVE DID NOT SEEM TO BE TOO CONCERNED ABOUT THE SITUATION. THE CONSUMER BELIEVES THE AIR BAG SHOULD HAVE	10052346					DURING A 40 MPH CRASH INTO A CONCRETE CENTER DIVIDER ON A INTERSTATE IN WHICH THE VEHICLE MADE CONTACT WITH THE FRONT AND DRIVER FRONT AREA, CAUSING EXTENSIVE DAMAGES. INCLUDING PUSHING BUMPER,GRILLE,HEADLIGHTS AND HOOD UP INTO THE ENGINE COMPARTMENT. TO MY SHOCK THE AIRBAGS DID NOT DEPLOY. WHAT IS UP WITH THIS? DO THEY JUST TELL YOU THEY ARE THERE AND THEY DON'T WORK WHEN YOU NEED THEM??? I WILL NOT PURCHASE ANOTHER ISUZU PRODUCT AND AM SEEKING A CLAIM AGAINST ISUZU TO FIND OUT
						FRONT END COLLISION YET NONE OF THE AIR BAGS DEPLOYED. THE CONSUMER CONTACTED THE MANUFACTURER ABOUT THE AIR BAGS BUT THE REPRESENTATIVE DID NOT SEEM TO BE TOO
	10083770	ISUZU	RODEO	2000	2004-02-26	

10087550	ISUZU	RODEO	2000	2004-02-26	VEHICLE WAS INVOLVED IN AN ACCIDENT WHILE TRAVELING AT 25 TO 30 MPH BUT THE AIR BAGS DID NOT DEPLOY.*MR THE CONSUMER WAS INVOLVED IN A FRONT END COLLISION YET NONE OF THE AIR BAGS DEPLOYED. THE CONSUMER CONTACTED THE MANUFACTURER ABOUT THE AIR BAGS BUT THE REPRESENTATIVE DID NOT SEEM TO BE TOO CONCERNED ABOUT THE SITUATION. THE CONSUMER BELIEVES THE AIR BAG SHOULD HAVE DEPLOYED AND DOESN'T FEEL SAFE IN THE VEHICLE. THE VEHICLE SUSTAINED \$6881. WORTH OF FRONT END DAMAGE. *NM
					I WAS IN AN ACCIDENT ON JULY 20,2006. A GIRL RAN A RED LIGHT AND I HIT HER IN THE PASSENGER SIDE OF HER CAR HEAD ON WITH MY 2000 ISUZU RODEO. IT WAS A FULL FRONTAL COLLISION FOR ME AND MY CHILDREN. LUCKILY, WE ARE ALWAYS BUCKLED UP BECAUSE NONE OF MY AIRBAGS DEPLOYED AT ALL. THE OTHER CAR WAS GOING ABOUT 60 MPH AND HER AIRBAG DEPLOYED WHEN I HIT HER BUT MINE DID NOT. LUCKILY, MY CHILDREN WERE NOT HURT BADLY BUT UNFORTUNATELY, I SUSTAINED NECK, BACK AND KNEE INJURIES. I WAS AND STILL AM VERY UPSET THAT MY AIRBAGS FAILED. EVEN THE OWNER OF THE BODY SHOP I USE WAS IN SHOCK THAT THEY DID NOT DEPLOY AS THE IMPACT WAS ENOUGH TO SPLIT THE FRAME OF MY RODEO AND TOTAL IT OUT. I WILL NOT BUY ANOTHER ISUZU AND I WILL ALSO NOT RECOMMEND THEM TO MY FAMILY OR FRIENDS IN THE FUTURE. THANK YOU FOR YOUR TIME, I HOPE I CAN HELP
10163811	ISUZU	RODEO	2000	2006-07-20	ANOTHER FAMILY FROM GETTING INJURED.
745106	ISUZU	TROOPER	2000	2001-05-02	THE ESTIMATES ARE NOT ALL IN YET, SO THE \$27,000 IS A GUESS AT THIS STAGE. MY FRIEND ALSO HAD A TROOPER WHOSE AIRBAGS FAILED AT LEAST ON ONE FRONT END CRASH.*AK WHILE DRIVING 45MPH T-BONED ANOTHER VEHICLE AND AIR BAGS DIDNOT DEPLOY. DRIVER AND
8009110	ISUZU	TROOPER	2000	2002-04-13	3 PASSENGERS SUSTAINED INJURIES. *AK
10160322	ISUZU	TROOPER	2000	2006-06-10	DT*: THE CONTACT STATED WHILE DRIVING 15 - 20 MPH THROUGH AT INTERSECTION ANOTHER VEHICLE RAN A STOP SIGN AND HIT THE CONTACT'S VEHICLE. THE VEHICLE RAN INTO A TREE SMASHING THE FRONT OF THE VEHICLE. THE FRONTAL AIR BAGS DID NOT DEPLOY. THE AIR BAG LIGHT DID NOT ILLUMINATE PRIOR TO THE INCIDENT. THE CONTACT WAS WEARING A SEATBELT, HOWEVER INJURIES WERE INCURRED. THE CONTACT HAD BRUISING TO THE FACE AND A SPRAINED HIP. A POLICE REPORT WAS FILED AT THE SCENE. THE VEHICLE WAS DEEMED TOTALED BY THE INSURANCE COMPANY.
10100322	13020	THOO! ER	2000	2000 00 10	
					MY VEHICLE WAS STRUCK HEAD ON BY AN ONCOMING AUTO TRAVELING AT 45 MPH. MY VEHICLE WAS TRAVELING AT 35 MPH. THE IMPACT WAS AT 12:00. MY AIRBAG DID NOT DEPLOY NOR DID THE PASSENGER SIDE AIR BAG. I WAS 3 POINT BELTED AT THE TIME OF THE COLLISION. THE OTHER
744466	CHEVROLET	ASTRO	1999	2001-04-23	VEHICLE WAS A CHEVROLET BERRETA 2 DOOR AUTOMOBILE.*AK  WAS IN FRONT IMPACT HEAD-N COLLISION ON 12/12/01. SPEED BETWEEN 40 AND 65 MPH.
757589	CHEVROLET	ASTRO	1999	2001-12-12	AIRBAGS FAILED TO DEPLOY.*AK
					AIR BAGS DID NOT DEPLOY IN A NEARLY HEAD-ON CRASH AT AN ESTIMATED SPEED OF 60 MPH. RELATIVE SPEED MAY HAVE BEEN LESS, BECAUSE VEHICLE WHICH THIS VAN HIT WAS SLIDING BACKWARDS IN THE SAME DIRECTION OF TRAVEL AS THE VAN. HOWEVER, CLOSING SPEED HAD TO BE SIGNIFICANT TO CAUSE IT TO BE DAMAGED BEYOND REPAIR WITHIN ITS \$13,000 VALUE. VEHICLE WAS A TOTAL LOSS. WE HAVE OWNED THIS VEHICLE SINCE NEW, NO MODIFICATIONS HAVE BEEN MADE TO IT, AND IT HAD NEVER BEEN IN AN ACCIDENT BEFORE THIS. DIGITAL PHOTOS
759758	CHEVROLET	ASTRO	1999	2002-02-19	OF DAMAGED VEHICLE ARE AVAILABLE IF DESIRED. *AK CONSUMER WAS TRAVELING ABOUT 35MPH ON A SIDE STREET AND ANOTHER VEHICLE VEERED
					INTO HIM BY CROSSING OVER INTO THE MERIDIAN STRIP. UPON IMPACT, NEITHER AIRBAG
873826	CHEVROLET	ASTRO	1999	2000-10-22	DEPLOYED, AND MORE THAN ONE PERSON WAS INJURED.*AK IN A FRONTAL COLLISION NONE OF THE AIR BAGS DEPLOYED ON IMPACT, CAUSING MAJOR
8016641	CHEVROLET	ASTRO	1999	2002-08-05	INJURIES TO DRIVER.*AK
10081510	CHEVROLET	ASTRO	1999	2004-06-22	WHILE DRIVING 40 MPH VEHICLE STALLED. THEN, VEHICLE SUDDENLY ACCELERATED. CONSUMER APPLIED THE BRAKES, BUT THEY WERE INOPERATIVE. THIS CAUSED THE VEHICLE TO CRASH INTO A TREE. UPON IMPACT, BOTH FRONTAL AIR BAGS FAILED TO DEPLOY. DRIVER AND TWO PASSENGERS SUSTAINED MAJOR INJURIES, AND WERE TRANSPORTED TO THE HOSPITAL BY AMBULANCE. THE VEHICLE WAS TOWED TO A GARAGE. *AK
10087718	CHEVROLET	ASTRO	1999	2004-08-11	WHILE DRIVING CONSUMER TRIED TO AVOID A PERSON ON A BICYCLE ON THE ROAD. SWERVED IN ORDER NOT TO HIT THE PERSON, BUT WAS UNABLE TO MAINTAIN CONTROL OF THE VEHICLE, JUMPED A CURB, AND COLLIDED WITH A FIRE HYDRANT, AND STRIKING A TREE. UPON IMPACT, BOTH FRONTAL AIR BAGS DID NOT DEPLOY DRIVER SUSTAINED HEAD AND NECK INJURIES, AND WAS TRANSPORTED BY AMBULANCE TO A HOSPITAL. VEHICLE WAS TOWED TO THE DEALER FOR INSPECTION. CONSUMER CONTACTED THE MANUFACTURER AND A REPRESENTATIVE CAME DOWN TO MEET WITH THE DEALER AND CONSUMER. THE REPRESENTATIVE INFORMED CONSUMER THAT THE VEHICLE WAS FUNCTIONING AS DESIGNED, AND THE RATE OF DECELERATION AND IMPACT WAS PRESENT. *AK

					TL*THE CONTACT OWNS A 2000 CHEVROLET ASTRO. WHILE DRIVING 25 MPH THROUGH SNOW AND ICE, THE CONTACT LOST CONTROL OF THE VEHICLE AND SLID OFF THE ROAD. THE VEHICLE THEN STRUCK A TELEPHONE POLE. THE AIR BAGS FAILED TO DEPLOY. THE SEAT BELT FAILED TO RESTRAIN HIM AND HE STRUCK HIS HEAD ON THE WINDSHIELD. THE WOUND TOOK 24 STITCHES TO CLOSE. MOST OF THE VEHICLE WAS REPAIRED AT THE COST OF \$4,500. THE MANUFACTURER'S INVESTIGATOR CONCLUDED THAT THE AIR BAG WOULD NOT DEPLOY AT 25 MPH. THE ARKANSAS POLICE DEPARTMENT FILED REPORT NUMBER 07-00343. THE CURRENT MILEAGE WAS 146,661
10205366		ASTRO ASTRO	1999 1999	2007-01-31	AND FAILURE MILEAGE WAS 125,000.  AIRBAGS FAILED TO DEPLOY IN AN APPROX. 50 MPH HEAD-ON CRASH. *TR
1034/236	CHEVROLET	ASTRO	1999	2010-08-03	AIRDAGS FAILED TO DEPLOT IN AN APPROX. SO WIPH HEAD-ON CRASH. TR
716098	CHEVROLET	BLAZER	1999	1999-12-12	VEHICLE IMPACTED A HORSE IN ROAD AT A SPEED OF 45 MPH. IMPACT WAS HEAD-ON. LEGS OF THE HORSE CONTACTED THE FRONT BUMPER PROPELLING THE HORSE INTO THE WINDSHIELD AND ONTO THE ROOF. THE CAR SUSTAINED MAJOR DAMAGE TO THE FRONT. ALTHOUGH THERE WAS SIGNIFICANT DENTING OF THE BUMPER THE AIR BAGS FAILED TO DEPLOY. THE ROOF OVER THE FRONT PASSENGER HAD MAJOR CRUSHING INCLUDING THE DRIVER'S FRONT PILLA. *AK FRONT OF CAR BUMPER AND ENGINE PUSHED IN 6-8 INCHES. WENT UP HILL HIT TREE OVER
767338	CHEVROLET	BLAZER	1999	2002-09-15	TURNED 2 TIMES. UPON IMPACT, AIR BAGS FAILED TO DEPLOY. *AK
859664	CHEVROLET	BLAZER	1999	2000-04-04	CONSUMER WAS TRAVELING ABOUT 42MPH IN GOOD WEATHER CONDITIONS, AND WAS HIT BY ANOTHER VEHICLE ON THE DRIVER'S SIDE DOOR AND THE FRONT HOOD. UPON IMPACT, AIRBAGS DIDN'T DEPLOY. DEALER WILL BE CONTACTED. *AK  CONSUMER WAS TRAVELING 32MPH & HAD A HEAD-ON COLLSION. CONSUMER WAS WEARING
874736	CHEVROLET	BLAZER	1999	2000-10-20	SEAT BELT RESTRAINT AT THE TIME, BUT FRONTAL AIR BAGS DIDN'T DEPLOY. DEALER CLOSED THE CASE AT ONE POINT & REOPENED IT ONCE. CONSUMER CONTACTED THEM A SECOND TIME.*AK *SLC
8004945	CHEVROLET	BLAZER	1999	2002-02-28	WHILE TRAVELING ON INTERSTATE AND WITHOUT PRIOR WARNING A DEER JUMPED IN FRONT OF VEHICLE. DRIVER'S SIDE SEATBELT DIDN'T HOLD, AND AIRBAGS DIDN'T DEPLOY.*AK THE TRUCK WENT INTO A SKID ON WET ROAD AFTER ATTEMPTING A REAR END COLLISION THAT
8020401	CHEVROLET	BLAZER	1999		OCCURED IN FRONT OF THEM. THE TRUCK DID AVOID COLLIDING WITH THEM BUT SPUN AROUND HITTING CONCRETE WALL. NEITHER AIR BAGS DEPLOYED UP IMPACT WITH ESTIMATED SPEED OF 65 MPH. PLEASE DESCRIBE DETAILS. MR
8021177	CHEVROLET	BLAZER	1999		WAS DRIVING, WHEN ANOTHER VEHICLE REAR ENDED VEHICLE IN FRONT OF IT. BLAZER AVOID HITTING VEHICLE ON WET ROAD & SPUN AROUND AFTER APPLYING BRAKES. VEHICLE HIT MEDIAN WALL WITH FRONT OF VEHICLE. UPON IMPACT, THE AIR BAGS FAILED TO DEPLOY. MR
0021177	CHEVILOLET	DEAZER	1333		THE VEHICLE WAS INVOLVED IN A FRONTAL COLLISION WITH A DEER WHILE DRIVING 60 MPH AND
10017194	CHEVROLET	BLAZER	1999	2003-04-18	NONE OF THE NEITHER AIR BAGS DEPLOYED. THE DEALER WAS NOTIFIED. *NLM
10021489	CHEVROLET	BLAZER	1999	2003-06-10	INVOLVED IN HEAD ON COLLISION, BOTH GOING APPROXIMATELY 30 MPH, NEITHER FRONT AIR BAG DEPLOYED. SEVERE FACIAL INJURIES FOR ONE AND CONCUSSION FOR PASSENGER RESULTED. *JB
					THE AIRBAGS DID NOT DEPLOY. THIS CAUSED INJURY TO THE DRIVER CHEST. THIS SHOULD NEED TO BE FIXED ASAP BY GM. I WILL NEVER PURCHASE A CHEVY AGAIN. AIRBAGS THAT DO NOT DEPLOY
10049340	CHEVROLET	BLAZER	1999	2003-12-06	WHEN YOU HIT HEAD ON AND ROLL SHOULD NOT BE ALLOWED. *LA
					WHILE DRIVING ON ICY ROAD AT 50 TO 55 MPH DRIVER LOST CONTROL OF VEHICLE. IT WENT
10050546	CHEVROLET	BLAZER BLAZER	1999 1999	2003-12-15 1999-03-23	AIRBORNE AND LANDED IN A DITCH. UPON IMPACT, NONE OF THE AIR BAGS DEPLOYED. *AK  THE AIRBAGS NEVER WENT OFF IN A FRONT END COLLISION.
10087245		BLAZER	1999	2004-06-09	WHILE DRIVING 35 MPH,ANOTHER VEHICLE HIT CONSUMER'S VEHICLE ON THE PASSENGER SIDE. THIS CAUSED THE VEHICLE TO SPIN AROUND AND SLAM INTO ANOTHER VEHICLE HEAD ON. UPON IMPACT, BOTH FRONTAL AIR BAGS DID NOT DEPLOY, NOR DID THE DRIVERS SEAT BELT LOCK. CONSUMER HAD THE VEHICLE TOWED TO THE DEALERSHIP FOR INSPECTION. *AK
					WHILE DRIVING 45 MPH, THE VEHICLE COLLIDED WITH THE VEHICLE IN FRONT OF HERS. THE AIR BAGS FAILED TO DEPLOY. THIS CAUSED THE DRIVER TO SUSTAINED MAJOR INJURIES AND WAS TRANSPORTED TO THE HOSPITAL. THE VEHICLE WAS TOWED TO A GARAGE FOR INSPECTION. THE
10099164		BLAZER	1999	2004-10-21	CAUSE HAS NOT BEEN DETERMINED AT THIS TIME. PLEASE PROVIDE FURTHER DETAILS. *JB  DT*: THE CONTACT STATED THE VEHICLE IMPACTED A TREE, HEAD ON. THE FRONTAL AIRBAGS FAILED TO DEPLOY, RESULTING IN INJURIES OF THE CONTACT'S LEFT KNEE, ELBOW AND HEAD. A POLICE REPORT WAS FILED AND PICTURES WERE TAKEN AFTER THE VEHICLE WAS MOVED TO THE JUNKYARD. NO REPAIRS WERE MADE BECAUSE THE VEHICLE WAS DETERMINED BY THE INSURER TO BE TOTALED. THE MANUFACTURER WAS CONTACTED. 08/04/06 CHEVY DRIVER HIT A CAR IN HER LANE FIRST, THEN RICOCHETED HEAD ON INTO A TREE. NEITHER TIME DID AIRBAGS DEPLOY.
10223949		BLAZER	1999	2006-06-03	*TT  1999 CHEVY BLAZER AIRBAGS FAILED TO DEPLOY IN AN ACCIDENT. CONSUMER STATES THAT THE AIRBAGS DID NOT DEPLOY. CONSUMER WAS INJURED AND VEHICLE WAS TOTALED. CONSUMER MIGHT NOT HAVE THOSE INJURIES IF THE AIRBAGS WORKED PRODERLY. *VB
10223949	CHEVROLET	BLAZEK	1999	2008-02-09	MIGHT NOT HAVE THOSE INJURIES IF THE AIRBAGS WORKED PROPERLY. *KB  NO DEPLOYMENT OF DRIVER AND PASSENGER SIDE AIR BAGS DURING COLLISION WITH FIXED
548902	CHEVROLET	SILVERADO	1999	1999-08-13	OBJECT (TREE) CAUSED INJURY TO DRIVE. NLM

					THE 1999 CHEVROLET TRUCK EX SILV ANTILOCK BREAKS HAVE BEEN FAILING AT RANDOM TIMES SINCE APRIL 1 1999. FIRST AT SLOW SPEEDS AND THEN AT HIGH SPEEDS RANDOMLY. ON 720-1999 MY SPEED WAS 60 MI HR AND THE BRAKES FAILED WHEN A DEER CROSSED THE STATE HIGHWAY BETWEEN GRAHAM TX AND BRECKENRIDGE TX. THE BRAKES DELAYED AND I HIT THE DEER DEAD
709384	CHEVROLET	SILVERADO	1999	1999-07-20	CENTER OF MY BUMPER AND GRILL! THE AIR BAGS DIDNOT INFLATE EVER!
741598	CHEVROLET	SILVERADO	1999	2000-01-13	MY AIR BAG DID NOT ACTIVATE AND IN A DIRECT FRONT END COLLISION. THE SUN SETTING BLINDED ME AND I HIT DIRECTLY THE REAR OF THE CAR IN FRONT OF ME AND IT'S AIRBAG DEPLOYED AND THE CHAIN REACTION OF THE TWO CARS IN FRONT OF THE CAR I HIT AIRBAGS DEPLOWED. GM SAID MY AIRBAG WAS NOT DEFECTIVE AND I ASKED TO HAVE IT CHECKED TWO TIMES. IT SHOULD HAVE DEPLOYED AND IT DID NOT. I WAS NOT WEARING A SEAT BELT AND I SUFFERED HEAD INJURIES. I SOLD TRUCK BECAUSE I DID NOT WANT TO DIE NEXT FAILURE.
					DRIVER HIT A STOPPED VEHICLE ON THE INTERSTATE AT APPROXIMATELY 60 MPH. OCCUPANT OF STALLED VEHICLE WAS KILLED AND OUR AIRBAGS DID NOT DEPLOY. WE FELT THAT IT SHOULD HAVE DEPLOYED AND GMC IS ARGUING THAT IT SHOULD NOT HAVE. ANY INFORMATION ABOUT
746679	CHEVROLET	SILVERADO	1999	2001-04-30	AIRBAGS WOULD BE APPRECIATED. *AK  DRIVER & PASSENGER AIR BAGS DIDN'T DEPLOY IN A 65 MPH COMBINED SPEED, HEAD ON CRASH.
762651	CHEVROLET	SILVERADO	1999	2002-05-21	*AK VEHICLE WAS INVOLVED IN A FULL FRONTAL COLLISION AT 40 MPH, AND NEITHER DRIVER'S SIDE
842094	CHEVROLET	SILVERADO	1999		NOR PASSENGER'S SIDE AIRBAGS DEPLOYED. CHEVROLET AND DEALER REFUSED TO GIVE ANY EXPLANATION WHY AIR BAGS DID NOT DEPLOY. *AK
844072	CHEVROLET	SILVERADO	1999	1999-07-21	WHILE DRIVING 40 MPH, LOST CONTROL. VEHICLE WENT INTO A DITCH. UPON IMPACT, DRIVER'S AND PASSENGER'S AIRBAGS DID NOT DEPLOY WHICH DID NOT PROTECT THE OCCUPANT IN THIS CRASH. PLEASE PROVIDE FURTHER INFORMATION AND VIN#. *AK
851420	CHEVROLET	SILVERADO	1999	1999-08-13	CONSUMER WAS DRIVING AND A DEER JUMPED IN FRONT OF HIS VEHICLE. CONSUMER SWERVED TO THE RIGHT AND HE WENT INTO A TREE. AIRBAGS DIDN'T DEPLOY AT ALL, CONSUMER SUSTAINED HEAD INJURIES. *AK
854784	CHEVROLET	SILVERADO	1999	1999-10-08	WHILE DRIVING 60 MPH HAD A FRONTAL IMPACT, AND DRIVER'S AND PASSENGER'S AIR BAGS DID NOT DEPLOY WHICH DID NOT PROTECT THE OCCUPANT IN THIS CRASH. *AK *ML
858532	CHEVROLET	SILVERADO	1999	2000-03-01	CONSUMER'S DAUGHTER WAS IN A CAR CRASH. PASSENGER'S SEAT BELT DIDN'T HOLD. THE PASSENGER AND DRIVER WERE EJECTED FROM THE VEHICLE. ALSO, AIRBAGS DIDN'T DEPLOY. *AK
858811	CHEVROLET	SILVERADO	1999	2000-02-18	VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AT 35 MPH. VEHICLE WAS TOTALLED, AND THE AIRBAGS DID NOT DEPLOY, RESULTING IN MINOR INJURIES. MANUFACTURER HAS INSPECTED THE VEHICLE, AND CLAIMS THAT THE AIR BAGS WERE NOT SUPPOSED TO DEPLOY IN THIS SORT OF ACCIDENT. *AK
859858	CHEVROLET	SILVERADO	1999	1999-04-03	WHILE TRAVELING ON A WET ROAD AT HIGHWAY SPEED OF 60 MPH VEHICLE HYDROPLANED, SPUN INTO A DITCH, AND COLLIDED INTO A TREE WITH BOTH SIDES AND FRONT OF VEHICLE. UPON IMPACT, AIR BAGS FAILED TO DEPLOY. MFR. NOTIFIED. *AK
866622	CHEVROLET	SILVERADO	1999	2000-07-27	CONSUMER WAS TRAVELING ABOUT 65 ON THE INTERSTATE AND FELL A SLEEP. HE HIT AN ENBANKMENT, AND AIRBAGS DIDN'T GO OFF, THERE WERE 2 INJURIES. *AK
871182	CHEVROLET	SILVERADO	1999	2000-04-29	WHILE DRIVING ABOUT 50 MPH AND WHEN EXITING A FREEWAY RAM STEPPED ON BRAKE PEDAL, BUT VEHICLE DID NOT STOP AND LOST CONTRO/ SPAN AND STRUCK A ROAD SIGN FRONT FIRST. UPON IMPACT, NONE OF THE AIR BAGS DEPLOYED.*AK
875702	CHEVROLET	SILVERADO	1999	2000-11-08	VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AT 55-60MPH. UPON IMPACT, AIRBAGS DID NOT DEPLOY, RESULTING IN MINOR INJURIES. VEHICLE WAS TOTALLED. *AK
877481	CHEVROLET	SILVERADO	1999	2000-12-16	FRONT CRASH AT 50 MPH, VEHICLE TOTALLED, DRIVER INJURED WHEN SHE HIT STEERING WHEEL, AND AIRBAG DID NOT DEPLOY. *AK
					WHILE DRIVING 70 MPH CONSUMER HAD A FRONT CRASH . BUMPER BROKE IN TWO, AND FRONT END WAS PUSHED BACK ABOUT 4-6 INCHES. VEHICLE HIT A TREE. UPON IMPACT, AIRBAGS DID
886863	CHEVROLET	SILVERADO	1999	2001-04-21	NOT DEPLOY. *AK
891163	CHEVROLET	SILVERADO	1999	2001-06-23	WHILE TRAVELING 35-40 MPH ON A BRIDGE WITHOUT PRIOR WARNING BACKEND OF VEHICLE BEGAN TO FISHTAIL, CAUSING VEHICLE TO LOSE CONTROL. CONSUMER RELEASED FOOT FROM GAS TO CORRECT VEHICLE STEERING. VEHICLE WAS UNRESPONSIVE, RESULTING IN A FRONTAL COLLISON WITH A JERSEY WALL. UPON IMPACT, PASSENGER AIRBAGS FAILED TO DEPLOY, ENGINE WAS PUSHED SIX INCHES UNDER THE DASH. CONSUMER HAS YET TO CONTACT DEALER. *AK DRIVER WAS INJURED IN ACCIDENT. *SLC
10026451	CHEVROLET	SILVERADO	1999	2003-05-06	1999 CHEVROLET SILVERADO FAULTY DRIVER RESTRAINT SYSTEM. *MR THE VEHICLE WAS INVOLVED IN AN ACCIDENT. THE SAFETY BELT FAILED TO THE RESTRAIN THE DRIVER, AND THE AIR BAG DID NOT DEPLOY. *TS. THE DRIVER RECEIVED SERIOUS HEAD INJURIES. (LAWYER JOHN KELLY ON BEHALF OF CLIENT, JAMES SCOTT). *JB
20020131	CHETHOLET	3.2. LIV 100	2333	2000 00	WHILE DRIVING APPROXIMATELY 20 MPH DRIVER LOST CONTROL OF THE VEHICLE AND IT CRASHED INTO A BRICK WALL. UPON IMPACT, BOTH FRONTAL AIR BAGS FAILED TO DEPLOY. DRIVER
10113304	CHEVROLET	SILVERADO	1999	2005-02-03	SUSTAINED MAJOR INJURIES, AND WAS TRANSPORTED TO THE HOSPITAL BY A HELICOPTER. THE VEHICLE WAS TOWED TO A GARAGE FOR INSPECTION. *AK


					DT THE CONTACT CTATED ANNUE TRANSLING AT CEANDLINE FELL ACCESS AT THE MULEEL. THE
					DT: THE CONTACT STATED WHILE TRAVELING AT 65 MPH HE FELL ASLEEP AT THE WHEEL. THE VEHICLE WAS INVOLVED IN A CRASH, IT HIT A GUARD RAIL. THIS WAS A FRONTAL IMPACT, AND
10144603	CHEVROLET	SILVERADO	1999	2005-11-01	THE DRIVER'S SIDE AIR BAG DID NOT DEPLOY. THE VEHICLE WAS TOTALED.
10144003	CHETROLLI	SILVLIVIDO	1333	2003 11 01	AIRBAGS FAILED TO DEPLOY ON FRONTAL INTERSTATE SPEED IMPACT. DEALER DISCLAIMED
					SERIOUSNESS. DOOR LOCKS WOULD LOCK AUTOMATICALLY, WITHOUT ANY ADULT IN THE CAR
					HOWEVER, THERE WERE CHILDREN IN CAR SEATS IN BACK. KEEP SPARE SET OF KEYS IN HAND AT
731578	CHEVROLET	SUBURBAN	1999	2000-01-15	ALL TIMES.
					60 MPH CROSS WIND BLEW THE SUBURBAN HEAD ON INTO THE CONCRETE MEDIAN. THE VEHICLE
					SPUN 360 DEGREES, WENT INTO THE DITCH, THE FRONT END HIT AGAIN THE VEHICLE WENT UP
					THE OTHER SIDE OF THE EMBANKMENT AND STOPPED IN A FIELD. ENTIRE FRONT END OF THE
					FRAME NOT REPAIRABLE, THE REAR PORTION OF THE FRAME BENT INTO A DIAMOND SHAPE.
					FRONT CROSSMEMBER BENT AND ENGINE MOVED UPWARDS AT A 10 DEGREE ANGLE. AIR BAGS
753287	CHEVROLET	SUBURBAN	1999	2001-10-08	FAILED TO DEPLOY. *AK
					CONSUMER WAS TRAVELING ABOUT 30-35 MPH AND ACCIDENTLY REAR ENDED ANOTHER
					VEHICLE, AIR BAGS DID NOT DEPLOY, CAUSING NECK INJURY/SHOULDER INJURY AND BACK INJURY.
829803	CHEVROLET	SUBURBAN	1999	1998-10-09	*AK
					CONSUMER WAS TRAVELING ABOUT 45 MPH ON HIGHWAY AND WAS STRUCK HEAD-ON BY
076004	CUEV/DOLET	CLIBLIBBAN	4000	2000 42 04	ANOTHER VEHICLE WHO ENTERED FREEWAY THROUGH EXIT. UPON IMPACT, FRONT DUAL
876094	CHEVROLET	SUBURBAN	1999	2000-12-01	AIRBAGS DIDN'T DEPLOY. CONSUMER WAS INJURED. *AK CONSUMER WAS TRAVELING ABOUT 40MPH ON HIGHWAY AND ANOTHER VEHICLE VEERED INTO
					HER LANE, HITTING HER HEAD-ON, AND PUSHING VEHICLE INTO ANOTHER LANE. VEHICLE HIT
					TELEPHONE POLE, AND DUAL AIRBAGS DIDN'T DEPLOY. CONSUMER WAS INJURED. CHEVROLET
877320	CHEVROLET	CLIDLIDDAN	1999	2000-12-01	HAS BEEN NOTIFIED. *AK
877320	CHEVROLLI	JOBONDAN	1333	2000-12-01	WHILE DRIVING 30-35 MPH VEHICLE HIT A FIRE HYDRANT, THEN A TREE. NEITHER AIRBAG
					DEPLOYED, NO INJURIES. DAMAGE TO VEHICLE UNKNOWN AT THIS TIME. IMPACT WAS MIDDLE OF
896346	CHEVROLET	SUBURBAN	1999	2001-09-04	FRONT OF VEHICLE. *AK
030010	OHE THOLE	56561157111	2555	2002 03 0 .	THE OF VEHICLE THE
					VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AT 20MPH. UPON IMPACT, AIR BAGS DID NOT
8001742	CHEVROLET	SUBURBAN	1999	2001-12-28	DEPLOY. DEALER HAS BEEN NOTIFIED. PLEASE PROVIDE ADDITIONAL INFORMATION.*AK
				2002 05 00	THIS COMPLAINT IS IN REGARDS TO MY RECENT MOTOR VEHICLE ACCIDENT ON MAY 8, 2003. THE OTHER DRIVER FAILED TO YIELD MY RIGHT AWAY. I WAS DRIVING A 1999 CHEVROLET SRUBURBAN. I SERVED INTO ONCOMING TRAFFIC, INTO A RESIDENCE YARD, STRIKING A TREE HEAD ON AT APPROXIMATELY 35 MILES PER HOUR. I HAVE CORRESPONDED WITH GMC VIA E-MAIL UNTO NOT MY SATISFACTION. I REQUESTED MY VEHICLE HAVE A DIAGNOSTIC EVALUATION CONDUCTED, AS I WANTED TO KNOW WHY THE AIR BAGS DID NOT DEPLOY. I HAVE BASICALLY BEEN TOLD BY GMC THAT IF THE AIRBAG LIGHT IS FUNCTIONING IN THE DASHBOARD OF MY TRUCK THEN THERE IS NOTHING WRONG WITH MY AIR BAGS PER A CUSTOMER RELATIONSHIP MANAGER AND THAT MY ACCIDENT DID NOT, MEET THE CRITERIA FOR AIR BAG DEPLOYMENT. I HIGHLY DISAGREE WITH GMCIS EXPLANATION AND CRITICIZE THE LACK OF PROFESSIONAL DIPLOMACY AND CONCERN. I WOULD HAVE EXPECTED MORE FROM ONE OF THE BIG 3 AUTO CORPORATIONS. MY VEHICLE STRUCK A TREE WITH ENOUGH FORCE TO BEND THE FRONT LEFT FRAME RAIL. THE IMPACT ALSO WAS GREAT ENOUGH TO RAISE THE REAR OF THE VEHICLE OF THE GROUND AND SET IT DOWN A FOOT TO THE LEFT OF THE INITIAL IMPACT. THIS HAS ALSO LEFT ME WITH DOCUMENTED INJURIES CAUSING ME TO BE UNABLE TO WORK. MY CONFIDENCE IN THIS VEHICLE'S AIR BAG SYSTEM HAS DIMINISHED TO SAY THE LEAST. THIS MATTER HAS NOT BEEN HANDLED NOR COMPLETED TO MY SATISFACTION. I EXPECTED AT LEAST AN OFFERING TO HAVE THE VEHICLE TAKEN TO A LOCAL DEALERSHIP TO HAVE A DIAGNOSTIC EVALUATION CONDUCTED. THIS WOULD ALLOW ME TO DRIVE THE VEHICLE WITH SOME CONFIDENCE THAT THE SYSTEM WOULD WORK IN THE EVENT I NEED IT AGAIN. I AM AT A STAND STILL AND I AM POSITIVE I AM NOT THE ONLY PERSON WHO HAS HAD THIS PROBLEM IN THE PAST. I WOULD LIKE MORE INFORMATION RELATED TO FAILED AIR BAG DEPLOYMENT AND GMC CHEVY SURBURBAN. I HAVE ALSO SEEN A RECALL ON THE INTERNET WHICH MY VEHICLE FALLS UNDER RELATED TO AIRBAGS. THANK YOU FOR YOUR TIME AND CONSIDERATION.*AK
10029300	CHEVROLET	SUBURBAN	1999	2003-05-08	TL*THE CONTACT OWNS A 1999 CHEVROLET SUBURBAN. WHILE DRIVING 55 MPH, THE CONTACT
10194121	CHEVROLET		1999	2007-06-24	TL*THE CONTACT OWNS A 1999 CHEVROLET SUBURBAN. WHILE DRIVING 55 MPH, THE CONTACT CRASHED INTO THE FRONT END OF ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT WAS SEATED IN THE PASSENGER SEAT AND SUFFERED A CONTUSION ON HER LEFT LEG AND BRUISES ON HER RIGHT LEG. THE DEALER HAS NOT INSPECTED THE VEHICLE TO DETERMINE THE CAUSE OF FAILURE. THE VEHICLE WAS DESTROYED. THE CURRENT AND FAILURE MILEAGES WERE 115,000.
					TL*THE CONTACT OWNS A 1999 CHEVROLET SUBURBAN. WHILE DRIVING 55 MPH, THE CONTACT CRASHED INTO THE FRONT END OF ANOTHER VEHICLE. THE AIR BAGS FAILED TO DEPLOY. THE CONTACT WAS SEATED IN THE PASSENGER SEAT AND SUFFERED A CONTUSION ON HER LEFT LEG AND BRUISES ON HER RIGHT LEG. THE DEALER HAS NOT INSPECTED THE VEHICLE TO DETERMINE THE CAUSE OF FAILURE. THE VEHICLE WAS DESTROYED. THE CURRENT AND FAILURE MILEAGES


	1	1	1		
10372658	CHEVROLET	SUBURBAN	1999	2010-12-21	TL* THE CONTACT OWNS A 1999 CHEVROLET SUBURBAN. THE CONTACT STATED THAT WHILE DRIVING APPROXIMATELY 40 MPH, HE CRASHED INTO THE PASSENGER SIDE OF ANOTHER VEHICLE. THE AIR BAGS DID NOT DEPLOY. THE CONTACT AND ANOTHER PASSENGER SUSTAINED MINOR ABRASIONS AND INJURIES TO THE NECK AND BACK. THE DRIVER OF THE SECOND VEHICLE WAS INJURED BUT THE EXTENT OF THE INJURIES WAS UNKNOWN. A POLICE REPORT WAS AVAILABLE. THE VEHICLE WAS TOWED TO AN INDEPENDENT MECHANIC WHERE THE CONTACT WAS INFORMED THAT THE VEHICLE WAS DEEMED AS DESTROYED. THE FAILURE MILEAGE WAS APPROXIMATELY 133,000. UPDATED 03/03/11
					THE VEHECLE WAS TRAVELING APPROX 40 MPH WHEN IT HIT BLACK ICE ANDM SLIDE OFF THE ROAD AND HIT A BIG ROCK ON THE PASSENGER SIDE FRONT. THE PASSENGER SIDE FRONT BODY AND AXLE WAS PUSHED BACK APPROX 6 TO 8". NIETHER AIR BAG OPENED PASSENGER OR DRIVER. THE PASSENGER MY WIFE SUFFERED A BROKEN BACK. THE VEHECLE WAS TOTALED BY THE INSURANCE. ONE REASON WE BOUGHT THE CHEVROLET TAHOE WAS BECAUSE OF THE DUEL AIR BAG. I FEEL THAT THE SEVERITY OF THE ACCIDENT THE AIR BAGS SHOULD HAVE OPENED. I HAVE TAKEN PICTURES AND STATE FARM INSURANCE IS ALSO INVESTIGATING THE ACCIDENT FOR THE
704617 757392	CHEVROLET	TAHOE TAHOE	1999 1999	1999-03-04 2002-01-22	FAILED AIR BAGS.  DRIVERS AIRBAG FAILED TO DEPLOY IN A FRONT END ACCIDENT. *AK
737392	CHEVROLET	TATIOE	1999	2002-01-22	THIS WAS A VERY HEAVY FRONT END COLLISION. THE VISUAL DAMMAGE EST. IS 10,000 DOLLARS AND STILL RISING THEY DO NOT HAVE THE INTERNAL DAMAGE EST. I CALLED GM AND FILED A FORMAL COMPLAINT. THEY TOLD ME THAT THEY WERE VERY BUSY AND DID NOT HAVE TIME TO INVESTIGATE THIS FAILURE. THEY ALSO TOLD ME THAT THIS WOULD COST THE TO MUCH MONEY TO DO AN INVESTIGATION. THE REP FROM GM TOLD ME THAT THEY COULD TELL IF THE WRECK WAS BAD ENOUGH BY THE DESCRIPTION OF THE WRECK OVER THE PHONE WITH OUT EVEN SEEING THE WRECK. THE DALLAS FIRE DEPARTMENT, DALLAS POLICE DEPARTMENT, TOW TRUCK DRIVER AND HUFFINES CHEVROLET WHICH IS A CERTIFIED CHEVROLET BODY SHOP SAID THAT THIS WAS WAY TO MUCH DAMAGE TO THE FRONT END AND THEY SHOULD HAVE WENT OFF. BUT COPRORATE GM SAID THAT IT WAS NOT AND THEY COULD TELL THAT WITHOUT SEEING THE VEHICLE. GM ALSO TOLD ME THAT THE OTHER VEHICLE IN THE ACCIDENT TOOK ALL THE IMPACT, WITHOUT EVEN SEEING THE VEHICLES HOW WOULD THEY NOW THIS? I STILL HAVE 10,000 DOLLARS OF FRONT END DAMAGE TO MY VEHICLE AND THAT IS WAY TO MUCH IF THE OTHER VEHICLE TOOK ALL THE IMPACT. THEY REPEATEDLY TOLD ME THAT IT WAS OK THAT THEY DID NOT GO OFF BECAUSE THE REST OF THE SAFTEY EQUIPMENT WORKED "I.E. SEATBELTS, CRUMPLE ZONES" BUT THAT DOES NOT CHANGE THE FACT THAT THE AIRBAG SYSTEM DID NOT WORK AND THIS WOULD HAVE KEPT MY 7 MONTH PREGNANT WIFE FROM HITTING THE DASH BOARD! IF YOU HAVE ANY QUESTION I WILL BE MORE THAN HAPPY TO ANSWER THEM LARGE OR SMALL. THANK
761485	CHEVROLET	TAHOE	1999	2002-04-19	YOU!*AK WHILE DRIVING DOWN THE ROAD AT 40 MPH ANOTHER VEHICLE RAN A STOP SIGN, CONSUMER
860103	CHEVROLET	TAHOE	1999	2000-04-08	HIT OTHER VEHICLE DIRECTLY IN THE SIDE OF CAR. UPON IMPACT, AIR BAGS DID NOT DEPLOY.  CONSUMER FELT AIR BAGS SHOULD HAVE DEPLOYED. *AK  WHILE TRAVELING AT 45 MPH ANOTHER VEHICLE PULLED OUT IN FRONT OF CONSUMER'S VEHICLE
863306	CHEVROLET	TAHOE	1999		RESULTING IN AN ACCIDENT. UPON IMPACT, AIR BAGS DID NOT DEPLOY AT ANY TIME. ALSO, ABS LOCKED UP. PLEASE PROVIDE FURTHER INFORMATION. *AK  CONSUMER WAS TRAVELING 55MPH ON HIGHWAY AND ANOTHER VEHICLE RAN IN FRONT. AND
878233	CHEVROLET	ТАНОЕ	1999	2000-12-29	CONSUMER'S VEHICLE HIT OTHER VEHICLE BROADSIDE. UPON IMPACT, AIRBAGS DIDN'T GO OFF.*AK
887011	CHEVROLET	TAHOE	1999	2001-04-13	CONSUMER WAS TRAVELING ABOUT 30MPH ON HIGHWAY AND WITHOUT PRIOR WARNING FRONT WNT INTO SHOULDERS OF A STEEP HILL. 45 DEGREE ANGLE, AND VEHICLE HIT A TREE. UPON IMPACT, DUAL BAGS DIDN'T GO OFF. DEALERSHIP WAS AWARE OF PROBLEM.*AK
55/011	CHEVROLET	TATIOE	1333	2001-04-13	VEHICLE HIT A TREE. UPON IMPACT, SEAT BELT DID NOT RETRACT, AND AIR BAGS DID NOT
887171	CHEVROLET	TAHOE	1999	2000-12-27	DEPLOY, RESULTING IN INJURIES.*AK FRONT COLLISION AT 25-30 MPH, AND NEITHER AIRBAG DEPLOYED, CONSUMER SUFFERED
8006232	CHEVROLET	TAHOE	1999	2002-03-13	MINOR INJURIES.*AK WHILE DRIVING 40 MPH VEHICLE WAS HIT IN THE FRONT CENTER. BOTH FRONTAL AIR BAGS DID
10040265	CHEVROLET	TAHOE	1999	2003-09-09	NOT DEPLOY. *AK  DURING A FRONT END COLLISION WHILE DRIVING AT 55 MPH FRONT AIR BAGS DID NOT DEPLOY.
					THREE PASSENGERS SUSTAINED MINOR INJURIES. CONSUMER HAD THE VEHICLE TOWED TO
10074130	CHEVROLET	TAHOE	1999	2004-04-27	DEALERSHIP FOR INSPECTION. *AK
10110864	CHEVROLET	TAHOE	1999	2004-11-15	THE VEHICLE'S AIR BAGS DID NOT DEPLOY DURING A FRONTAL COLLISION. *NM COUNCIL FOR THE CONSUMER STATED THAT AIR BAGS NEED TO BE TESTED AT CHEVROLET'S EXPENSE. *TC*JB
10265716	CHEVROLET	ТАНОЕ	1999	2009-02-15	WHILE DRIVING MY 99 TAHOE DOWN A 4 LANE ROAD, A DRUNK HAD PULLED OUT INFRONT OF ME. I HAD SLAMMED ON MY BRAKES AND SWERVED TO AVOID HIM BUT STILL HIT HIM PRETTY HARD IN HIS REAR QUARTER PANEL. AS A RESULT OF THE ACCIDENT, I HAD SUFFERED A DOUBLE HEMATOMA TO MY BRAIN AND HAD BRAIN SURGERY TO STAY ALIVE. MY COMPLAINT WITH MY TAHOE IS 1) MY AIRBAG IN MY STEERING WHEEL DID NOT DEPLOY. I THINK IF IT DID, MY INJURY WOULD HAVE BEEN AVOIDED. 2) I QUESTION THE STOPPING ABILITY IF MY ANTI DIVE FRONT BRAKES. I WAS ON THE BRAKES HARD WITH THE VEHICLE NOSING DOWN BUT I THINK MY STOPPING DISTANCE SHOULD HAVE BEEN SHORTER. *TR

					TL*THE CONTACT OWNS A 1999 CHEVROLET TAHOE. THE CONTACT WAS DRIVING APPROXIMATELY 15 TO 20 MPH ON NORMAL ROAD CONDITIONS AND UNEXPECTEDLY, THE OPPOSING VEHICLE CRASHED INTO THE FRONT END OF THE VEHICLE WHICH RESULTED IN A HEAD
					ON COLLISION. THE POLICE AND AMBULANCE WERE CALLED TO THE SCENE. THE CONTACT SUSTAINED SEVERE INJURIES. THE AIR BAG FAILED TO DEPLOY WITH THE MASSIVE LEVEL OF IMPACT. THE VEHICLE WAS COMPLETELY DESTROYED. THE VEHICLE WAS TOWED TO A COLLISION CENTER. THE CONTACT HAD CONCERN OF THE SAFETY RISK INVOLVED. THE FAILURE MILEAGE WAS
10299900	CHEVROLET	TAHOE	1999	2010-01-10	141,000.
10350098	CHEVROLET	TAHOE	1999	2009-02-17	I HAVE A 99 TAHOE THAT I WAS INVOLVED IN AN ACCIDENT. I HIT A CAR WHILE DOING 40MPH THAT HAD PULLED OUT INFRONT OF ME. MY AIR BAGS DIDN'T DEPLOY AND MY SAFETY BELT DIDN'T KEEP ME FROM HITTING THE STEERING WHEEL HARD. UPON REVIEW OF MY SAFETY BELT, I NOTICED THAT IT IS ROUTED INCORRECTLY AT THE TOP HOLDER. IT BINDS ON ITSELF PREVENTING IT FROM RETRACTING. MY PASSENGER SIDE IS ROUTED CORRECTLY AND WORKS PERFECTLY. I SUFFERED A BRAIN INJURY BECAUSE OF THIS AND AM QUITE CONCERNED. *TR
					TL* THE CONTACT OWNED A 1999 CHEVROLET TAHOE. WHILE DRIVING 35 MPH, THE CONTACT HAD A HEAD ON COLLISION WITH A LIGHT POLE. THE AIR BAGS DID NOT DEPLOY. THERE WERE NO WARNING INDICATORS ILLUMINATED. THE CONTACT WAS INURED AND RECEIVED MEDICAL ATTENTION. A POLICE REPORT WAS FILED. THE VEHICLE WAS TOTALED AND TOWED TO THE CONTACT'S RESIDENCE. AN UNKNOWN DEALER WAS MADE AWARE OF THE FAILURE, BUT DID NOT ASSIST. THE VEHICLE WAS NOT DIAGNOSED. THE MANUFACTURER WAS NOT MADE AWARE OF THE
11203728	CHEVROLET	TAHOE	1999	2019-04-20	FAILURE. THE FAILURE MILEAGE WAS UNKNOWN.  VEHICLE REAR ENDED ANOTHER VEHICLE AT 25 MPH. UPON IMPACT, BOTH AIR BAGS FAILED TO
859422	CHEVROLET	TRACKER	1999	2000-03-28	DEPLOY. DEALER /MANUFACTURER WERE NOT CONTACTED AT THIS TIME. *AK
865216	CHEVROLET	TDACVED	1999	2000-06-27	CONSUMER'S WIFE WAS TRAVELING ABOUT 35MPH ON THE HIGHWAYAND ANOTHER VEHICLE DIDN'T YIELD AND VEERED INTO HER VEHICLE, AND FORCE HER OFF THE ROAD. THEN SHE WENT INTO A UTILITY POLE. UPON IMPACT, AIR BAGS DID NOT DEPLOY. *AK ALSO HORN IS DIFFICULT TO LOCATE ON THE STEERING WHEEL. *YH
865216	CHEVKULET	TRACKER	1333	2000-06-27	VEHICLE WAS INVOLVED IN A FRONTAL COLLISION WITH A DOGE RAM PICK UP AT A IMPACT OF 30-
868967	CHEVROLET	TRACKER	1999	2000-08-25	35 MPH, AND AIR BAGS DIDNOT DEPOLY. DEALER NOTIFIED. FEEL FREE TO PROVIDE ANY FURTHER DETAILS. *AK  VEHICLE WAS INVOLVED IN A FRONTAL COLLISION BETWEEN 35-40 MPH, AND BOTH FRONTAL AIR
899309	CHEVROLET	TRACKER	1999	2001-11-10	BAGS DID NOT DEPLOY. DEALER / MANUFACTURER WERE NOTIFIED. FEEL FREE TO PROVIDE ANY FURTHER INFORMATION CONCERNING THIS MATTER. *AK
					WE CONTACTED GMC CUSTOMER SERVICE (VICTOR JOHNSON) AND REQUESTED AN INVESTIGATION. GMC HAS NOW TOLD US THAT SINCE NO ONE WAS FATALLY INJURED THERE WILL BE NO INVESTIGATION. HOW CAN THEY DO THIS? MY WIFE HAS BEEN INJURED - PROBABLY PERMANENTLY- AND WE WANT TO KNOW WHY THEY DID NOT DEPLOY - AS THIS WAS A DIRECT FRONTAL IMPACT. I BELIEVE THAT THE MANUFACTURER HAS AN OBLIGATION TO US AND IS MERELY PLAYING A GAME AT THIS POINT. IS IT IN OUR BEST INTEREST TO HIRE AN ATTORNEY ON
706419	GMC	YUKON	1999	1999-04-12	THE MATTER OR WHAT SHOULD WE DO? *AK
853931	GMC	YUKON	1999		OWNER APPLIED BRAKES AND THE VEHICLE KEPT GOING AND HIT ANOTHER VEHICLE. UPON IMPACT, NEITHER DRIVER'S SIDE NOR PASSENGER'S SIDE AIRBAGS DEPLOYED. DEALER HAS SEEN VEHICLE. *AK
55575					
862202	GMC	YUKON	1999	2000-05-17	VEHICLE WAS INVOLVED IN A FRONTAL COLLISION AT APPROXIMATELY 45 MPH WITH ANOTHER VEHICLE. UPON IMPACT, BOTH AIR BAGS FAILED TO DEPLOY. DEALER NOTIFIED. *AK
	- Cinc		2555	2000 03 17	CONSUMER INVOLVED IN AN ACCIDENT, REARENDED ANOTHER VEHICLE. VEHICLE TRAVELING AT APPROXIMATELY 50 MPH, AND AIR BAGS DID NOT DEPLOY. PLEASE FILL IN ANY ADDITIONAL
880890 8007774	GMC ISUZU	YUKON AMIGO	1999 1999	2001-02-01 2002-01-25	INFORMATION. *AK IN A CAR CRASH AIRBAGS DID NOT DEPLOY. *AK
3007774	13020	AWIIGO	1555	2002 01 23	CONSUMER WAS GOING AT ABOUT 55 AND ANOTHER VEHICLE HIT CONSUMER'S VEHICLE AT ABOUT 85 MPH . CONSUMER'S VEHICLE, IN TURN, HIT A UTILITY VEHICLE, AND WENT INTO A
862789	ISUZU	RODEO	1999	2000-05-19	GAURDRAIL. UPON IMPACT, AIRBAGS DIDN'T DEPLOY. CONSUMER'S VEHICLE WAS TOTALLED.  *AK
895855	ISUZU	RODEO	1999	2001-08-10	VEHICLE WAS INVOLVED IN A DIRECT FRONTAL IMPACT AT 35MPH. UPON IMPACT, AIR BAGS DID NOT DEPLOY. PLEASE PROVIDE ADDITIONAL INFORMATION.*AK  THE VEHICLE WENT AIRBORNE AND LANDED ON THE FRONT END AND THE AIR BAGS FAILED TO
10009019	ISUZU	RODEO	1999		DEPLOY.*JB
10019881	ISUZU	RODEO	1999		WHEN THE BRAKES WERE APPLIED, THE REAR OF THE VEHICLE SLID, AS A RESULT, THE CONSUMER REAR ENDED ANOTHER VEHICLE AND NONE OF THE AIRBAGS DEPLOYED. *JB
10044798	ISUZU	RODEO	1999	2003-10-27	WHILE DRIVING AT 60 MPH, HIT A DEER, AND NEITHER OF THE AIR BAGS DEPLOYED. DRIVER WORE THE SEAT BELT. *AK
10186592	ISUZU	RODEO	1999	2007-03-30	TL*- THE CONTACT OWNS A 1999 ISUZU RODEO, AND STATED THAT WHILE DRIVING ON THE ROAD AT 30 MPH THE VEHICLE IN FRONT OF THE CONTACT'S VEHICLE SLAMMED THE BRAKES SUDDENLY, CAUSING THE CONTACT TO DO THE SAME. THE CONTACT STATED THAT THE VEHICLE HAD SEVERE DAMAGE IN THE FRONT. UPON IMPAQCT, THE AIRBAGS DID NOT DEPLOY. THERE WERE NO WARNING LIGHTS CONCERNING THE AIRBAGS BEFORE AND SUBSEQUENT TO THE ACCIDENT. THE CONTACT COULD PROVIDE PICTURE IF NEEDED. THE FAILURE MILEAGE WAS 96,371 MILES. *AK

# **EXHIBIT B**

Case 4:21-cv-06338-JST Document 1 Filed 08/17/21 Page 148 of 160

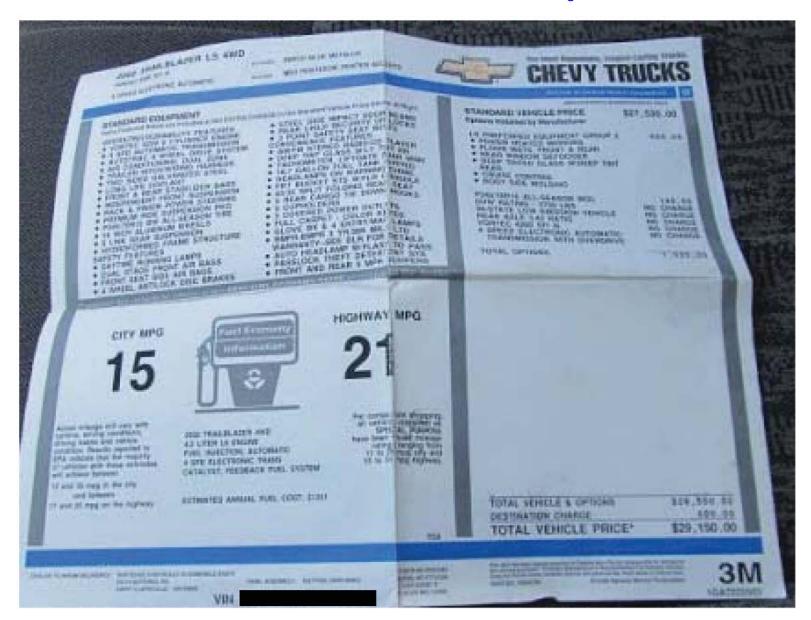

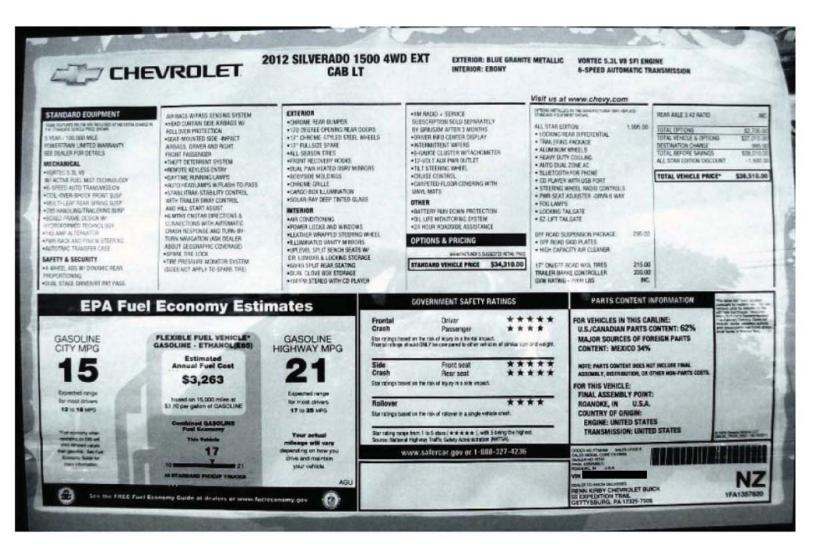

### 2000 ENVOY 4WD (4-DOOR)

VORTEC 4300 VS SFI GAS ENGINE

EXTEREM PEWTER METALLIC

4-SPO AUTO TRANS W/ OVERDRIVE

STERIOR PEWTER INTERIOR TRIM



### 22

\$34,170.00

NO CHARGE

750.00 NO CHARGE NO CHARGE NO CHARGE NO CHARGE NO CHARGE NO CHARGE

STANDARD	VEHICL	E PRICE
AND AND LOCAL PROPERTY.	STORY OF STREET	Political Carrier Company

MARKETING OPTION PACKAGE - 18G

POWER SUNROOF
FULL FEATURE BUCKET SEATS
GVW RATING - 5.350 LBS
FEDERAL EMISSIONS
REAR AXLE - 1.42 RATIO
VORTEC 4500 V6 SF GAS ENGINE
4-SPD AUTO TRANS W OVERDRIVE
AND ELECTRONIC CONTROL
LIFTGATE/LIFTGLASS BODY
RR RADIO CNTRL & EARPHONE JACKS
ENVOY DECOR
SOLID COLOR

NO CHARGE NO CHARGE NO CHARGE NO CHARGE TOTAL OPTIONS \$750.00

MAXIMUM TOW RATING FOR THIS VEHICLE IS 5,400 LBS/ 2,540KG WITH APPROPRIATELY RATED TRAILER HITCH. TOW RATING MUST BE REDUCED BY WEIGHT OF PASSENGERS, CARGO AND OPTIONAL EQUIPMENT. SEE DEALER AND OWNER'S MANUAL FOR MORE INFORMATION.

STANDARD EQUIPMENT

STANDARD EQUIPMENT

TRUCK CAPABILITY EQUIPMENT:

HIGH INTERSITY HEADLAIMES

FULL LENGTH STEEL TRUCK FRAME

FULL LINGTH STEEL TRUCK FRAME

FULL SIZE SPARE TIRE

FULL SIZE SPARE TIRE

HEAVY DUTY BATTERY

RECOVERY HOOKS

OUTSIDE TEMPERATURE GAUGE

INTEGRAL FOGLAMPS

PROTECTIVE BODYSIDE CLADDINGS

PROTECTIVE BODYSIDE CLADDINGS

HEAVY DUTY TRAILERING PACKAGE

OON-BOARD AIR COMPRESSOR

SAFETY & SECURITY FEATURES:

DUAL FRONT AIR BAGS

A WHEEL DISC ANTILOCK BRAKES

PASSLOCK THEFT DETERRENT SYS. \*\*MODE IN THE STANDARD PRICE PRICE SHOWN AT FRIGHT

\*\*WINDOW LOCKOUT & CHILD LOCKS

\*\*DAYTHER FUNNING LAMPS
COMFORT/CONVENIENCE EQUIPMENT:

\*\*D-WAY PWR DRIVER SEAT

\*\*D-WAY PWR PASSENGER SEAT

\*\*HEATED PWR LUMBAR FRT SEAT

\*\*LECTRONIC CUMATE CONTROL

\*\*REMOTE KEYLES ENTRY W/PANIC

\*\*BOSE PREMIUM SOUND WICASSETTE

\*\*SEEK/SCAN. SSV AND CLOCK

\*\*DISC CD CHANGER

\*\*REAR SEAT AUDIO CONTROLS

\*\*INTERMITTENT WIPPER/WASHERS

\*\*DOOR ACTIVATED INTERIOR LAMPS

\*\*SPLIT FOLDING REAR SEAT

\*\*OVERHEAD AND FLOOR CONSOLE

\*\*LECTROCHROMIC MIRRORS

\*\*HEATED POWER FOLDING MIRRORS

\*\*HOMELINK TRANSMITTER TRIP

\*\*COMPUTER\*\*

Compare this vehicle to others in the FREE FUEL ECONOMY GUIDE available at the dealer

HIGHWAY MPG

CITY MPG

ACTUAL MILEAGE WELL VARY WITH (STEEMS, DECEMBE COMBITTION, DECEMBE SARETH AND VARIABLES COMMITTION SESSIOL TO MEPORITED TO SPA WENCAST THAT THE WALDERTY OF VENEZIES WITH THESE STEMATICS WILL ACCOUNT SETWINGS

If AND 29 MPS ON THE

**Fuel Economy** Information

2000 JIMMY 4WO
4.3 LITER WI ENGINE
FUEL INJECTION ELECT WILOCK UP
4 SPEED TRANSMISSION
CATALYST, FEEDBACK FUEL BYSTEM

ESTIMATED ANNUAL FUEL COST: \$1.018

FOR COMPARISON SHOPPING

SPECIAL PURPOSE MILITAGE RATINGS M TO W MPS CITY

60 TG 60 MPG

21148

TWA

TOTAL VEHICLE & OPTIONS DESTINATION CHARGE

TOTAL VEHICLE PRICE

\$35,445.00

\$34,920.00

BOB SELLERS PONTIAC-GMC TRUCK, INC. P.D. BOX 2070 FARMINGTON HILLS, MI 48333-2070

STOCK COST STOCK COST SEALTH NO THE

VIN

Engine: ENGINE, VORTEC 4200 MFI L6 includes transmission oil cooler (275 HP [205.1 kW] @...

Year: 2004 Make: Buick

MECHANICAL

All-wheel-drive

suspension

full-size steel spare

EXTERIOR

GVWR, 5750 lbs.

Rear axle, 3.73 ratio

Alternator, 150 amps

Model: Rainier 4dr CXL AWD

Transfer case, AWD electronic automatic

system, variable driving torque percentage

Battery, heavy-duty, includes rundown

protection and retained accessory power

Differential, locking, heavy-duty, rear

Suspension Package, Premium Smooth

Suspension, rear, load-leveling, 5-link solid

Suspension, front, double A arm

Trailering equipment, heavy-duty,

Trailering wire harness, connector

includes trailering hitch platform, 7-wire harness plus CHMSL wire and heavy-duty

Tires, P255/60R17, all-season, blackwall

wheel located at rear underbody of vehicle

Wheels, 4 - 17" x 7" custom aluminum, 8-

spoke, includes tri-shield center caps and

Steering, power Brakes, 4-wheel antilock, 4-wheel disc

Fuel capacity, approximate, 22 gallons

Luggage rack, rooftop, includes side rails

Bumpers, front and rear, color-keyed

Headlamps, dual halogen composite,

includes flash-to-pass feature and

 Daytime running lamps, includes automatic exterior lamp control

heated, with turn signal indicators

License plate bracket, front, includes

Body, liftgate with liftglass, includes

Custom Perforated Leather-appointed

 Seats, front leather-appointed reclining buckets, with adjustable head restraints;

driver and passenger seat includes 8-way

lumbar; center console and storage pocket

power adjustment and 2- way power

on passenger seat only

electric release and rear-window

Wipers, intermittent, front

cover for states where a front license plate

Glass, Solar-Ray deep tinted

Fog lamps, front, halogen Mirrors, outside rearview, foldaway,

automatic lamp control

Lamps, cornering

is not required

wiper/washer

INTERIOR

Tire, spare, full-size, includes 17" steel

axle, electronically controlled air

VIN:

· Seat adjuster, power passenger 8-way

Exterior: Black

Interior: Medium Pewter

· Seats, rear, 2nd row, split-folding

· Floormats, color-keyed, carpeted front and rear, removable

 Steering wheel, leather-wrapped rim, includes accessory controls for audio and Driver Information Center

· Steering column, Tilt-Wheel, adjustable, includes brake/transmission shift interlock

 QuietTuning, includes acoustic laminate in windshield, laminated front door glass, 26 strategically-placed elements of sound insulation, specially- selected quiet-riding tires and exhaust modifications

 Windows, power, includes driver and front passenger, express-down feature and lockout features

· Door locks, power programmable

 Keyless entry, remote, programmable, includes 2 transmitters, panic button and content theft alarm

 Driver Information Center, monitors up to 13 different systems, includes trip computer, fluid levels and door ajar

OnStar, 1-year Safe and Sound service, includes automatic notification of air bag deployment, emergency services, roadside assistance, stolen-vehicle tracking, AccidentAssist, remote door unlock, remote diagnostics, online concierge and remote horn and lights. Drivers can also opt for other available OnStar services, including making and receiving voice-activated, hands-free phone calls with Personal Calling and getting location-based traffic and weather reports with Virtual Advisor

 Memory Package, 2-position memory, driver seat and outside rearview mirrors

· Cruise control

 Travel Note digital recorder, located in overhead console

 Universal transmitter, HomeLink, includes garage door opener, 3-channel programmable

· Theft-deterrent system, PASSlock

· Theft-deterrent alarm system, content theft alarm

· Air conditioning, dual-zone, automatic, individual climate settings for driver and right front passenger

· Defogger, rear-window, electric

 Sound system, ETR AM/FM stereo with CD and cassette player, includes seek-and-scan, digital clock, auto-tone control, speedcompensated volume, TheftLock, random select, auto-reverse cassette and Radio Data System

 Sound system feature, rear audio controls, includes headphone jacks and controls

· Cupholders, front and rear of center console

Glovebox, passenger side of instrument panel

 Power outlets, auxiliary, covered, 2 in front bottom of instrument panel, 1 in rear of center console, 12-volt

 Lighting, perimeter with theater dimming, cargo compartment, reading lamps in all rows, door- and tailgate-activated switches, illuminated entry, exit feature and rear map lights

· Console, overhead, custom

 Visors, padded, color-keyed, driver and passenger side with cloth trim, extendable feature, illuminated vanity mirrors

· Cargo storage well

#### SAFETY

- · Brakes, 4-wheel antilock, 4-wheel disc
- Air bags, frontal, driver and right front passenger
- Daytime running lamps, includes automatic exterior lamp control
- · Door locks, child security, rear

CITY MPG

14

Transmission: TRANSMISSION, 4-SPEED AUTOMATIC, ELECTRONICALLY CONTROLLED WITH ...



**HIGHWAY MPG** 

19

Actual mileage will vary with options, driving conditions, driving habits and vehicle's condition

### New

MSRP	\$37,595.00
INSTALLED OPTIONS	
Emissions, Federal Requirements	\$0
GVWR, 5750 LBS. (2608 KG)	\$0
CXL Preferred Equipment Group  • standard equipment	\$0
Convenience Package	\$150
<ul> <li>convenience net</li> <li>rear reversible cargo mat and cargo shade</li> <li>rear</li> </ul>	
Pedals, Power Adjustable	\$150
Seats, Heated, Driver And Front Passenger	\$275
<ul> <li>separate control for back and seat cushion</li> <li>Smokers Package</li> <li>muffin ashtray and lighter</li> </ul>	\$30
Sunroof, Power, Tilt Sliding, Electric With Express Open And Wind Deflector	\$885
Original Shipping Charge	\$685
RETAIL PRICE (ORIGINALLY NEW)	\$39,770.00

### Get more information on your smartphone:





www.BillMarsh.com 800-596-2774

Year: 2012 Make: Buick

Model: Enclave AWD 4dr Premium

VIN:

Engine: V6 Cylinder Engine

Transmission: TRANSMISSION, 6-SPEED AUTOMATIC

Exterior: White Diamond Tricoat

Interior: Titanium

### MECHANICAL

- Axle. 3.16 ratio
- All-wheel drive
- Alternator, 170 amps
- Trailering provisions, 2000 lbs. (907
- · GVWR, 6459 lbs. (2930 kg)
- · Suspension, Premium Ride, 4-wheel independent
- Steering, power, variable effort
- · Exhaust, dual with bright chromed

### **EXTERIOR**

- · Luggage rack side rails, roofmounted, chromed
- · Headlights, articulating
- · Fog lamps, front, halogen, with projector technology
- Glass, Solar-Ray deep-tinted, rearside, quarter panel and liftgate
- Wipers, front intermittent with structureless wiper blades
- · Wiper, rear intermittent with washer
- · Liftgate, rear power

### ENTERTAINMENT

· SiriusXM Satellite Radio is standard on nearly all 2012 GM models. Enjoy a 3-month trial to the 'XM Select' package, with over 170 channels including commercial-free music, all your favorite sports, exclusive talk and entertainment. And now add premium channels to your trial at nocost. Welcome to the world of satellite radio. (Requires a subscription sold separately by SiriusXM after the trial period. If you decide to continue your service at the end of your subscription, service will automatically renew and bill, at the rates in effect at the time of renewal, until you call SiriusXM at 1-866-635-2349 to cancel. See our Customer Agreement for complete terms at www.siriusxm.com. Available only to those at least 18 and older in the 48 contiguous USA and D.C. Replaced by (UBS) NavTraffic when (UUM) Audio system with Navigation or (U4H) Audio system with Rear Seat Entertainment are ordered.) Bluetooth for phone personal cell

phone connectivity to vehicle audio

system and HMI (Human Machine

Inerface)

· QuietTuning Buick exclusive process to reduce, block and absorb noise and vibration to create a quiet interior cabir

### INTERIOR

- · Seat adjuster, 4-way power front passenger (fore-aft and recline), power lumbar
- · Floor mats, front and rear auxiliary, covering (Floormats first, second and
- · Steering wheel, leather-wrapped with Mahogany wood accents
- Instrumentation includes Driver Information Center, tachometer, speedometer, fuel, coolant temperature, battery, gear selector, outside air temperature and compass display (Digital compass display moves to navigation screen with (UUM) Audio system with Navigation and (U4H) Audio system with Rear Seat Entertainment and Navigation.)
- · Instrumentation, engine oil life
- · Windows, power with driver Express-Up and -Down features, passenger Express-Down feature
- · Universal Home Remote, includes garage door opener, 3-channel programmable
- Theft-deterrent system, vehicle, PASS-Key III, engine immobilizer with content theft alarm
- · Air conditioning, tri-zone automatic climate control with individual climate settings for driver and right front passenger and rear seat occupants
- · Defogger, rear-window electric
- · Glovebox, locking, passenger-side of instrument panel
- Mirror, inside rearview auto-dimming
- · Visors, driver and front passenger illuminated vanity mirrors

### SAFETY

- · Brakes, 4-wheel antilock, 4-wheel disc
- · Air bags, dual-stage frontal and sideimpact, driver and front passenger and side curtain for first, second and third row outboard passengers with Passenger Sensing System and roll over protection (Always use safety belts and child restraints. Children are safer when properly secured in a rear seat in the appropriate child restraint. See the Owners Manual for more information.)
- Door locks, rear child security
- · Tire Pressure Monitor System

CITY MPG

16



HIGHWAY MPG

22

Actual mileage will vary with options, driving conditions, driving habits and vehicle's condition

### New

MSRP	\$45,765.00
INSTALLED OPTIONS	
Emissions, Federal Requirements	\$0
1 SN Preferred Equipment Group  • Standard Equipment	\$0
Wheels, 20" (50.8 CM) Chrome Clad Aluminum	\$300
Tires, P255/55 R20 All Season, Blackwall	\$0
Wheel, 17" (43.2 CM) Compact Steel Spare Wheel And Tire	\$0
White Diamond Tricoat	\$795
Titanium, Perforated Leather Seating Surface	\$0
Audio System With Rear Seat Entertainment And Navigation	\$3,185
Sunroof, Power	\$1,400
License Plate Bracket, Front Mounting Package	\$15
Navtraffic	\$0
Original Shipping Charge	\$825
RETAIL PRICE (ORIGINALLY NEW)	\$52,285.00

### Get more information on your smartphone:



## Pilson Auto Centers

pilsonauto.com 217-234-6461

Engine: 4 Cylinder Engine

Year: 2014 Make: Buick

MECHANICAL

electronic

Model: Encore AWD 4dr Leather

VIN:

Axle, 3.53 final drive ratio

Drivetrain, all-wheel drive

Exhaust system, rear exit

Keys, ignition, foldable

includes rocker moldings

Fog lamps, front

Glass, deep-tinted

Mechanical jack

EXTERIOR

cargo floor

strips

washers

preventative

Suspension, Ride and Handling

Steering, power, variable effort,

Exhaust tip, styled stainless-steel

Tires, P215/55R18 all-season, blackwall

Tire, compact spare 16", located under

· Fascias, front and rear accent color

projector beam with blue translucent

ring and automatic exterior lamp control

Lamp, center high-mounted stop/brake

· Headlamps, halogen composite

Glass, acoustic, laminated

Windshield, solar absorbing

with turn signal indicators

Wiper, rear intermittent

Vehicle protection, corrosion

Mirrors, outside heated power-

adjustable, body-color, manual-folding

· Door handles, body-color with chrome

Wipers, front intermittent with pulse

Alternator, 130 amps

· Steering wheel, leather-wrapped 3-spoke, color-keyed with theft-deterrent locking feature

Interior: Ebony

Exterior: Quicksilver Metallic

· Steering wheel, heated

and phone interface controls

 Driver Information Center includes tachometer, speedometer, fuel, coolant temperature, battery and compass

display, located on audio system

speedometer and tachometer

climate control with individual climate settings for driver and right front passenger

of center console

illuminated vanity mirrors, covered

· Lighting, interior, dimming instrument panel cluster

Lighting, interior, Ice Blue ambient,

· Lighting, interior, rear cargo compartment

lamp

removable

### ENTERTAINMENT

Antenna, roof-mounted

· Audio system feature, 6-speaker system

Audio system feature, color display, 7" diagonal

QuietTuning Buick exclusive process that consists of acoustically enhanced windshield and side glass, along with numerous noise canceling acoustic treatments to reduce, block and absorb noise and vibration to create a quiet interior cabin

· Noise control system, active noise cancellation

### INTERIOR

Memory Package driver side "presets" for seat position

· Seats, heated driver and front passenger

Seat adjuster, driver 6-way power with manual recline and power lumbar adjustment

· Seat adjuster, front passenger 6-way power with manual recline and power lumbar adjustment

Seatback, passenger flat-folding

Headrests, 2-way adjustable, up/down

Door sill plate cover, front

Steering column, tilt and telescopic, adjustable

· Steering wheel controls, mounted audio

· Instrumentation, outside temperature

· Instrumentation, analog with mpg

Oil life monitoring system

· Cruise control, electronic with set and resume speed

· Air conditioning, dual-zone automatic

· Air filter, particle

· Defogger, rear-window electric

Shift knob, satin silver and chrome

· Glovebox, dual

· Power outlet, 120-volt, located on the rear

· Mirror, inside rearview auto-dimming

· Visors, driver and front passenger

located on instrument panel

· Lighting, interior, overhead courtesy lamp

· Cargo storage, tray under rear floor

· Cargo cover, rear, stowable and

· Side Blind Zone Alert

#### SAFETY

· Brakes, 4-wheel antilock, 4-wheel disc

StabiliTrak, stability control system

· Daytime Running Lamps, reduced intensity low beam

· Air bags, frontal and knee for driver and front passenger, side-impact seat-mounted and roof rail for front and rear outboard seating positions

· Air bag, Passenger Sensing System, sensor indicator inflatable restraint, front passenger/child presence detector

Safety belts, 3-point, driver and front passenger height-adjustable with load limiters

· Safety belts, 3-point rear, all seating positions

· Restraint provisions, child, Isofix 2 point only, point/latch includes 3 top tether points

Rear Cross-Traffic Alert

· Rear Vision Camera

· Door locks, child security, rear, electrical

· Tire Pressure Monitor, manual learn

· Horn, dual note tone

CITY MPG

23



**HIGHWAY MPG** 

Actual mileage will vary with options, driving conditions, driving habits and vehicle's condition

#### INSTALLED OPTIONS

Transmission: TRANSMISSION, 6-SPEED AUTOMATIC, ELECTRONICALLY CONTROLLED WITH ...

Emissions, Connecticut, Delaware, Maine, \$0 Maryland, Massachusetts, New Jersey, New York, Oregon, Pennsylvania, Rhode Island, Vermont And Washington State Requirements

1 SL Preferred Equipment Group \$0

· Standard Equipment

Quicksilver Metallic \$0

. (BT3) Dark Argent Metallic lower accent color

Dark Argent Metallic Lower Accent Color included Ebony, Leather Appointed Seats \$0 Audio System With Navigation, \$795

Am/Fm/Siriusxm Stereo, Single CD Player And MP3 Player

navigation
 IntelliLink 7" diagonal color LCD display

GPS navigation system

Radio Data System (RDS) and auxiliary input

License Plate Bracket, Front Mounting

Package

Original Shipping Charge \$925



www.creditnow.com 866-864-9899

Engine: 8 Cylinder Engine

Year: 2012 Make: Cadillac

VIN:

Model: Escalade 2WD 4dr Platinum Edition

Interior: Cocoa/Light Linen

Transmission: TRANSMISSION, 6-SPEED AUTOMATIC, HEAVY-DUTY, 6L80E, ELECTRONICALLY...

Exterior: White Diamond Tricoat

### MECHANICAL

- Throttle control, electronic
- Cooling, external engine oil cooler, heavy-duty
- Cooling, external transmission oil cooler, heavy-duty air-to-oil
- Rear wheel drive
- Differential, heavy-duty locking rear
- Rear axle, 3.42 ratio
- Battery, heavy-duty with rundown protection and retained accessory power
- Alternator, 160 amps
- Trailering equipment, heavy-duty includes trailering hitch platform, 7wire harness with independent fused trailering circuits and 7-way sealed connector
- GVWR, 7100 lbs.
- · Suspension, front independent, SLA, coil over shock and stabilizer bar
- Suspension, rear 5-link coil springs
- Automatic level control, heavy-duty,
- Steering, power, rack-and-pinion
- Exhaust, dual-outlet stainless-steel

#### EXTERIOR

- · Tires, P285/45R22, all-season, blackwall TL AL2
- · Tire inflation kit
- · Fascia, front, body-color
- · Fascia, rear, body-color
- · Moldings, color-keyed bodyside with chrome accents
- Headlamps, LED
- Headlamps, Twilight Sentinel automatic delay
- · Headlamps, IntelliBeam
- Fog lamps, front rectangular halogen, integral in front fascia
- · Tail lamps, LED illumination
- · Mirrors, outside heated poweradjustable, power-folding and driverside auto-dimming, color-keyed with integrated turn signal indicators, ground illumination and programmable to provide curb view when in reverse
- · Wipers, front intermittent

- · Wiper, rear intermittent with washer
- · Door handles, chrome
- · Body, power liftgate

### ENTERTAINMENT

- · Bluetooth for phone, personal cell phone connectivity to vehicle audio system and HMI
- · NavTraffic is available in over 100 markets and works with your vehicle's navigation system to give you continuously updated traffic data right when you need it most - while you're driving. You'll avoid traffic tie-ups, save time and gas by getting alternate routes, and, in some cases, receive traffic speed and drive-time information. Plus, you can use NavTraffic at the same time you're enjoying SiriusXM Satellite Radio. You'll find that once you start using NavTraffic, you won't want to drive without it.
- · Audio system feature, Bose 5.1 Cabin Surround Sound system with 10 speakers

### INTERIOR

- · Seat release, second row, power for tumble and fold
- Floor covering, color-keyed carpeting
- · Steering wheel, power-tilt, color-keyed with wood and leather-wrapped rim, locking.
- · Steering wheel controls, mounted audio and Driver Information Center controls
- · Instrumentation, analog with speedometer, odometer, fuel level, engine temperature and tachometer
- · Windows, power with driver and front passenger Express-Up/Down and lockout features
- · Pedals, power-adjustable for accelerator and brake
- · Remote vehicle start, adaptive
- · Cruise control, electronic with set and resume speed
- · Theft-deterrent system, vehicle, PASS-Key III+
- · Cup holders, quad front, dual second row and single third row
- · Cup holders, heated and cooled
- · Mirror, inside rearview auto-dimming, includes OnStar controls.
- Visors, driver and front passenger illuminated vanity mirrors with extenders

#### SAFETY

- · Brakes, 4-wheel antilock, 4-wheel disc, VAC power
- · Daytime Running Lamps with automatic exterior lamp control
- · Air bags, head curtain side-impact, first, second and third row outboard seating positions with rollover sensor
- Air bags, seat-mounted side-impact, driver and right-front passenger for thorax and pelvic protection
- · Rear Park Assist
- Rear Vision Camera
- · Safety belts, first and second row belts to body, third row belts to seat, lap and shoulder all seating positions
- Door locks, child rear security

CITY MPG



HIGHWAY MPG

Actual mileage will vary with options, driving conditions, driving habits and vehicle's condition

### New

MSRP	\$79,945.00
INSTALLED OPTIONS	
Emissions, Federal Requirements	\$0
Platinum Edition Preferred Equipment	\$0
Group  • Standard Equipment	
White Diamond Tricoat	\$0
Cocoa/Light Linen, Tehama Full Leathe Seats With Mini Perforated Inserts	r \$0
Audio System With Navigation, Compact Flash, Am/Fm/Siriusxm Stered With MP3/CD/DVD Video/Audio Change	
Lpo, Wheel Locks	\$55
Original Shipping Charge	\$995
RETAIL PRICE (ORIGINALLY NEW)	\$80,995.00

### Get more information on your smartphone:





www.AtlantaAutos.com 678-213-4455

Engine: 8 Cylinder Engine

Year: 2005 Make: GMC

MECHANICAL

retained accessory power

Alternator, 160 amps

pressure gas shocks

bar, and stabilizer bar

Steering, power

muffler and tailpipe

· Bumper, front, chrome

Grille, chrome surround

automatic lamp control

passenger easy entry

EXTERIOR

Air dam, Gray

bright insert

wiper/washer

INTERIOR

SLT decor

panel

Model: Yukon XL 4dr 1500 4WD SLT

· Battery, heavy-duty, 600 cold-cranking

amps, includes rundown protection and

· Suspension Package, Premium Smooth

Suspension, front, independent torsion

Suspension, rear, multi-link with coil

· Tire carrier, lockable, outside spare,

Exhaust, aluminized stainless-steel

Tools, mechanical jack and wheel

wrench, stored in rear quarter trim

Luggage rack, roof-mounted, Black

· Bumper, rear, chrome step, includes

Moldings, bodyside, body-color, with

Assist steps, Black, mounted between

Headlamps, dual halogen composite,

Fog lamps, front, rectangular, halogen Glass, Solar-Ray deep tinted

 Body, liftgate with liftglass, rear door system, includes rear-window

Seats, middle leather appointed 60/40

split-folding bench, 3-passenger with

center armrest, storage tray and rear

 Seats, rear 3rd row vinyl bench, 3passenger, 1-piece removable

includes flash-to-pass feature and

front and rear wheels at bottom of rocker

winch-type mounted under frame at rear

Fuel capacity, approximate, gallon 31

Ride, includes 46mm diameter high

Trailering wiring harness, 7-wire Recovery hooks, 2 front, frame-

VIN:

mounted · GVWR, 7200 lbs.

springs

· Cupholders, in front seating area

· Cupholders, in rear of floor console

· Cupholders, driver and passenger side in 3rd row side trim

Exterior: Sport Red Metallic Interior: Pewter/Dark Pewter

 $\cdot$  Smokers Package, includes a shtray and lighter

· Floor covering, color-keyed carpeting

 Floormats, color-keyed, carpeted front and 2nd row, removable

· Steering column, Tilt-Wheel, adjustable, includes brake/transmission shift interlock

· Steering wheel, leather-wrapped rim, Black

 Steering wheel, mounted controls, includes audio and driver information center controls

 Driver Information Center, full functionality, monitors numerous systems

· Tire pressure monitoring system

 Instrumentation, analog, includes speedometer, odometer with trip odometer, fuel level, voltmeter, engine temperature, oil pressure and tachometer

 Warning tones, headlamp on, key-inignition, buckle-up reminder, turn signal on

 Windows, power, includes driver expressdown and lockout features

 Cruise control, electronic with set and resume speed, includes telltale in instrument panel cluster

· Heater and defogger, includes front and side window defoggers, rear passenger heating ducts and heater, rear auxiliary

 Defogger, rear-window, electric
 Sound system feature, Bose Premium speaker system, 9 speakers, includes

speaker system, 9 speakers, includes subwoofer in center console • OnStar, 1-year Safe and Sound Service,

includes automatic notification of air bag deployment, stolen vehicle tracking, emergency services, roadside assistance, remote door unlock, remote horn and lights, GM Goodwrench remote diagnostics, AccidentAssist and online concierge. Drivers can also obtain the available voice-activated, hands-free Personal Calling service and Virtual Advisor that provides location-based traffic and weather reports and other personalized information

 Door trim, lights on front doors, side reflectors on rear doors

 Armrests, driver and passenger doors, padded

 Mirror, inside rearview, electrochromic, 8point compass, outside temperature indicator and right front passenger air bag status

 Visors, padded, Shale-colored, driver and passenger side with cloth trim, extenders, illuminated vanity mirrors and corner storage pockets on back of visors

 Assist handles, front passenger and outboard 2nd row seats

 Coat hooks, driver and passenger side, rear seat and cargo area

 Storage bin, behind rear driver side quarter panel

#### SAFETY

· Air bags, frontal, dual-stage, driver and right front passenger, includes Passenger Sensing System

Brake/transmission shift interlock

CITY MPG

Transmission: TRANSMISSION, 4-SPEED AUTOMATIC, electronically controlled with overdrive.

14



### **HIGHWAY MPG**

18

Actual mileage will vary with options, driving conditions, driving habits and vehicle's condition

### New

MSRP	\$42,155.0
INSTALLED OPTIONS	
Suspension Package, Autoride	included
Emissions, Federal Requirements	\$0
SLT Preferred Equipment Group	\$5,080
Tires, P265/70 R17, All Season, White Outlined Letter	\$125
Seats, Front Leather Seating Surfaces Power Reclining Full Feature Buckets	included
Sound System, Etr Am/Fm Stereo With 6 Disc CD Changer	included
Wheels, 4 17" X 7.5" (43.2 CM X 19.1 CM) 6 Spoke Premium Aluminum Ultra Bright Polish	\$645
Safe And Secure Package	\$1,470
Sun, Sound And Entertainment Package	\$2,720
Trailering Equipment, Heavy Duty	\$330
Air Cleaner, High Capacity	\$0
Cooling, External Transmission Oil Cooler, Heavy Duty Air To Oil	included
Cargo Package	included
Mirrors, Outside Rearview, Power Folding, Power Adjustable, Heated, Color Keyed, Driver Side Electrochromic	included
Air Bags, Side Impact, Driver And Right Front Passenger	included
Entertainment System, Rear Seat	included
Pedals, Power Adjustable	included
Sound System Feature, XM Satellite Radio.	included
Sunroof, Power, Tilt Sliding, Electric	included
Universal Transmitter, Homelink	included
Customer Dialogue Network	\$0
Original Shipping Charge	\$850
RETAIL PRICE (ORIGINALLY NEW)	\$53,375.00



www.BillMarsh.com 800-596-2774

Year: 2007 Make: GMC

Model: Acadia FWD 4dr SLT

VIN:

Engine: V6 Cylinder Engine Transmission: Automatic 6-spd

Exterior: Liquid Silver Metallic

Interior: Ebony

### MECHANICAL

- Axle. 3.16 ratio
- Front wheel drive
- Alternator, 170 amps
- GVWR, 6400 lbs. (2903 kg)
- Suspension, Ride and Handling
- · Steering, power, variable effort
- Exhaust, double dual with chrome

tips

### EXTERIOR

- · Spoiler, rear
- · Roof rails, brushed aluminum, Iongitudinal
- Moldings, body-color bodyside
- Headlamps, dual halogen projector lamp
- · Headlamp control, automatic on and off
- · Fog lamps, front round halogen
- Glass, Solar-Ray deep-tinted (all windows except light-tinted glass on windshield and driver- and front passenger-side glass)
- · Door handles, chrome (Bright beltline molding.)
- · Wipers, front intermittent with washers
- · Wiper, rear intermittent with washer
- Body, manual rear liftgate

### INTERIOR

- · Seats, heated driver and front passenger
- Console, front center with 2 cup holders and storage

- · Cup holders, 2 front on the floor console
- · Cup holders, 2 in the second row
- · Floor mats, color-keyed carpeted front, second and third row, removable
- Floor covering, color-keyed carpeting
- · Insulation, acoustical package
- · Steering wheel, leather-wrapped with redundant audio controls
- · Steering wheel, Tilt-Wheel and telescopic with brake/transmission shift interlock
- · Instrumentation, 5-gauge with Enhanced Driver Information Center and outside temperature indicator
- · Tire Pressure Monitoring System
- · Cruise control, electronic with set and resume speed
- · OnStar, 1-year of Directions and Connections plan. Includes the innovative easy to use Turn-by-Turn Navigation services which provide voice-guided directions (where available). Also includes Automatic Notification of Air Bag Deployment, Stolen Vehicle Location Assistance, Emergency Services, Roadside Assistance, Remote Door Unlock, OnStar Vehicle Diagnostics, Hands-Free Calling, AccidentAssist, Remote Horn and Lights, Information and Convenience Services, and Driving Directions (OnStar services require vehicle electrical system (including battery), wireless service and GPS satellite signals to be available and operating for features to function properly. OnStar acts as a link to existing emergency service providers. Stolen Vehicle Location Assistance and Remote Door Unlock success varies with conditions. OnStar Vehicle Diagnostic available on most 2004 MY and newer GM vehicles. Diagnostic capability varies by model. Turn-by-Turn Navigation requires ABS and is not available in certain areas. Visit onstar.com or call 1-888-466-7827 for system limitations and details) · Universal Home Remote, includes
- garage door opener, 3-channel programmable
- · Theft-deterrent system, vehicle, PASS-Key III, engine immobilizer
- Defogger, rear-window, electric
- · Audio system controls, rear with 2 headphone jacks (headphones not included) and controls for volume, station selection and media
- · Antenna, Quad-Band for AM/FM stereo and OnStar
- Mirror, inside rearview auto-dimming with 8-point compass display
- · Visors, driver and front passenger, padded with cloth trim, color-keyed
- · Cargo storage, under rear floor

#### SAFFTY

- · Door locks, rear child security
- · Horn, dual-note

CITY MPG

16



### HIGHWAY MPG

22

Actual mileage will vary with options, driving conditions, driving habits and vehicle's condition

### New

MSRP	\$33,225.00
INSTALLED OPTIONS	
Body, Power Rear Liftgate	included
Emissions, Federal Requirements	\$0
SLT 2 Preferred Equipment Group	\$0
Tires, P255/55 R19 H Rated	\$0
Audio System With Navigation, Am/Fm Stereo With MP3 Compatible CD/DVD Player And DVD Based Navigation	\$2,145
Wheels, 4 19" X 7.5" (48.3 CM X 19.1 CM) Machined Ultrabright Aluminum	\$1,295
Mirrors, Outside Heated Power Adjustable, Power Folding And Driver Side Auto Dimming, Body Color	included
Audio System Controls, In The Rear Cargo Area	\$150
Cargo Package	included
Convenience Package	included
Trailering Package	\$425
Trailer Hitch, Factory Installed	included
Entertainment System, Rear Seat DVD Player	\$1,295
Audio System Feature, Bose Advanced 10 Speaker System	\$0
XM Satellite Radio.	included
Antenna, Quad Band	included
Head Up Display	\$350
Power Outlet, 3 Prong Household Style, 115 Volt	included
Remote Vehicle Start	included
Seat, 8 Way Power Driver	included
Seat, 4 Way Power Passenger	included
Sunroof, Dual Skyscape 2 Panel Power, Tilt Sliding Front And Fixed Rear	\$1,300
Washer Nozzles, Heated Windshield	included
Original Shipping Charge	\$735
RETAIL PRICE (ORIGINALLY NEW)	\$40,920.00



www.BillMarsh.com 800-596-2774

Engine: 8 Cylinder Engine

Colors: Summit White / Ebony

Year: 2009 Make: GMC

Model Yukon XL Denali AWD 4dr 1500

VIN:

CITY MPG

Transmission: TRANSMISSION, 6-SPEED AUTOMATIC, HEAVY-DUTY, ELECTRONICALLY CONTR.



**HIGHWAY MPG** 

Stock #: 2019-321

Actual mileage will vary with options, driving conditions, driving habits and vehicle's condition

### MECHANICAL

Rear axle, 3.42 ratio

- Tow/haul mode selector button located at end of shift lever
- · Cooling, external engine oil cooler, heavy-duty air-to-oil integral to driver side of radiator
- Cooling, auxiliary external transmission oil cooler, heavy-duty air-to-oil
- Transfer case, AWD, electronic automatic system
- All-wheel drive Alternator, 160 amps

- Recovery hooks, 2 front, frame-mounted Differential, heavy-duty locking rear
- GVWR, 7400 lbs.
- Suspension Package, Autoride, bi-state variable shock dampening and rear air-assisted load-leveling includes automatic air level control Suspension, front coil-over-shock with stabilizer bar
- Suspension, rear multi-link with coil springs Trailering equipment, heavy-duty includes trailering hitch platform, 7-wire harness with independent fused trailering circuits mated to a 7-way sealed connector and 2" trailering receiver
- Steering, power Brakes, 4-wheel antilock, 4-wheel disc
- Exhaust, aluminized stainless-steel muffler and
- Tools, mechanical jack and wheel wrench stored in rear quarter trim

#### EXTERIOR

- Wheels, 4-20" x 8.5" chrome aluminum
- Tires, P275/55R20 all-season, blackwall
- Wheel, 17" full-size, steel spare Tire, spare P265/70R17
- Tire carrier, lockable outside spare winch-type mounted under frame at rear
- Fascia, front color-keyed Fascia, rear color-keyed
- Luggage rack, roof-mounted, body-color with bright
- Luggage rack center rails
- Moldings, body-color bodyside with bright inserts Grille, chrome surround
- Assist steps, Black with chrome insert, mounted
- between the front and rear wheels
- Headlamps, projector beam with automatic exterior amp control and flash- to-pass feature Fog lamps, front round, halogen
- Mirrors, outside heated power-adjustable, power-folding and driver-side auto-dimming, body-color, with integrated turn signal indicators, ground illumination and curb-tilt
- Glass, Solar-Ray deep-tinted Wipers, front intermittent, Rainsense
- Wiper, rear intermittent with washer
- Liftgate with liftglass, rear door system with rear-window wiper/washer
- Liftgate, rear power-operated controlled from front overhead console, remote key fob or button inside liftgate

### ENTERTAINMENT

- Audio system, AM/FM stereo with MP3 compatible 6disc in-dash CD changer seek-and-scan, digital clock and auto-tone control
- Audio system feature, Bose Centerpoint Surround Sound 10-speaker system
- XM Radio. XM Radio includes 3 trial months of service. XM turns your world on with commercial-free music channels from Rock to Jazz, Country to Classical, Latin Pop to Hip Hop, and virtually classical, cauring to many hop, and writing weerything in between, all in amazing digital sound. Turn on your favorite Sports with every Major League Baseball game from Opening Day until the World Series, NHL Hockey, the PGA TOUR and college football and basketball. Plus XM brings you the biggest names in news and talk, outrageous comedy, award-winning family programming -- wherever you go from coast to coast. Exclusive live concerts, Oprah and Friends, Radio Disney, and so much more.
- Find what turns you on

   Audio system controls, rear with 2 headphone jacks
  , power outlet and controls for volume, station election and media
- Bluetooth for phone personal cell phone connectivity to vehicle audio system

#### INTERIOR

- Seats, front bucket with leather-appointed seating. 12-way power driver and front passenger seat adjusters, including power lumbar control, power recline, heated seat cushion and seatbacks, 2-position driver memory, adjustable head restraints, storage pockets and floor console - Seat adjuster, driver power
- Seat adjuster, front passenger power

Seats, heated second row Seat release, second row, power release only Seats, third row 50/50 split-bench with vinyl, 3-bassenger removable, all-belts-to-seat Console, floor with storage area, 4 cup holders and

Mileage: 200,006

integrated second row audio and HVAC controls Cup holders, in front seating area

Cup holders, in rear of floor console Cup holders, driver and passenger-side in third row side trim

Floor covering, color-keyed carpeting

- Floor mats, color-keyed carpeted front and second row removable · Acoustical Insulation Package, premium
- Steering column, Tilt-Wheel, adjustable with brake/transmission shift interlock
- Steering wheel, Deluxe, leather-wrapped with power-

Steering wheel, heated

Steering wheel controls, mounted audio and cruise controls includes Driver information Center controls

Driver Information Center, full-functionality included with temperature and compass

- Instrumentation, analog with speedometer, odometer with trip odometer, fuel level, voltmeter, engine temperature, oil pressure and tachometer
- Warning tones headlamp on, key-in-ignition, driver and passenger buckle up reminder and turn signal on Windows, power with driver Express-Down and lockout features
- Door locks, power programmable with lockout protection
- Remote vehicle starter system includes Remote Keyless Entry
- Pedals, power-adjustable for accelerator and brake,
- includes Rear Parking Assist Universal Home Remote includes garage door opener,
- 3-channel programmable

  Cruise control, electronic with set and resume speed Air conditioning, tri-zone automatic climate control with individual climate settings for driver and right-front passenger
- Air conditioning, rear auxiliary Heater, rear auxiliary with rear passenger heating
- Defogger, rear-window electric
- Rear Parking Assist, Ultrasonic with rearview LED display and audible warning Theft-deterrent system, vehicle, PASS-Key III
- Door trim, side reflectors on the rear doors Armrests, driver and passenger doors, padded
- Mirror, inside rearview auto-dimming Console, overhead mini with map lights
- Visors, driver and front passenger illuminated vanity mirrors, padded with cloth trim, extends on rod, Shale-
- Assist handles, front passenger and second row outboard
- Coat hooks, driver- and passenger-side rear seat and cargo area
- Lighting, interior with dome light, driver- and passenger-side door switch with delayed entry feature, cargo lights, door handle or Remote Keyless Entry activated illuminated entry and map lights in front and second seat positions
- Power outlets, 4 auxiliary with covers, 12-volt, 3 in floor console, 1 in cargo area
   Storage bin, behind driver-side rear quarter panel
- Cargo mat

- StabiliTrak, stability control system with traction
- control
   Air bags, dual-stage frontal, driver and right-front
  passenger with Passenger Sensing System
   Air bags, head curtain side-impact, first and second
  row outboard seating positions with rollover sensor, includes third row seating positions with 3-passenger third row bench seat
- OnStar, 1-year of Directions and Connections plan. Includes the innovative easy to use Turn-by-Turn Navigation services which provide voice-guided directions . Also includes Automatic Crash Notification, Automatic Notification of Air Bag Deployment, Stolen Vehicle Location Assistance, a link to all Emergency Services, Roadside Assistance, Remote Door Unlock, OnStar Vehicle Diagnostics, Hands-Free Calling, AccidentAssist, Remote Hom and Lights, Information and Convenience Services, and Driving Directions
- LATCH system for child safety seats Tire Pressure Monitoring System

### New

MSRP	\$55,935.00
INSTALLED OPTIONS	
Emissions, Federal Requirements	\$0
Preferred Equipment Group  • standard equipment	\$0
Solid Paint	\$0
Summit White	\$0
Ebony, Perforated Nuance Leather Appointed Seat Trim	\$0
Audio System With Navigation, Am/Fm Stereo With MP3 Compatible CD/DVD Player And DVD Based Navigation	included
Sun, Entertainment And Destinations	\$4,790
Package	
<ul> <li>(UVB) AM/FM stereo MP3 compatible CD/DVD player and DVD-based navigation</li> <li>(U42) rear seat entertainment system</li> <li>(UVC) rearview camera system and (CF5) power sunroof</li> <li>(CF5) power sunroof</li> </ul>	
Sunroof, Power, Tilt Sliding	included
<ul> <li>express-open and close and wind deflector</li> </ul>	1002420
License Plate Bracket, Front	\$15
Entertainment System, Rear Seat DVD Player	included
<ul> <li>remote control</li> <li>overhead display</li> <li>2 sets of 2-channel wireless infrared headphones and auxiliary audio/video input jacks</li> </ul>	
Seats, Heated And Cooled, Seat Cushion And Seat Back For Driver And Front Passenger	\$650
Rearview Camera System	included
XM Navtraffic	\$0
Customer Dialogue Network	\$0
Original Shipping Charge	\$950
RETAIL PRICE (ORIGINALLY NEW)	\$62.340.00



www.redsautoandtruck.com 303-726-5520

# **EXHIBIT C**

2274330.1

### 1 I, RAMIRO PEREDA, declare as follows: 1. I have personal knowledge of the facts stated herein and, if called upon to do 2 so, could competently testify thereto. 3 2. I am a Plaintiff in the above-captioned action. 4 3. I submit this declaration in support of the Complaint in this case, which is 5 based in part on violations of the Consumers Legal Remedies Act, California Civil 6 Code section 1750 et seq. 7 4. Venue is proper in this judicial District because Defendants conduct business 8 9 in the counties comprising the Northern District of California. I reside in Alameda County and my vehicle that is the subject of this action is situated in this district. 10 5. The Complaint has been filed in the proper place for trial of this action. 11 12 I declare under penalty of perjury under the laws of the United States that the 13 foregoing is true and correct to the best of my knowledge. 14 Executed on August \, 2021 in San Leardro, Califo 15 Bv: 16 Ramiro Pereda 17 18 19 20 21 22 23 24 25 26 27 28 2274330.1 -2-